Swivel and turning stations SWS

Stationary systems for process optimization

Structure and application

The individually designed workstations are intended for integration into ongoing work and production processes in which loads need to be swiveled or turned. This significantly reduces throughput times while increasing workplace safety. Operation of the stations takes place from a safe distance using a separately positioned control panel equipped with all required control functions. These functions are tailored to the customer's specific requirements, ensuring efficient, safe, and streamlined process optimization.

- Custom-designed construction for process optimization
- Swiveling and turning functions via robust geared motors
- Electric height adjustment using linear guides and cylinders
- Integration of clamping, positioning, or locking devices
- Integration of pneumatic actuators
- Operation via separate control panel with dead-man switch
- Safety devices (light barriers, etc.) according to specification
- PLC control with programming



Swivel station SWS-90E-HV-150KG

With height adjustment for pre-assembly of motorhome floors.



Turning station SWS-270E-HV-200KG

With height adjustment and pneumatically adjustable suction elements for motorhome roof components.



Turning station SWS-180E-HV-200KG

With height adjustment for turning sandwich elements during pre-assembly.




Turning station SWS-180E-HV-250KG

With height adjustment for turning aluminium sheets up to 13.000 mm in length.

Swivel and turning stations SWS

Technical data

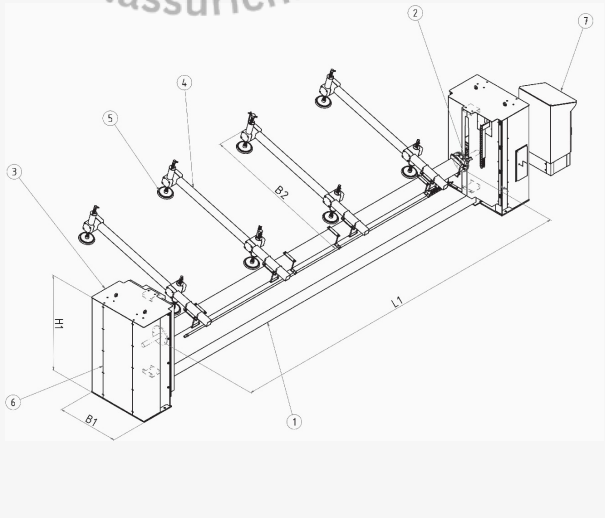

1. Robust base frame made of steel construction
2. Optional height adjustment via lifting cylinders or chain hoists
3. Swivel drives powered by geared motors
4. Steel frame for vacuum components
5. Suction grippers individually designed for the workpiece
6. Separately positioned vacuum power unit
7. Control panel with all required switches
8. Electronic warning device with signal horn

Load capacity (kg)	Type	Handling	Workpiece dimensions min (mm)	Workpiece dimensions max (mm)	Swivel / turning time (s)	Lifting time per 100 mm (s)	L1 (mm)	B1 (mm)	H1 (mm)	Dead weight (kg)
125	SSS	Swivel-	2.000 x 500	10.000 x 2.500	15-30	0,5-2	3.000-12.000	2.000-7.000	1.000-1.500	250-350
	SWS	Turning	2.000 x 500	10.000 x 2.500	30-60	0,5-2	3.000-12.000	2.000-7.000	1.000-3.500	350-500
250	SSS	Swivel-	2.000 x 500	10.000 x 2.500	15-30	0,5-2	3.000-12.000	2.000-7.000	1.000-1.500	300-400
	SWS	Turning	2.000 x 500	10.000 x 2.500	30-60	0,5-2	3.000-12.000	2.000-7.000	1.000-3.500	450-600
500	SSS	Swivel-	2.000 x 500	10.000 x 2.500	15-30	0,5-2	3.000-12.000	2.000-7.000	1.000-1.500	500-750
	SWS	Turning	2.000 x 500	10.000 x 2.500	30-60	0,5-2	3.000-12.000	2.000-7.000	1.000-3.500	750-1.000