RB Series

Application field: It is widely used in burnishing, polishing, machine loading/unloading and automatic transport on punching automation production lines.

Type		DOF	Drive Method	Payload (kg)	Repeatability (mm)	Motion Range(°)						Top Velocity(°/s)						Permissible Inertia of Wrist (kg.m2)			Allowed Top Torque (N.m)			Motion Radius (mm)	Machine Weight (kg)
						J1	J2	J3	J4	J5	J6	J1	J2	J3	J4	J5	J6	J4	J5	J6	J4	J5	J6		
RB03A1-562		6	AC Servo Drive	3	±0.02	±150	+136~-51	+64~-131	±150	±120	±360	375	375	419	600	600	750	0.077	0.077	0.029	9.3	9.3	4.5	562	36
RB06-900				6	±0.03	±170	+135~-100	+155~-110	±170	±120	±360	337.5	270	375	300	375	468				12	10	6	900	60
RB08Q1-1440				6 (For welding)	±0.05	±155	±90	+90~-270	±180	±130	±360	225	200	225	450	360	650	/	0.272	0.074	17.2	17.2	10	1440	70
				8(For handling)	±0.05	±155	±90	+90~-270	±180	±130	±360	200	160	200	450	360	650	/	0.272	0.074	17.2	17.2	10	1440	70
RB08A3 系列	RB08A3-1490			8	±0.04	±170	+120~-85	+83~-150	±180	±135	±360	200	200	200	400	356	600	/	0.19	0.065	14	12	7	1490	185
	RB08A3-1700			8	±0.04	±170	+120~-85	+83~-150	±180	±135	±360	180	180	180	400	356	600	/	0.19	0.065	14	12	7	1700	187
RB12-1500				12	±0.04	±170	+120~-85	+83~-150	±180	±135	±360	160	160	160	300	300	360	0.33	0.33	0.17	24	24	13	1500	186
RB20A3 系列	RB20A3-1700			20	±0.04	±170	+160~-80	+76~-112	±180	±138	±360	175	175	180	330	330	450	/	0.93	0.4	40	50	22	1700	265
	RB20A3-1900			15	±0.04	±170	+160~-80	+76~-112	±180	±138	±360	175	175	180	330	330	450	/	0.93	0.4	40	50	22	1900	273
RB35 系列	RB35-1850			35	±0.04	±170	+120~-85	+85~-155	±180	±135	±360	160	160	175	310	360	375	2.46	2.46	1.41	75	75	68	1850	369
	RB35-2050			30	±0.04	±170	+120~-85	+85~-155	±180	±135	±360	160	160	160	310	360	375	2.46	2.46	1.41	75	75	68	2050	372
RB50 系列	RB50-1956			50	±0.05	±178	+130~-90	+75~-200	±360	±115	±360	171	171	171	215	251	365	51.5	51.5	16	196	196	127	1956	650
	RB50A1-2071			50	±0.05	±178	+130~-90	+75~-200	±360	±115	±360	171	171	171	215	251	365	51.5	51.5	16	196	196	127	2071	650
RB80 系列	RB80-2250			80	±0.06	±180	-84~+164	-193~+68	±360	±130	±360	140	155	140	215	230	270	36.3	27.5	18.9	324	328	186	2250	680
	RB80-2080			100	±0.06	±180	-84~+164	-193~+68	±360	±130	±360	140	160	140	205	220	260	36.3	27.5	18.9	401	406	232	2080	678
	RB80A1-2550			50	±0.06	±180	-84~+164	-193~+68	±360	±115	±360	140	155	140	215	251	285	27.4	43.7	22	203	211	117	2550	744
				80	±0.06	±180	-84~+164	-193~+68	±360	±115	±360	110	130	130	215	230	270	27.4	43.7	22	324	328	186	2550	744
RB130 系列	RB130A1-3500			100	±0.08	±175	+75~-60	+80~-185	±360	±130	±360	100	94	120	205	220	260	36.3	27.5	18.9	401	406	232	3500	1210
	RB130A1-3100			130	±0.08	±175	+75~-60	+80~-185	±360	±125	±360	100	94	120	169	200	220	64.5	64.5	51.1	784	784	411.5	3100	1300
RB165A1-2790				165	±0.08	±175	+75~-60	+80~-185	±360	±115	±360	100	94	104	152	160	220	85	85	45	951	951	490	2790	1350
RB210-2700				210	±0.08	±175	+75~-60	+80~-185	±360	±115	±360	88	94	104	152	118	200	160	160	100	1274	1274	686	2700	1430
RB300 系列	RB300-2508			300	±0.10	±175	±55	+116~-85	±360	±115	±360	85	95	95	120	120	180	160	160	100	1600	1600	850	2508	1800
	RB300A1-2850			300	±0.10	±175	±70	-85~+130	±360	±115	±360	110	100	100	180	150	200	160	160	100	1600	1600	850	2850	1650
	RB300A2-2850			300	±0.10	±175	±70	-85~+130	±200	±125	±360	110	100	100	180	150	200	160	160	100	1600	1600	850	2850	1650
	RB300A2-3200			220	±0.10	±175	±70	-85~+130	±200	±125	±360	110	100	100	180	150	200	160	160	100	1600	1600	850	3200	1680
RB350-3400				350	±0.10	±178	+105~-60	+70 ~ -62	±180	±115	±360	80	85	88	110	98	170	550	500	235	3400	3400	1700	3400	3340
RB500-2882				500	±0.10	±178	+105~-60	+70 ~ -62	±180	±115	±360	80	85	88	110	98	175	550	500	235	3400	3400	1700	2882	3300


Note: Avoid to contact with the inflammable and explosive and corrosive gas and liquid; do not splash the water, oil and dust; keep away from the electric appliances' noisy resource (plasma).




RB Series

Application field: It is widely used in burnishing, polishing, machine loading/unloading and automatic transport on punching automation production lines.


RB03A1-562
Motion range diagram

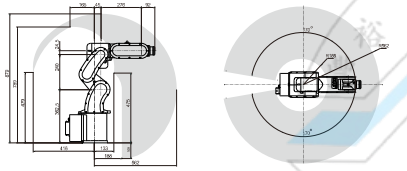


RB06-900
Motion range diagram

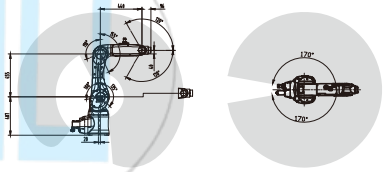


RB08A3-1490
Motion range diagram

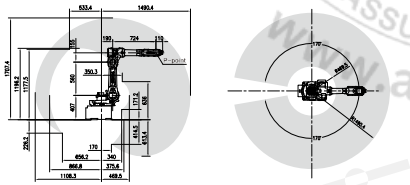


RB08A3-1700
Motion range diagram

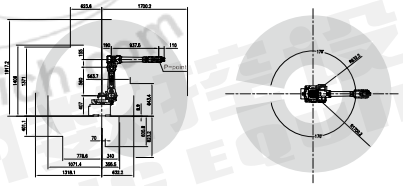


RB12-1500
Motion range diagram

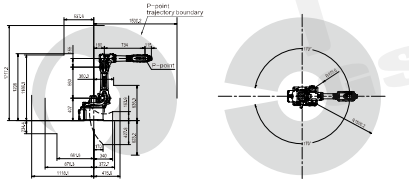


RB20A3-1700
Motion range diagram

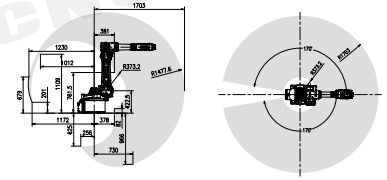


RB20A3-1900
Motion range diagram

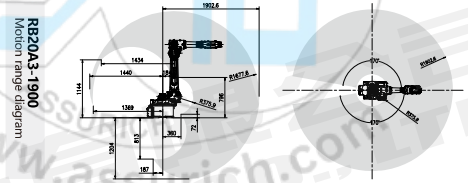


RB35-2050
Motion range diagram

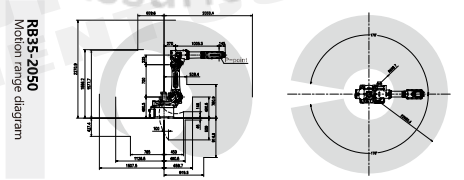


RB50A1-2071
Motion range diagram

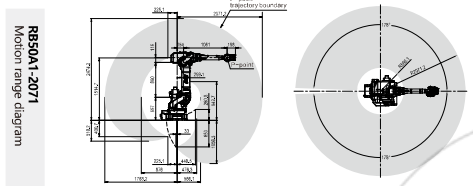


RB35-1850
Motion range diagram

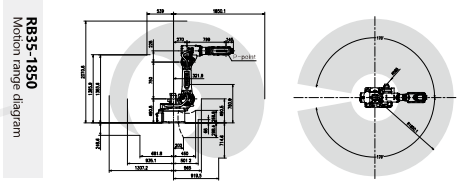

RB50-1956
Motion range diagram

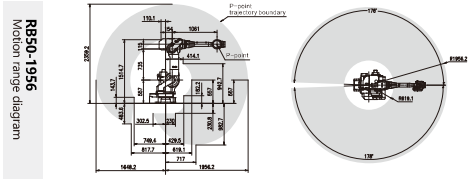


RB80-2250
Motion range diagram

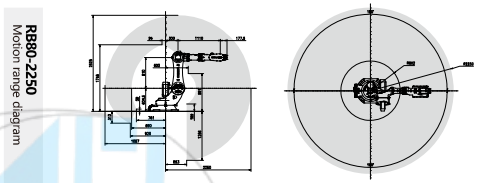


RB Series

Application field: It is widely used in burnishing, polishing, machine loading/unloading and automatic transport on punching automation production lines.


RB80-2080
Motion range diagram

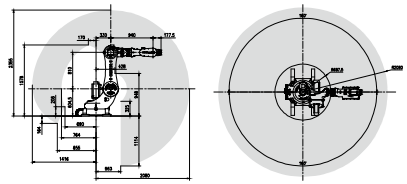


RB80A1-2550
Motion range diagram

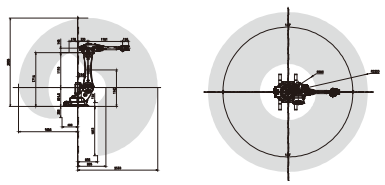


RB130A1-3500
Motion range diagram

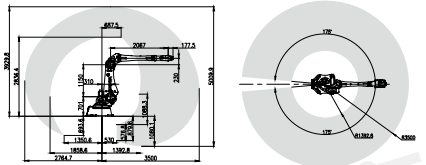


RB130A1-3100
Motion range diagram

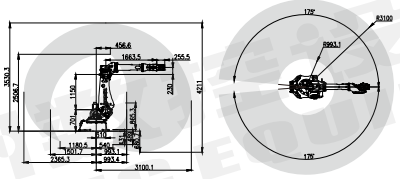


RB165A1-2790
Motion range diagram

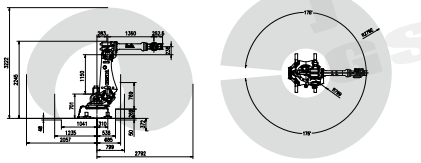


RB210-2700
Motion range diagram

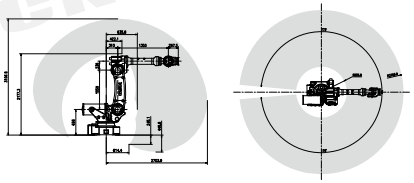


RB300-2508
Motion range diagram

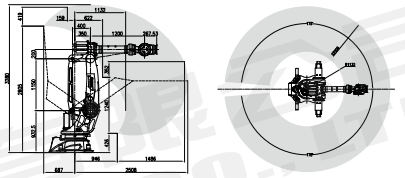


RB300A2-2850
Motion range diagram

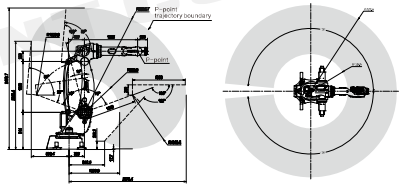


RB350-3250
Motion range diagram

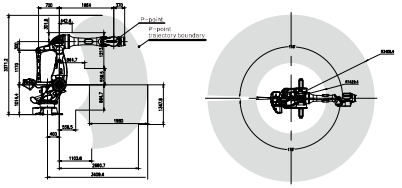

RB300A1-2850
Motion range diagram

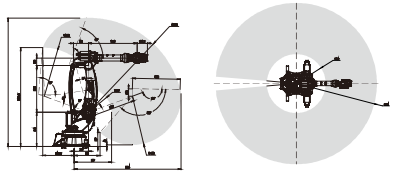

RB300A2-3200
Motion range diagram

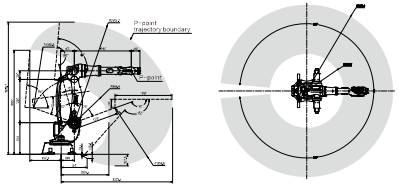

RB500-2882
Motion range diagram

