RMD Series

Application: stacking, unstacking, transferring, stamping, loading and unloading in packing, drinking, chemical industry and food industry.


Type	DOF	Drive Method	Payload (kg)	Repeatability (mm)	Motion Range (°)				Top Velocity (m/s)				Wrist Allowable Load Inertia (kg·m²)	Cycle Time (r/h)	Motion Radius (mm)	Machine Weight (kg)
					J1	J2	J3	J4	J1	J2	J3	J4				
RMD08	4	AC Servo Drive	8	±0.05	±170	+90~-40	+68~-90	±360	251	195	195	367.5	0.25	1800①	1433	180
RMD20	4	AC Servo Drive	20	±0.05	±170	+106~-45	+73~-90	±360	175	175	185	330	0.51	1780①	1755	266
RMD35	4	AC Servo Drive	35	±0.05	±170	+95~-45	+75~-90	±360	160	160	175	375	1.24	1560①	2100	360
RMD50	4	AC Servo Drive	50	±0.1	±178	+90~-40	+65~-78	±360	171	171	171	222	4.5	1700①	2154	660
RMD120-2400	4	AC Servo Drive	120	±0.1	±180	+85~-40	+120~-20	±360	145	130	140	420	53	2200①	2404	1020
RMD160	4	AC Servo Drive	160	±0.1	±180	+100~-44	+121~-15	±360	123	123	128	300	78	1500①	3150	1500
RMD200	4	AC Servo Drive	200	±0.1	±180	+100~-44	+121~-15	±360	105	107	114	242	78	1300①	3150	1500
RMD300	4	AC Servo Drive	300	±0.1	±180	+100~-44	+121~-15	±360	85	90	100	190	134	1000①	3150	1500

Note: ① The testing track covers 150 mm in height and 1000mm in width. Actual cycle time suject to working situation.
② The testing track covers 200 mm in height and 1000 mm in width. Actual cycle time suject to working situation.
③ The testing track covers 400 mm in height and 2000 mm in width. Actual cycle time suject to working situation.
Avoid to contact with the inflammable and explosive and corrosive gas and liquid; do not splash the water, oil and dust; keep away from the electric appliances' noisy resource (plasma).




RMD160/RMD200/RMD300 RMD120-2400 RMD50 RMD35 RMD20 RMD08


RMD08
Motion range diagram

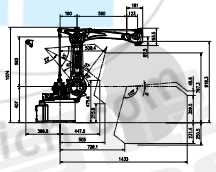


RMD20
Motion range diagram

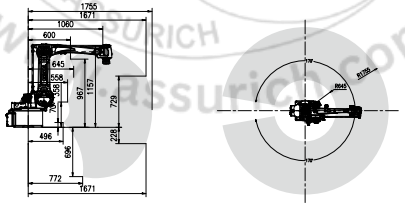


RMD35
Motion range diagram

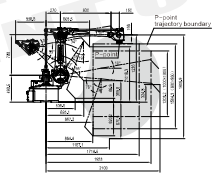

RMD50
Motion range diagram

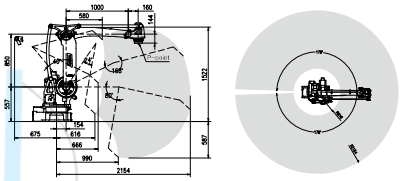

RMD120-2400
Motion range diagram

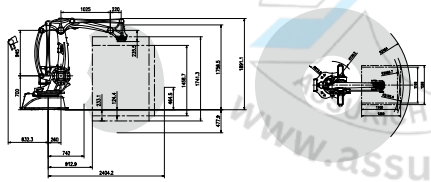

RMD160/200/300
Motion range diagram

