



回程载量大 起飞超重风险

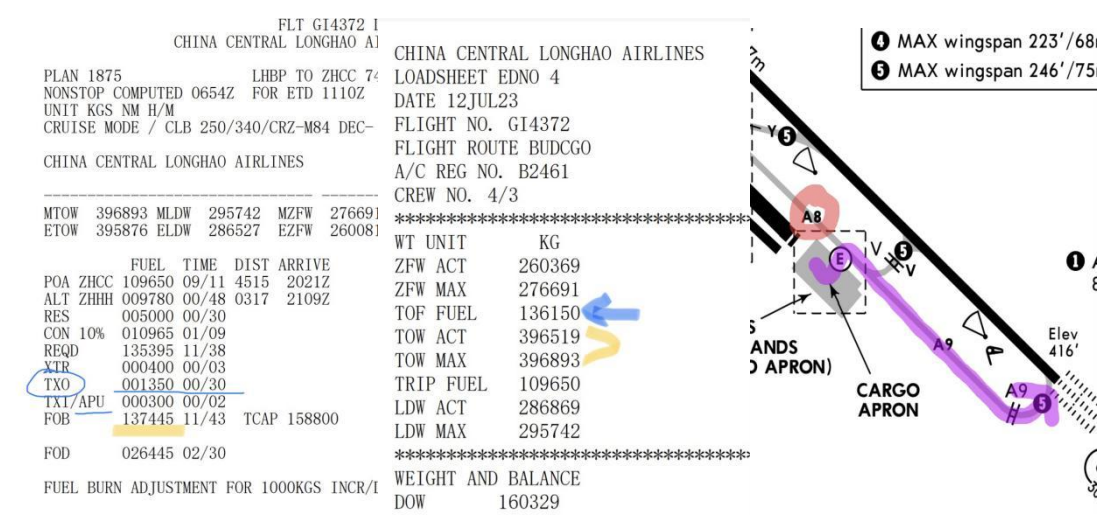


以 2023 年 7 月 12 日，布达佩斯-郑州为例：飞行计划加注燃油 137.5 吨，舱单计算起飞油量 136.2 吨，起飞剩余载量 300 公斤。

实际运行中，飞机停靠 CARGO APRON, 得到推出开车许可后，飞机推到 A8 滑行道启动。从 A8 滑行道经 A9 滑行道到 RW31R 等待点距离非常近，无法按计划消耗 TXO 1350 千克燃油。跑道外经机组计算起飞超重。

翼展受限滑行道/区域

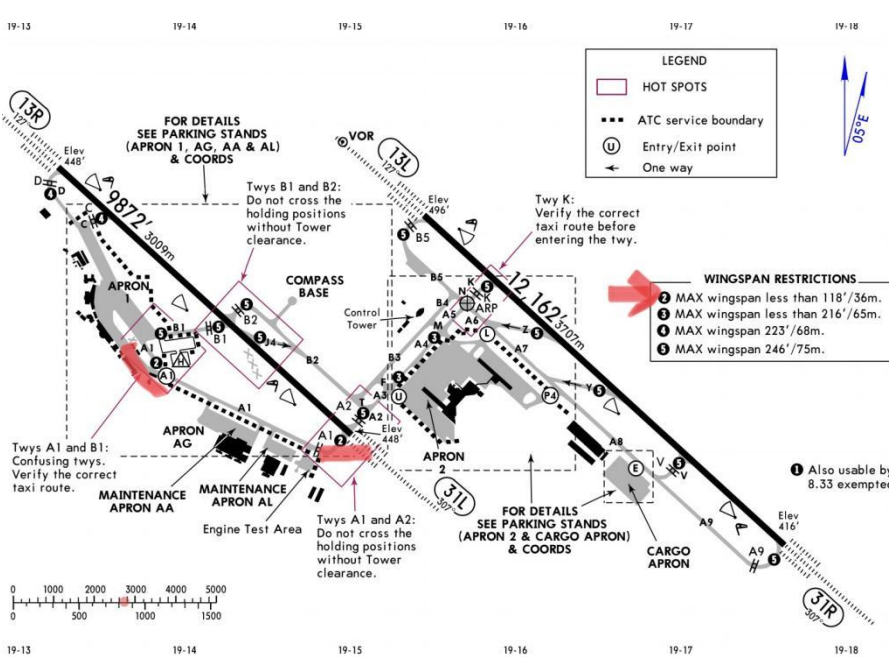

落地脱离

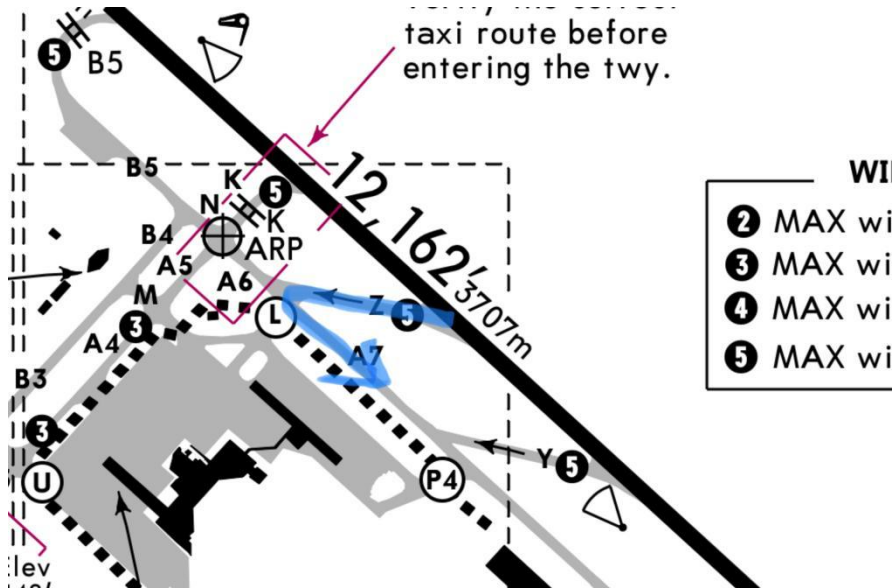

航空器使用 RW31R 跑道落地后，预计使用 Z 滑行道脱离左转 A7 滑行。Z 滑行道较窄，Z 转向 A7 滑行道转弯角度大，注意控制滑行速度，注意大角度转弯操作

落地后指令

航空器脱离跑道转入正常滑行后，地面管制席位发布指令“外侧发动机限制在慢车推力工作” (Outer engine set to idle power)

In Case of other Types

When taxiing is commenced, ATC requests the air crew to operate the outer (two) engines at idle throttle during taxiing.

外部电源与 APU

1. GENERAL

AUXILIARY POWER UNIT (APU) (2200-0600LT)

- The APUs must be stopped at the latest within 5 minutes of arrival on stands equipped with a ready-installed external power source in operational condition.
- APUs may only be restarted for essential technical checks, or immediately prior to planned departure maximum 5-30 minutes prior to passenger boarding, depending on the ACFT type.
- The operation of APUs is not permitted without the presence of trained specialist staff.

夜间 APU 在接驳外部电源后应尽快关闭
在预计起飞时刻前 5-30 分钟再次启动

海关边防

2023 年运行布达佩斯航线期间，进出布达佩斯边防使用的是同一张该航班去程总申报单，按要求来说 AOC 应提供回程总申报单，机组提出相关问题后，AOC 会向机组或酒店前台发送回程总申报单电子邮件，自行打印。

后续布达佩斯航班正常运行后，进出匈牙利边防需要在公务护照上盖章，可向匈牙利边防单位申请签章纸，后续进出边防均可盖章在签章纸相应位置，防止护照签证页短期盖满换照。

欧洲机场当局，海关会不定期对机组行李抽查，航空器登机临检。注意机组携带物品进出海关相关规定，注意航空器相关证照存放位置，应急设备位置，配备数量，工作状态，机组行李摆放要求等。

The image shows a detailed AOC form for flight 2023, dated 16:30. It includes fields for flight details, crew information, and various checks. The form is filled out with handwritten and printed information, including the flight number 2023, the date 16:30, and the flight status. The form is signed by the Captain and the First Officer.

The image shows a Flight Deck checklist for flight 2023, dated 16:30. It includes various checks such as 'General condition', 'Emergency exit', 'Equipment', 'Documentation', 'Radio', 'Flight data', 'Safety equipment', and 'Cabin'. The checklist is filled out with handwritten and printed information, including the flight number 2023, the date 16:30, and the flight status. The checklist is signed by the Captain and the First Officer.

机组摆渡车

经常发生进场机组在 GAT (General Aviation Terminal) 没有摆渡车摆渡去货机坪需要提前和相关单位电话沟通确认车辆避免意外延误。

和家里机组调度联系响应较慢，直接打电话 (英文电话讲的越简单越好，CHINA CREW FROM GAT TO CARGO APRON)

回程如遇到酒店发车时间，机组车未到位，联系 Celebi 客服 +36 1 550 0000

Celebi Ground Handling - Operations Contacts - Budapest (BUD/LHBP)			
Management	Operations Coordination Center		Loadcontrol & Operations Department
Head of Operation Mr. László Jakab Phone: +36 30 445 2841 email: laszlo.jakab@celebiaviation.hu	Operations Coordination Center (H24) Phone: +36 70 332 4011 Fax: +36 1 296 9992, +36 1 296 9993 email: coordination@celebiaviation.hu SITA: BUDCRXH VHF: 131.675 MHz		Head of department Mr. Lajos Gábor Kiss Phone: +36 70 307 9001 email: lajos.gabor.kiss@celebiaviation.hu
Service Delivery Manager Phone: +36 1 296 5085 Mobile: +36 30 202 9048 (H24) Fax: +36 1 296 9991 email: dhm@celebiaviation.hu SITA: BUDCMXH	SCHEDULE CHANGE FLIGHT DOCUMENTATION PACKAGE GENERAL DOCUMENTATION ON FLIGHT IRREGULARITY AND EXTRA REQUEST HANDLING		Loadcontrol & Operations Office Phone: +36 70 332 4039, +36 70 332 4047, +36 70 332 4041 Loadcontrol supervisor: +36 70 332 4062 Fax: +36 1 296 9992 email: loadcontrol@celebiaviation.hu SITA: BUDCRXH
Cargo Services Head of Cargo Services: Mr. László Trifin Phone: +36 30 445 2826 email: laszlo.trifin@celebiaviation.hu	General Aviation Terminal and Exclusive Services Head of GAT Services: Ms. Szilvia Tóth Phone: +36 30 445 2821 email: szilvia.toth@celebiaviation.hu		Ramp Services Department Head of Department: Mr. Ottó Karl Phone: +36 70 332 4038 email: otto.karl@celebiaviation.hu
Cargo Duty Handling Manager Phone: +36 70 307 9003 (H24) email: cargo.dhm@celebiaviation.hu	General Aviation Terminal Customer Service (H24) Phone: +36 70 332 4044, 70 932 5033, +36 1 296 6292 Fax: +36 1 296 8449 email: gat@celebiaviation.hu SITA: BUDCGXH AFTN: LHBPYDYY VHF: 130.9 MHz		
SCHEDULE CHANGE ON FLIGHT IRREGULARITY AND EXTRA REQUEST HANDLING	SCHEDULE CHANGE FLIGHT DOCUMENTATION PACKAGE GENERAL DOCUMENTATION ON FLIGHT IRREGULARITY AND EXTRA REQUEST HANDLING		

机场细则要求航空器保持速度 165 节到五边 5 海里，无法遵守尽早通报

机组进场/退场由 GAT 候机楼进出，未设海关退税部门

布达佩斯昼夜温差大，目前夏秋交替季节日间最高温度 31 摄氏度，夜间最低温度 17 摄氏度

布达佩斯回程需由机长组织全体机组开展航前协作准备会