


Weekly Quality Report (18th March 2026)

Key Highlights of the Week


- Aland(S):** Following the issuance of the penalty, M/s KVGGN has **deployed** a Senior Quality Engineer at site on **14th March-26**, resulting in improved management of the Request for Inspection (RFI) process and quality control of the transmission line work.
- Team Updates:** BP-QA team has **provided** detailed guidelines to M/s Vaibhavi to **carry out** painting and coating of the ICOG (Incoming-Outgoing) shed at Tharad site in accordance with **IS 1477 (Part 1 & 2)** and **IS 101** and to **use** only **approved** shade **RAL 7035** to ensure proper corrosion protection.
- Training:** **124 personnel** trained in quality aspects, such as High Tension (HT) cable laying, ensure proper continuous welding, Insulation Resistance (IR) test, cube filling and testing, tightening, torquing, and marking of Module Mounting Structures (MMS) etc.

Name	Challenges	Action Points	Timeline
Aland (S)	Despite multiple reminders, M/s. Vaibhavi has failed to raise the required number of RFIs for structure and module tightening work. Unverified tilt angles and loose connections pose a risk of potential generation losses if structure gets uprooted due to heavy wind.	M/s. Vaibhavi has been instructed to raise required number of RFIs for structure and module tightening work on immediate basis . Failure to comply will result in the imposition of financial penalties as per contract.	Immediate (M/s Vaibhavi)
	M/s Vaibhavi has laid Optical Fiber Cable (OFC) by using High-Density Polyethylene (HDPE) pipe instead of Hume pipe (NP3 grade), thus deviating from approved drawings and impacting the mechanical protection of the cables.	An NC has been raised . M/s Vaibhavi to take appropriate measures against the same and to submit a detailed Root Cause Analysis (RCA) along with the Corrective and Preventive Action (CAPA) within this week .	21.03.2026 (M/s Vaibhavi)
	M/s Vaibhavi has laid the HT cable and OFC cable at the same level at blocks- 02 and 03, without maintaining the minimum vertical separation of 443 mm as specified in approved drawings, posing a risk of electromagnetic interference and communication signal disturbances in future.	An NC and work stoppage notice has been issued in this regard and M/s. Vaibhavi has been instructed to execute the work as per the approved drawings only.	23.03.2026 (M/s Vaibhavi)
Tharad	M/s Vaibhavi has failed to submit critical documents including ERT (Earth resistivity test) reports, V _{oc} checklists etc. against their committed timelines, thus delaying the HoTo process.	M/s Vaibhavi to submit the pending documents within a week to ensure smooth HoTo process.	20.03.2026 (M/s Vaibhavi)
Aland (W)	Repeated damages have been identified in incoming sets of WTG material (Blade tip, tower exterior, ELLE tape etc.), occurring due to improper handling during transportation by M/s Sangreen. The observed defects may compromise material integrity and impact the project timelines.	M/s Sangreen to ensure proper handling, loading, and transportation of materials and to submit the Root Cause Analysis (RCA) and a Corrective and Preventive Action (CAPA) to avoid recurrence of the damages during transportation activities.	22.03.2026 (M/s Sangreen)


Key Statistics

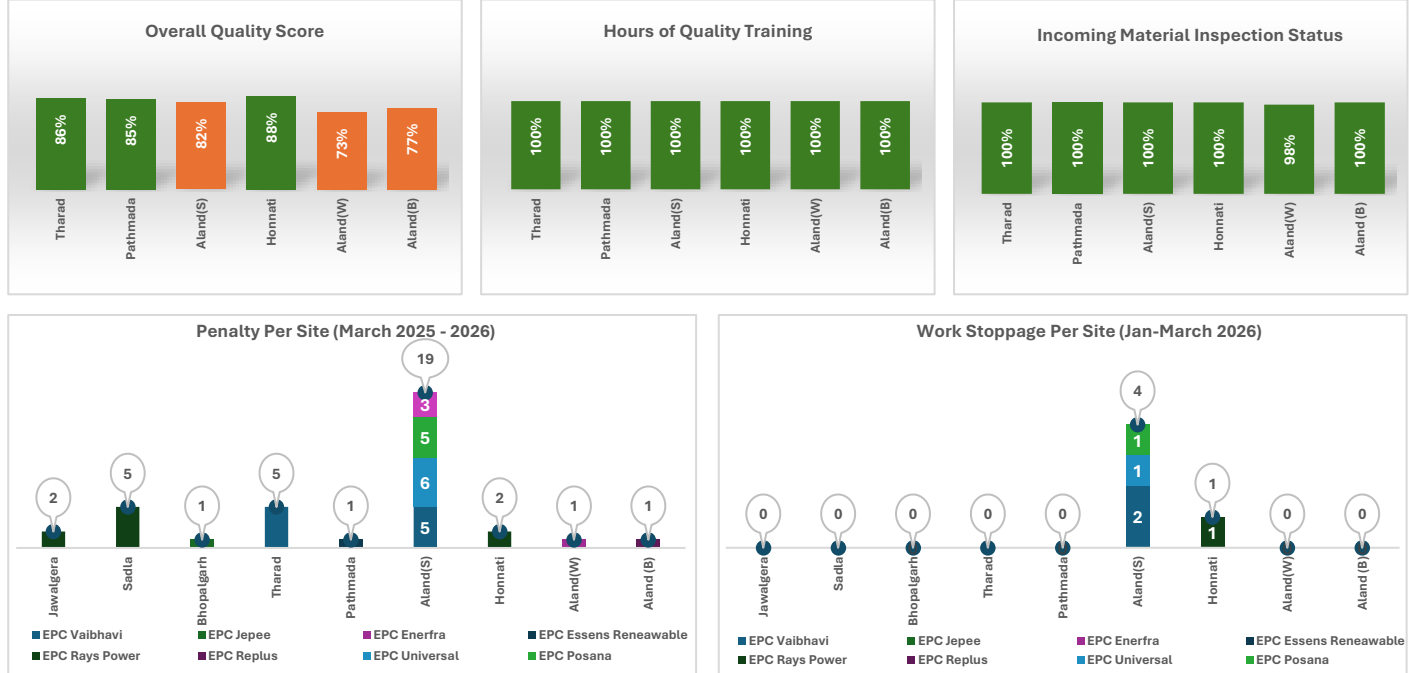

RFI Status

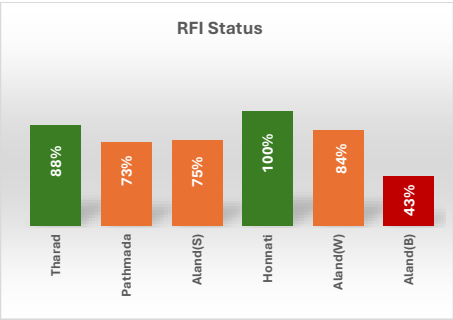

Resource Deployment by Contractor

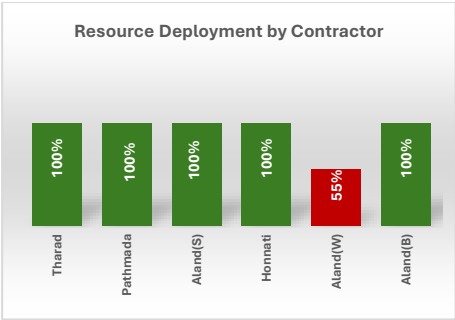

Non Conformity Closure status

