

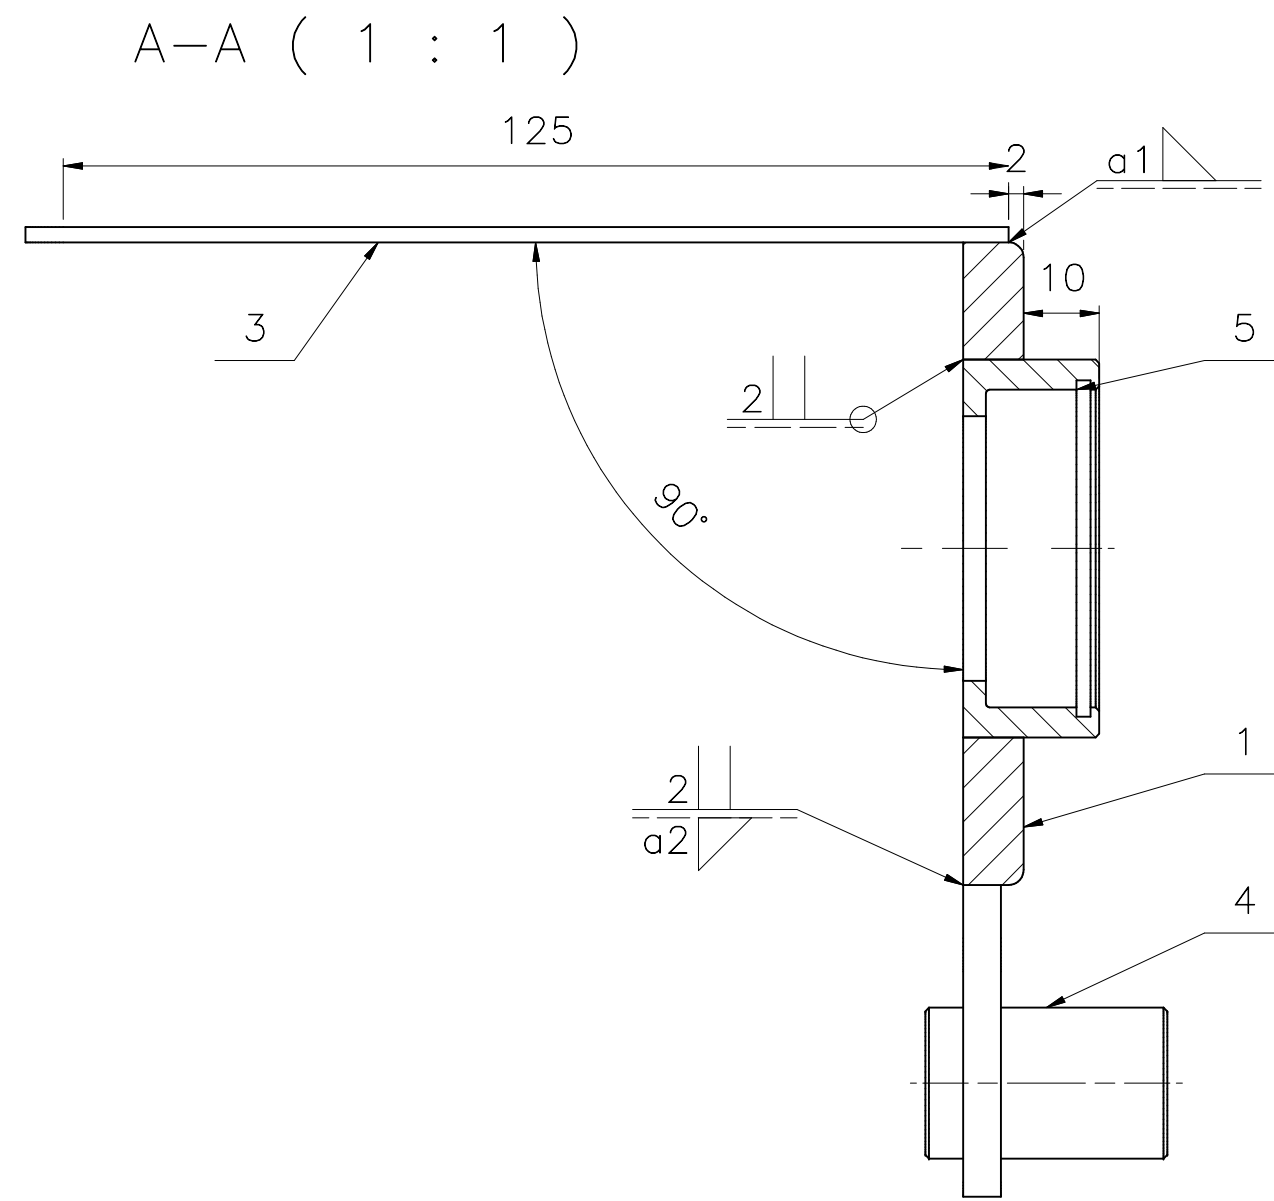
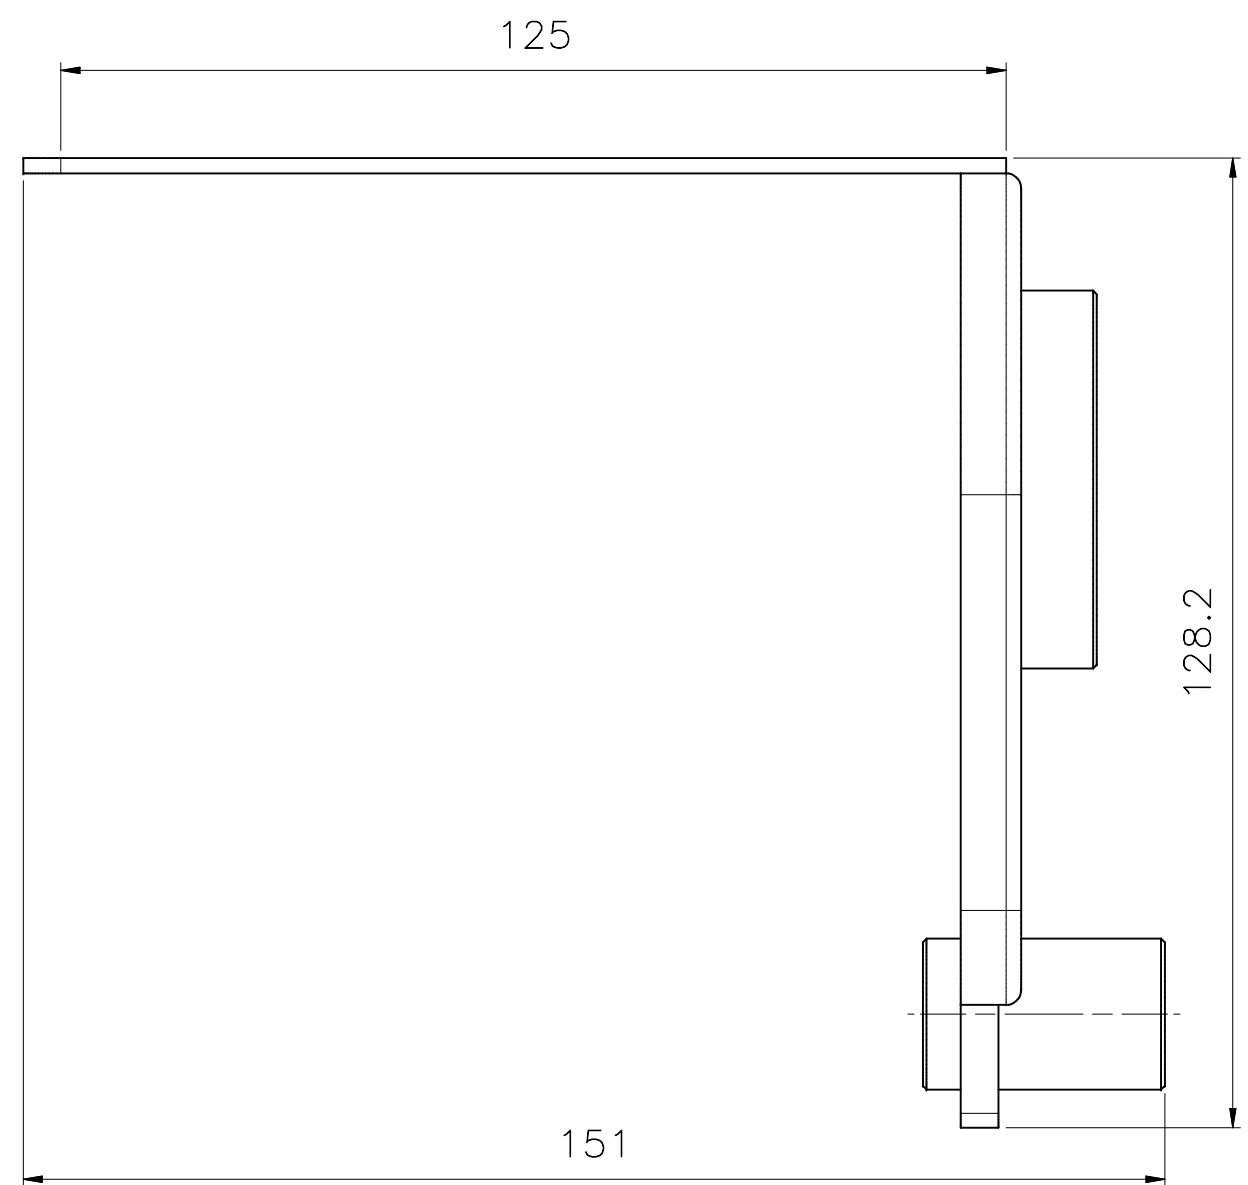
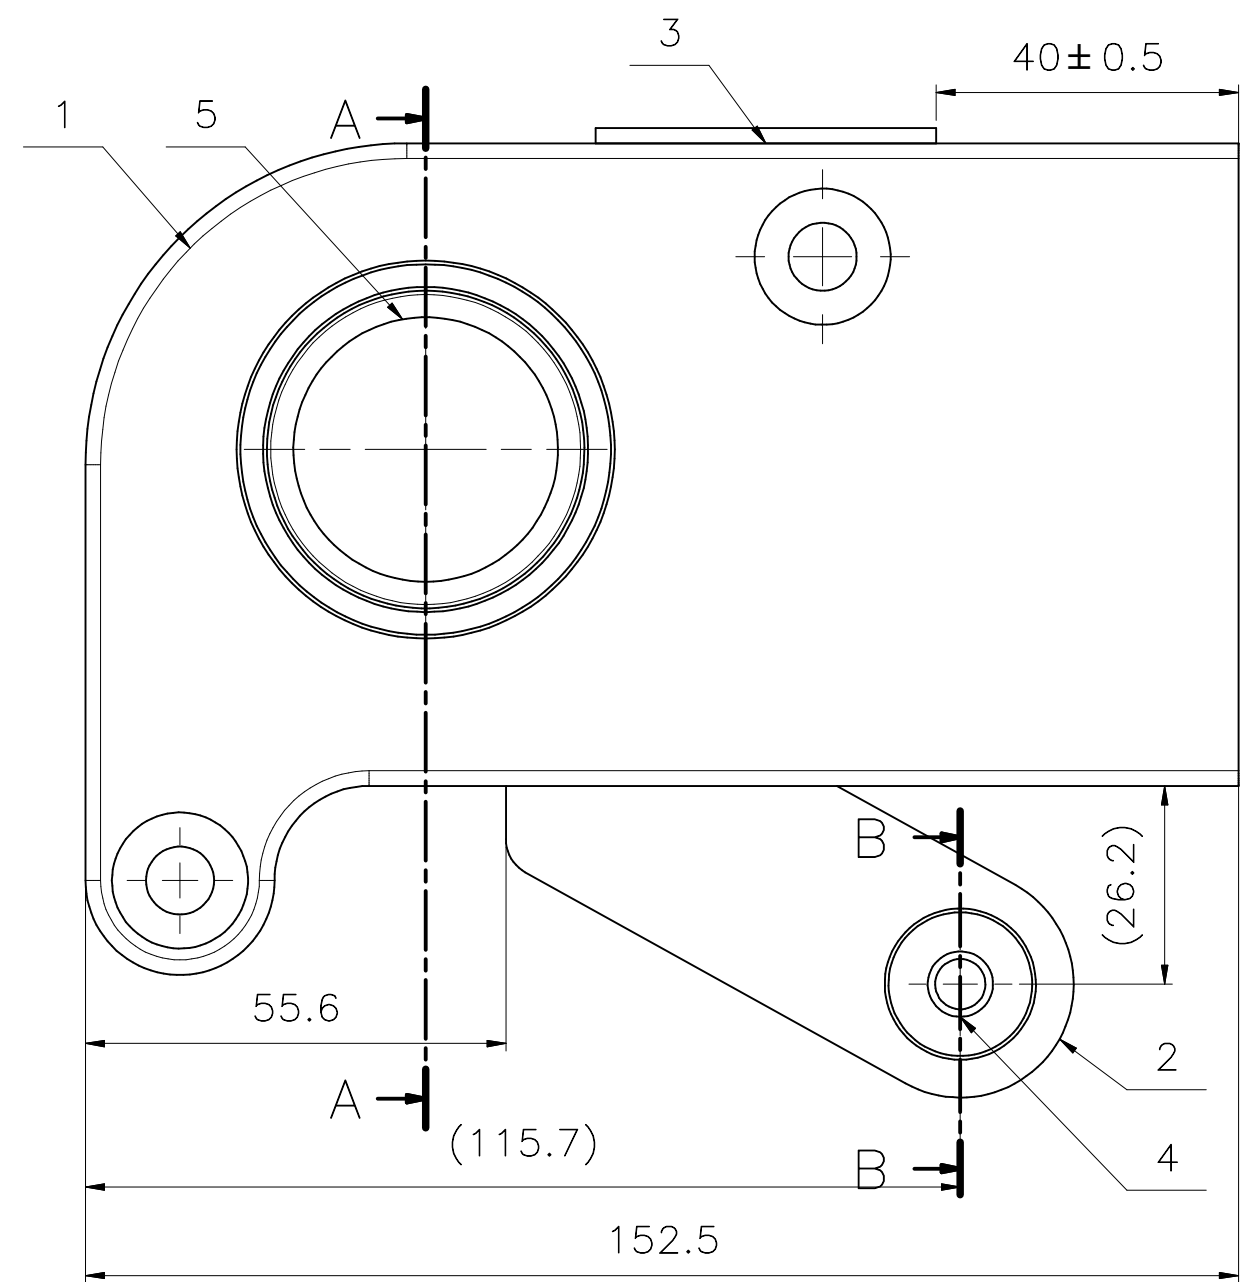
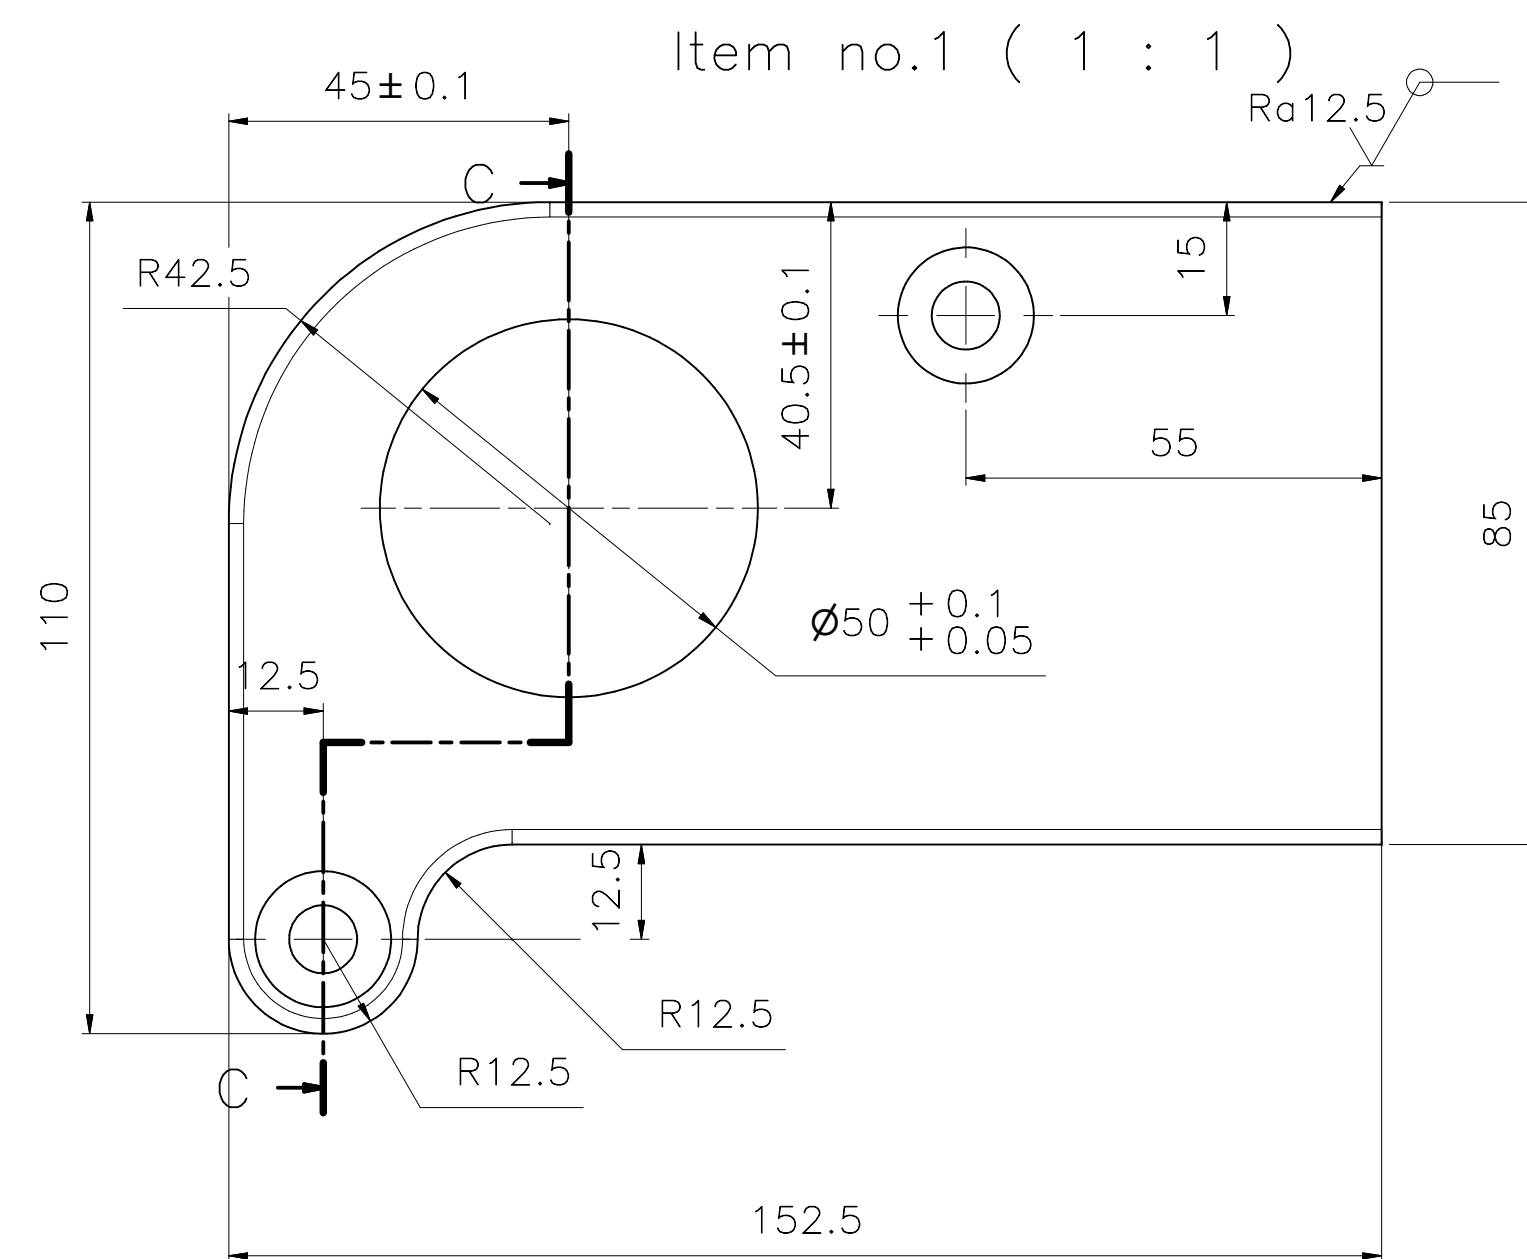


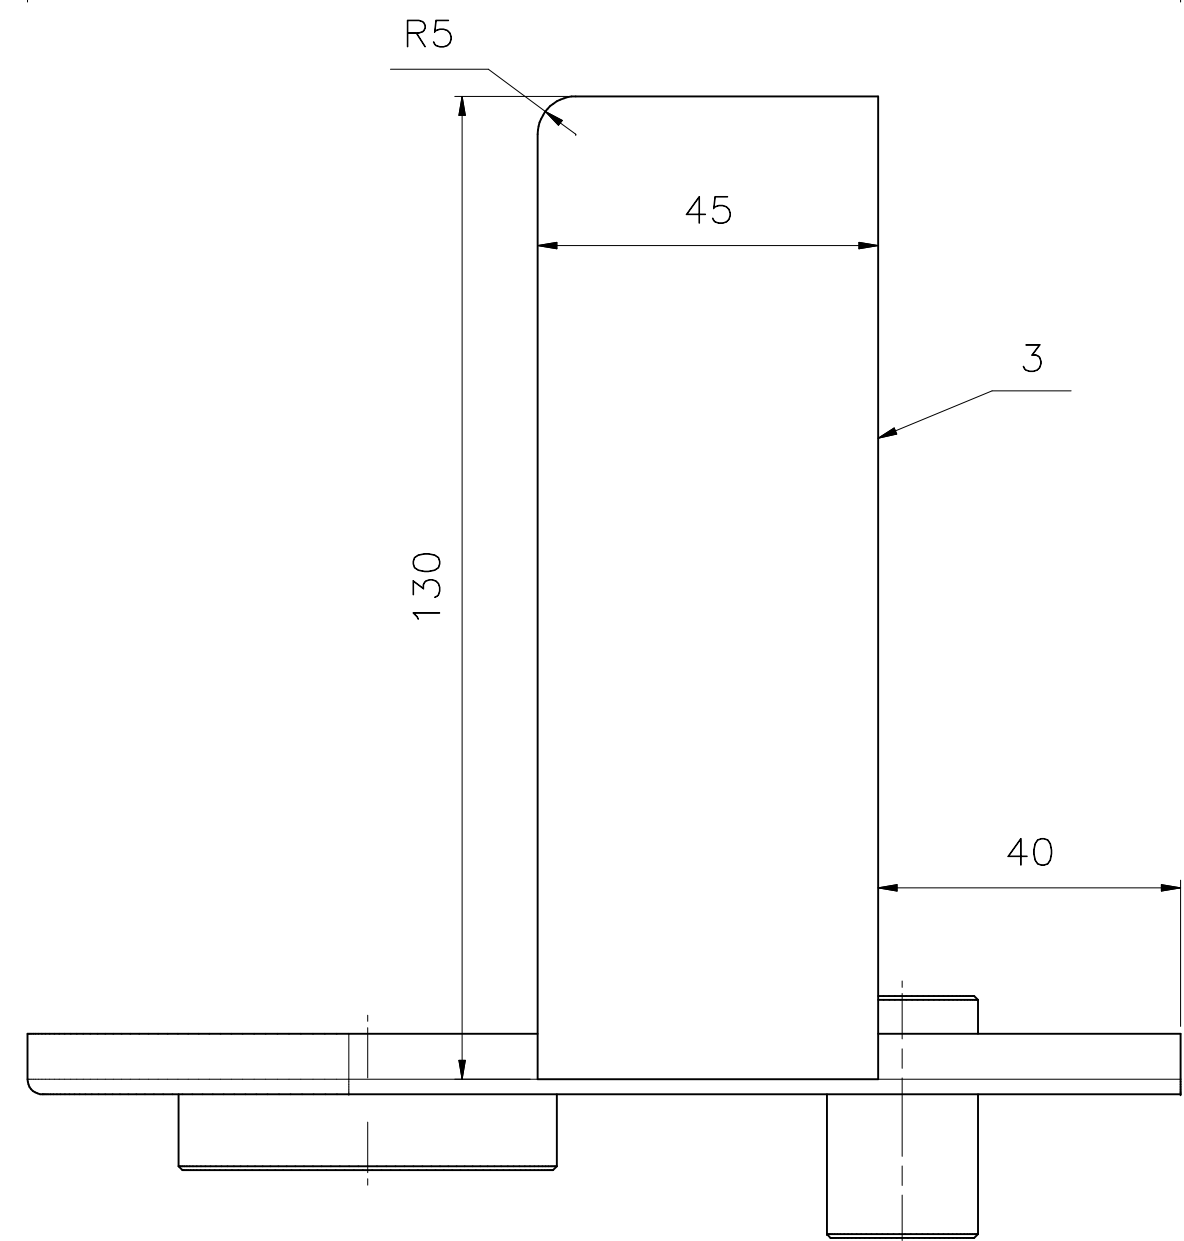


Comments:

1. Check assemblability.
2. Perform Assembly as shown in drawing.
3. Make a trial motions of individual mechanisms and moving parts in order to verify the correctness of installation.
4. Protect against damage and corrosion on time waiting for the main installation.




B-B (1 : 1)

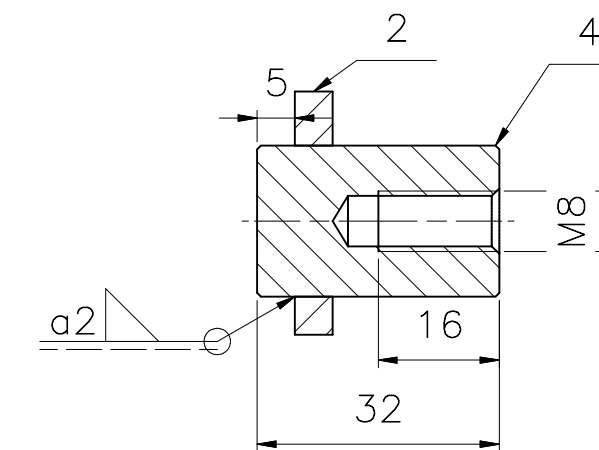


C-C (1 : 1)

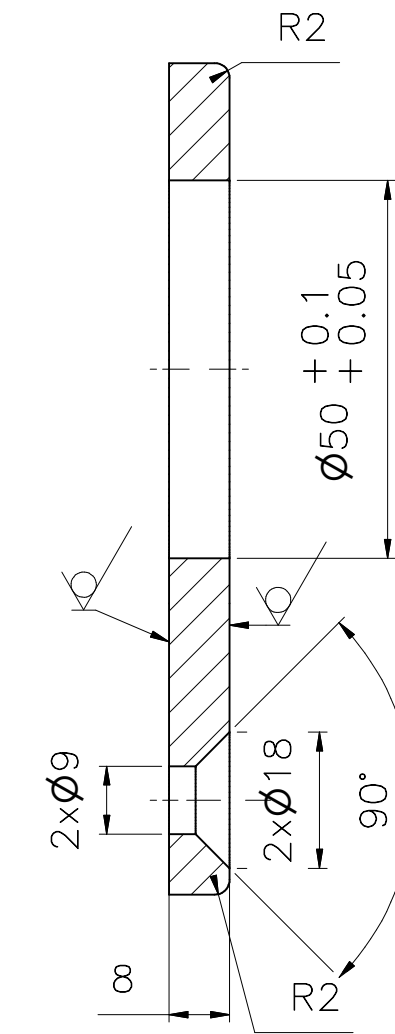



Item no.5 (2 : 1)

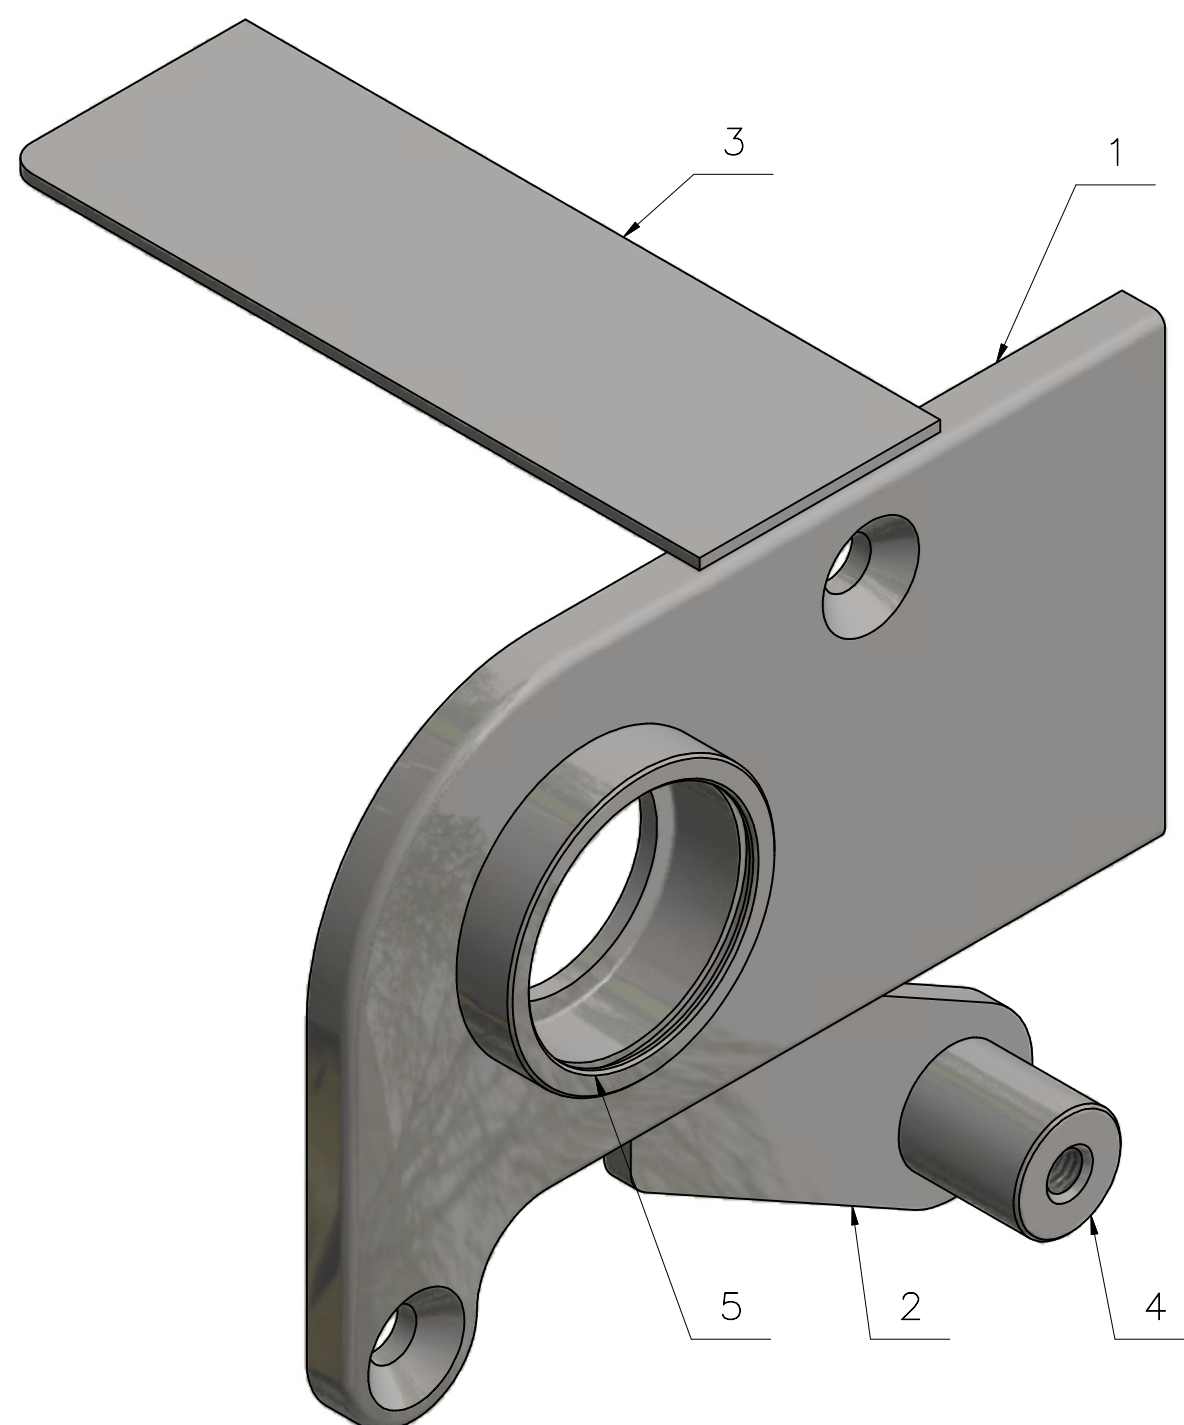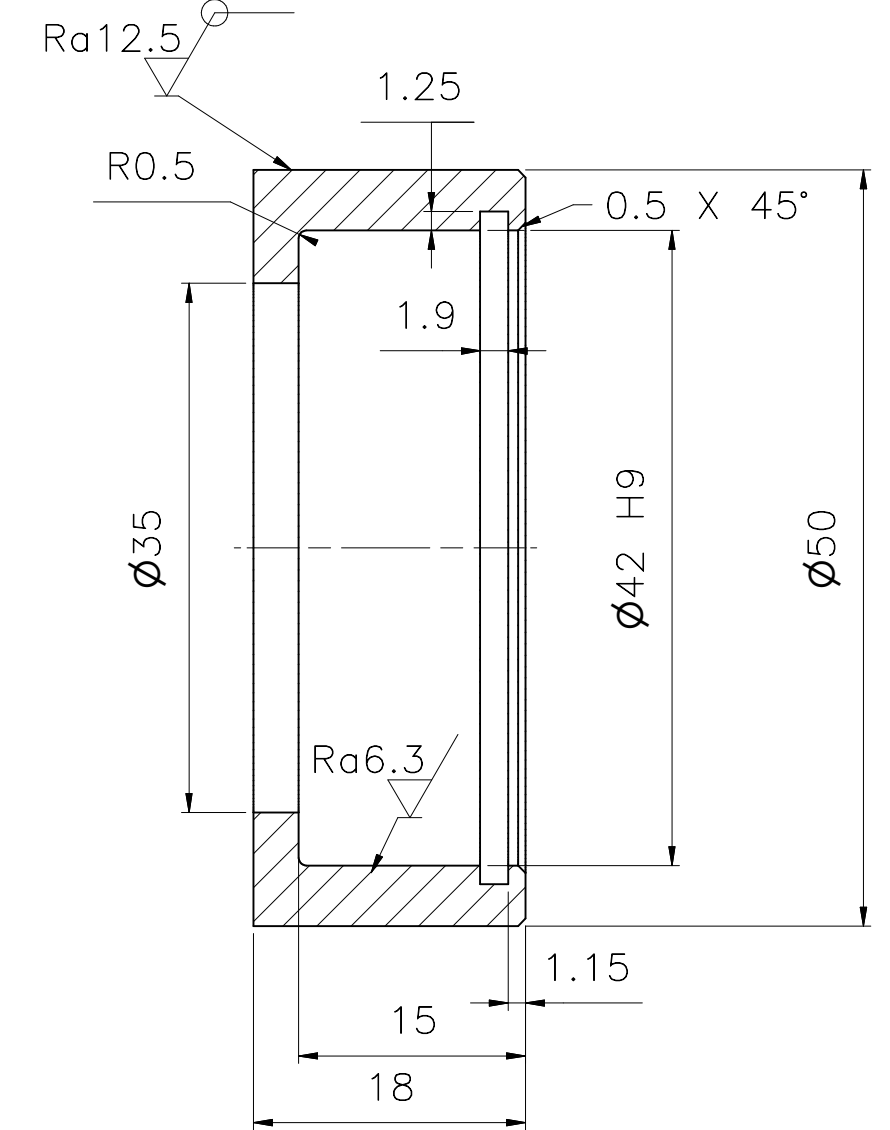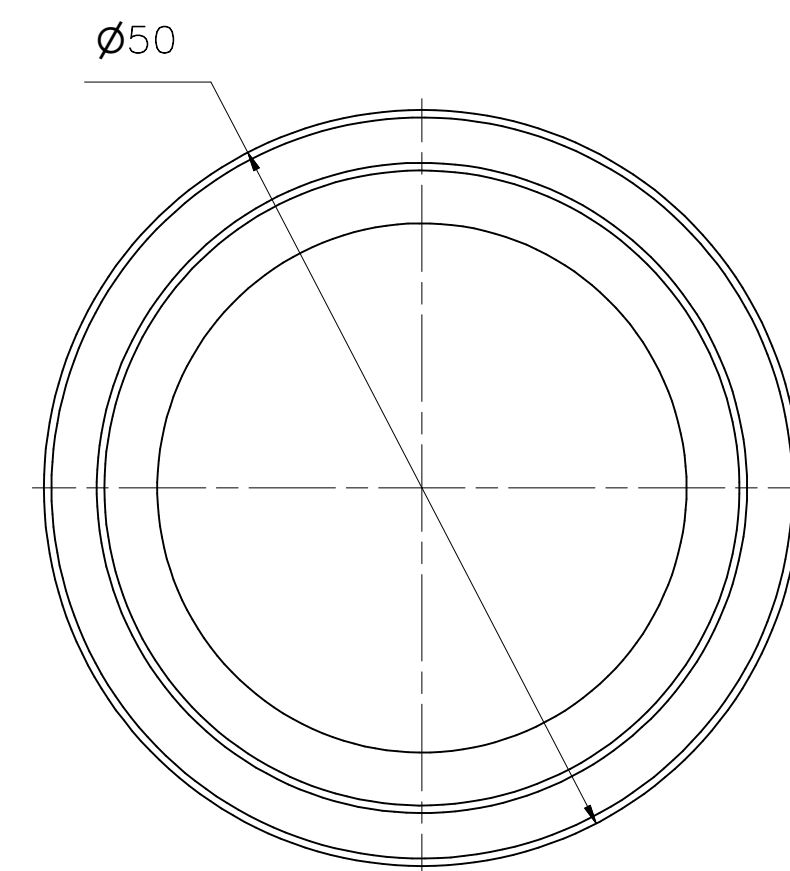


Item no.2 (1 : 1)

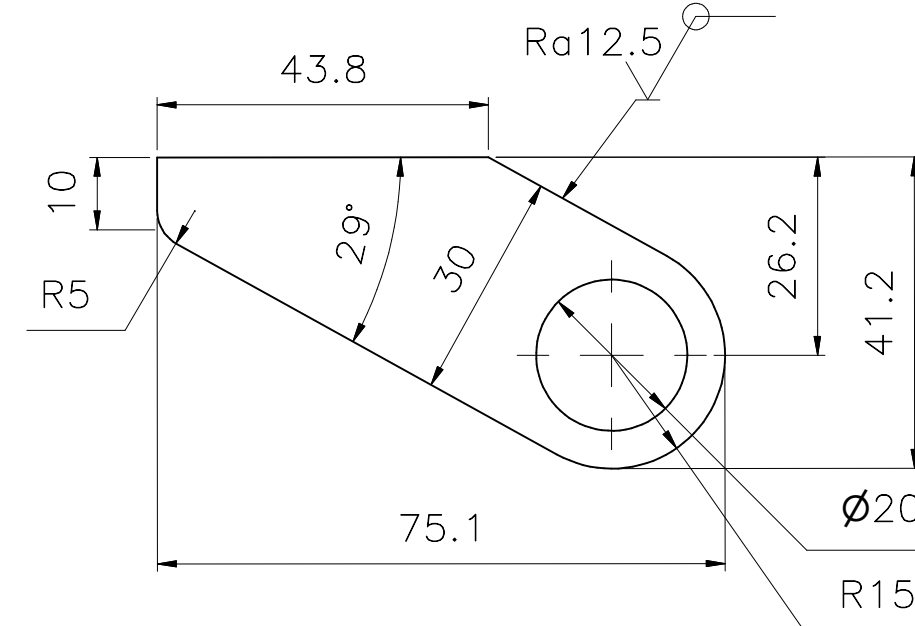

Item no.3 (2 : 1)

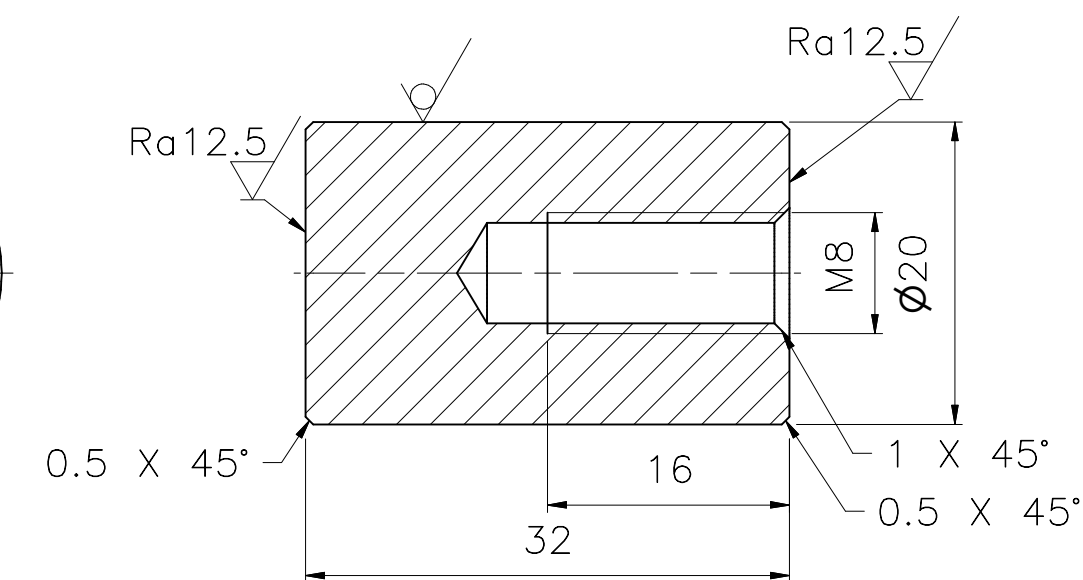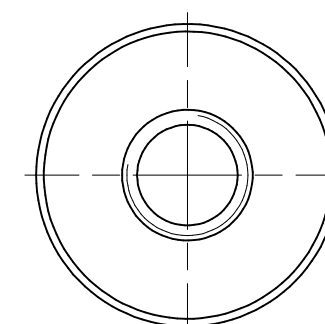

Item no.4 (1 : 1)

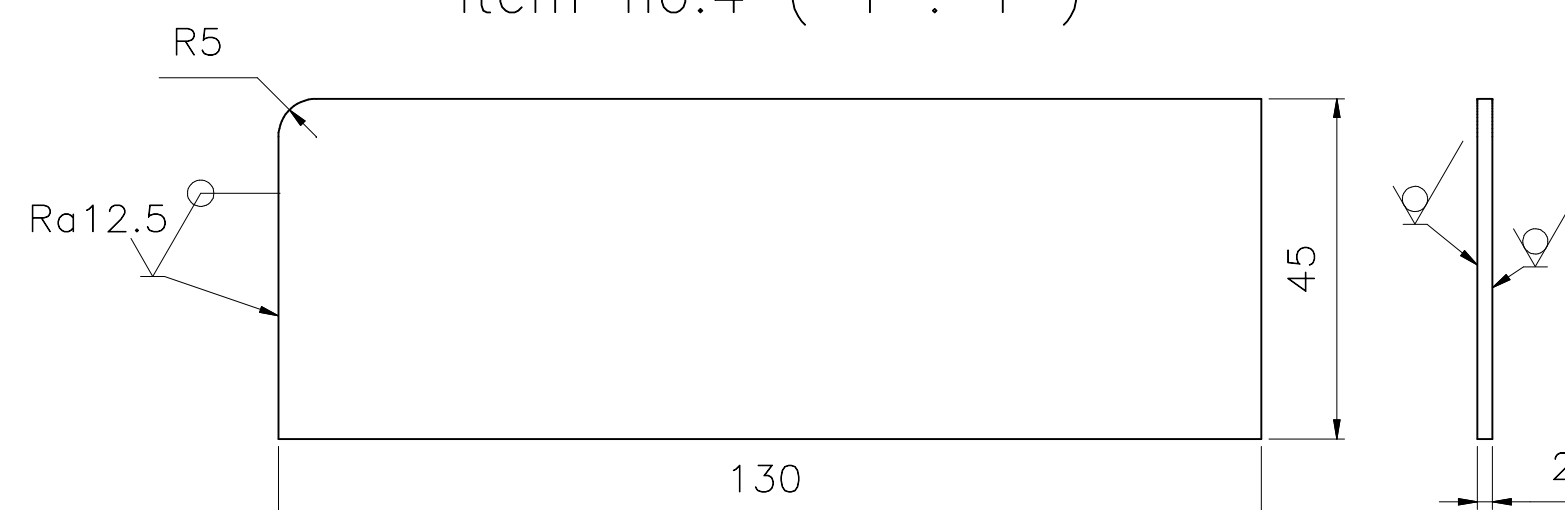

1	1	Plate 8x110x152,5	DIN-EN 10029	0	1.4301	0.7	Ex. Right
2	1	Plate 5x41x75	DIN-EN 10029	0	1.4301	0.06	
3	1	Plate 2x45x130	DIN-EN 10029	0	1.4301	0.09	
4	1	Bar Ø20-32	DIN-EN 10060	0	1.4301	0.07	
5	1	Bar 18x Ø50/Ø35	DIN-EN 10060	0	1.4301	0.09	
Item	Qty.	Name of part	Drawing number, standard	Rev.	Material	Weight Ipcs. kg	Comments
Investor:							
		Weight 1 set 1.0 kg	Drawing name Conveyor Belt 900mm Conveyor Body Drum support 1				
Engin.	2016-05-28	papacad	Drawing number CB-900 01.01.00.00		Revision 0		
Draw.	2016-04-29	papacad					
Check.	2016-05-28	papacad					
Ver.	2016-04-29	papacad					
Appr.	2016-04-29	papacad					
papacad 3D & 2D CAD PROJECTS free & purchase			www.papacad.com	Scale 1 : 1	Format A1	Sheet 1 / 1	