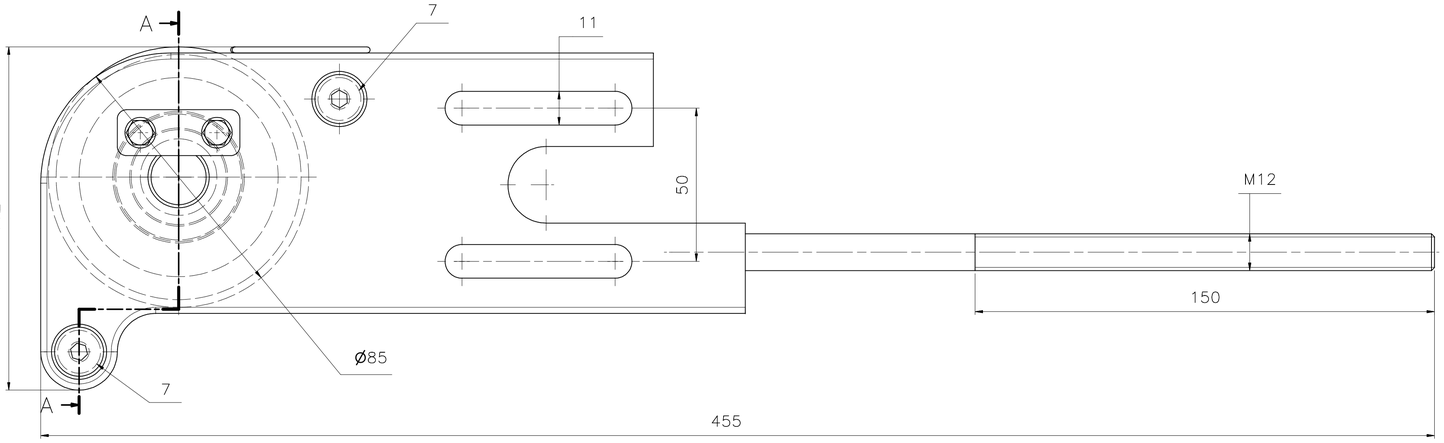

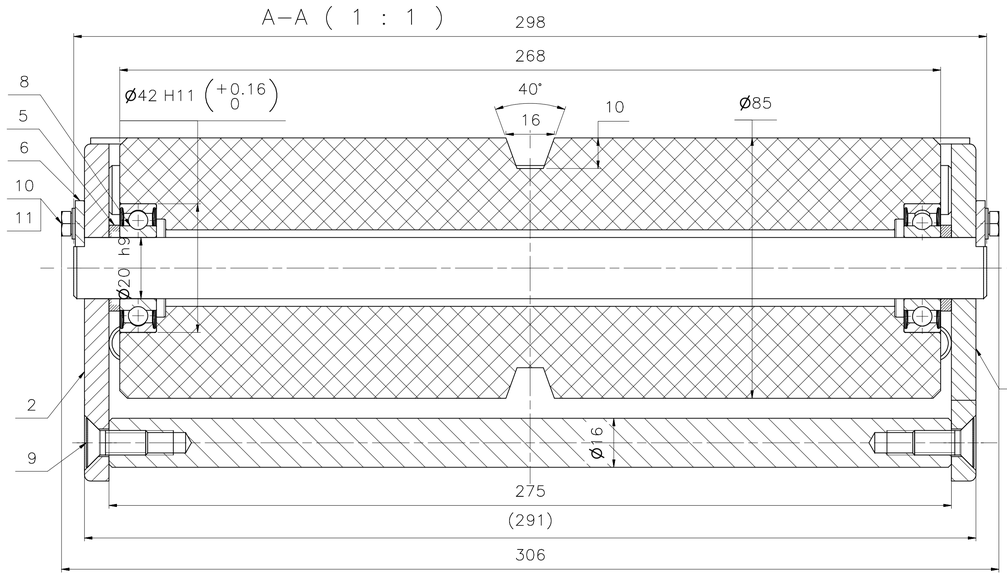

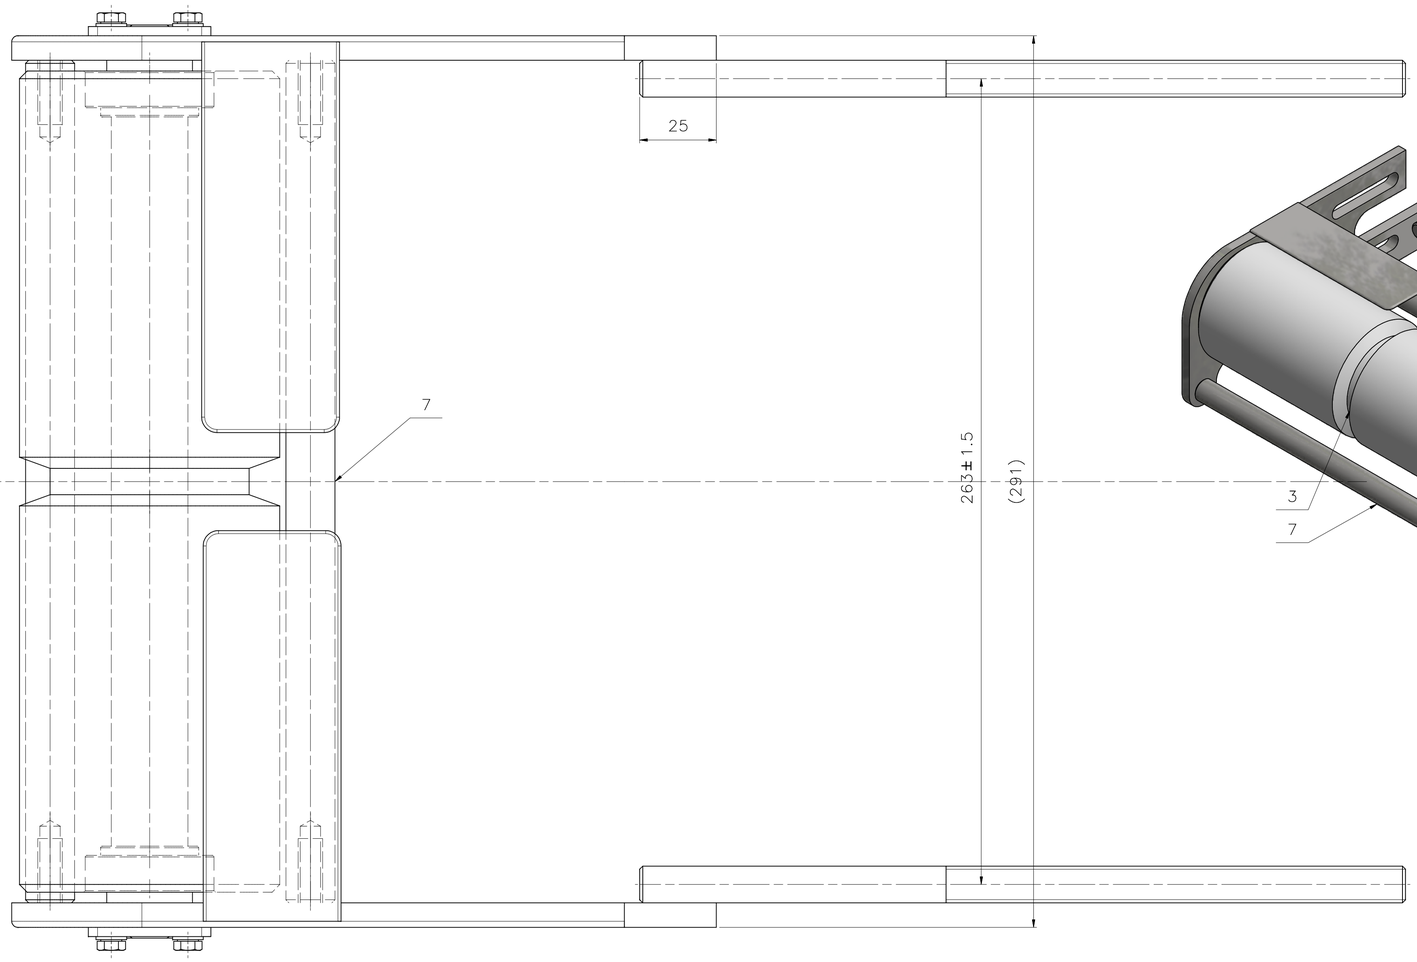

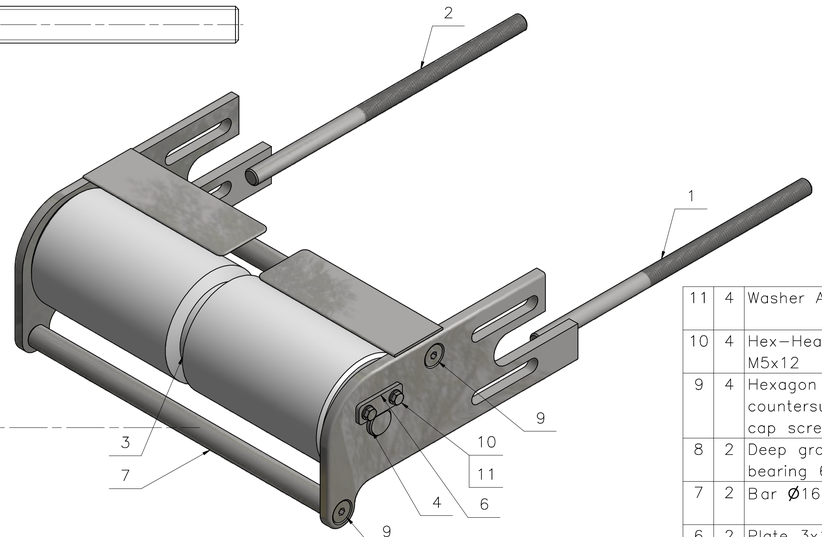

Item	Qty.	Name of part	Drawing number, standard	Rev.	Material	Weight 1pcs. kg	Comments
11	4	Washer A5.3	DIN 125 – A 5,3	0	A2	0	
10	4	Hex–Head Bolt M5x12	ISO 4017 – M5 x 12	0	A2	0	
9	4	Hexagon socket countersunk head cap screw M8x20	DIN 7991 – M8x20	0	A2	0.01	
8	2	Deep groove bearing 6004–2RS1	SKF	0		0.01	
7	2	Bar Ø16–275	CB–900 00.00.00.01	0	1.4301	0.43	
6	2	Plate 3x15x40	CB–900 03.00.00.04	0	1.4301	0.01	
5	2	Bar Ø28, L=5	CB–900 03.00.00.03	0	1.4301	0.01	
4	1	Bar Ø20, L=298	CB–900 03.00.00.02	0	1.4301	0.73	
3	1	Drum	CB–900 03.00.00.01	0	PA 6	1.34	
2	1	Tension Drum support – execution L	CB–900 03.02.00.00	0	wg rysunku	1.29	Exec.L
1	1	Tension Drum support – execution R	CB–900 03.01.00.00	0	1.4301	1.29	Exec.P

Inwestor:

Weight 1 set 5,6 kg

Engin.	2016–05–27	papacad
Draw.	2016–05–27	papacad
Check.	2016–05–27	papacad
Ver.	2016–05–27	papacad
Appr.	2016–05–27	papacad

Drawing name: Conveyor Belt 900mm Main Assembly Tension Drum

Drawing number: CB–900 03.00.00.00

Revision: 0

papacad 3D & 2D CAD PROJECTS free & purchase

www.papacad.com

Scale: 1 : 1

Size: A1

Sheet: 1 /1

Comments:

1. Check assemblability.
2. Perform Assembly as shown in drawing.
3. Make a trial motions of individual mechanisms and moving parts in order to verify the correctness of installation.
4. Protect against damage and corrosion on time waiting for the main installation.