ME 535 Assignment 8 - Fall 2018


Debabrata Auddya

Ex. 6.12 — Revolution

1. Create a NURBS represented revolved surface.

```
% Copyright: Xiaoping Qian @ UW-Madison
close all; clear all;
% profile 1
P = [0001;
      500 1;
     5 0 5 1;
      0 0 5 1;]; % curve in x-z plane
knots = [0 0 0 0 1 1 1 1];
order = 4;
% profile 2
P = [0 \ 0 \ 0 \ 1;
     7 0 -8 1;
     10 0 -10 1;
     8 0 -15 1;
     11.5 0 -17.5 1;
     7.5 0 -20 1;
     6.5 0 -25 1;
     5.5 0 -29 1;
     4.7 0 -35.5 1;
     5.5 0 -37.5 1;
     6.5 0 -40.5 1;
     13.5 0 -45 1;];
knots = [0 0 0 0 0.333 0.47 0.48 0.49 0.54 0.59 0.62 0.666 1 1 1 1];
%do plot of control polygon
Q = bsplineCurve(P, order, knots, 50);
plot3(P(:,1),P(:,2), P(:,3), 'r-s');
hold on:
plot3(Q(:,1),Q(:,2), Q(:,3), b', 'linewidth',2);
axis equal;
%print('-dpdf','-painters','revolution0.pdf')
P0 = P; % curve CPs
P1 = P0(:,1:4)+P(:,1)*[0 1 0 0]; P1(:,4) = P(:,4).*sqrt(2)/2; % offset CPs
P2 = P1(:,1:4)+P(:,1)*[-1 0 0 0]; P2(:,4) = P(:,4); % offset CPs
P3 = P2(:,1:4)+P(:,1)*[-1 0 0 0]; P3(:,4) = P(:,4)*sqrt(2)/2;
P4 = P3(:,1:4)+P(:,1)*[0 -1 0 0]; P4(:,4) = P(:,4); % offset CPs
P5 = P4(:,1:4)+P(:,1)*[0-100]; P5(:,4) = P(:,4)*sqrt(2)/2;
P6 = P5(:,1:4)+P(:,1)*[1 0 0 0]; P6(:,4) = P(:,4); % offset CPs
P7 = P6(:,1:4)+P(:,1)*[1 0 0 0]; P7(:,4) = P(:,4)*sqrt(2)/2;
P8 = P7(:,1:4)+P(:,1)*[0 1 0 0]; P8(:,4) = P(:,4); % offset CPs
CPs = [P0; P1; P2; P3; P4; P5; P6; P7; P8]; % v first
knots_u = [0 \ 0 \ 0 \ 1 \ 1 \ 2 \ 2 \ 3 \ 3 \ 4 \ 4 \ 4]/4.;
knots_v = knots;
k1 = 3;
k2 = order;
ncp_u = 9;
ncp_v = size(P,1);
cph=[CPs(:,1:3).*CPs(:,4), CPs(:,4)]; % turn into homogneous coorinates
tCP = reshape(cph', [4, ncp_v, ncp_u]);
```

```
CPs_d3 = permute(tCP,[1,3,2]); % change it to u first by switching 3rd dimension w/ 2nd dimension
nrbs.type = 'Surface';
nrbs.number = [ncp_u, ncp_v];
nrbs.coefs = CPs_d3; % CPs in homogeneous coordinates
nrbs.knots = {knots_u knots_v};
nrbs.order = [k1 k2];
plotNrbs(nrbs);
```

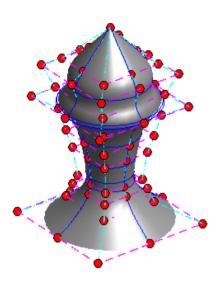

```
%print('-dpdf','-painters','revolution1.pdf')

nrbs_Spink.form='B-NURBS';
nrbs_Spink.dim = 4

nrbs_Spink = struct with fields:
    form: 'B-NURBS'
    dim: 4

nrbs_Spink.number = [ncp_u, ncp_v];
tCP = reshape(CPs',[4,ncp_v,ncp_u]);
CPs_d3 = permute(tCP,[1,3,2]); % change it to u first by switching 3rd dimension w/ 2nd dimension nrbs_Spink.coefs = CPs_d3; % CPs in Euclidean coordinates
nrbs_Spink.knots = {knots_u knots_v};
nrbs_Spink.order = [k1 k2];
NrbsSrf2IGES(nrbs_Spink,'revolutionChess.igs','./');
```

ans = 'Finished Export to IGES'


2. Export the surface into an IGES file.

```
disp('Igs file exported and named as revolutionChess.igs')
```

Igs file exported and named as revolutionChess.igs

3. Import the IGES file into a CAD software and render the surface.

```
figure(2)
image1 = imread('image1.png');
imshow(image1)
```

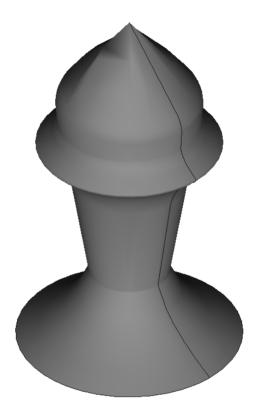


Ex. 6.13 — Sweeping

${\bf 1.}\ Create\ a\ NURBS\ represented\ translationally\ sweeping\ surface.$

```
% Copyright: Xiaoping Qian @ UW-Madison
close all; clear;
% profile 1
P = [ 0 0 0 1;
     5 0 0 1;
     5 0 5 1;
     0 0 5 1;] % curve in x-z plane
P =
    0
         0
                 1
         0
                 1
    5
            0
    5
              5
                1
knots = [0 0 0 0 1 1 1 1];
order = 4;
```

```
% profile 2
P = [25 \ 5 \ 0 \ 1;
     10 10 0 1;
     15 30 0 1;
     -15 30 0 1;
     -20 50 0 1;
     -25 55 0 1];
knots = [0 \ 0 \ 0 \ 0 \ 0.333 \ 0.666 \ 1 \ 1 \ 1 \ 1];
P2= [0 0 0 1;
    15 0 0 1;
    15 0 15 1;
    0 0 15 1];
%do plot of control polygon
Q = bsplineCurve(P, order, knots, 50);
plot3(P(:,1),P(:,2), P(:,3), 'r-s');
hold on;
plot3(Q(:,1),Q(:,2), Q(:,3),'b','linewidth',2);
axis equal;
%print('-dpdf','-painters','revolution0.pdf')
P0 = P; % curve CPs
CPs=[];
for i=1:size(P2,1)
    tCP=P(:,1:3)+P2(i,1:3);
    tCP(:,4) = P(:,4)*P2(i,4);
    CPs=[CPs;tCP];
end
%
%
      P1()=P0(:,1:3)+P2(i,1:3)
%
%
%
% end
% P1 = P0(:,1:4)+P(:,1)*[0 1 0 0]; P1(:,4) = P(:,4).*sqrt(2)/2; % offset CPs
% P2 = P1(:,1:4)+P(:,1)*[-1 0 0 0]; P2(:,4) = P(:,4); % offset CPs
% P3 = P2(:,1:4)+P(:,1)*[-1 0 0 0]; P3(:,4) = P(:,4)*sqrt(2)/2;
% P4 = P3(:,1:4)+P(:,1)*[0 -1 0 0]; P4(:,4) = P(:,4); % offset CPs
% P5 = P4(:,1:4)+P(:,1)*[ 0 -1 0 0]; P5(:,4) = P(:,4)*sqrt(2)/2;
% P6 = P5(:,1:4)+P(:,1)*[1 0 0 0]; P6(:,4) = P(:,4); % offset CPs
% P7 = P6(:,1:4)+P(:,1)*[1 0 0 0]; P7(:,4) = P(:,4)*sqrt(2)/2;
% P8 = P7(:,1:4)+P(:,1)*[0 1 0 0]; P8(:,4) = P(:,4); % offset CPs
% CPs = [P0; P1; P2; P3; P4; P5; P6; P7; P8]; % v first
knots_u = [0 \ 0 \ 0 \ 4 \ 8 \ 8]/8.;
knots_v = knots;
k1 = 3;
k2 = order;
ncp_u = size(P2,1);
ncp_v = size(P,1);
cph=[CPs(:,1:3).*CPs(:,4), CPs(:,4)]; % turn into homogneous coorinates
tCP = reshape(cph', [4, ncp_v, ncp_u]);
CPs_d3 = permute(tCP,[1,3,2]); % change it to u first by switching 3rd dimension w/ 2nd dimension
nrbs.type = 'Surface';
nrbs.number = [ncp_u, ncp_v];
nrbs.coefs = CPs_d3; % CPs in homogeneous coordinates
nrbs.knots = {knots_u knots_v};
nrbs.order = [k1 k2];
```

plotNrbs(nrbs);

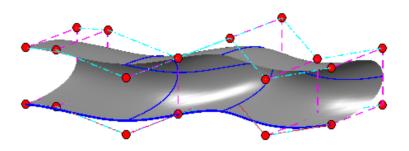

```
%print('-dpdf','-painters','revolution1.pdf')

nrbs_Spink.form='B-NURBS';
nrbs_Spink.dim = 4

nrbs_Spink = struct with fields:
    form: 'B-NURBS'
    dim: 4

nrbs_Spink.number = [ncp_u, ncp_v];
tCP = reshape(CPs',[4,ncp_v,ncp_u]);
CPs_d3 = permute(tCP,[1,3,2]); % change it to u first by switching 3rd dimension w/ 2nd dimension nrbs_Spink.coefs = CPs_d3; % CPs in Euclidean coordinates
nrbs_Spink.knots = {knots_u knots_v};
nrbs_Spink.order = [k1 k2];
NrbsSrf2IGES(nrbs_Spink,'sweep.igs','./')
```

ans = 'Finished Export to IGES'

2. Export the surface into an IGES file.

```
disp('Igs file exported and named as sweep.igs')
```

Igs file exported and named as sweep.igs

3. Import the IGES file into a CAD software and render the surface.

```
figure(3)
image2 = imread('image2.png');
imshow(image2)
```

