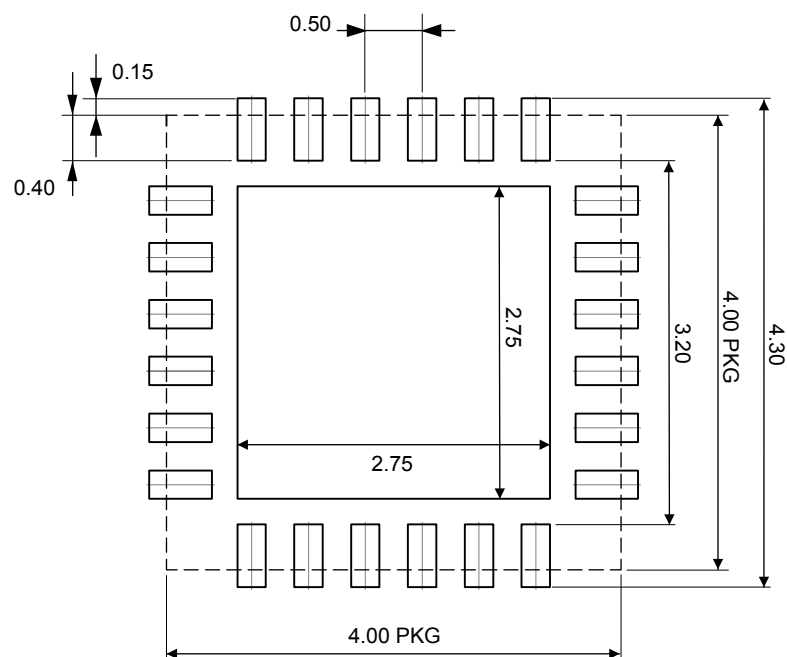


Table 73. UFQFPN24 - Mechanical data

Symbol	Millimeters			Inches ⁽¹⁾		
	Min	Typ	Max	Min	Typ	Max
A	0.45	-	0.60	0.0177	-	0.0236
A1	0	-	0.05	0	-	0.0020
A3 ⁽²⁾	0.152 REF			0.0060 REF		
L	0.30	0.40	0.50	0.0118	0.0157	0.0197
b	0.18	0.25	0.30	0.0071	0.0098	0.0118
D ⁽³⁾	4.00 BSC			0.1575 BSC		
E ⁽³⁾	4.00 BSC			0.1575 BSC		
e ⁽³⁾	0.50 BSC			0.0197 BSC		
D2	2.60	-	2.85	0.1024	-	0.1122
E2	2.60	-	2.85	0.1024	-	0.1122
bbb	-	0.10	-	-	0.0039	-
ccc	-	0.10	-	-	0.0039	-
eee	-	0.08	-	-	0.0031	-
N ⁽⁴⁾	24			24		

1. Values in inches are converted from mm and rounded to three decimal digits.
2. REF stands for reference.
3. BSC stands for basic dimensions. It corresponds to the nominal value and has no tolerance. For tolerances refer to the form and position table
4. Total number of terminals

Figure 42. UFQFPN24 - Footprint example


1. Dimensions are expressed in millimeters.