SkyG Speed 90B · revision C6B-24 · 2026-10-17 - carbon tube 40 x 38 mm, x 50-370 (320 mm) - cutting template page 1/3

Red: cut out (windows) or drill 5 mm (small crosses; a printed countersunk washer goes in each), 3.4 mm at the four wing-screw crosses (vertical: use the printed drill guide DG). Wrap the strip round the tube, ends flush, TOP line on top; tape it.
Windows: first drill a 6 mm hole at each corner cross (drill aimed at the tube's axis, a dowel inside behind the wall), then cut straight from hole to hole with a diamond disc just inside the red line and file to it: the holes make the r 3 corners.

Carbon dust: FFP3 mask, vacuum at the disc or cut wet, eye protection. Seal every cut edge and hole with thin CA (carbon conducts: no bare edge may touch a wire).

FRONT END of the tube (x 50): align the strip's edge with the cut tube end

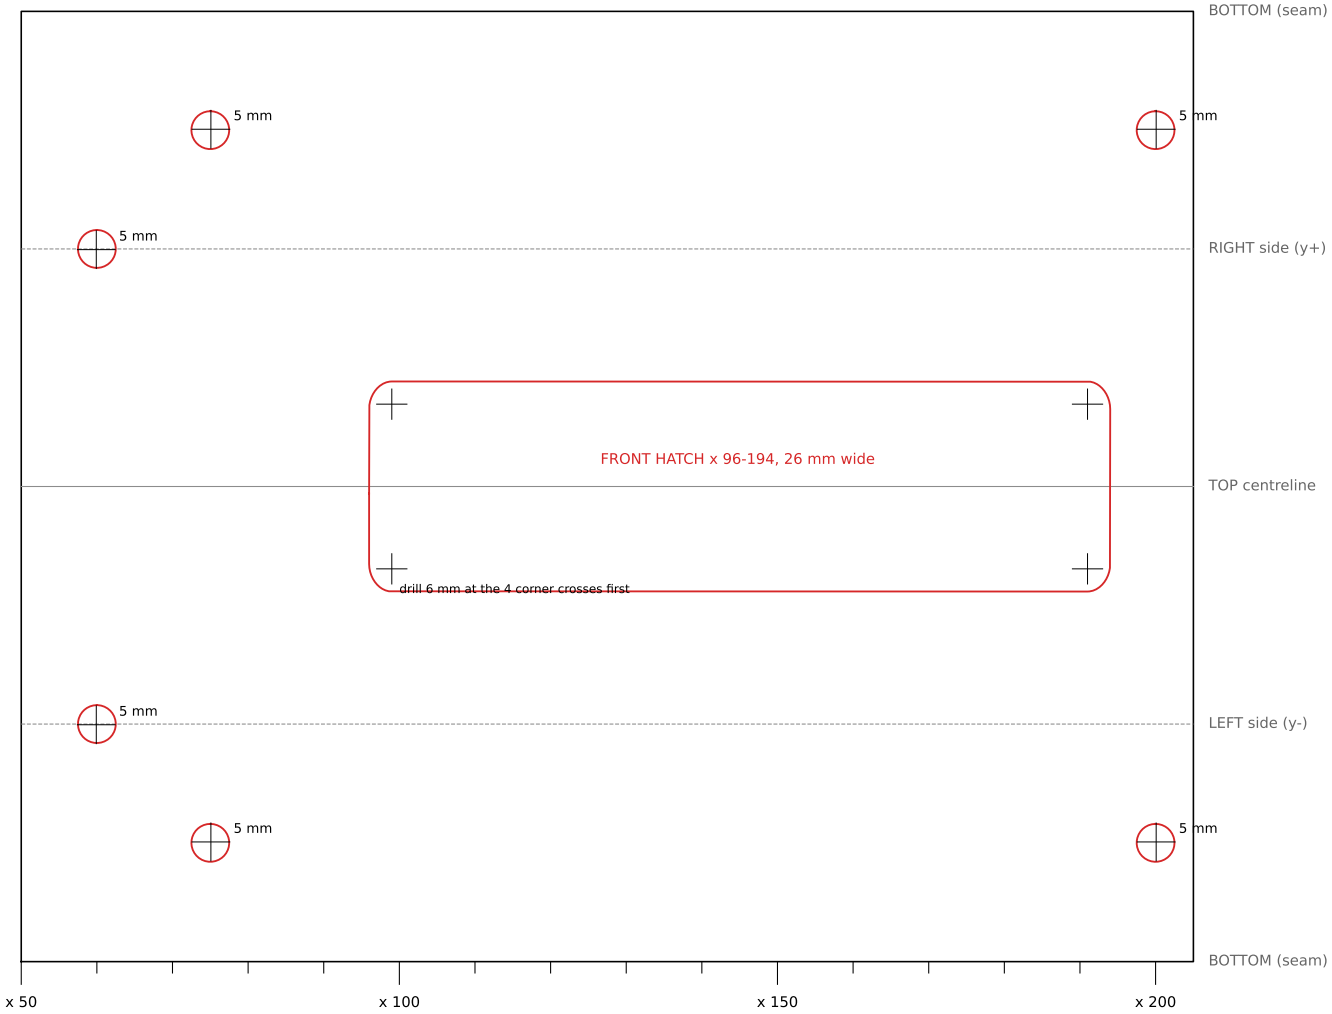

100 mm: measure this before cutting (print at 100 %, no scaling)

SkyG Speed 90B · revision C6B-24 · 2026-10-17 - carbon tube 40 x 38 mm, x 50-370 (320 mm) - cutting template page 2/3

Red: cut out (windows) or drill 5 mm (small crosses; a printed countersunk washer goes in each), 3.4 mm at the four wing-screw crosses (vertical: use the printed drill guide DG). Wrap the strip round the tube, ends flush, TOP line on top; tape it.
Windows: first drill a 6 mm hole at each corner cross (drill aimed at the tube's axis, a dowel inside behind the wall), then cut straight from hole to hole with a diamond disc just inside the red line and file to it: the holes make the r 3 corners.

Carbon dust: FFP3 mask, vacuum at the disc or cut wet, eye protection. Seal every cut edge and hole with thin CA (carbon conducts: no bare edge may touch a wire).

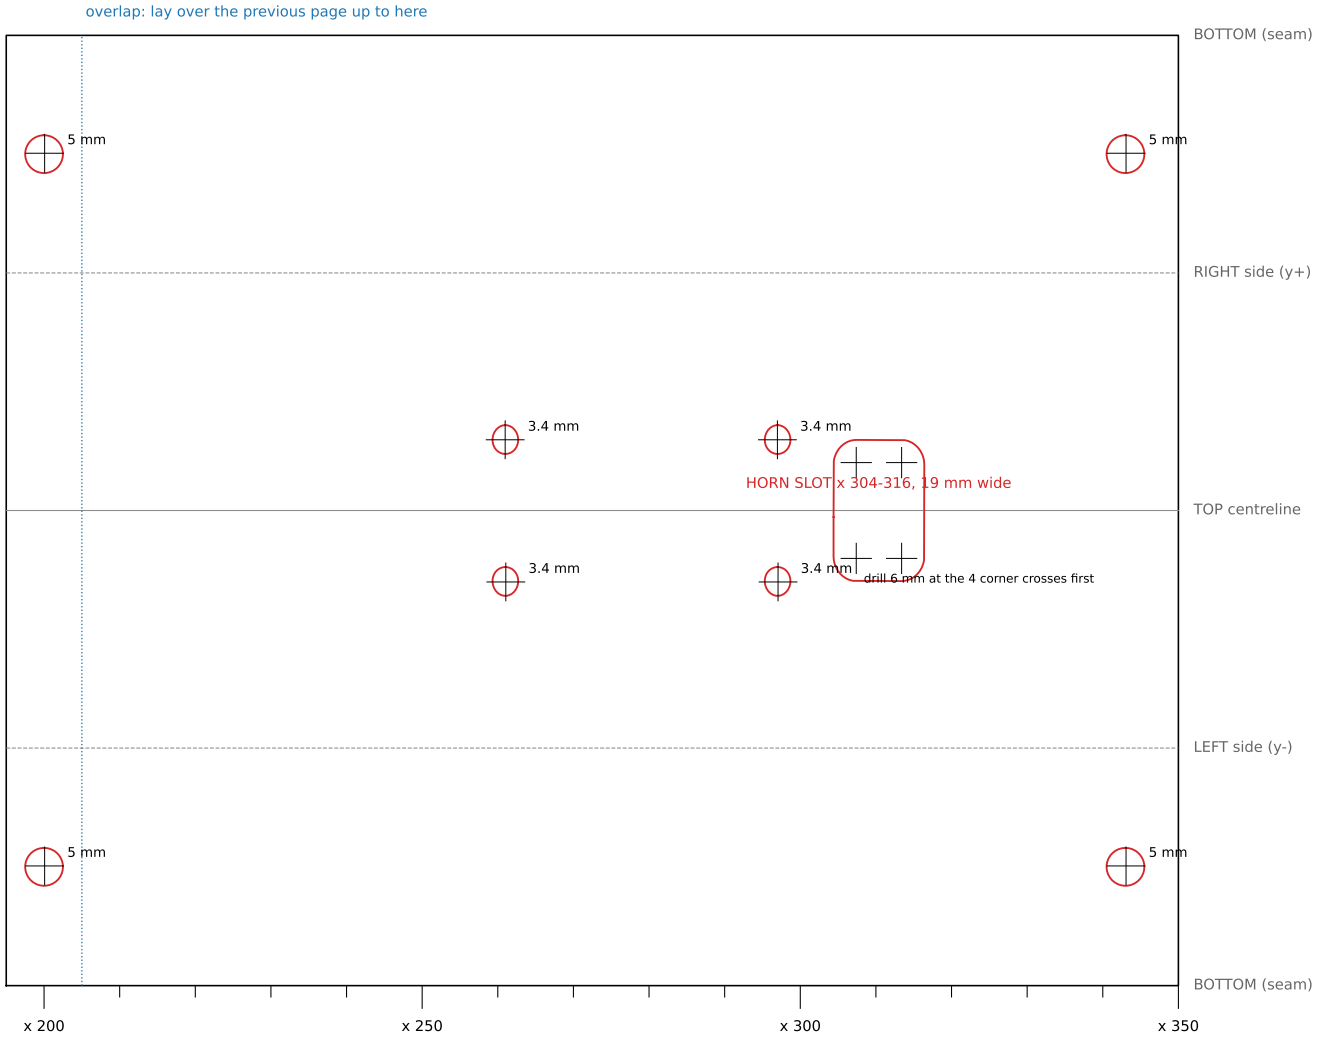

100 mm: measure this before cutting (print at 100 %, no scaling)

SkyG Speed 90B · revision C6B-24 · 2026-10-17 - carbon tube 40 x 38 mm, x 50-370 (320 mm) - cutting template page 3/3

Red: cut out (windows) or drill 5 mm (small crosses; a printed countersunk washer goes in each), 3.4 mm at the four wing-screw crosses (vertical: use the printed drill guide DG). Wrap the strip round the tube, ends flush, TOP line on top; tape it.
Windows: first drill a 6 mm hole at each corner cross (drill aimed at the tube's axis, a dowel inside behind the wall), then cut straight from hole to hole with a diamond disc just inside the red line and file to it: the holes make the r 3 corners.

Carbon dust: FFP3 mask, vacuum at the disc or cut wet, eye protection. Seal every cut edge and hole with thin CA (carbon conducts: no bare edge may touch a wire).

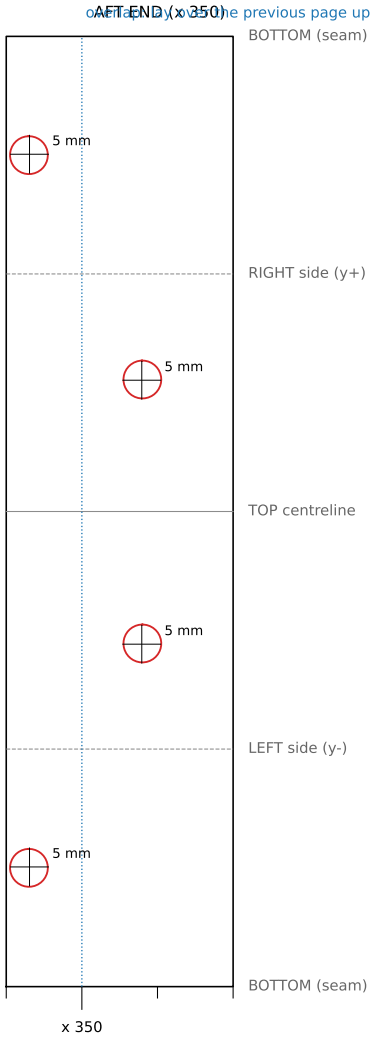

100 mm: measure this before cutting (print at 100 %, no scaling)