TECHNICAL NOTEEdition Anglaise



77 11 188 300 APRIL 1996

388A Service 0422

Type

S/Section

42

TWINGO

XXX	X

42


RE-PROOFING THE LOWER WING PANEL ROUNDED SECTION TO ACCOMMODATE SNOW CHAINS

Basic Manual: M.R. 306

The radius of the wing panel rounded section (pillar lining) has been increased to allow the fitting of snow chains. Therefore, on an older vehicle, for partial replacement of this component when cutting the middle of the rounded section, it will be necessary to adjust the shape of the edging of the part supplied by the Parts Department (see method described in the technical note).


UPPER FRONT STRUCTUREWing Panel (pillar lining)

PART SUPPLIED BY THE PARTS DEPARTMENT

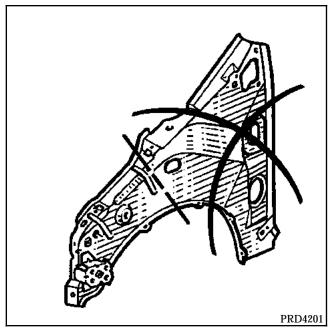



ON THE VEHICLE

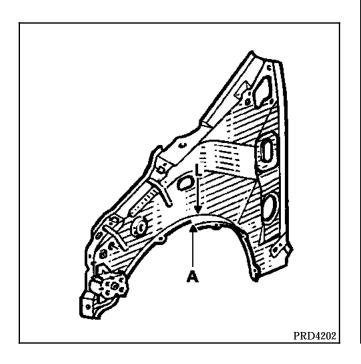

Shape the edge of the original along the line (L) in such a way as to adjust the rounded section of both parts of the component, then cut off any excess metal at (A).