INTRALOX

Site walk report — Example Foods - Smithfield

Infeed to packing · Site call · 29 October 2026

VISIT DETAILS

Date	29 October 2026
Customer	Example Foods - Smithfield
Site or area	Infeed to packing
Intralox contact	Alex Example


PEOPLE

NAME	ROLE
Jo Bloggs	Maintenance
Pat Example	Engineering Manager


NOTES

- Walked three conveyors with Jo Bloggs, from the infeed (CV-100) to packing (CV-300).
- CV-100 infeed: carryway wear strips worn at the transfer end, about half their height left. Example Foods maintenance will replace them at the next shutdown. Belt, tracking, sprockets, shafts and return way are fine.
- CV-200 spiral exit: rods walking out on the left side about every third row, with worn hinges, since the wash-down change about six weeks ago. Drive sprocket teeth are hooked. A new belt and sprockets are recommended (Belts to quote, below).
- CV-300 packing: belt tracking to the right and rubbing the side frame near the outfeed. Not urgent; check the take-up adjustment at the next service. Hygiene is good.
- Second packing line: Pat Example is planning a second packing line next year, about 30 m of conveyor. Design starts in March, installation over the Christmas shutdown. Intralox to help with the layout.
- Follow-ups: quote the CV-200 belt and sprockets by Friday 30 October (Alex Example). Send the spiral and transfer case studies to Pat Example next week (Alex Example).

PHOTOS

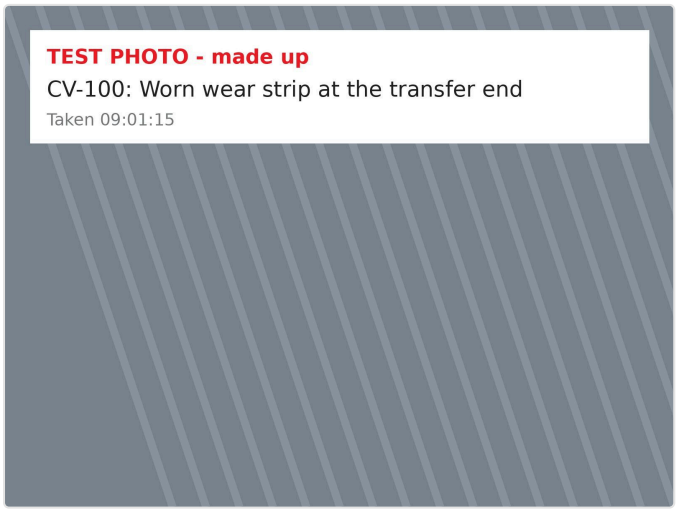

09:01 CV-100: carryway wear strips worn down at the transfer end.

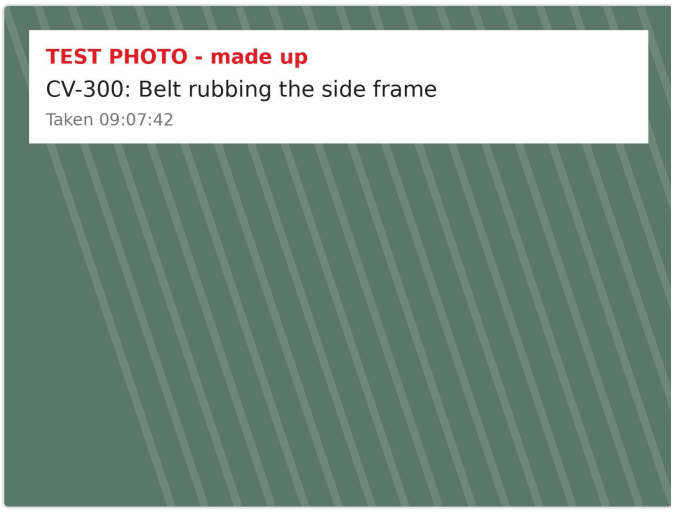

09:07 CV-300: belt rubbing the side frame near the outfeed.


BELTS TO QUOTE

Belt 1 — CV-200


BELT	
Line / description	Spiral exit
Series	800
Style / surface	Flat Top
Belt material	Acetal
Colour	White
Belt width (mm)	457
Belt length (m)	24 (about)
SPROCKETS	
Description	11 tooth
Bore	40 mm square

GENERAL COMMENTS


Replacing a belt with rods walking out and worn hinges; the drive sprockets are hooked and are replaced with it. Quote requested by Friday 30 October.

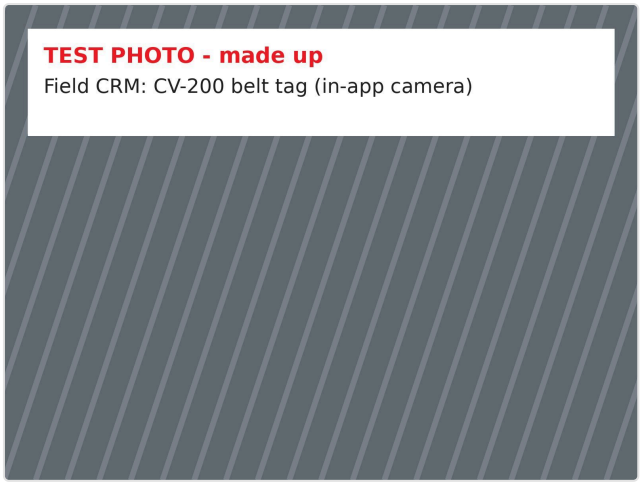

CV-200: belt tag, photographed in Field CRM.

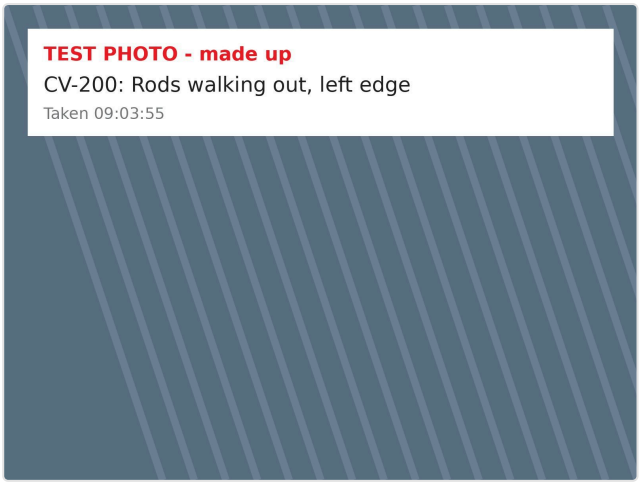

09:03 CV-200: rods walking out on the left edge.

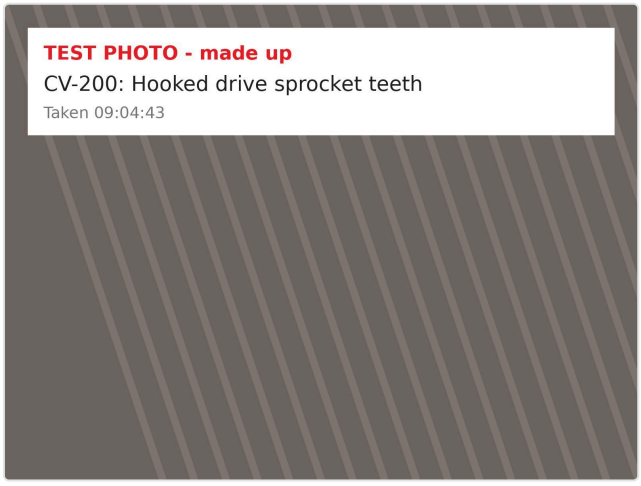

09:04 CV-200: drive sprocket teeth hooked.