

LOC/DME I-HRJ	APP CRS	Rwy Ldg
108.35	048°	5005
Chan 20(Y)		TDZE 196
		Apt Elev 202




LOC RWY 5

HARNETT RGNL JETPORT (HRJ)

DME required.

MISSED APPROACH: Climb to 700 then climbing left turn to 2000 on heading 290° and RDU R-194 to LANHO INT/RDU 21.2 DME and hold.

AWOS-3 119.025	FAYETTEVILLE APP CON 125.175 285.575	UNICOM 122.7 (CTAF) 0
--------------------------	--	---------------------------------

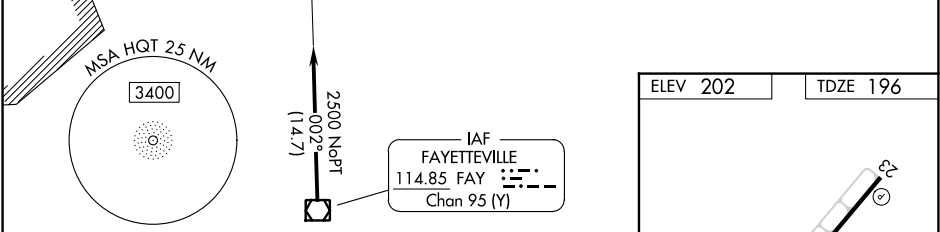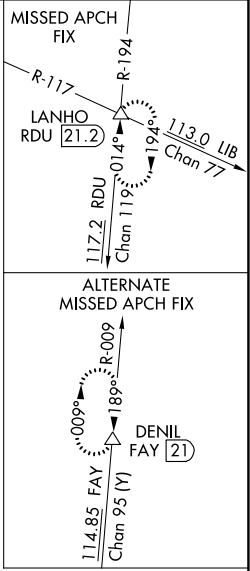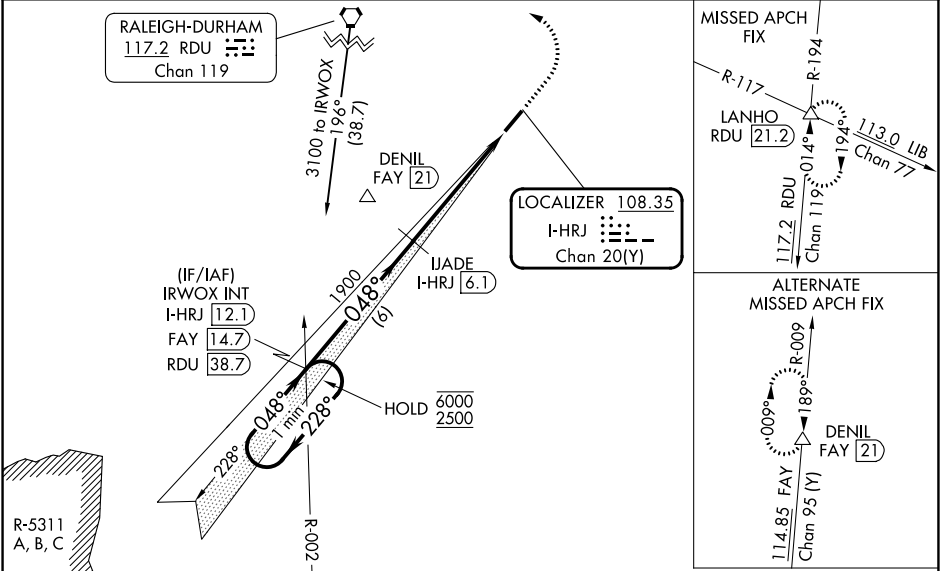

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 39).

IRWOX INT I-HRJ [12.1]	IADE I-HRJ [6.1]	700	2000	RDU R-194	LANHO
6000	2500	228°	048°	hdg 290°	△
1900		3.04°	TCH 35	I-HRJ [2.2]	I-HRJ [0.9]
6 NM		3.9 NM	1.3		

CATEGORY	A	B	C	D
S-5	640-1	444 (500-1)	640-1 $\frac{3}{4}$ 444 (500-1 $\frac{3}{4}$)	NA
CIRCLING	660-1 458 (500-1)	720-1 518 (600-1)	780-1 $\frac{1}{2}$ 578 (600-1 $\frac{1}{2}$)	NA

REIL Rwy 5 and 23 0
MIRL Rwy 5-23 0