

ILS or LOC RWY 34
PORTSMOUTH INTL AT PEASE (PSM)

T Circling NA east of Rwy 16-34. DME from PSM DME.
A Simultaneous reception of I-PSM and PSM DME required.
 For inop ALS, increase S-ILS 34 Cat E visibility to RVR 4000;
 increase S-LOC 34 Cat E visibility to 1 $\frac{3}{8}$ SM.




MISSED APPROACH: Climb to 1500 then climbing left turn on heading 290° to 3000 and ENE VOR/DME R-242 to RAYMY INT/CON VOR/DME 22.5 DME/RADAR and hold.

The map displays the Pease Lake area with the following details:


- Navigation Aids and Frequencies:**
 - Kennebunk:** 117.1 ENE, Chan 118
 - Localizer:** 110.1, I-PSM
 - Pease:** Chan 112
 - Raymy:** CON 22.5, RADAR
 - Misled Approach Fix:** 112.9 CON, Chan 76
- Routes and Bearings:**
 - R-242:** A route line passing through the lake area.
 - R-130:** A route line extending from the bottom right towards the center.
 - Bearings:** 130° and 310° are indicated near the 'MISSED APCH FIX'.
- Other Markers:**
 - 3000 203° (31.1):** A marker indicating a distance of 3000 feet and a bearing of 203 degrees.

Procedure NA for arrival on
ENE VOR/DME airway
radials 178 CW 271.

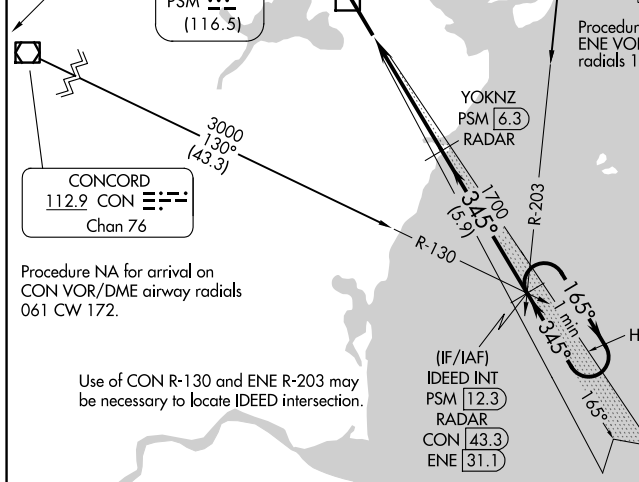

Procedure NA for arrival on
CON VOR/DME airway radials
061 CW 172.

Use of CON R-130 and ENE R-203 may be necessary to locate IDEED intersection.

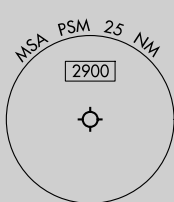

FAF to MAP 4.9 NM					
Knots	60	90	120	150	180
Min:Sec	4:54	3:16	2:27	1:58	1:38

PORTSMOUTH INTL AT PEASE (PSM)
ILS or LOC RWY 34