

WAAS CH 72614 W05A	APP CRS 055°	Rwy Ldg 5080
	TDZE 360	Apt Elev 361

RNAV (GPS) RWY 5

ENTERPRISE MUNI (EDN)


RNP APCH - GPS.

▼

NA

Baro-VNAV NA when using OZR altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 54°C. When local altimeter setting not received, use OZR altimeter setting and increase LNAV visibility Cat C ½ SM. Circling Rwy 23 NA at night.

MISSED APPROACH: Climb to 2500 direct CEYLU and left turn via track 295° to HAXES and left turn via track 191° to ROTOY and hold.

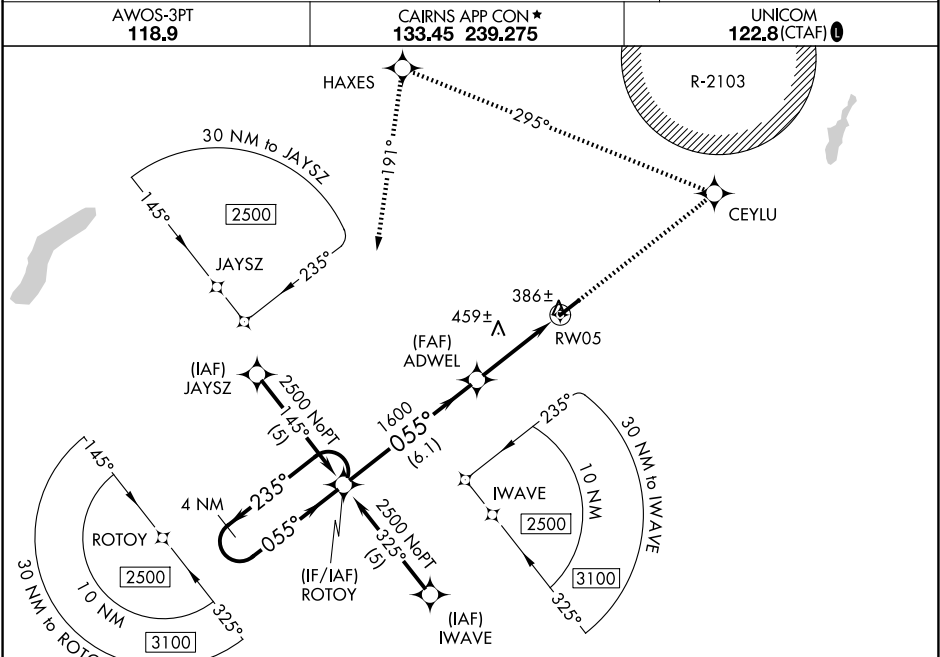

ELEV 361

TDZE 360

4 NM Holding Pattern ROTOY

2500 CEYLU

HAXES

ROTOY

2500 ← 235°

GP 3.00° TCH 40

055° →

055°

1600

ADWEL

1600

RW05

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 50).

6.1 NM

3.8 NM

CATEGORY	A	B	C	D
LPV DA	642-1 282 (300-1)			NA
LNAV/VNAV DA	688-1¼ 328 (400-1¼)			NA
LNAV MDA	760-1 400 (400-1)		760-1⅛ 400 (400-1⅛)	NA
CIRCLING	920-1 559 (600-1)		1100-2 739 (800-2)	NA

REIL Rwys 5 and 23

MIRL Rwy 5-23