


WAAS CH 56239 W34B	APP CRS 326°	Rwy Ldg TDZE 182 Apt Elev 192
--	------------------------	---

RNAV (GPS) RWY 34L


WASHINGTON MANASSAS/HARRY P DAVIS FLD (HEF)





⚠ DME/DME RNP-0.3 NA. When local altimeter setting not received, use Washington Dulles Intl altimeter setting and increase all MDA 60 feet; increase LNAV Cat C/D and Circling Cat C and D visibility ¼ mile. Helicopter visibility reduction below ¾ SM NA.	MISSED APPROACH: Climbing left turn to 3000 direct CSN VORTAC and hold.
--	---

ATIS 125.175	POTOMAC APP CON 128.525 306.925	MANASSAS TOWER ★ 133.1 (CTAF) 0 360.75	GND CON 121.8
------------------------	---	--	-------------------------

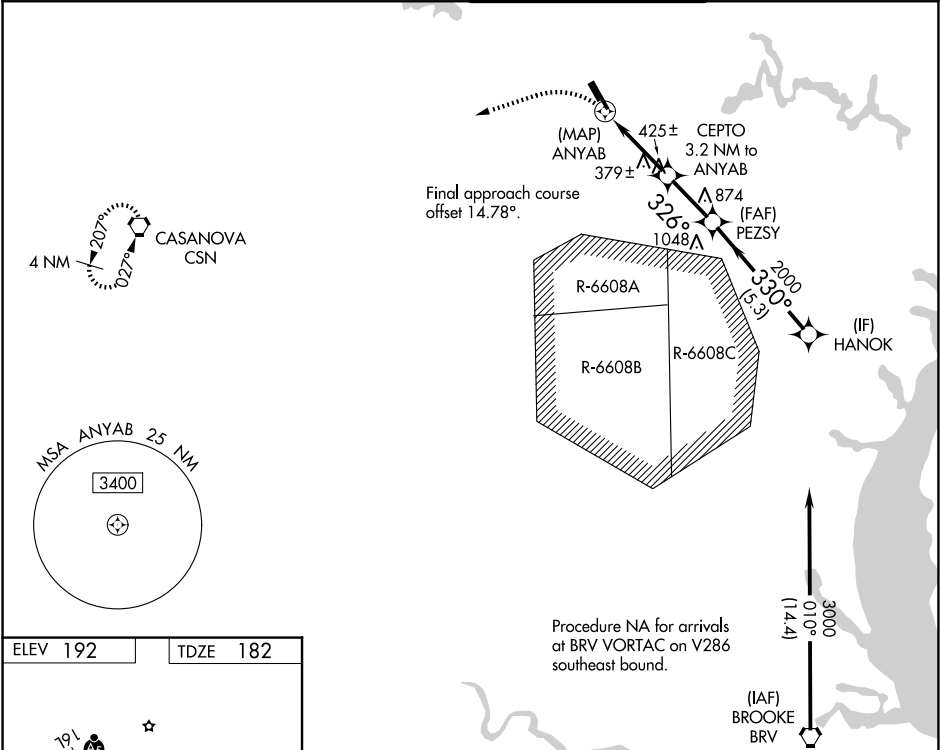

ELEV 192	TDZE 182
-----------------	-----------------

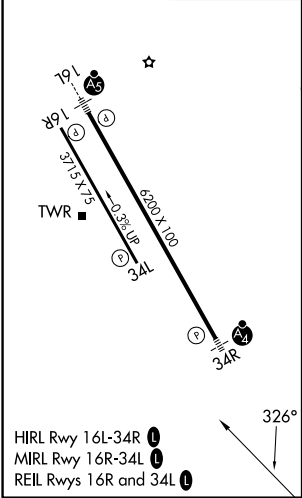

		VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 43).			
		CEPTO 3.2 NM to ANYAB			
		ANYAB			
					
					
CATEGORY		A	B	C	D
LP MDA	640-1	458 (500-1)		640-1 3/8	458 (500-1 3/8)
LNAV MDA	680-1	498 (500-1)		680-1 3/8	498 (500-1 3/8)
CIRCLING	720-1 528 (600-1)	740-1 548 (600-1)		840-1 3/4 648 (700-1 3/4)	880-2 1/4 688 (700-2 1/4)

RNAV (GPS) RWY 34L

NE-3, 01 OCT 2026 to 29 OCT 2026

NE-3, 01 OCT 2026 to 29 OCT 2026