

ILS or LOC RWY 28R
MONTGOMERY-GIBBS EXEC (MYF)

MISSED APPROACH: Climb to 1100 then climbing left turn to 3000 on heading 270° and MZB VORTAC R-326 to CARIF INT/MZB 16.3 DME and hold.




The diagrams illustrate frequency coordination for the Carif MZB area. The left diagram shows a standard frequency plan, while the right diagram shows an alternate missed APCH fix plan. Both diagrams include a localizer at 111.95 and a CARIF MZB at 16.3.

Left Diagram (Standard Plan):

- OCN 115.3 Chan 100
- JLI 113.75 Chan 84(Y)
- MZB 117.8 Chan 125
- CARIF MZB 16.3
- LOCALIZER 111.95

Right Diagram (Alternate Missed APCH Fix Plan):

- ALTERNATE MISSED APCH FIX
- OCN 115.3 Chan 100
- JLI 113.75 Chan 84(Y)
- MZB 117.8 Chan 125
- CARIF MZB 12.8
- LOCALIZER 111.95

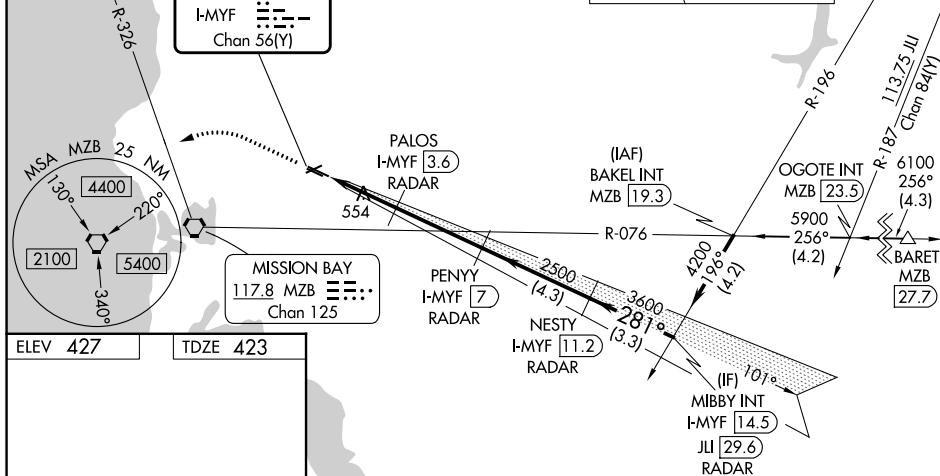

CATEGORY	A	B	C	D
S-ILS 28R	673- $\frac{3}{4}$	250 (300- $\frac{3}{4}$)		NA
S-LOC 28R	820- $\frac{3}{4}$	397 (400- $\frac{3}{4}$)		NA
CIRCLING	920-1	493 (500-1)		NA

FAF to MAP 6.3 NM

Knots	60	90	120	150	180
Min:Sec	6:18	4:12	3:09	2:31	2:06

SW-3, 01 OCT 2026 to 29 OCT 2026