

TACAN Y RWY 23

TACAN	NRB	APCH CRS	Rwy Idg	8001	[USN] MAYPORT NS (ADM DAVID L. MC DONALD FLD) (KNRB)
Chan	51	221°	TDZE	15	
			Arpt Elev	15	


T Visibility reduction by helicopters not authorized.

MISSED APPROACH: Climbing left turn to 2000 via NRB TACAN R-081 to HELES and hold.


ATIS ★ 236.775	JACKSONVILLE APP CON 124.9 308.4	TOWER ★ 118.75 239.30	GND CON 126.5 233.7	ASR/PAR
-------------------	-------------------------------------	--------------------------	------------------------	---------

CRG feeder route requires turn in hold.


CAUTION: Procedure not authorized at night when the VGSI is inop, unless the station has an approved observer watching for marine traffic in the St. John's River channel.

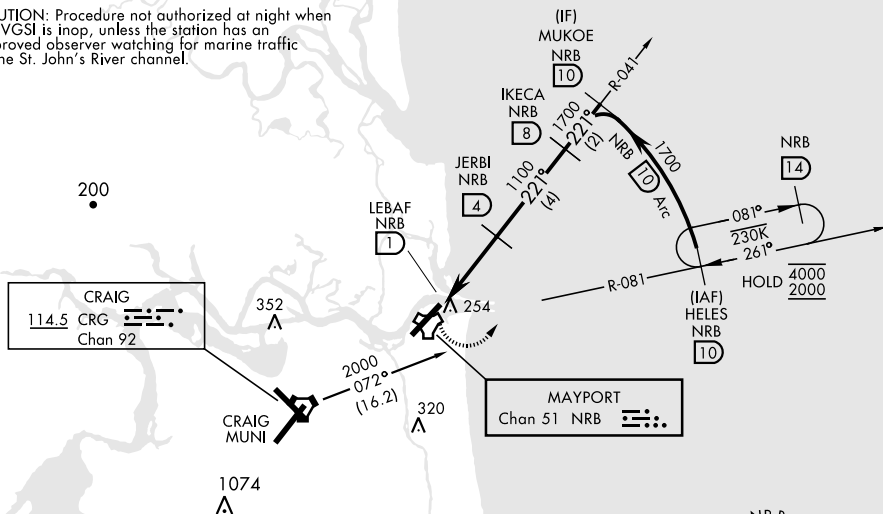

CAUTION: Vessels with masts up to 150' transitioning the St. Johns River inside of NRB 2 DME.

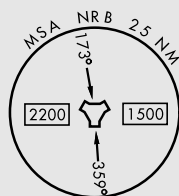

EMERG SAFE ALT 100 NM 2800

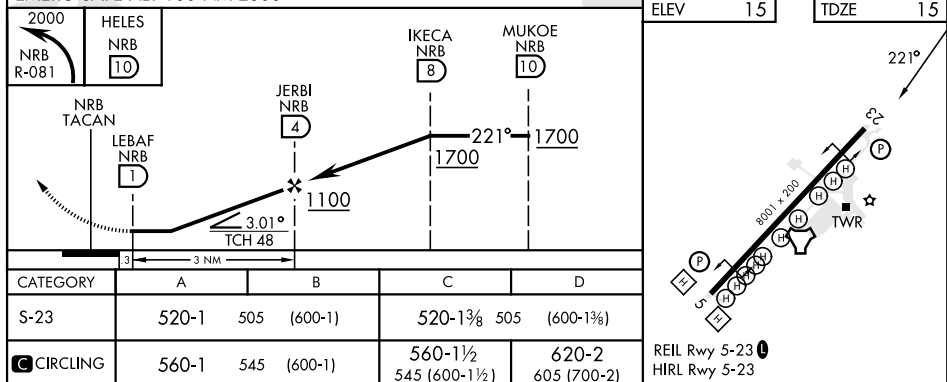

MAYPORT, FLORIDA

30°23'N-81° 25'W MAYPORT NS (ADM DAVID L. MC DONALD FLD) (KNRB)

Amdt 6 05SEP24

TACAN Y RWY 23

SE-3, 01 OCT 2026 to 29 OCT 2026

SE-3, 01 OCT 2026 to 29 OCT 2026