

ILS RWY 17L (CAT II & III)
ORLANDO INTL (MCO)

MISSED APPROACH: Climb to 500 then climbing left turn to 3000 on heading 100° and ORL VORTAC R-140 to PRESK INT/ORL 16.2 DME and hold, continue climb-in-hold to 3000.



ALTERNATE MISSED
APCH FIX

R-305


116.0 LAL
R-065
Chan 107

125°


305°

PRESK
MLB 30

115.85 MLB
Chan 105(Y)

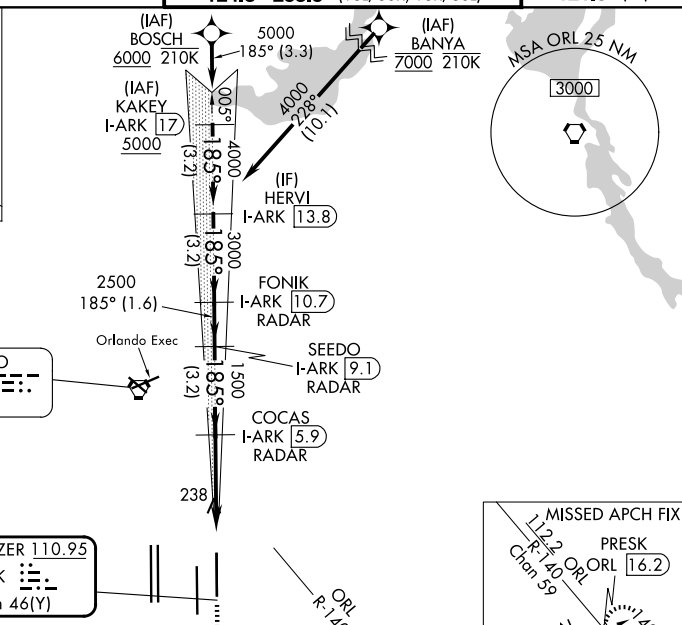

HIRL all rwys
REIL Rwy 36L
TDZL/RCLS Rwys 17L/R,
35L/R and 36L/R

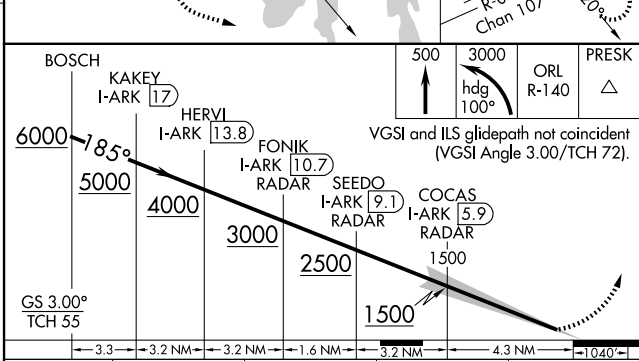

CATEGORY	A	B	C	D
S-ILS 17L	CAT II	RA 101/12	100 DA 190	
S-ILS 17L		CAT III	RVR 06	

CATEGORY II & III ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED