

LOC/DME I-DDO
110.5
Chan **42**

APP CRS
005°

Rwy Ldg
TDZE **88**
Apt Elev **96**

ILS RWY 35L (CAT II & III)
ORLANDO INTL (MCO)



RADAR required for procedure entry. DME or RADAR required.

Bright lights on highway midway between Rwy 35L and Rwy 35R may be mistaken for runway lights. Simultaneous approach authorized. When using alternate missed approach, simultaneous approach NA.


ALSF-2

MISSED APPROACH: Climb to 3000 on heading 005° and ORL VORTAC R-049 to OVIDO INT/ORL 13 DME and hold.

D-ATIS 121.25	ORLANDO APP CON 124.8 307.0	ORLANDO TOWER 118.45 253.5 (17L/35R, 17R/35L) 124.3 253.5 (18L/36R, 18R/36L)	GND CON 126.4 (E) 121.8 (W)
-------------------------	---------------------------------------	--	---

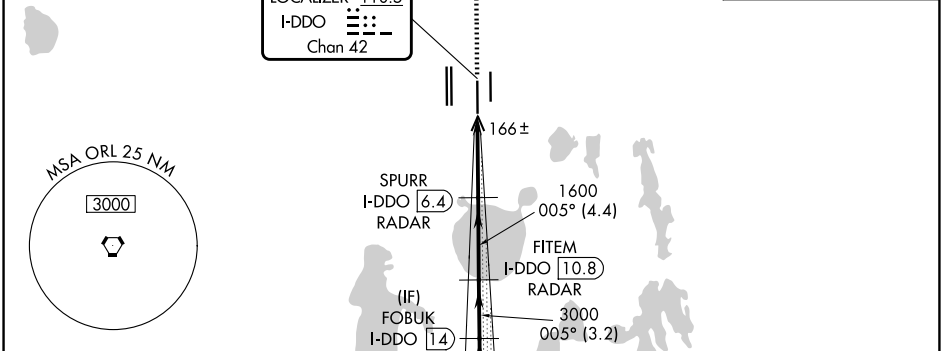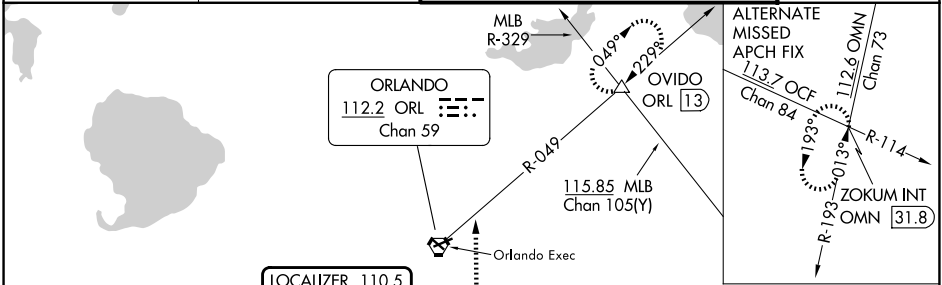

ELEV 96	D	TDZE 88
---------	----------	---------

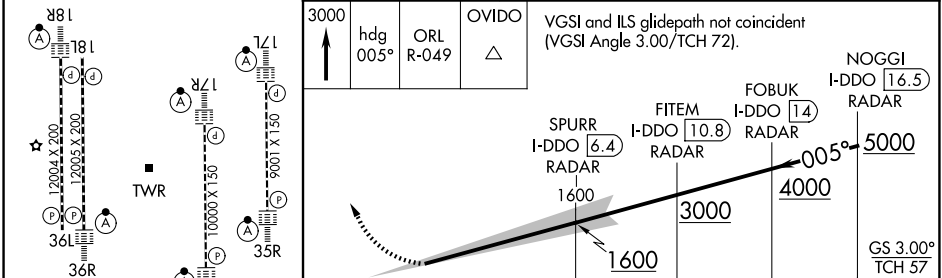

CATEGORY	A	B	C	D
S-ILS 35L	CAT II RA 106/12	100	DA 188	
S-ILS 35L	CAT III	RVR 06		

CATEGORY II & III ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED