

TACAN Y RWY 23

TACAN NRB Chan 51	APCH CRS 221°	Rwy Idg 8001 TDZE 15 Arpt Elev 15
-----------------------------	-------------------------	--

[USN] MAYPORT NS (ADM DAVID L. MC DONALD FLD) (KNRB)


T Visibility reduction by helicopters not authorized.

MISSED APPROACH: Climbing left turn to 2000 via NRB TACAN R-081 to HELES and hold.


ATIS ★ 236.775	JACKSONVILLE APP CON 124.9 308.4	TOWER ★ 118.75 239.3 0	GND CON 126.5 233.7	ASR/PAR
-------------------	-------------------------------------	---------------------------	------------------------	---------

CRG feeder route requires turn in hold.

CAUTION: Procedure not authorized at night when the VGSI is inop, unless the station has an approved observer watching for marine traffic in the St. John's River channel.

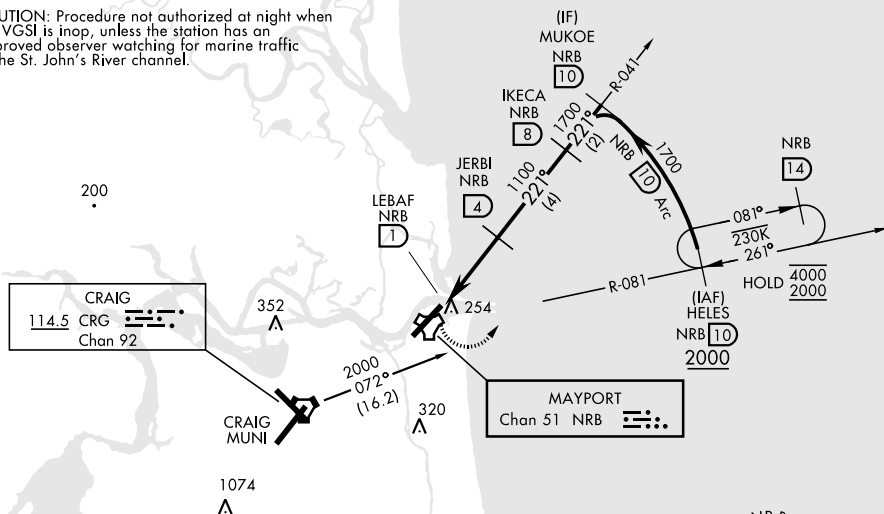

CAUTION: Vessels with masts up to 150' transitioning the St. Johns River inside of NRB 2 DME.

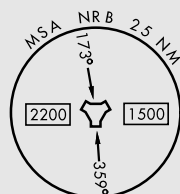

EMERG SAFE ALT 100 NM 2800

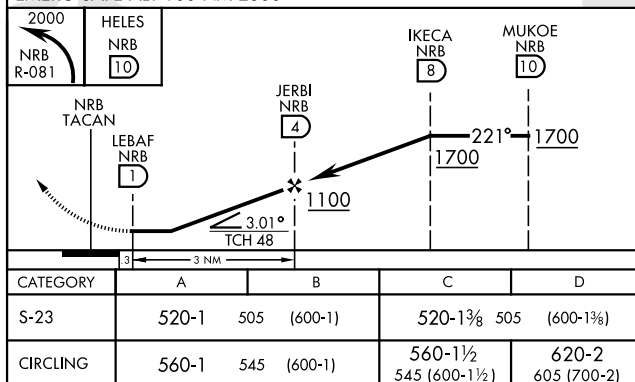


Diagram illustrating the runway layout for HIRL Rwy 5-23. The runway is oriented at 221°. The diagram shows the runway centerline, edge lights, and various navigational aids including a TWR (Tower) and a star symbol. The diagram also indicates the REIL (Runway End Identifier Lights) and HIRL (High Intensity Runway Lights) for Runway 5-23.

MAYPORT, FLORIDA

30° 23'N-81° 25'W

MAYPORT NS (ADM DAVID L. MC DONALD FLD) (KNRB)

Amdt 6 05SEP24

TACAN Y RWY 23

SE-3, 29 OCT 2026 to 26 NOV 2026