

LOC/DME I-VDF 111.35 Chan 50 (Y)	APP CRS 226°	Rwy Ldg TDZE Apt Elev	4200 21 21
--	------------------------	-----------------------------	---------------------------------------



ILS or LOC RWY 23
TAMPA EXEC (VDF')

⚠ When local altimeter setting not received, use Tampa Intl altimeter setting and increase S-ILS 23 DA to 323; increase all MDA 40 feet and S-LOC and Circling Cat C visibilities ½ SM. For inop MALSRR when using Tampa Intl altimeter setting, increase S-LOC 23 Cat C visibility to 1½. Inop table does not apply to S-ILS 23 and S-LOC 23 Cats A/B. Rwy 23 helicopter visibility reduction below ¾ SM NA. Circling Rwy 18, 36 NA at night.

MALSRR

MISSED APPROACH: Climb to 800 then climbing left turn to 2000 direct LAL VORTAC and hold.

AWOS-3 121.125	TAMPA APP CON 120.475 290.3	UNICOM 122.7 (CTAF) 0
--------------------------	---------------------------------------	--

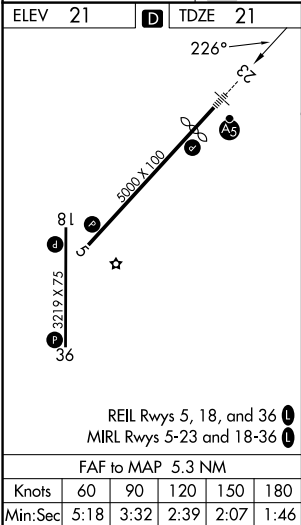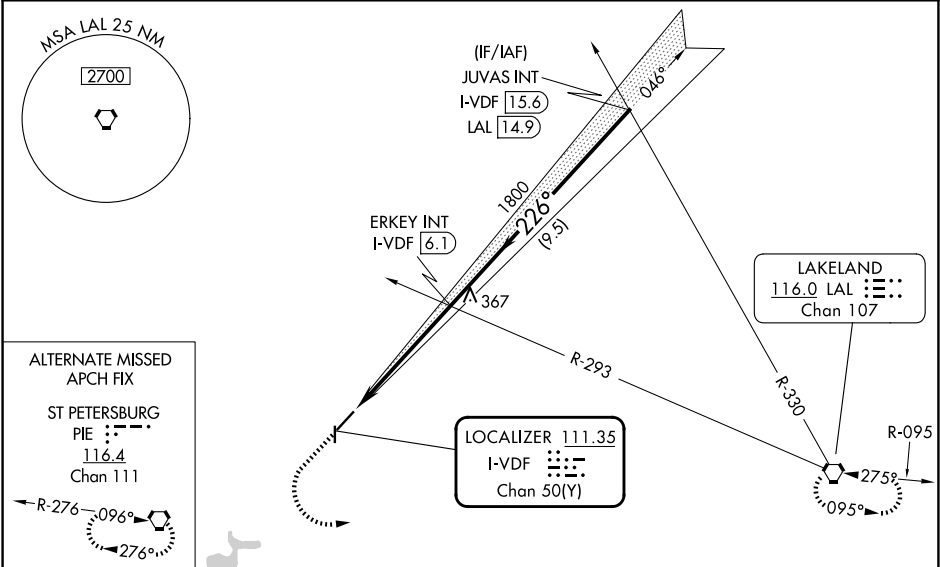

	800	2000	LAL				
				ERKEY INT I-VDF 6.1	JUVAS INT I-VDF 15.6		
				1800	1800		
				I-VDF 0.8			
				5.3 NM	9.5 NM		
CATEGORY	A	B	C	D			
S-ILS 23	298-1	277 (300-1)		NA			
S-LOC 23	560-1	539 (600-1)		NA			
CIRCLING	560-1 539 (600-1)	760-1 739 (800-1)	800-2¼ 779 (800-2¼)	NA			