


Extraction Lab Biomass Flow Chart


From biomass lot charge through wet THCA / HTE pour and output confirmation

App checkpoint Critical control Manual / inferred Branch / decision Handoff

1. Lot Charge And Reactor Setup

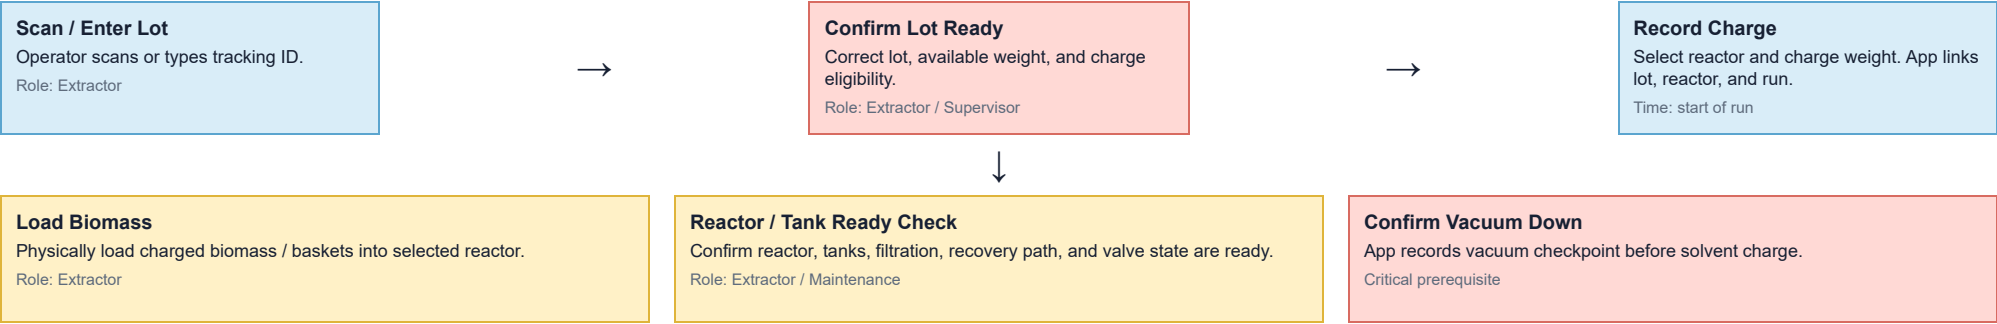

2. Primary Extraction

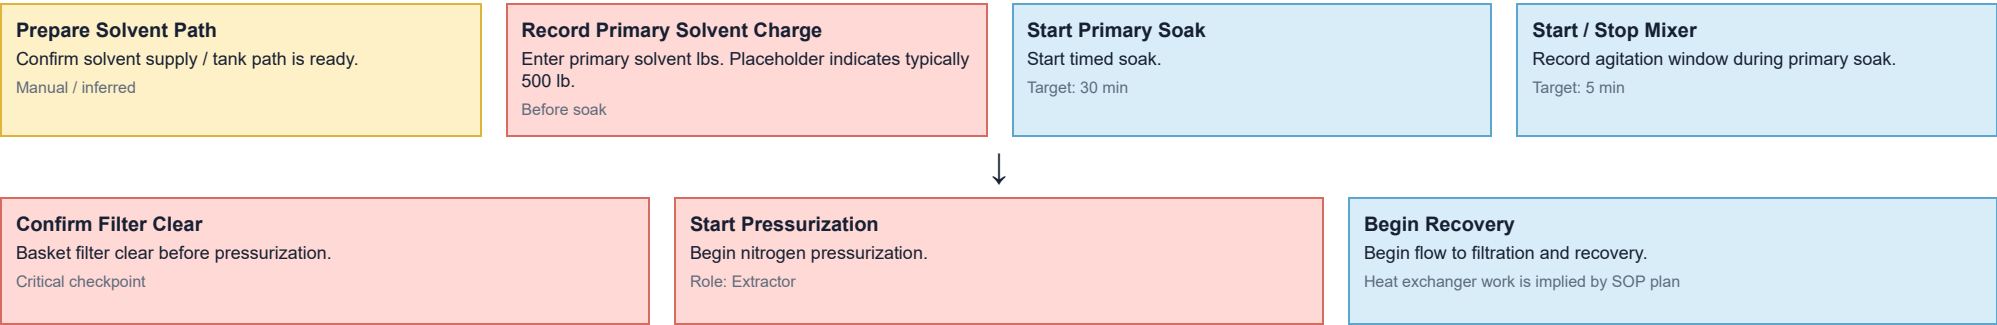

Note: This chart separates physical work from app checkpoints. Several equipment preparation steps are operationally critical even where the app currently stores only the downstream checkpoint.

Flush, Flow Decision, Final Purge, And Pour

Branches show where operators loop until the condition is acceptable.

App checkpoint Critical control Manual / inferred Branch / decision Handoff

3. Flush Cycle

Begin Flush Cycle

Move from primary extraction into flush controls.
After recovery checkpoint

Verify Flush Temps

Record solvent chiller and plate temperatures. Evidence upload supported.
Before flush solvent

Record Flush Solvent Charge

Enter flush solvent lbs. Placeholder indicates typically 500 lb.
After temp verification

Start / Stop Flush

Run timed flush soak.
Target: 10 min

4. Branch A/B - Flow Resumed?

Branch A - Yes, Flow Resumed

Confirm Flow Resumed

Operator confirms flow has resumed.



Proceed To Final Purge

App advances to final purge stage.

Branch B - No, Adjustment Required

Flow Not Resumed

App enters adjustment-required state.



Adjust And Re-check

Adjust recovery/flow condition, then tap Re-check Flow until yes.

5. Final Purge And Shutdown

Start Final Purge

Begin timed purge / burp step.
Optional target in Settings

Stop Final Purge

Record purge completion and duration.
Role: Extractor

Final Clarity Decision

System clear enough to proceed?
Branch C/D

Shutdown Checklist

Recovery inlets closed, filtration pump-down started, nitrogen off, dewax inlet closed.
Before run complete

Branch C - Clarity Confirmed

Confirm Final Clarity

Operator confirms clear enough.



Complete Shutdown

Finish checklist and mark run complete.

Branch D - More Purge Needed

Not Clear Yet

App enters clarity-adjustment state.



Resume Final Purge

Run more purge work, then confirm clarity again.

6. Wet Output Pour / Handoff

Mark Run Complete

Extraction booth workflow closes.
After shutdown

Select Pathway / Start Post-Extraction

Choose 100 lb pot pour or 200 lb minor run.
Handoff begins

Pour / Weigh Wet HTE And THCA

Collect outputs into labeled containers and enter wet grams.
Wet HTE + Wet THCA required

Confirm Initial Outputs

App timestamps wet output confirmation and downstream branch can continue.
End of this chart