




GTC4Lusso USA - Checking fluid level of PTU electrohydraulic actuator system - Latest Update: 2021-01-26

Protected by copyright. Copying for private or commercial purposes, in part or in whole, is not permitted unless authorised by Ferrari S.p.A. Ferrari S.p.A. does not guarantee or accept any liability with respect to the correctness of information in this document.
Copyright by Ferrari S.p.A. - P.IVA 00159560366


A3.09 Checking fluid level of PTU electrohydraulic actuator system

Checking fluid level of PTU electrohydraulic actuator system

- Remove the front wheelhouses (🔧 E3.05).
 - ❗ Remove the front element of the front left hand wheelhouse.
- Turn the ignition switch **ON**.
- Connect the DEIS tester to the diagnostic socket (🔧 F2.09).
 - ❗ Using the DEIS diagnostic tester, perform the cycle "**EV Drop-off valve**", selecting "**NDA > Actuator**".

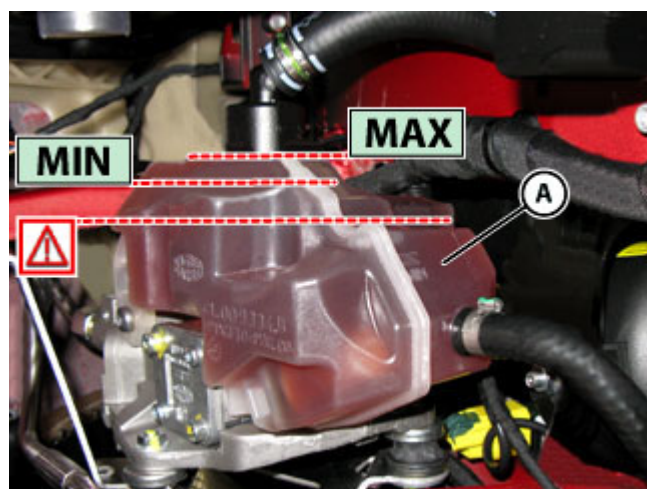

- Check that the oil level in the reservoir (**A**) is between **MIN** and **MAX**.
 - ❗ The difference between the **MIN** and **MAX** levels is **5 mm**.
- If the oil level is above the **MAX** level, aspirate the excess oil via the auxiliary reservoir filler neck as described as follows.
- If the oil level is between the **MIN** and **WARNING** levels, top up with the specified oil using the following procedure.
 - ❗ The difference between the **MIN** and **WARNING** levels is **10 mm**.
- If the oil level is below the **WARNING** level, open an "**ROL**".
- Remove the engine compartment cosmetic shields (🔧 E3.14).
 - ❗ Remove the left hand lateral cosmetic shield.

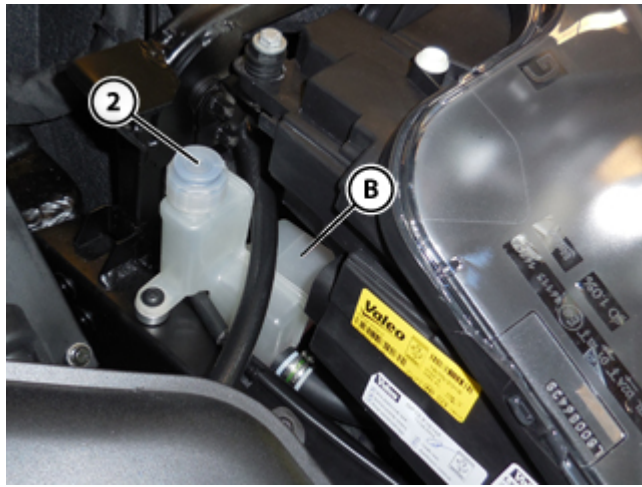

- Undo and remove the cap (2).
- If the oil level is above the **MAX** level, aspirate the excess oil via the auxiliary reservoir filler neck (B).
- If the oil level is between the **MIN** and **WARNING** levels, add the specified oil to the auxiliary reservoir (B) to reach the correct level.
- Fit the cap (2) and tighten securely.

- Refit the engine compartment cosmetic shields (🔧 E3.14).

i Refit the left hand lateral cosmetic shield.

- Refit the front wheelhouses (🔧 E3.05).

i Refit the front element of the front left hand wheelhouse.