



GTC4Lusso USA - Fuel vapour separator - Latest Update: 2021-01-26

Protected by copyright. Copying for private or commercial purposes, in part or in whole, is not permitted unless authorised by Ferrari S.p.A. Ferrari S.p.A. does not guarantee or accept any liability with respect to the correctness of information in this document.


Copyright by Ferrari S.p.A. - P.IVA 00159560366

B3.06 Fuel vapour separator


Removing the fuel vapour separator

➤ Remove the rear wheelhouses ( E3.05).


 Remove the rear right hand wheelhouse.

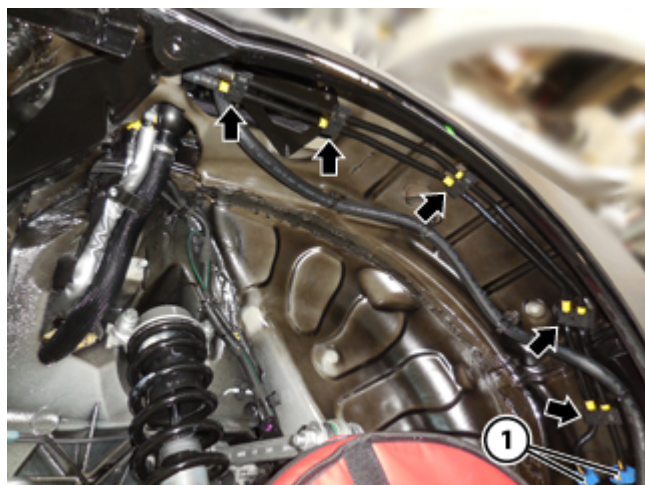


- Release and disconnect the "double-lock" quick connectors **(1)**.
- Release and open the indicated clips.

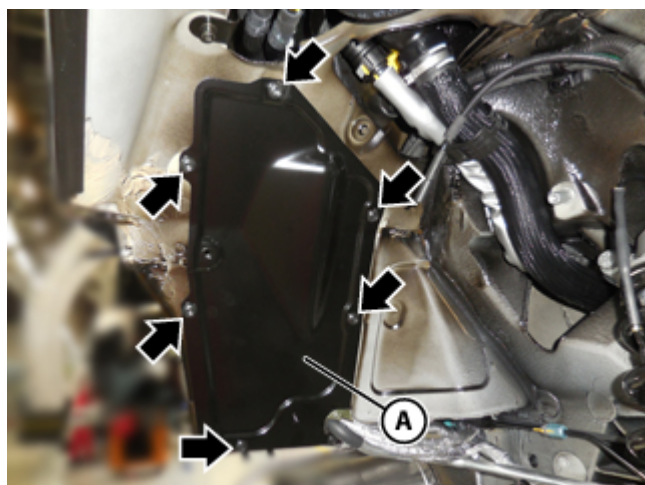

- Undo the screws indicated.
- Remove the cover **(A)**.

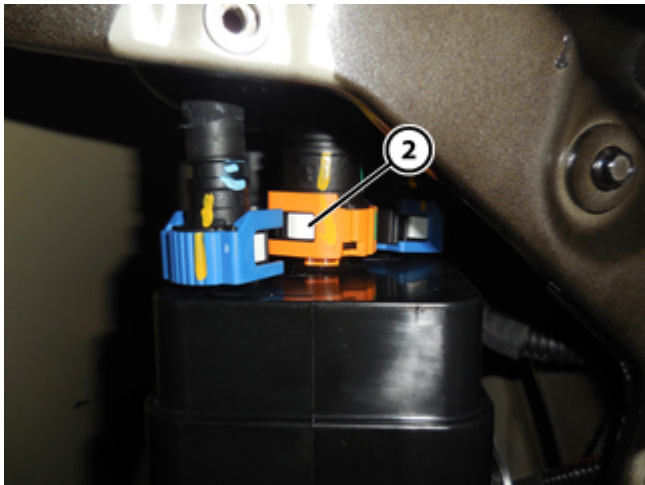


- Release and disconnect the "double-lock" quick connector **(2)**.

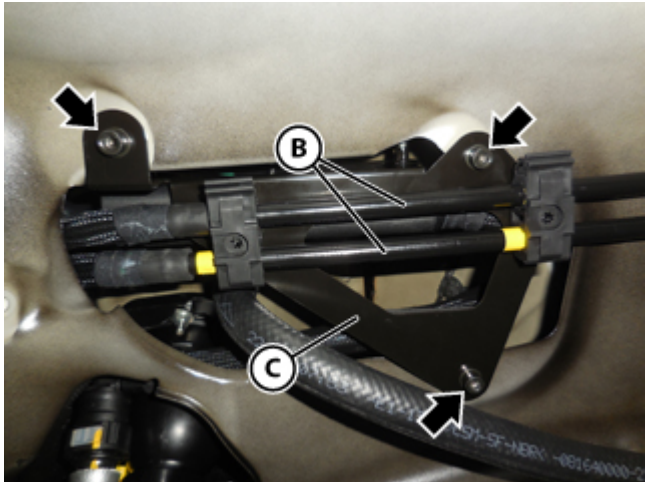

- Move the pipes **(B)** out of the way.
- Undo the screws indicated.
- Remove the bracket **(C)** complete with fuel vapour separator.

Refitting the fuel vapour separator


			
Tightening torque		Nm	Class
Fastening the fuel vapour separator mounting bracket	Screw	9 Nm	B
Fastening the active carbon filter cover	Screw	9 Nm	B

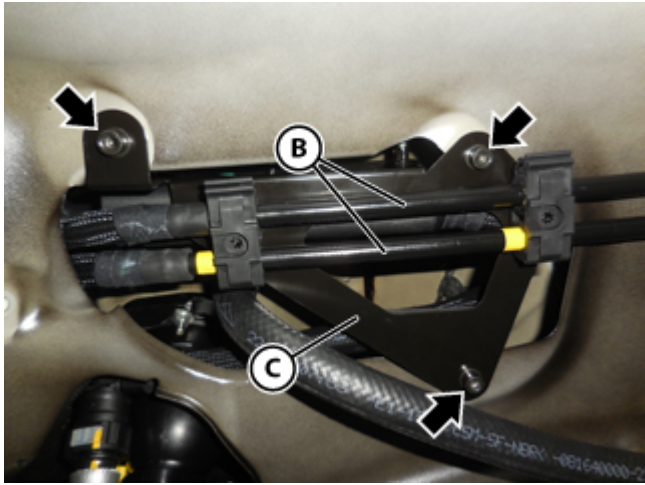


- Fit the bracket **(C)** complete with fuel vapour separator.
- Tighten the screws indicated.

		
Tightening torque	Nm	Class
Screw	9 Nm	B

- Fit and fasten the pipes **(B)**.

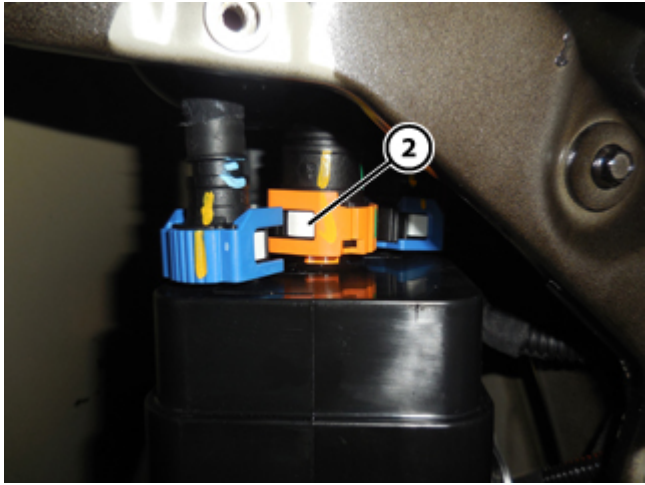


- Connect and fasten the "double-lock" quick connector **(2)**.

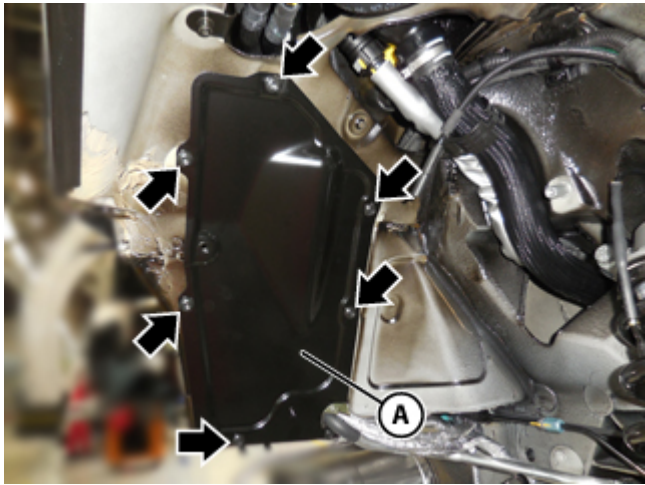

- Fit the cover **(A)**.
- Tighten the screws indicated.

		
Tightening torque	Nm	Class
Screw	9 Nm	B

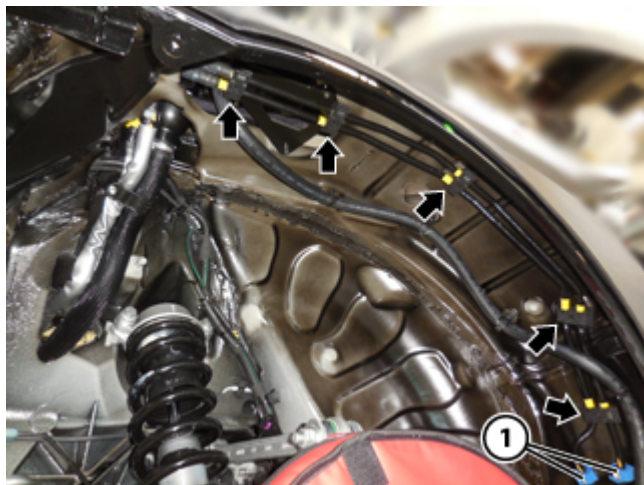

- Connect and fasten the "double-lock" quick connectors (1).
- Close and fasten the indicated clips.

➤ Refit the rear wheelhouses (🔧 E3.05).

🔧 Refit the rear right hand wheelhouse.

➤ Connect the DEIS tester to the diagnostic socket (🔧 F2.09).

🔧 Perform the respective cycle with the DEIS diagnostic tester.