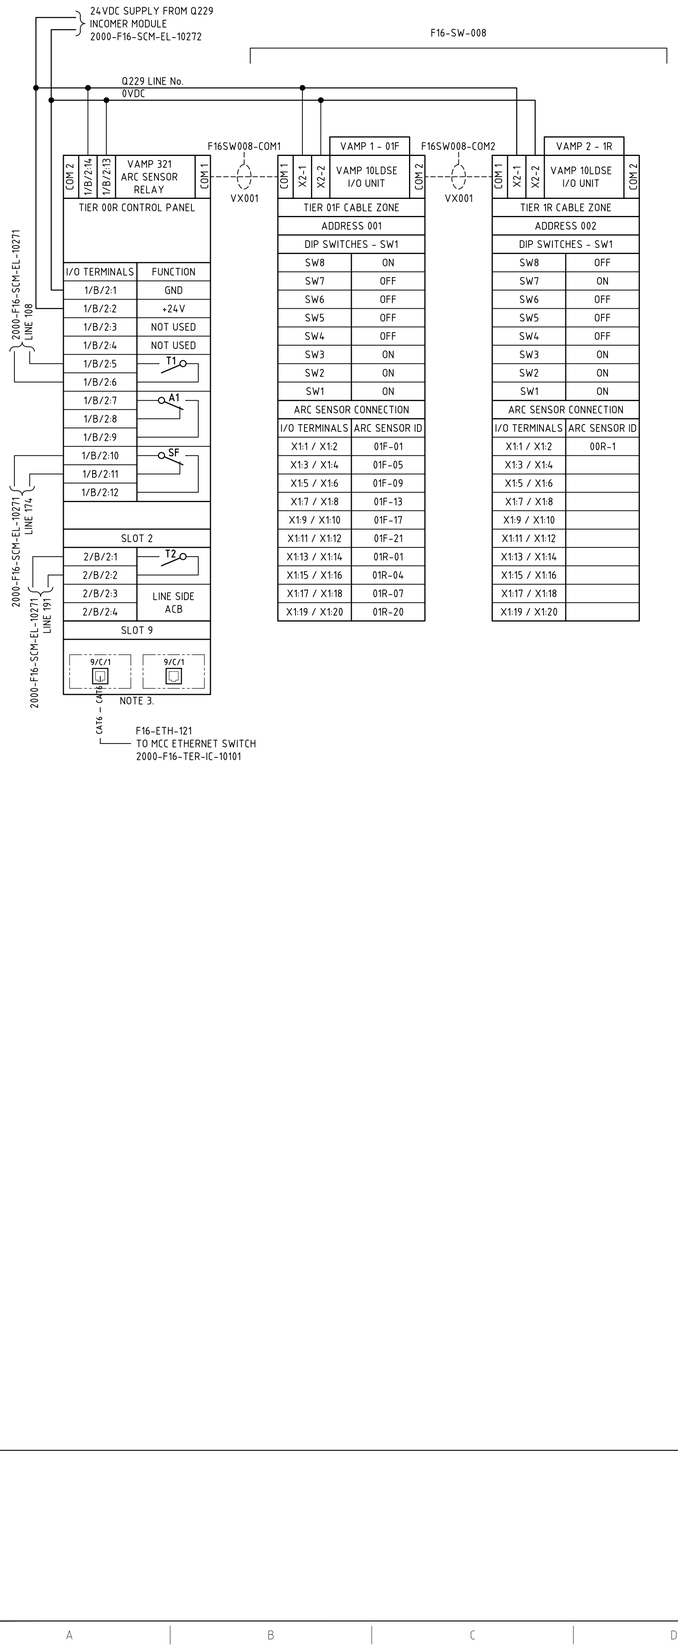


DIP SWITCHES - SW1	
SW8	ON
SW7	OFF
SW6	OFF
SW5	OFF
SW4	OFF
SW3	ON
SW2	ON
SW1	ON

ARC SENSOR CONNECTION	
I/O TERMINALS	ARC SENSOR ID
X1:1 / X1:2	01F-01
X1:3 / X1:4	01F-05
X1:5 / X1:6	01F-09
X1:7 / X1:8	01F-13
X1:9 / X1:10	01F-17
X1:11 / X1:12	01F-21
X1:13 / X1:14	01R-01
X1:15 / X1:16	01R-04
X1:17 / X1:18	01R-07
X1:19 / X1:20	01R-20

DIP SWITCHES - SW1	
SW8	OFF
SW7	ON
SW6	OFF
SW5	OFF
SW4	OFF
SW3	ON
SW2	ON
SW1	ON

ARC SENSOR CONNECTION	
I/O TERMINALS	ARC SENSOR ID
X1:1 / X1:2	00R-1
X1:3 / X1:4	
X1:5 / X1:6	
X1:7 / X1:8	
X1:9 / X1:10	
X1:11 / X1:12	
X1:13 / X1:14	
X1:15 / X1:16	
X1:17 / X1:18	
X1:19 / X1:20	

NOTES

1. CABLE NUMBER FOR ARC FLASH SENSOR VA1DA SHALL BE THE EQUIPMENT NUMBER FOLLOWED BY COM FOR COMMUNICATION AND A SEQUENTIAL NUMBER e.g. F16SW008-COMx.
2. EACH CABLE SHALL BE IDENTIFIED AT BOTH ENDS WITH CABLE NUMBER.
3. VAMP 321 ARC FAULT PROTECTION RELAY SHALL BE MOUNTED TO THE DOOR OF THE PANEL INCOMER CONTROL CUBICLE.
4. VAM 10LDSE INTERFACE SHALL BE MOUNTED ON THE CABLE ZONE DOOR.
5. MAXIMUM 16 VAM10LDSE I/O UNITS IN SERIES.
6. MAXIMUM LENGTH OF VX001 CABLE BETWEEN 2 UNITS (I/O UNITS OR VAMP321 UNIT) IS 30m & TOTAL LENGTH OF THE BUS CABLE FROM THE START TO THE END OF 100m SHALL NOT BE EXCEEDED.

LEGEND

F16SW008-COMx

CABLE MARKER LABEL

24VDC SUPPLY CABLE

COMMUNICATION CABLE

DIP SWITCHES KEY VAMP 10LDSE		
	ON	OFF
SW8	1	0
SW7	2	0
SW6	4	0
SW5	8	0
SW4	16	0
SW3	L>	L> + I>
SW2	LATCH	NON LATCHING
SW1	L> INT	L> EXT

L = LIGHT / I = CURRENT

2000-F16-SCM-EL-10273_Rev2

F16-SW-008 - F16-SW-008 arc flash system - schematic and diagram