



8.3 级维修

8-1. 框图

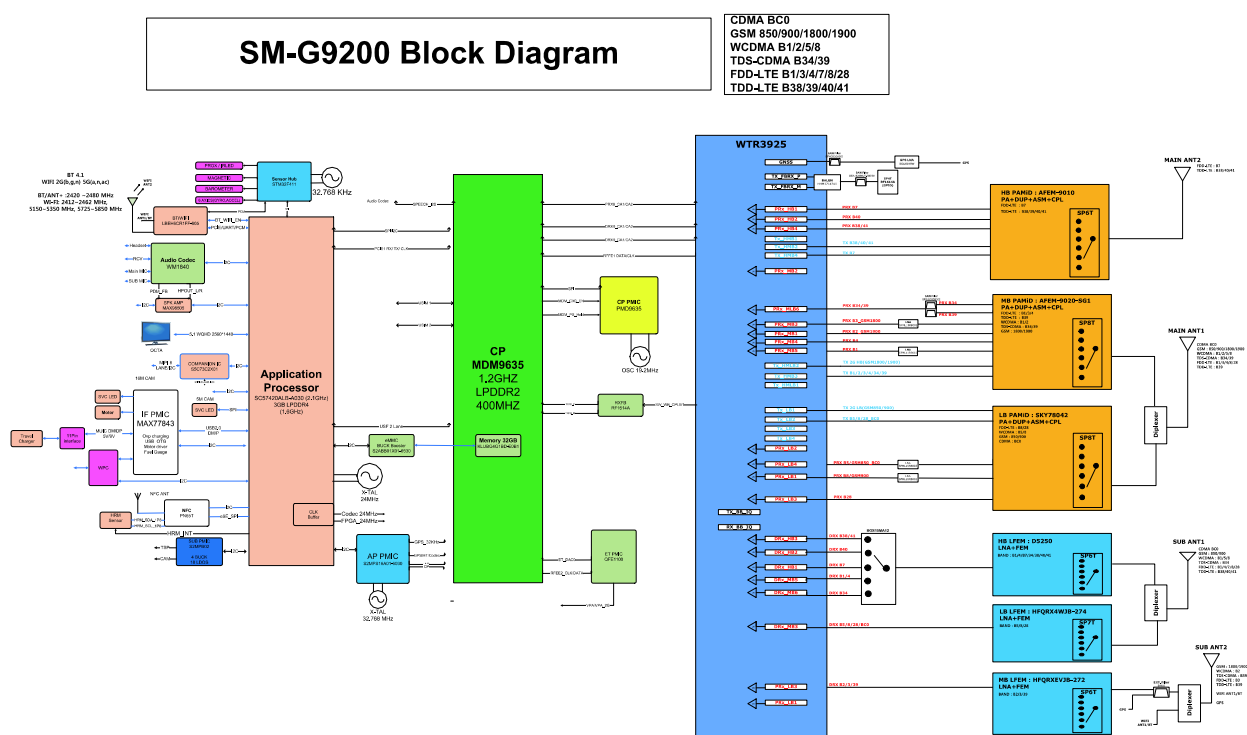

8-2. PCB 图解


8-2-1. 顶部

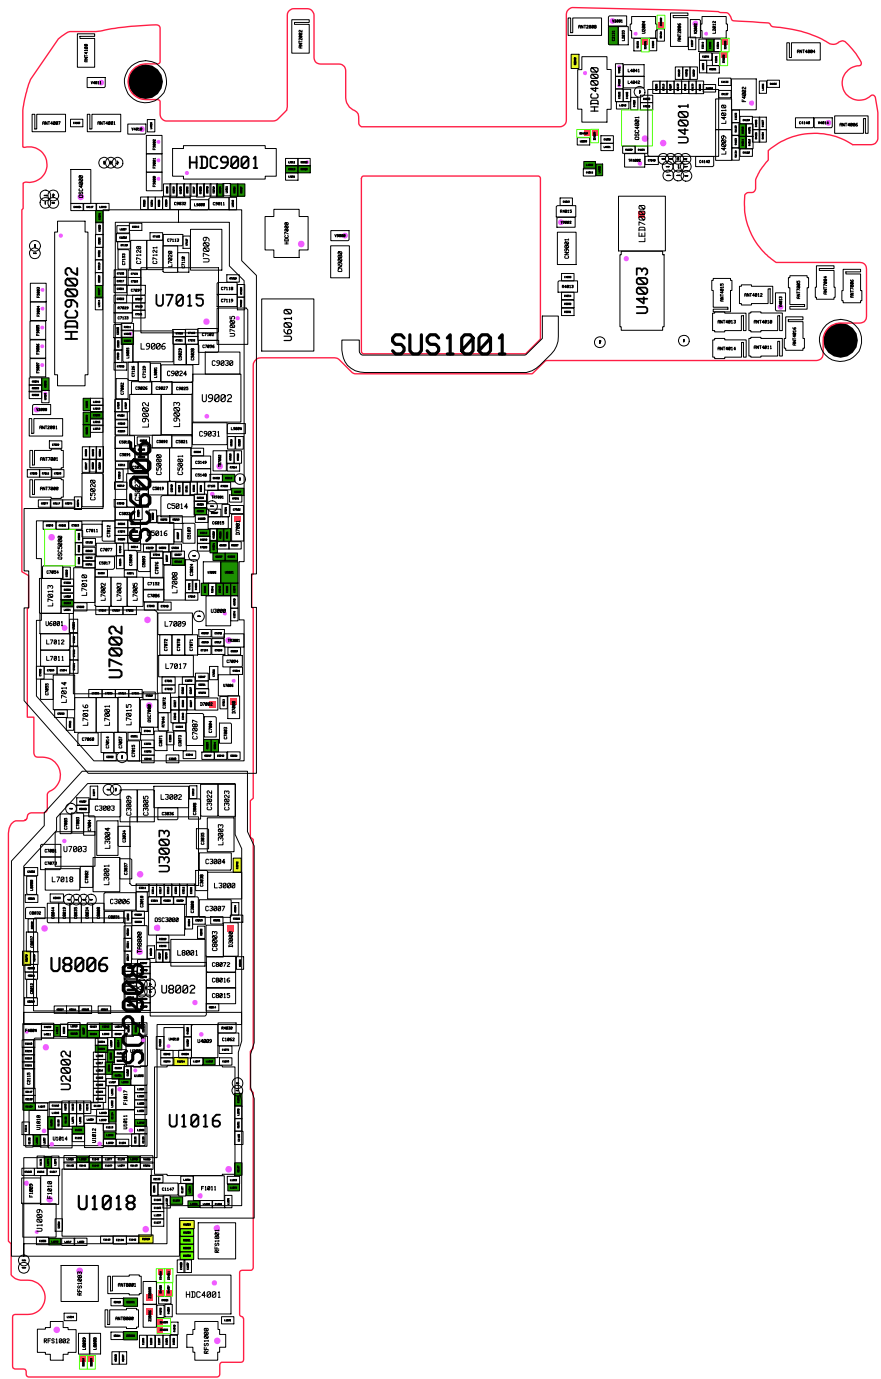




未经三星书面授权而发布，传送，或违背本文件中的任何内容或数据是严格禁止的。

8-2-3. 副 PBA 顶部

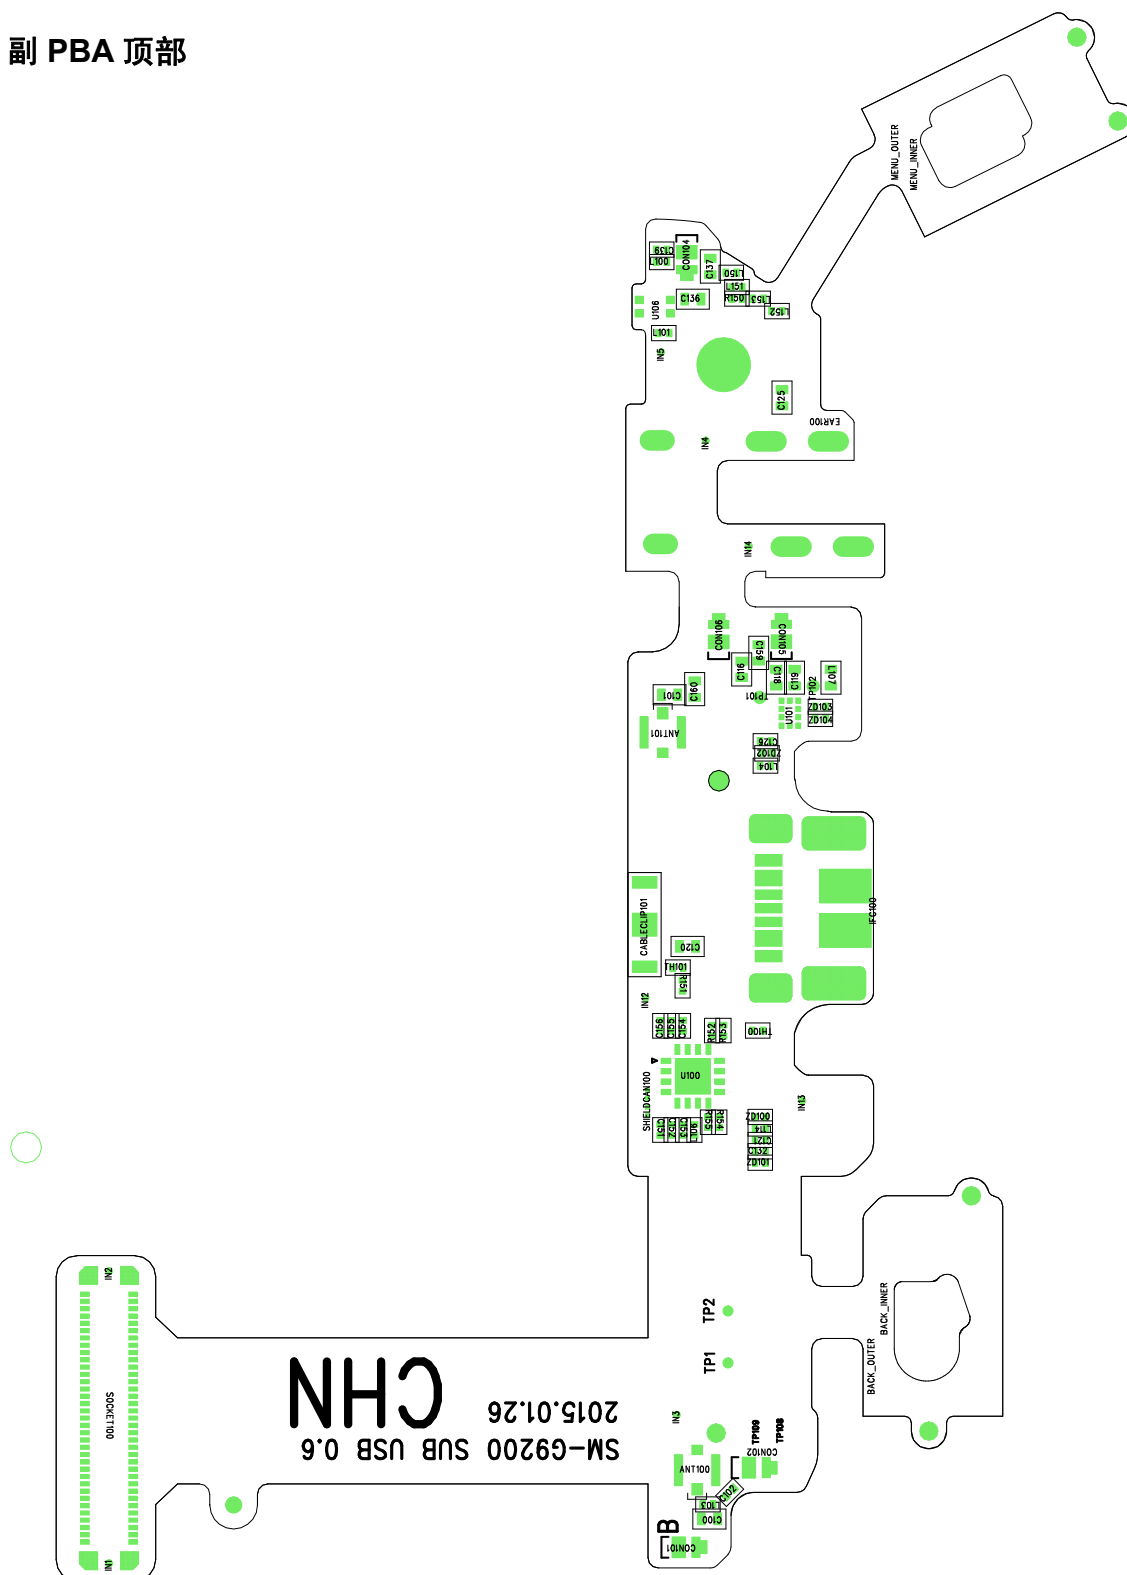


8-2-3. 副 PBA 底部

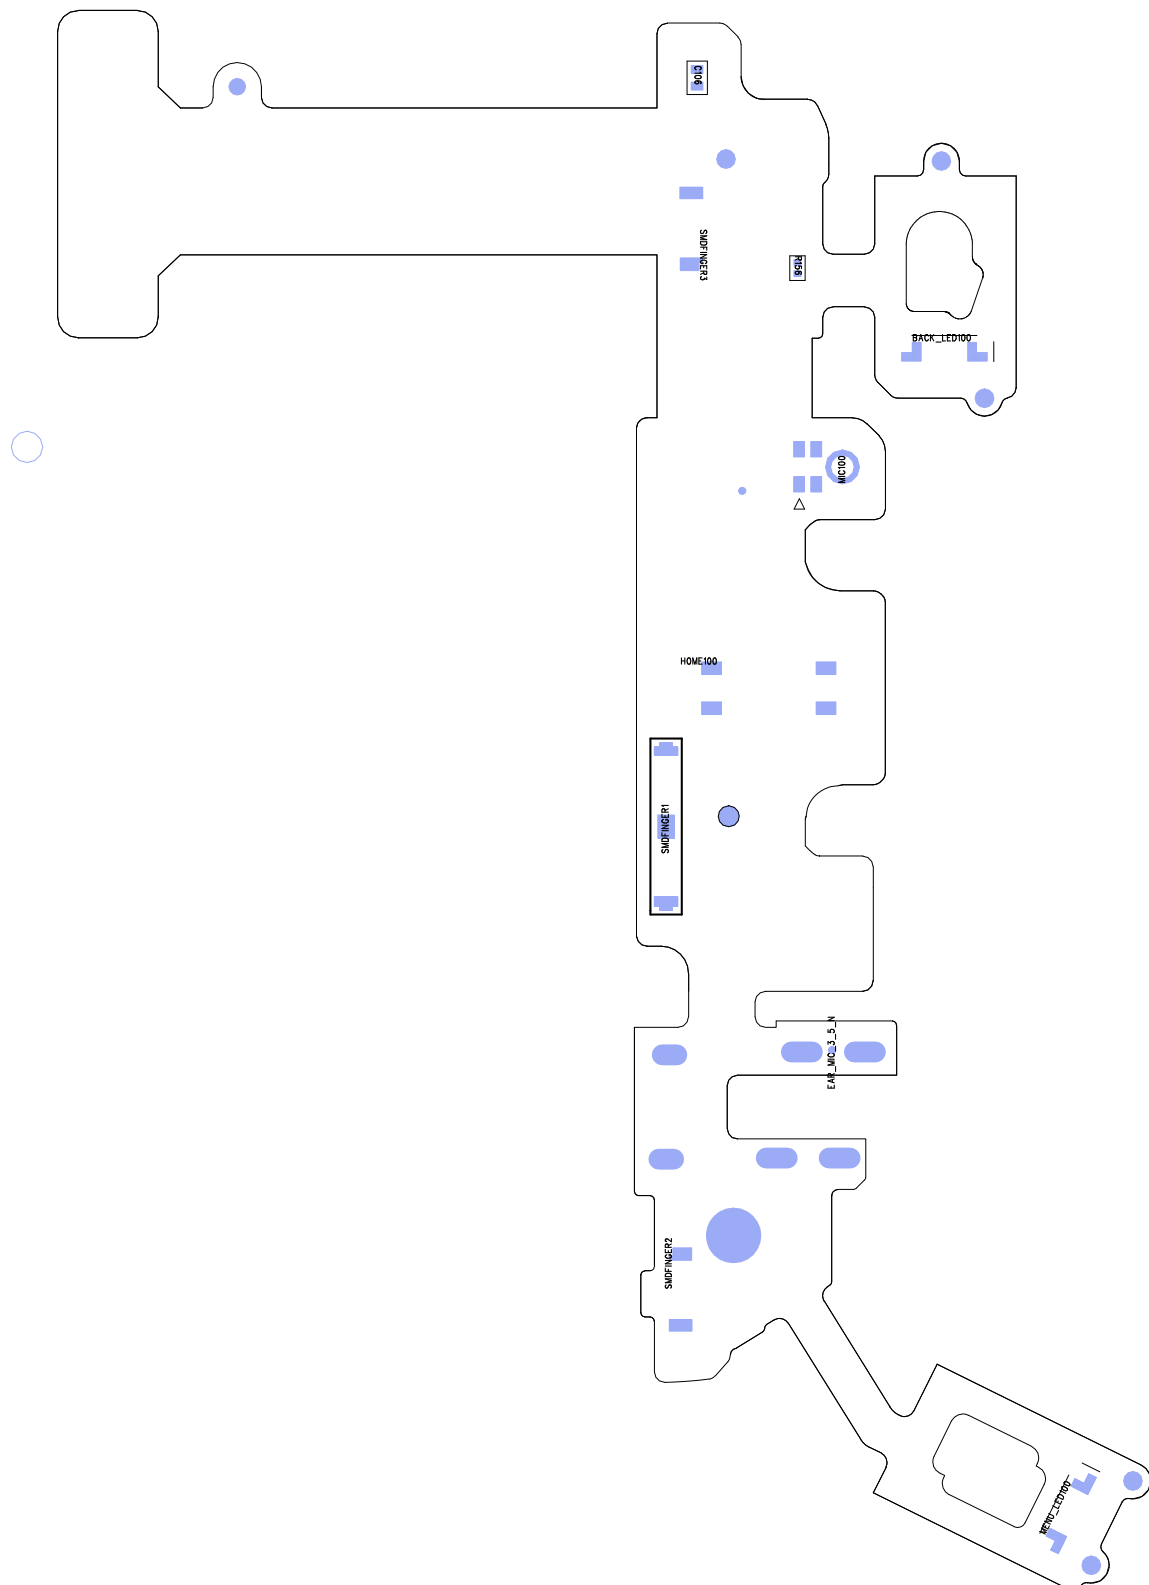

8-3. 故障排除流程图

设备

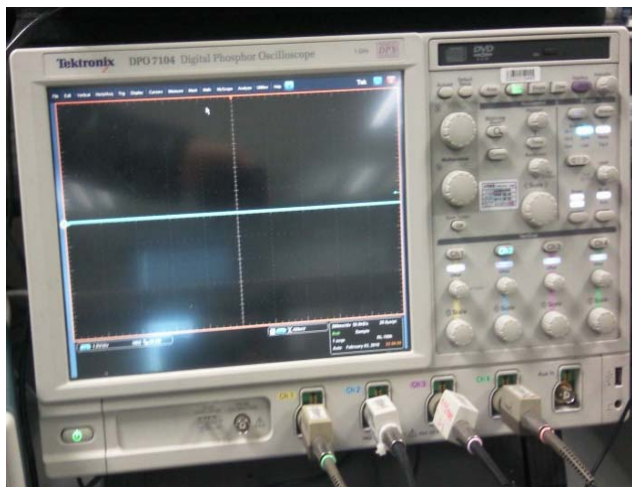

↑示波器




↑数字万用表



↑电源供电



↑+字螺丝刀，ESD 安全镊子

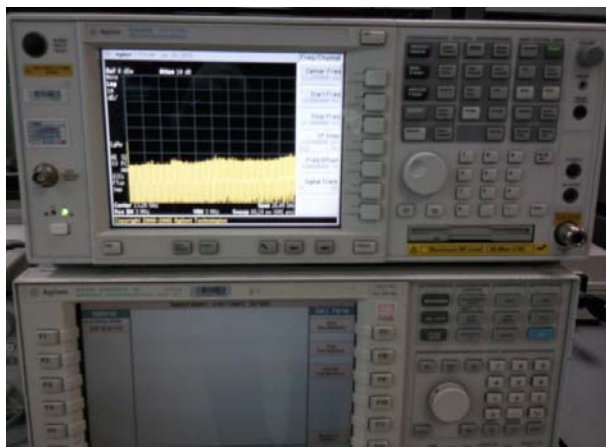



↑8960 和频谱仪




↑焊接烙铁


8-3-1. 开机

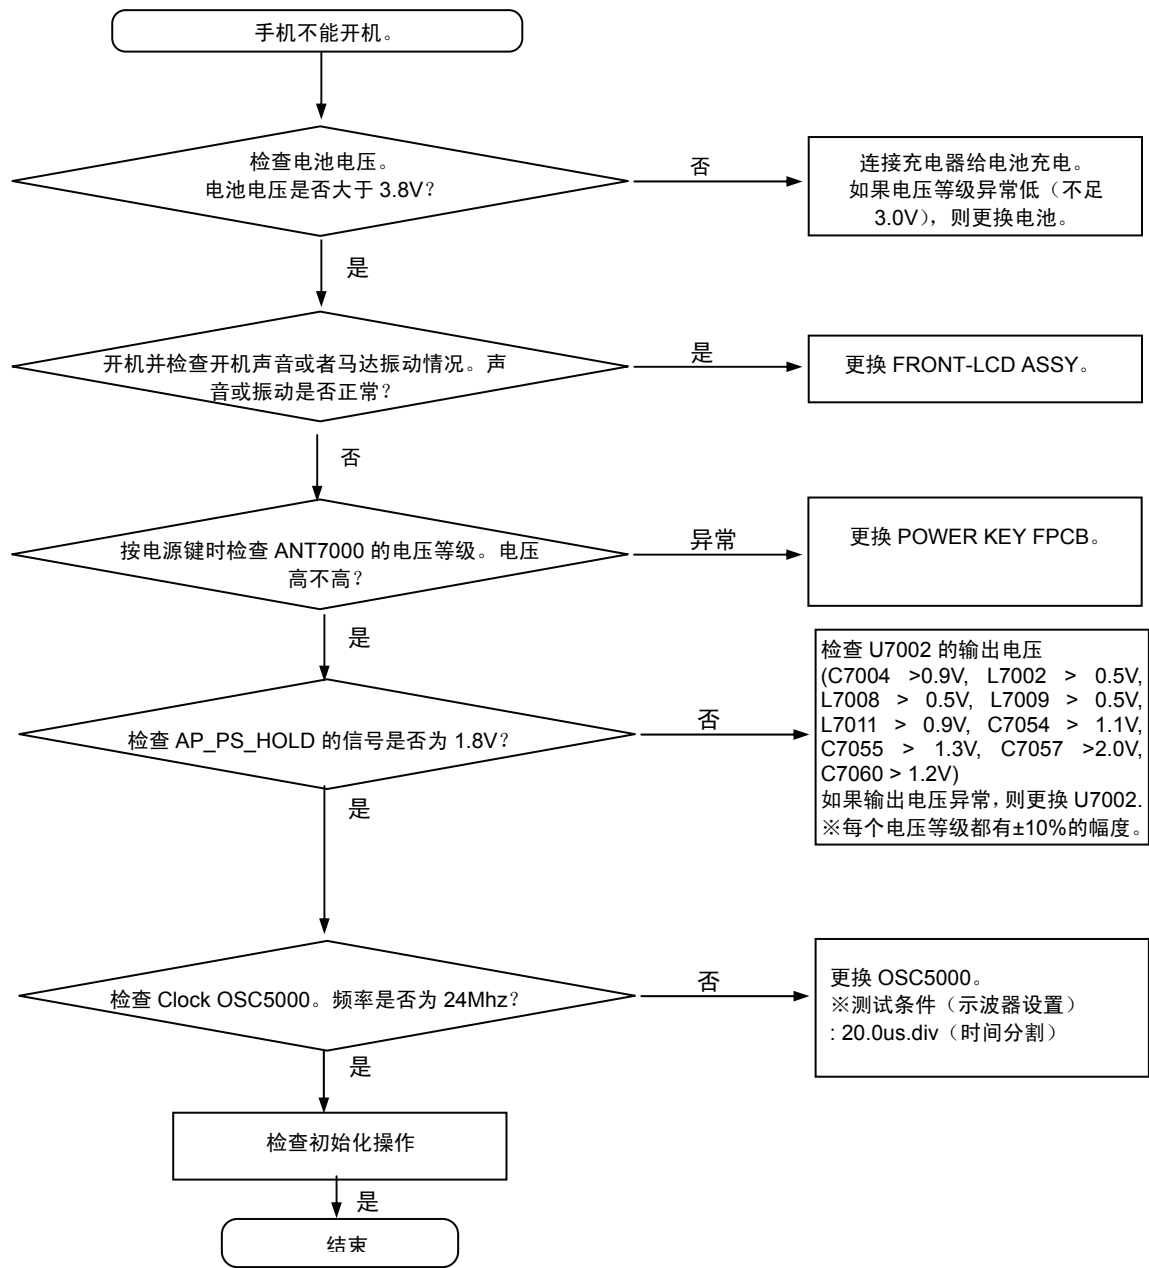


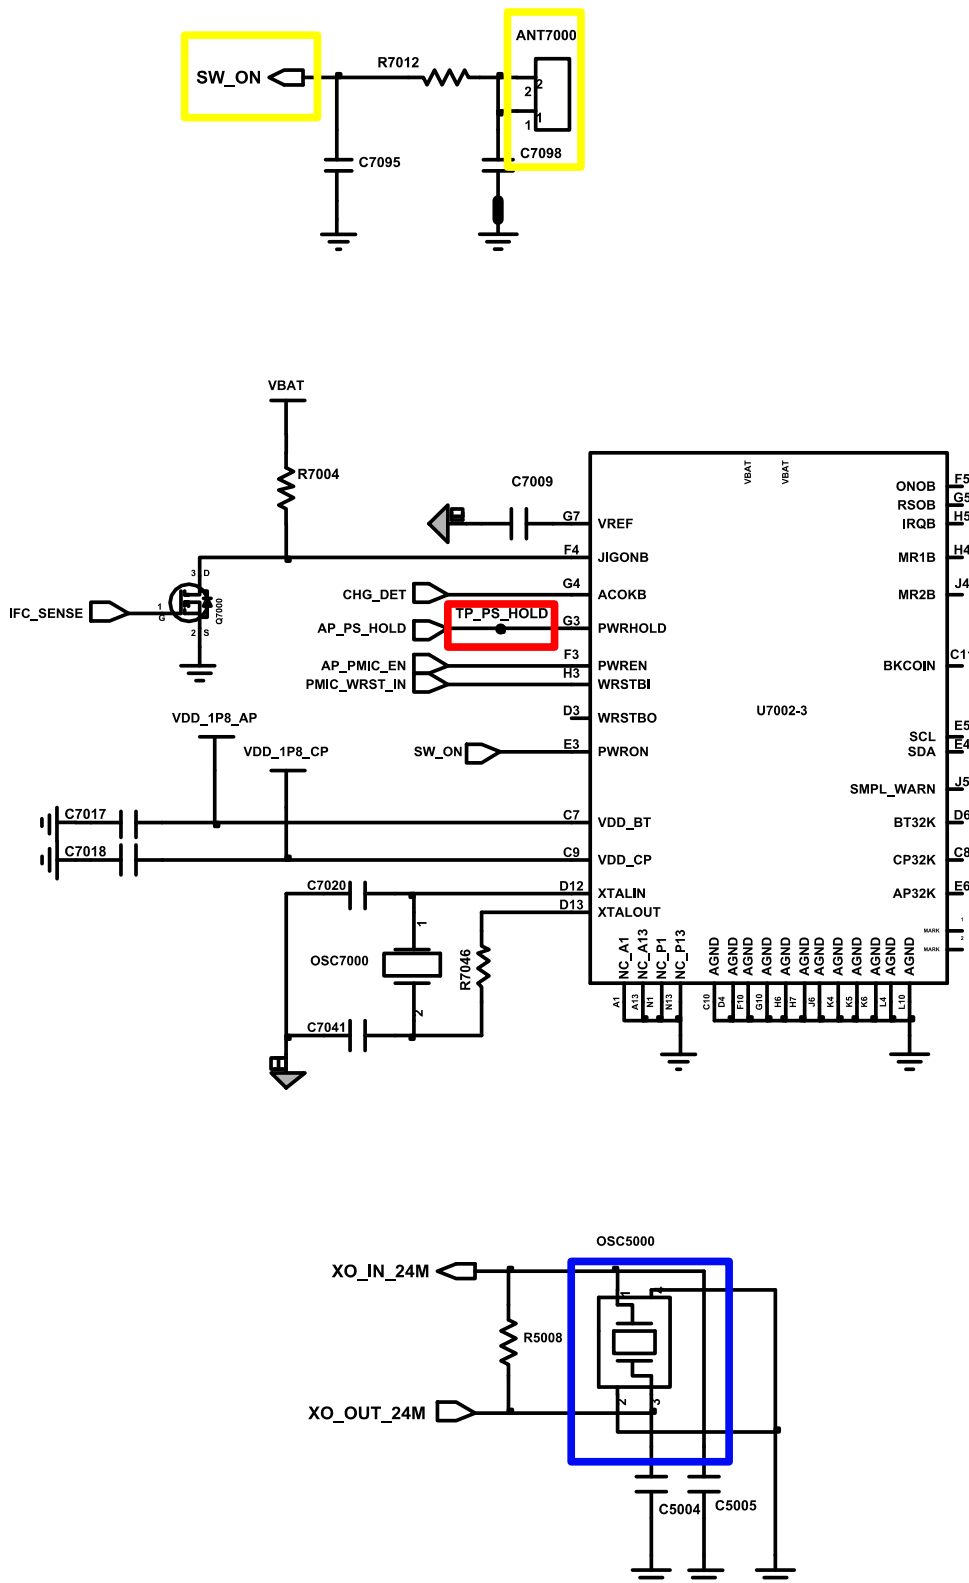

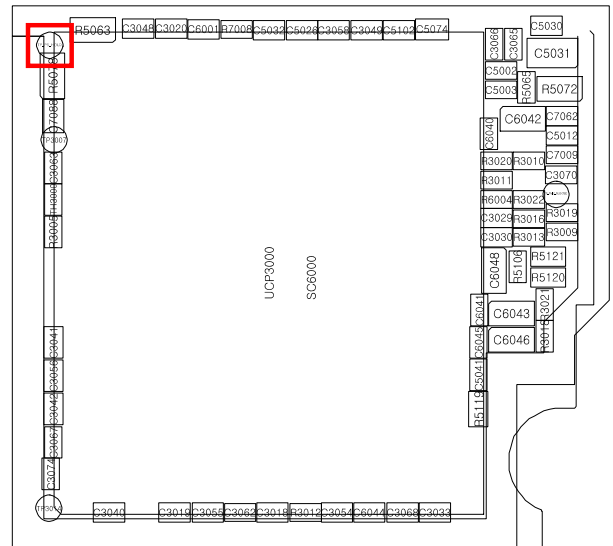



8-3-2 初始化

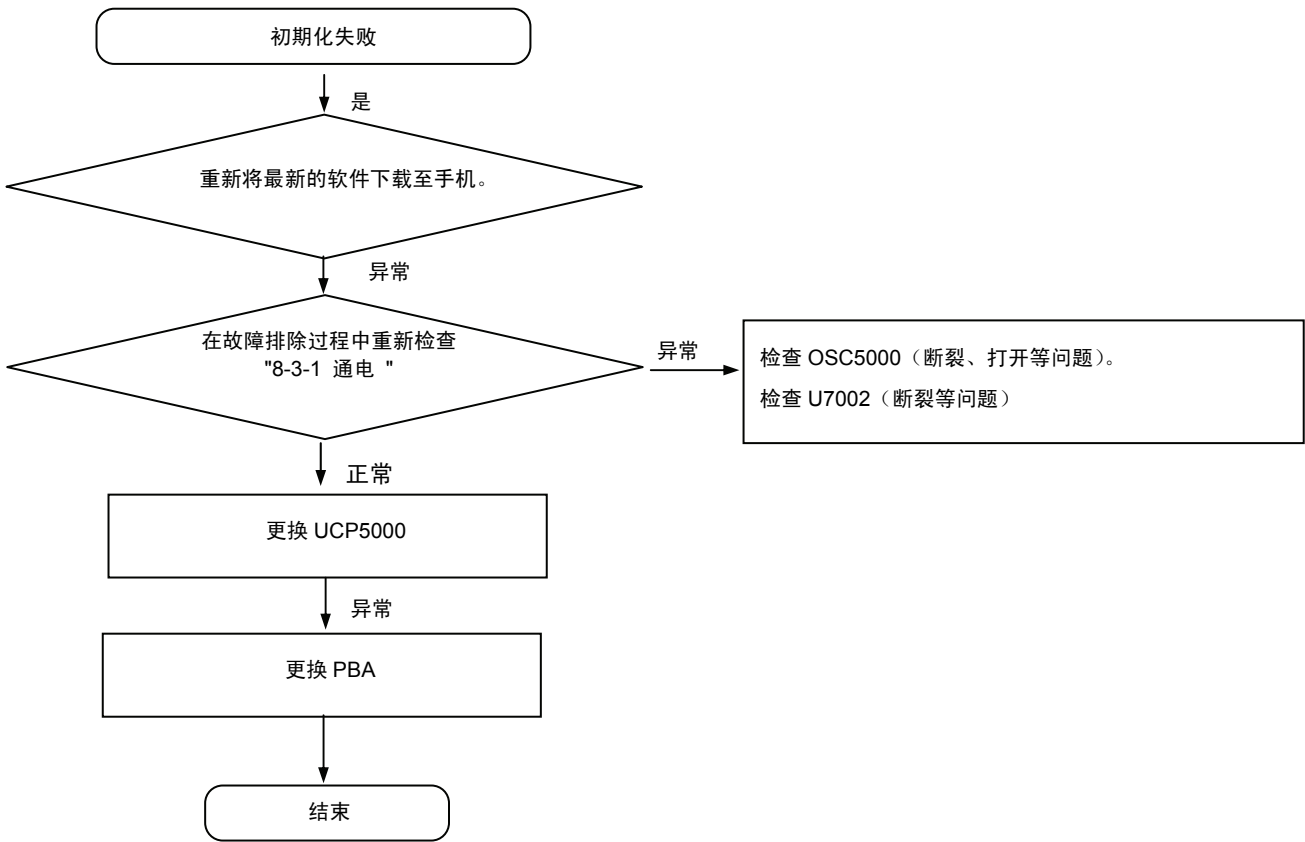

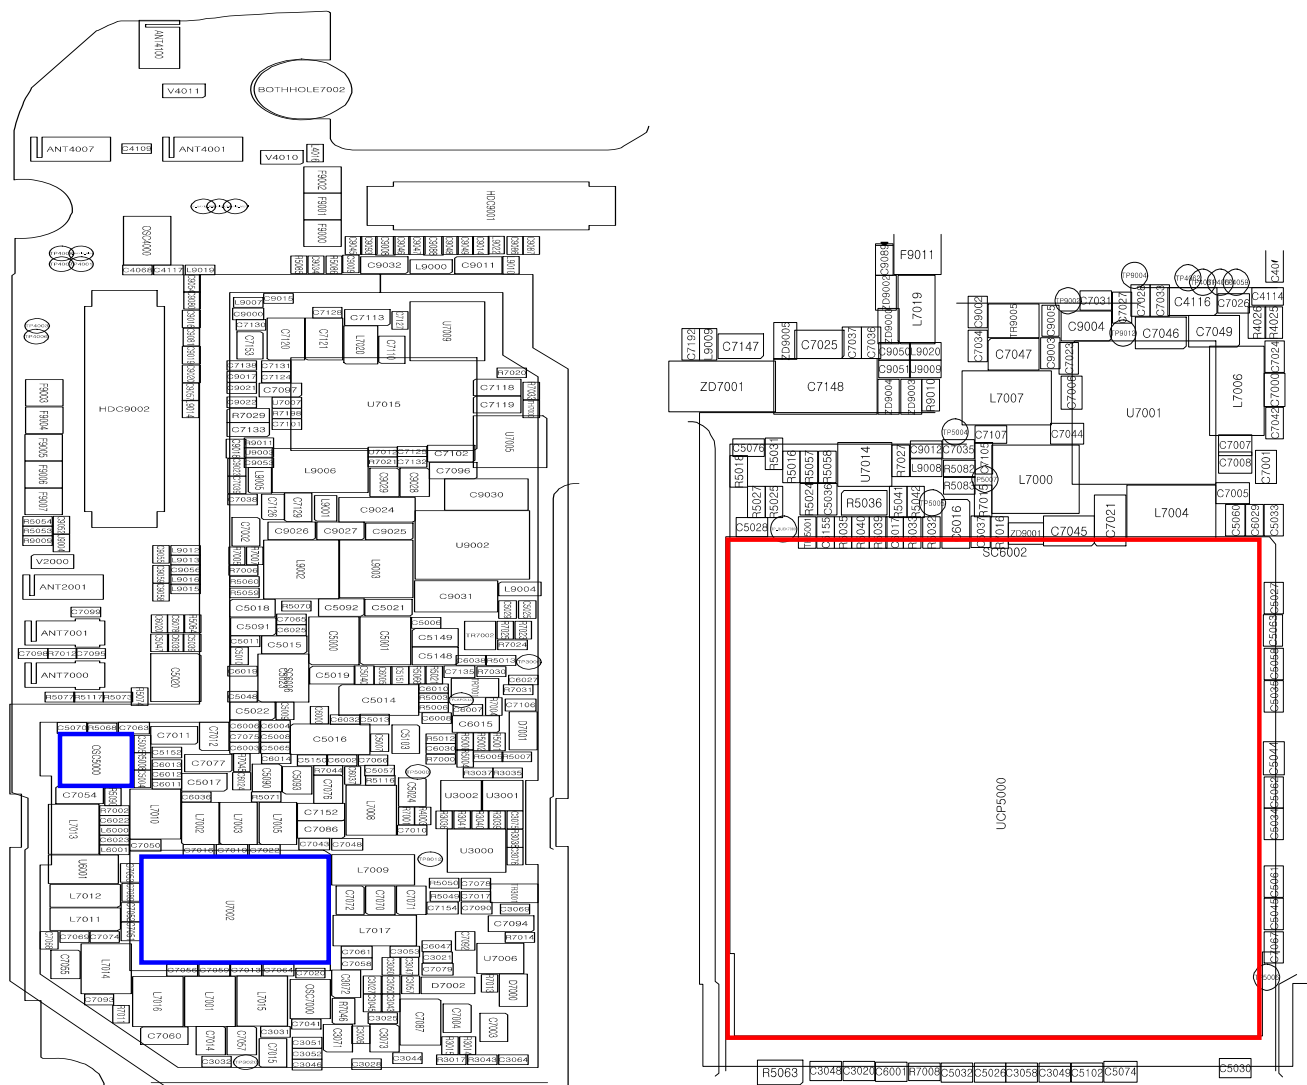



8-3-3. 无服务

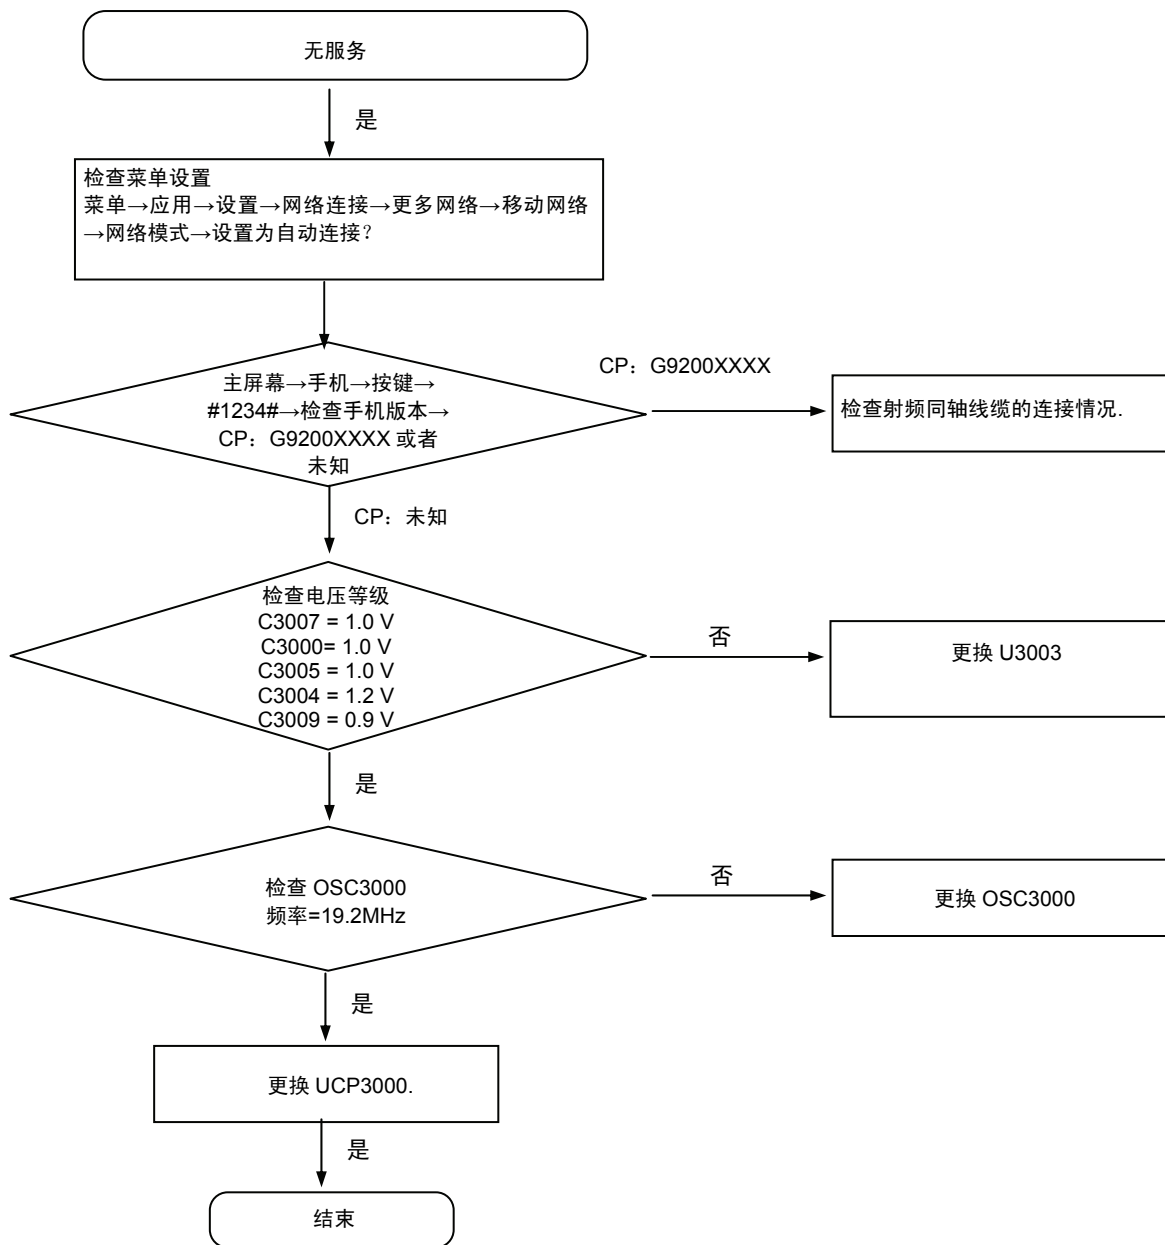


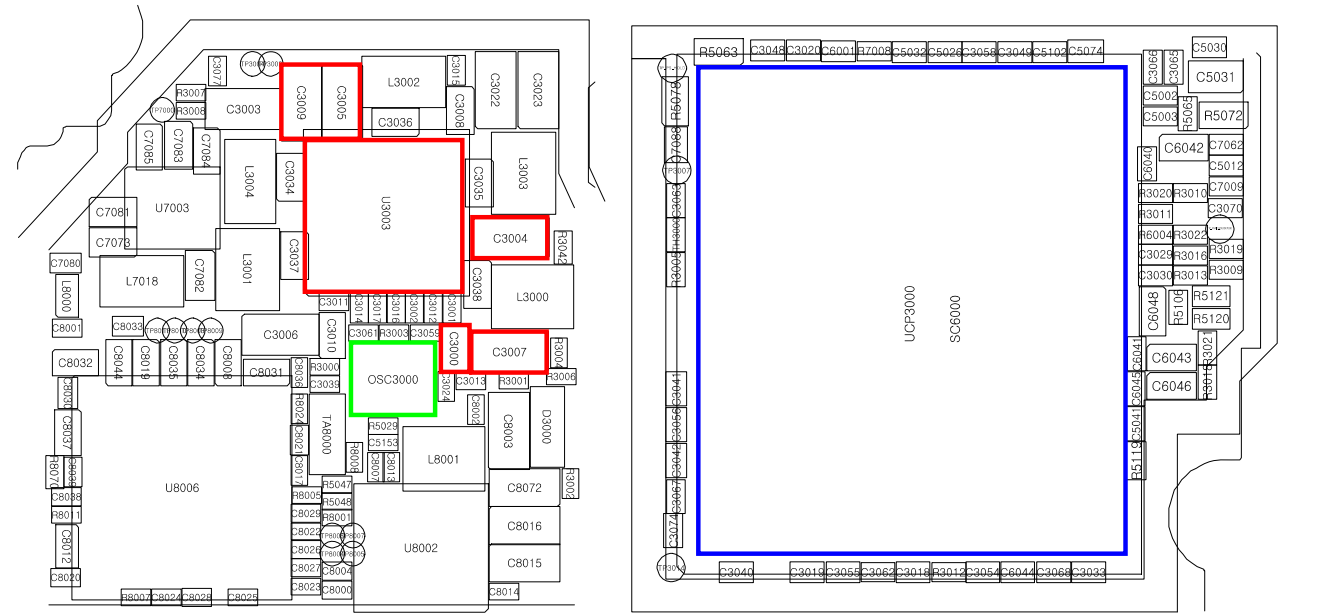


8-3-4. Sim 部分



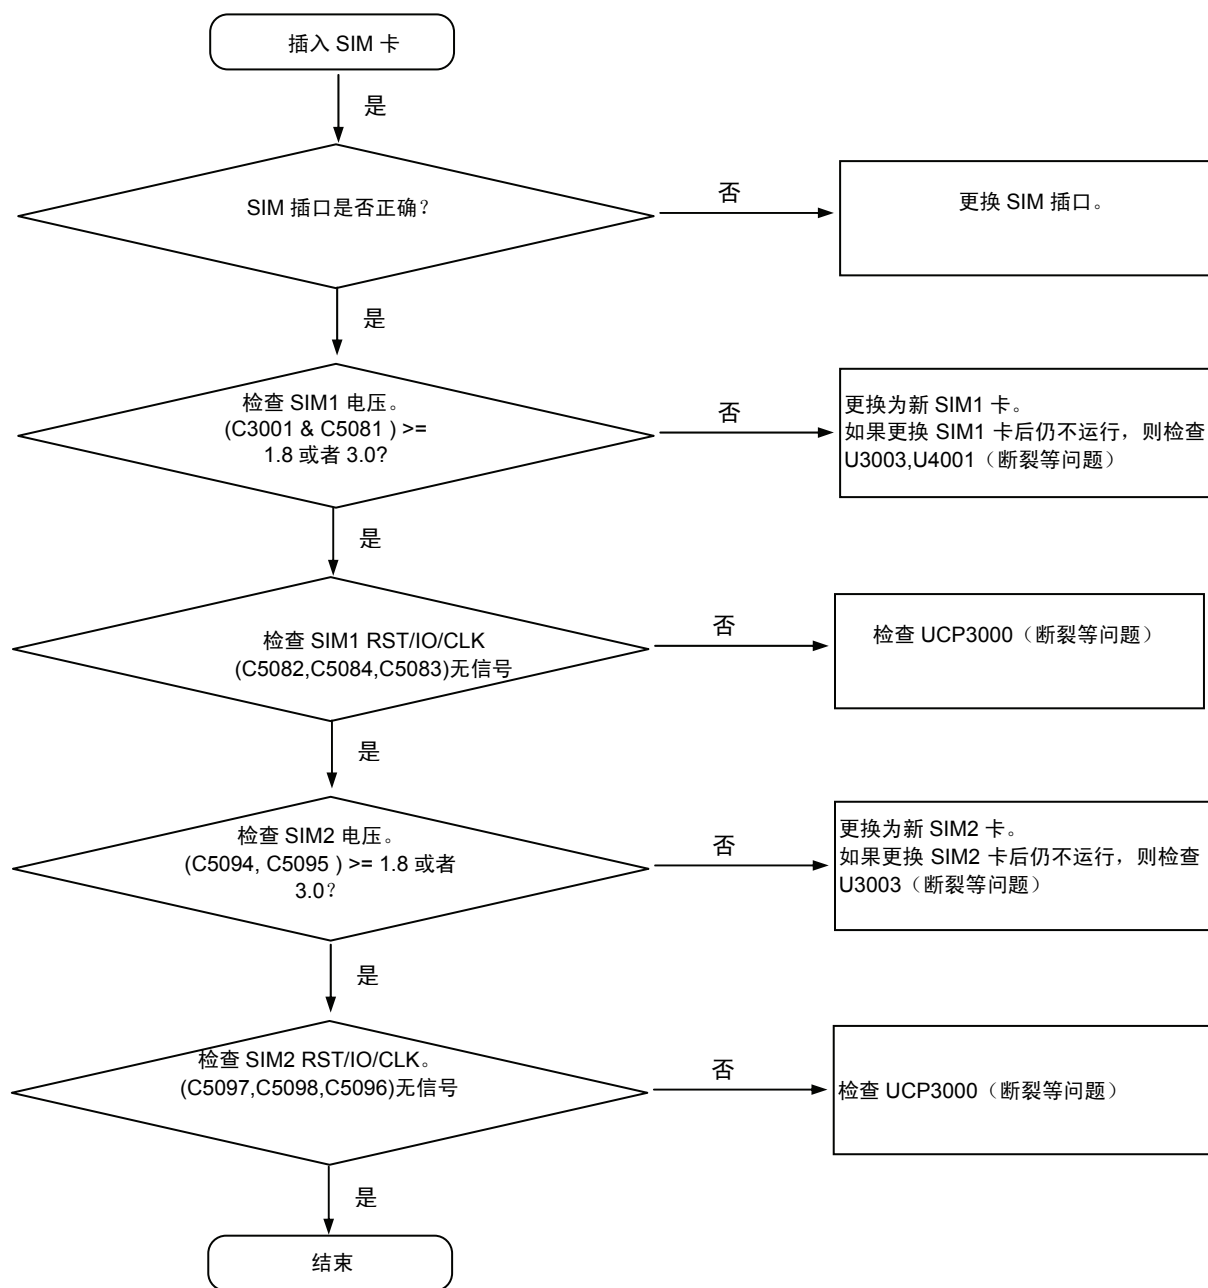




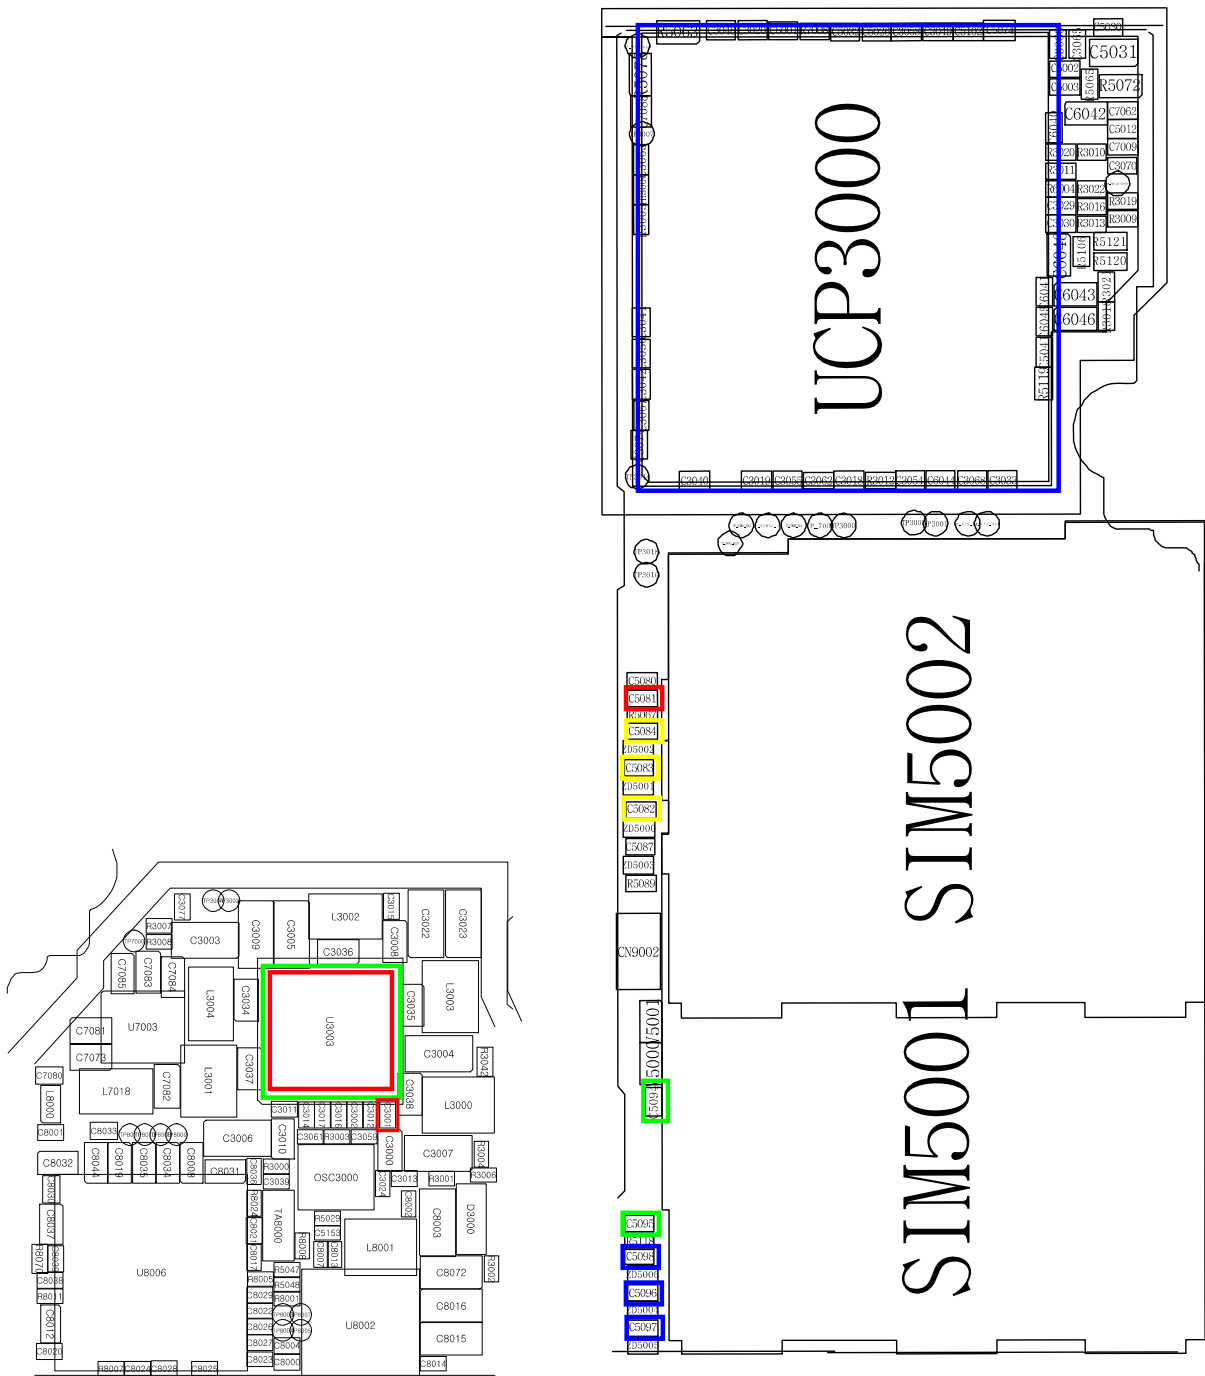




8-3-5. 充电部分

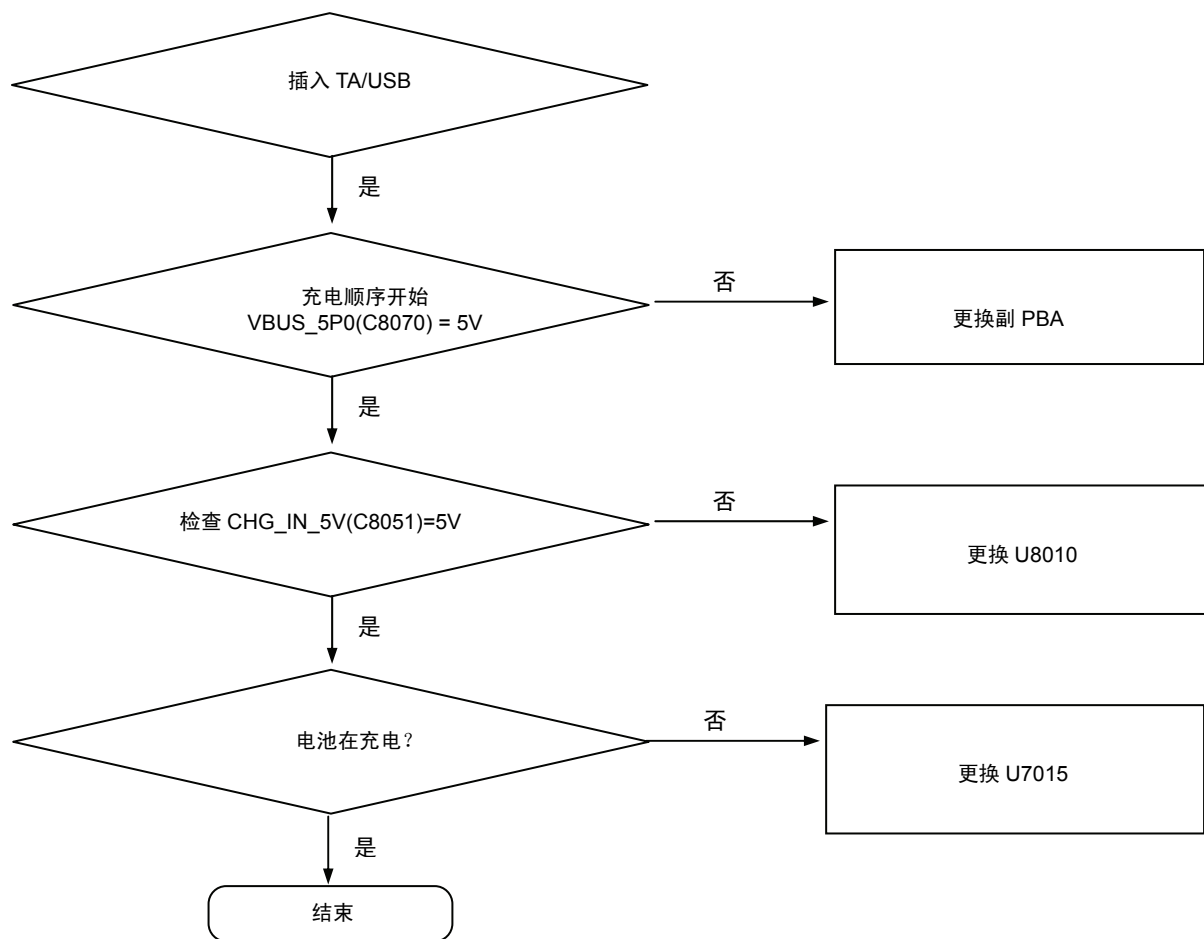

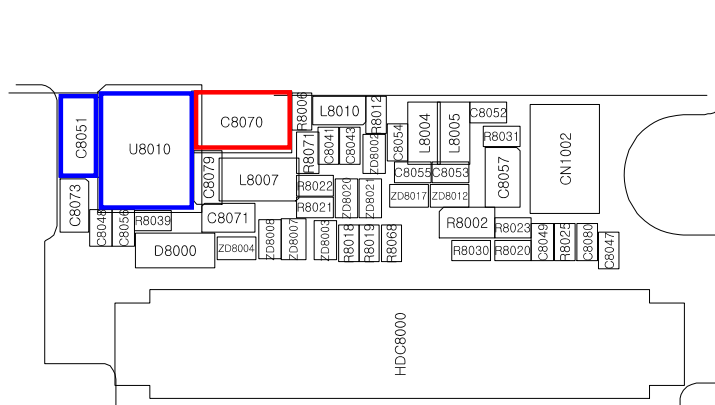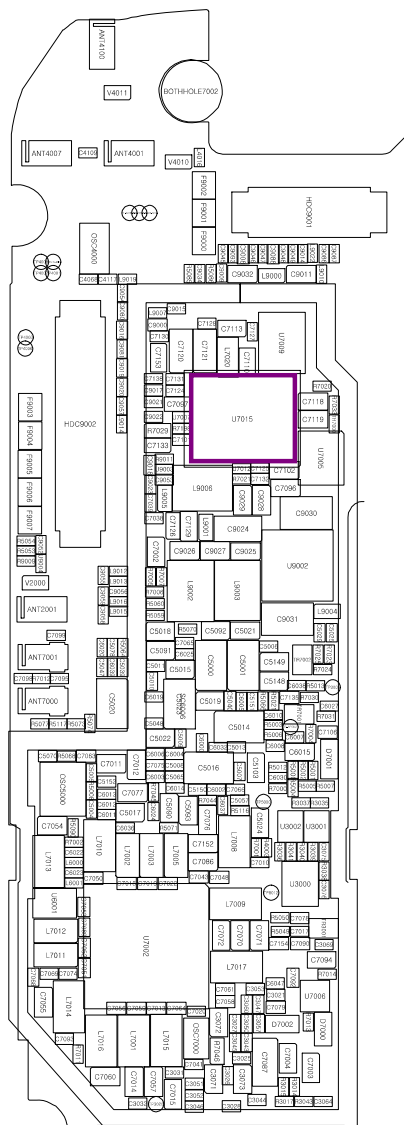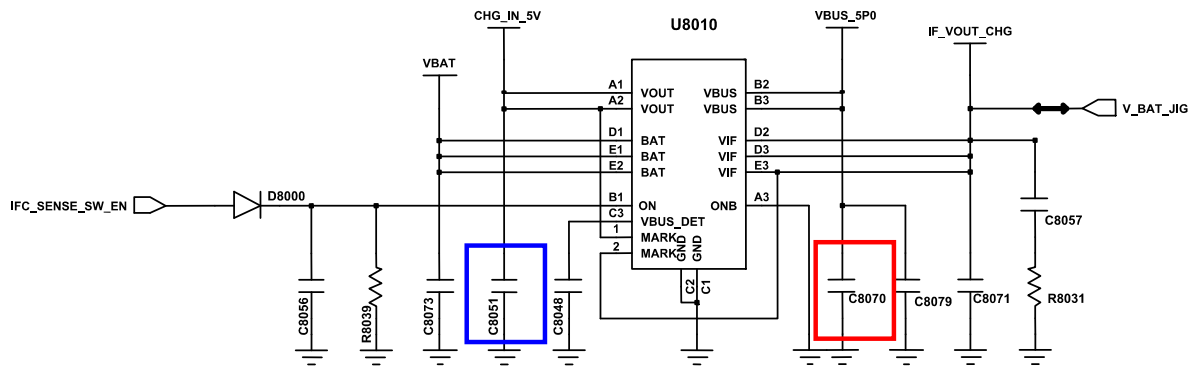



8-3-6. OTG

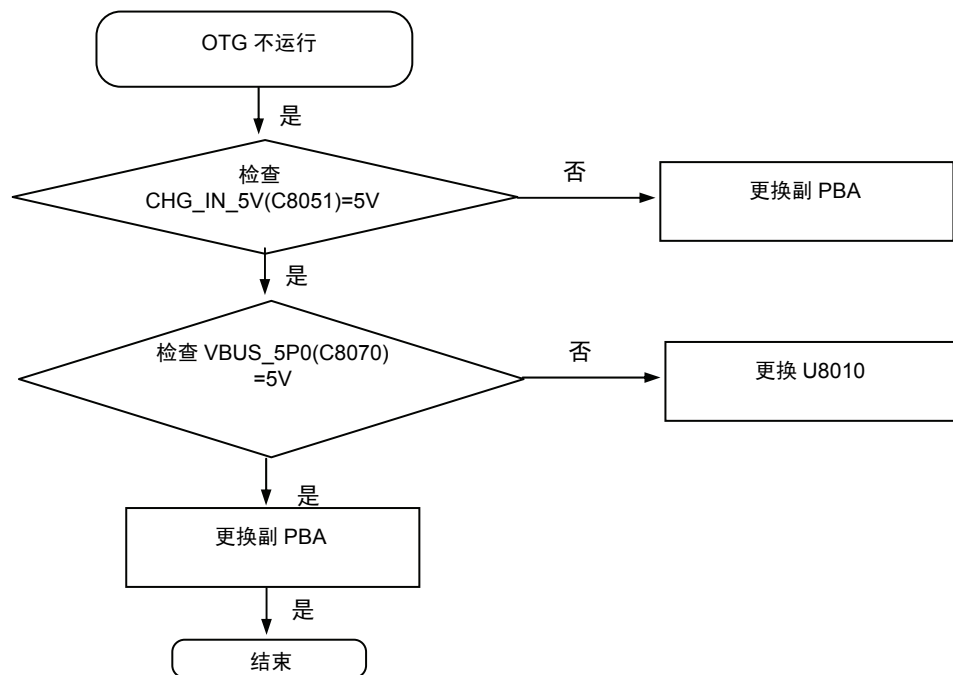

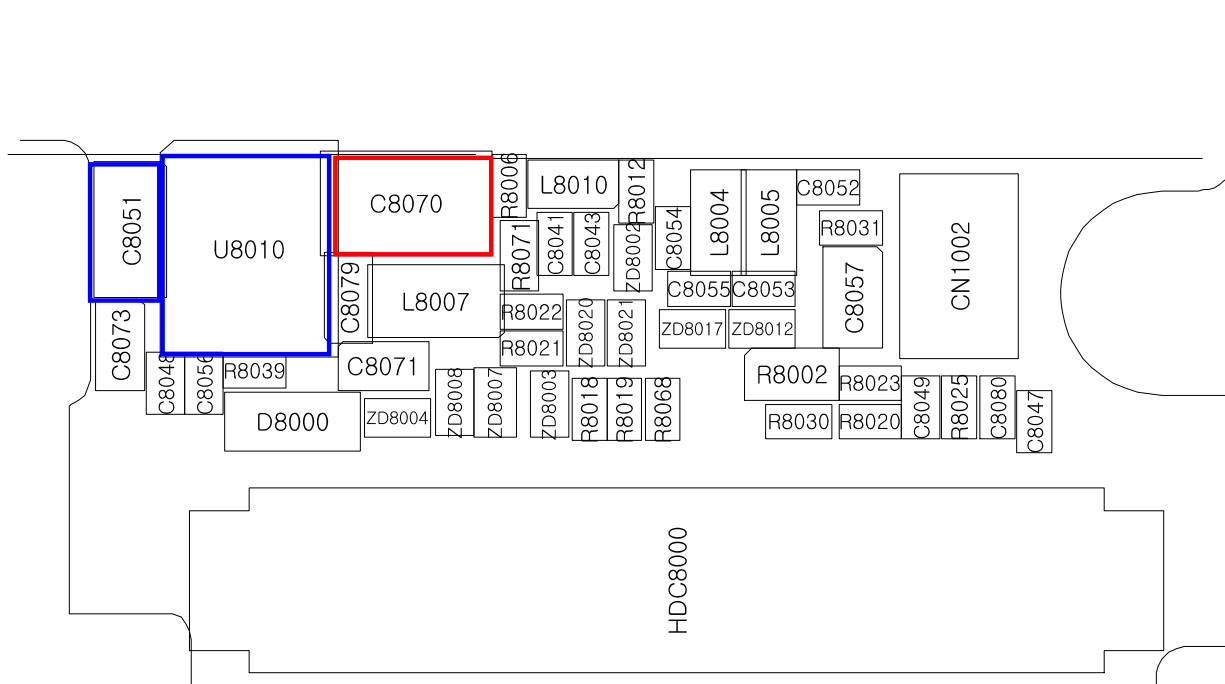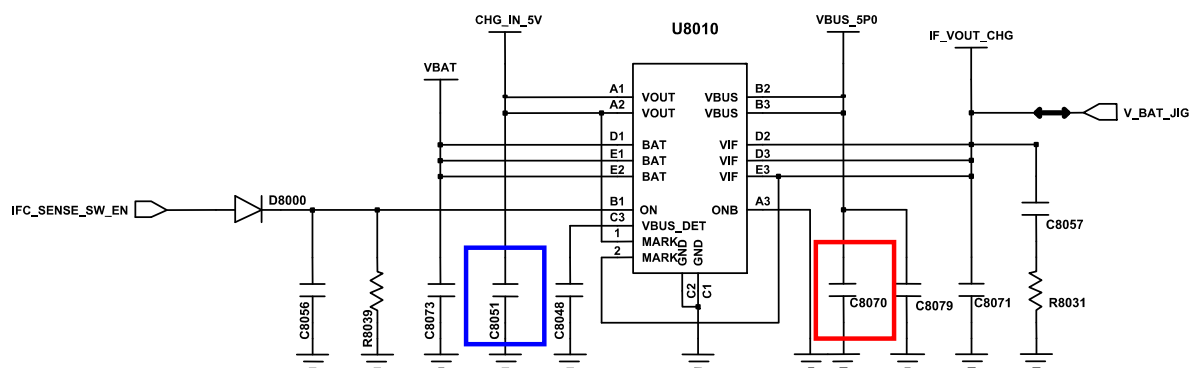



8-3-7. 传感器中枢

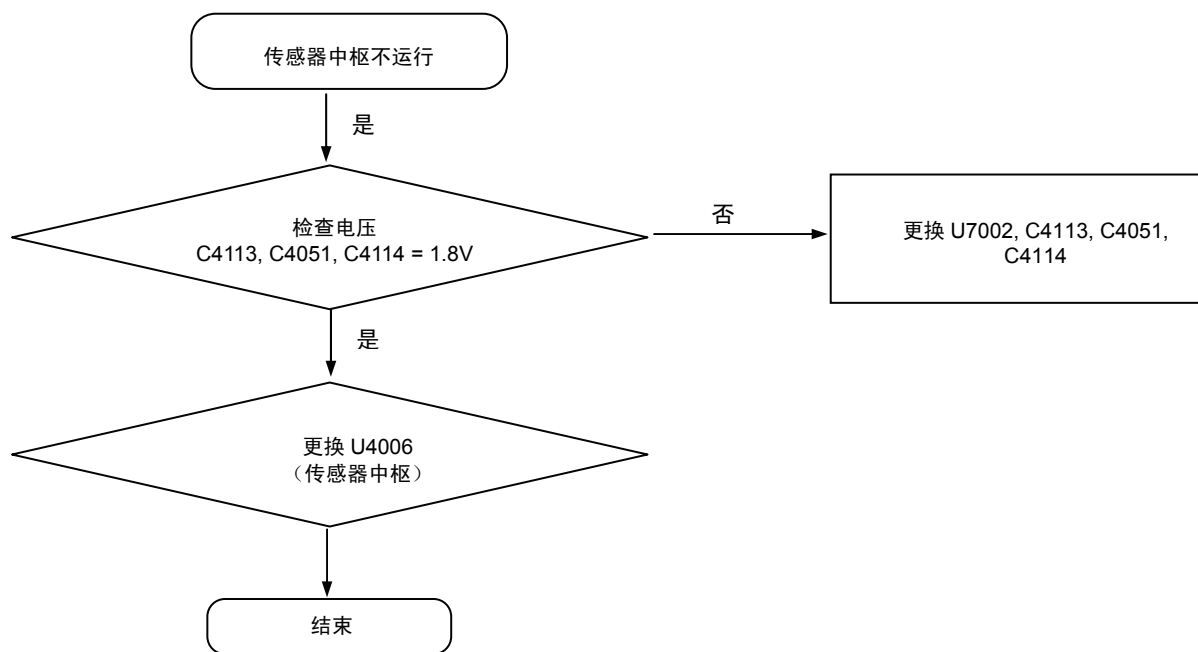

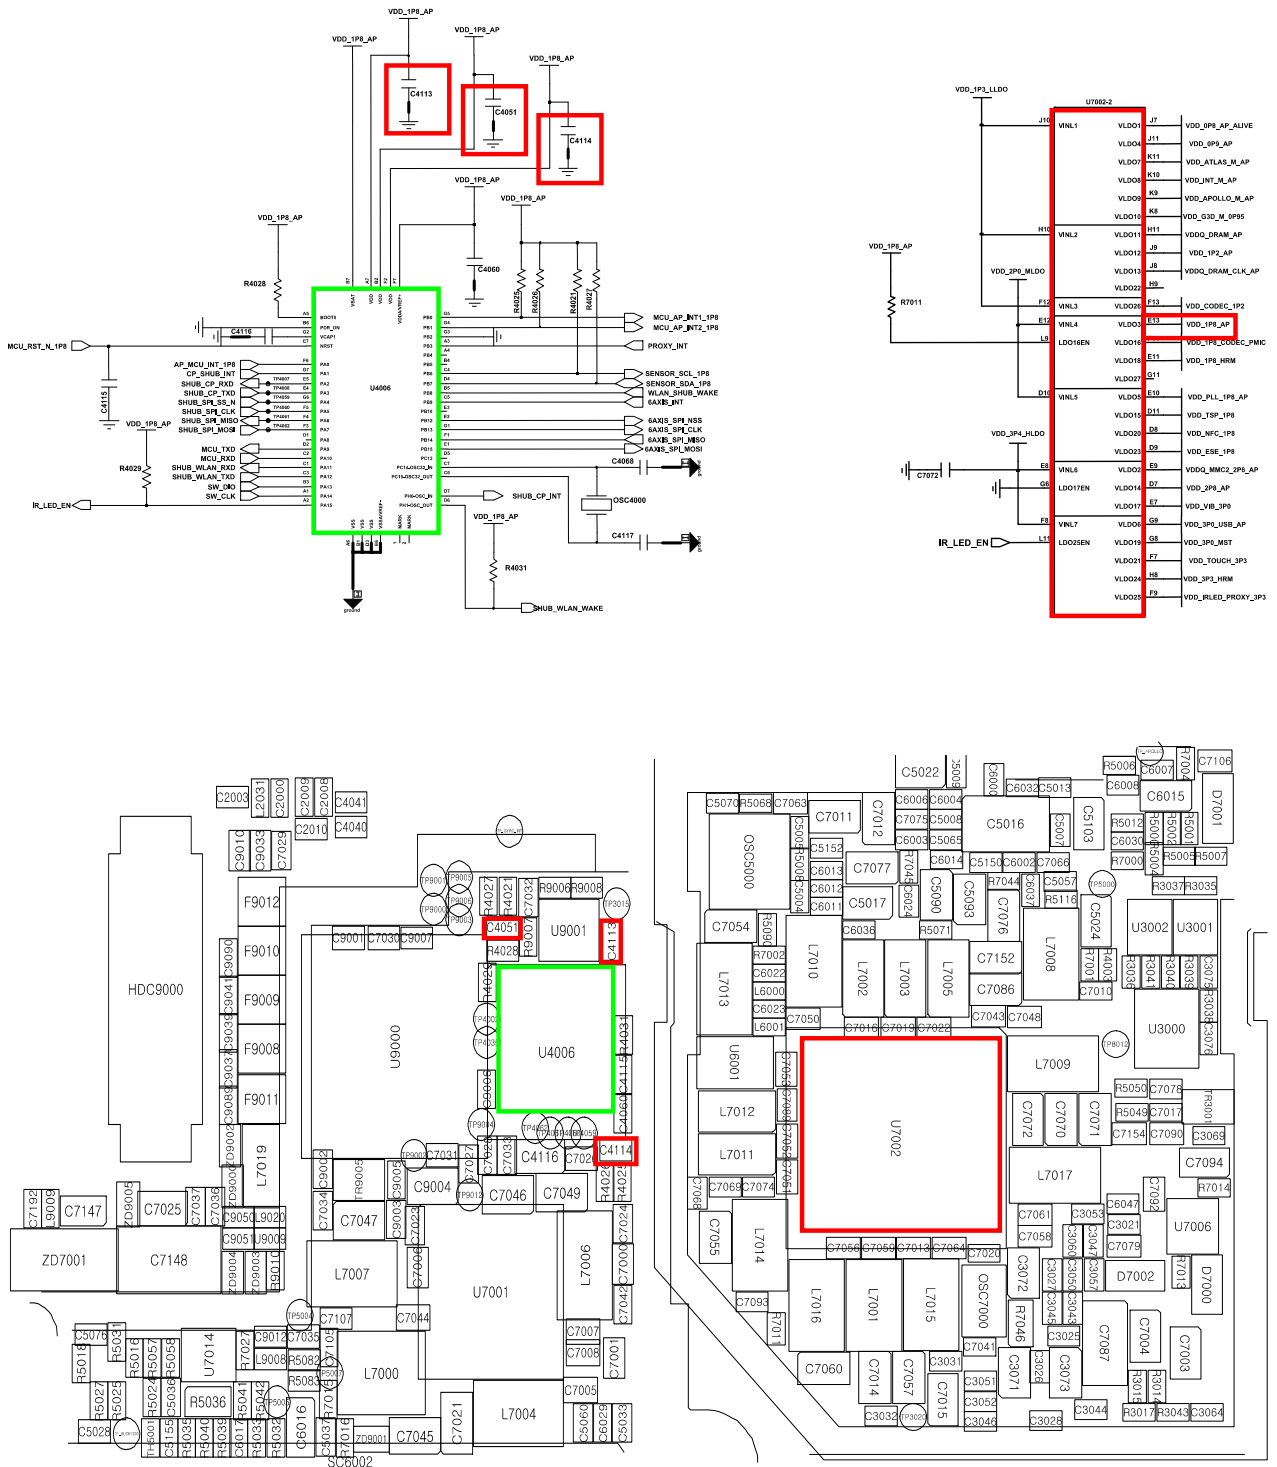


8-3-7-2. 磁传感器

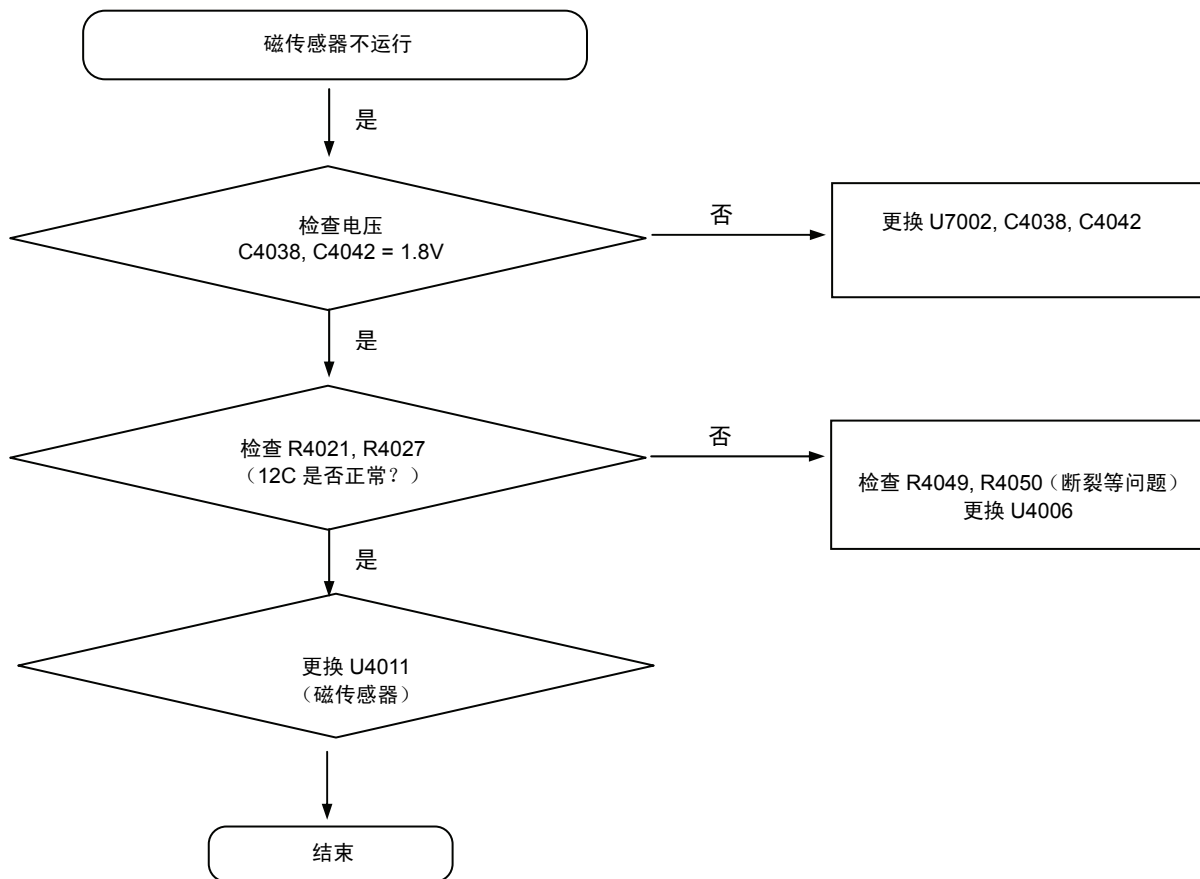








8-3-7-3. 6Axis 传感器

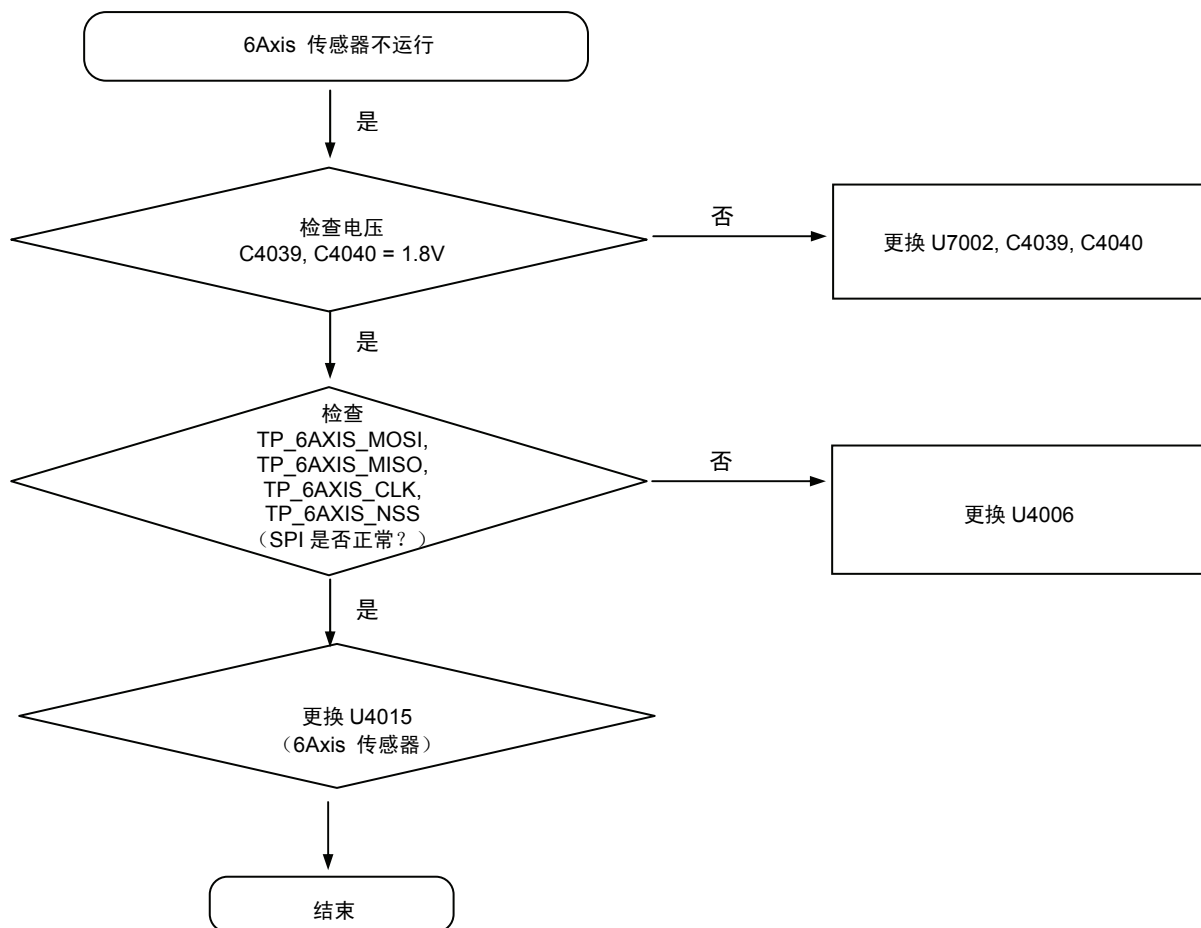




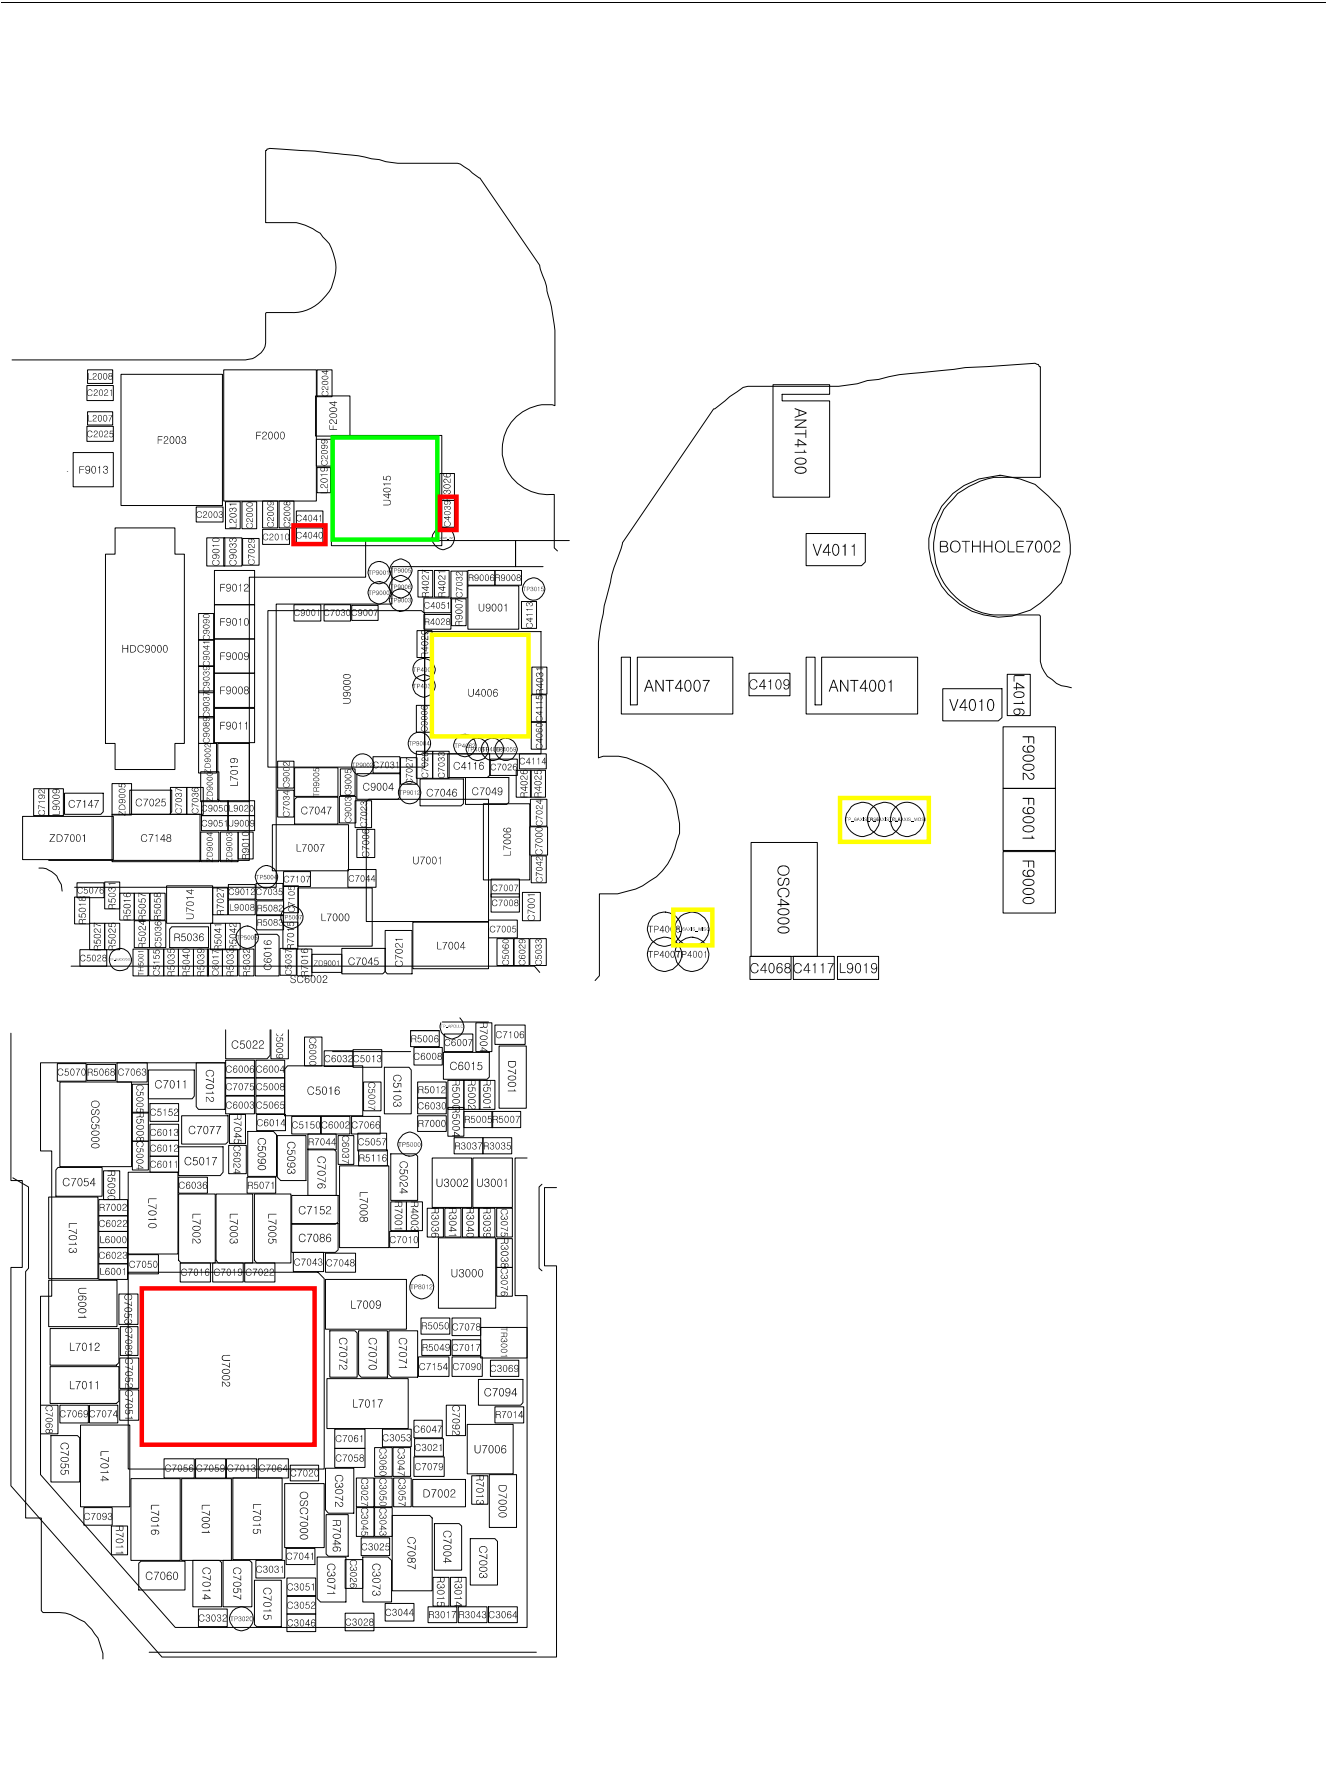


8-3-8. IRLED

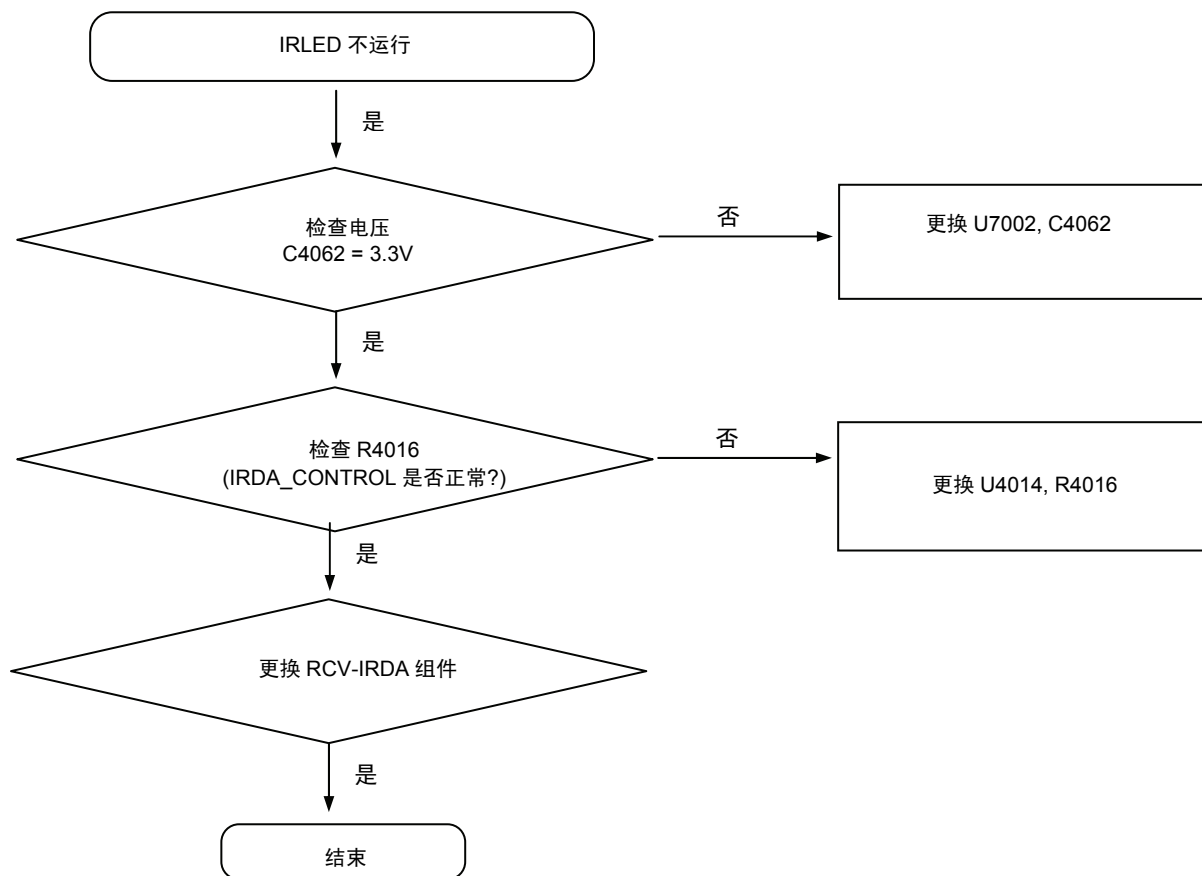


8-3-9-1. 麦克风部分—主麦克风

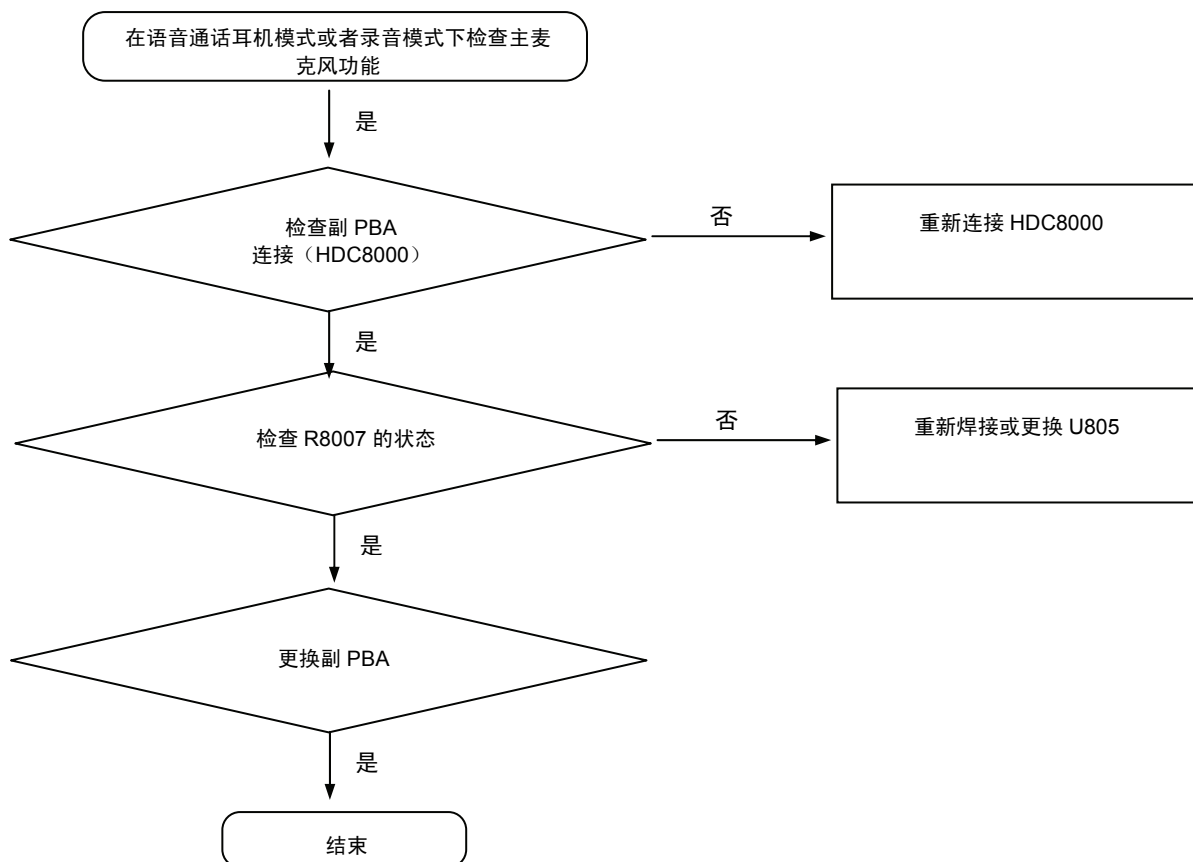



8-3-9-2. 麦克风部分一副（第二个）麦克风

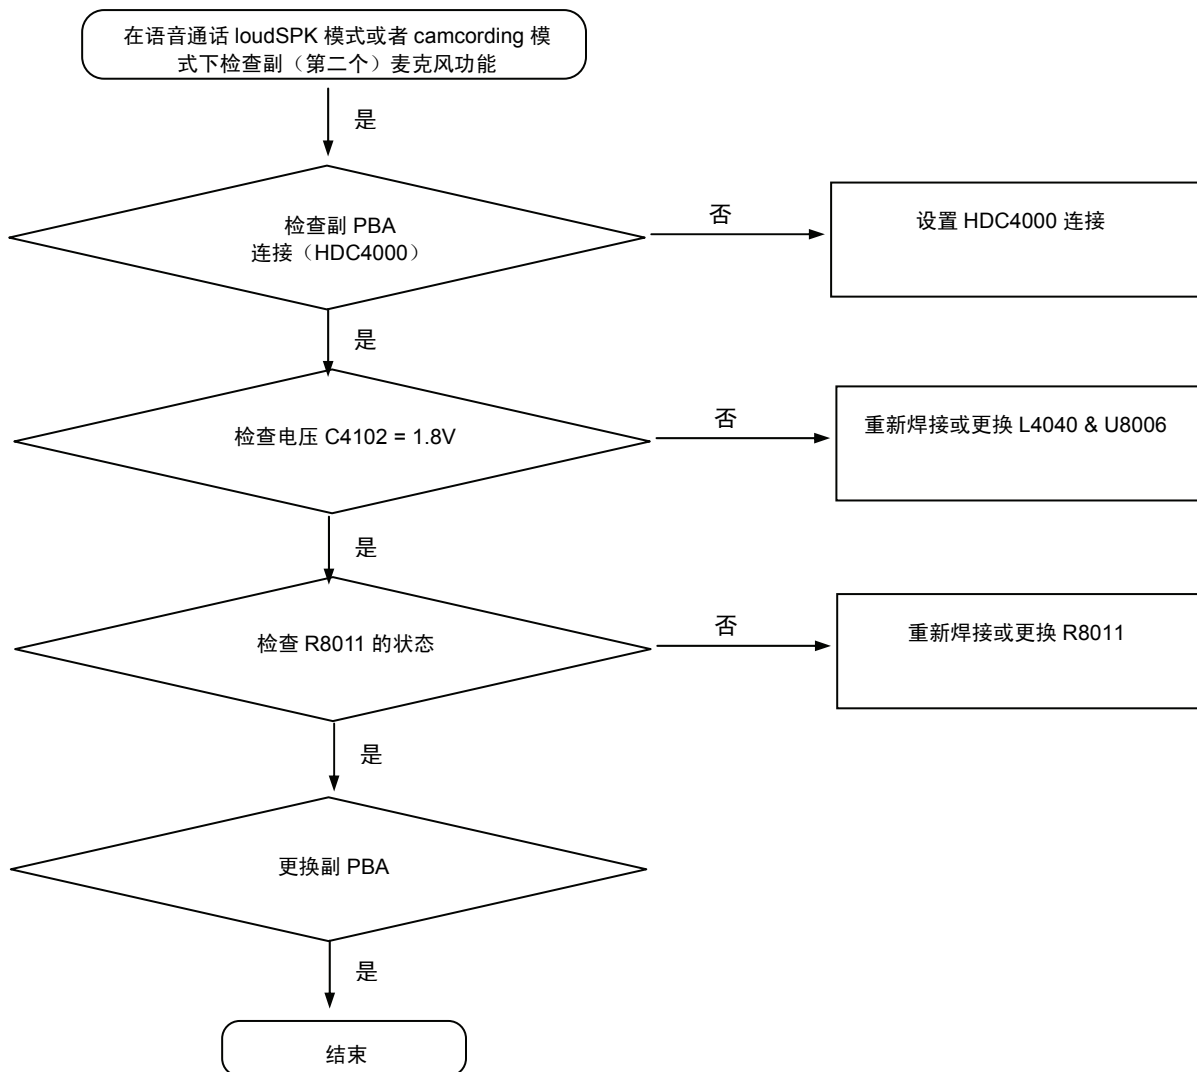

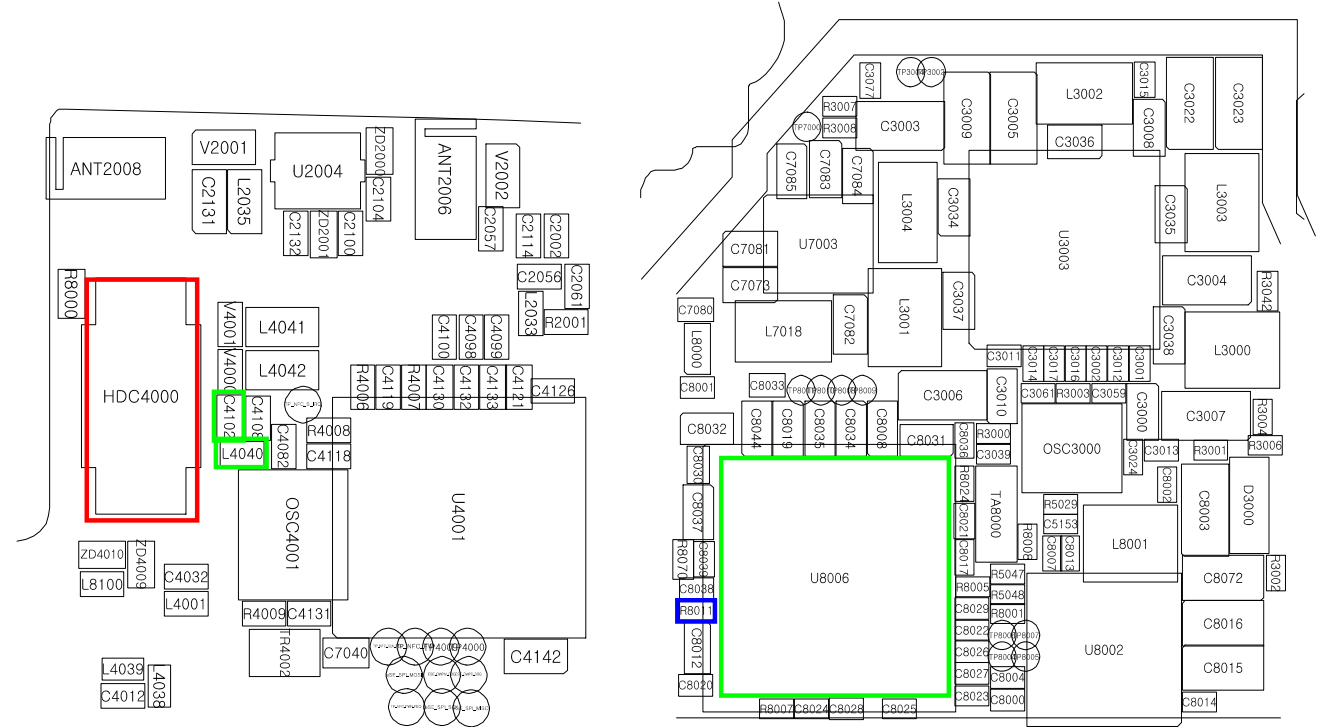


8-3-10. 扬声器部分

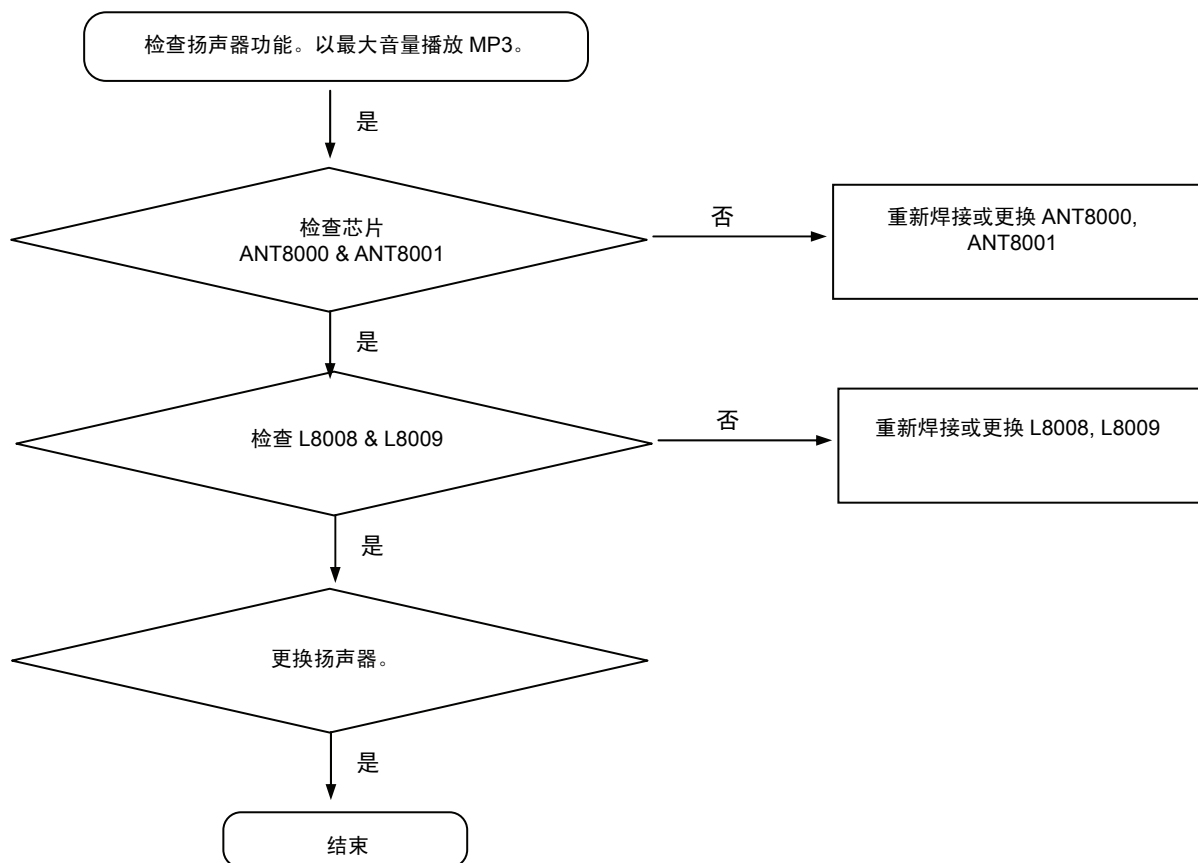


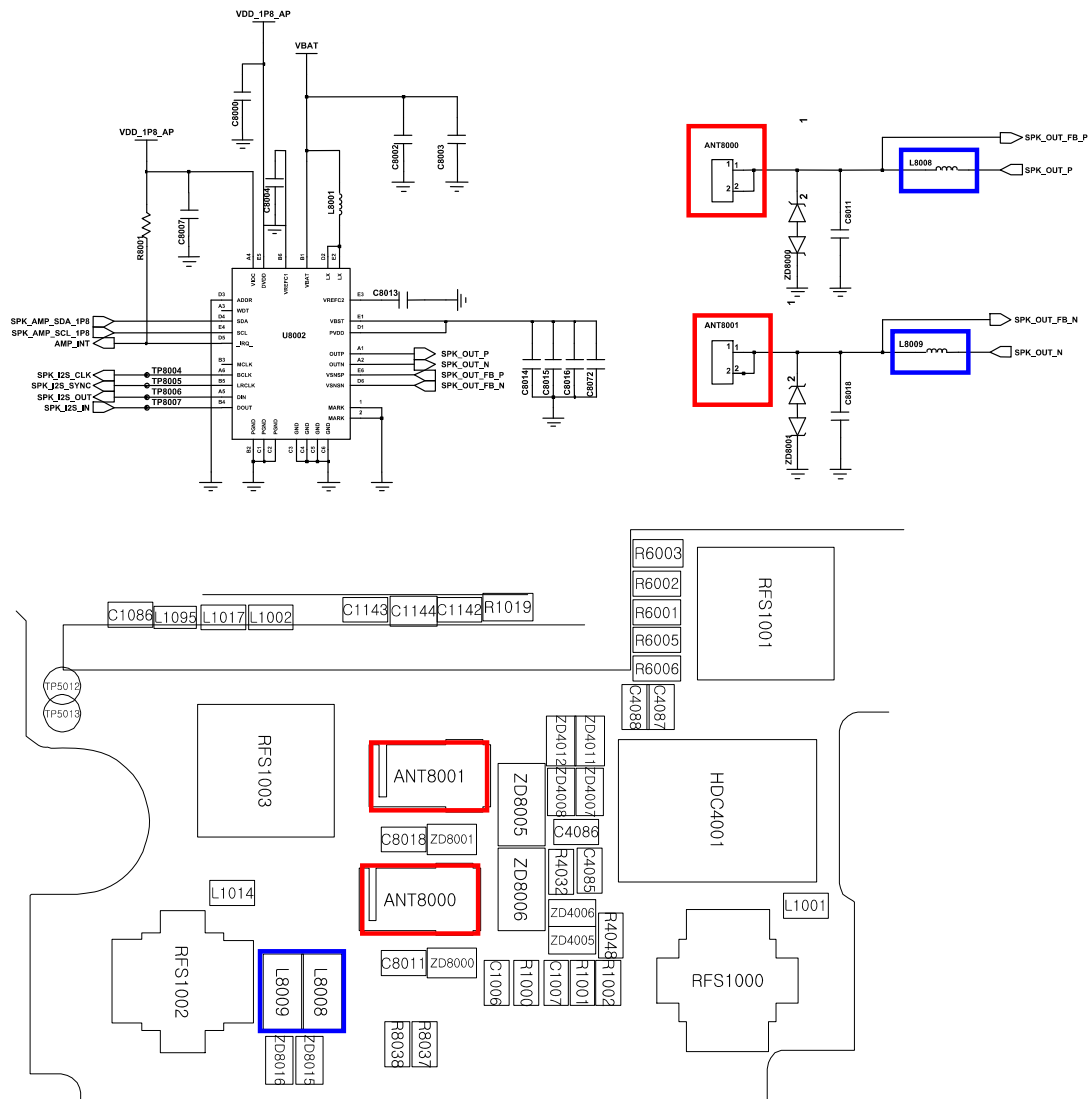


8-3-11. 接收器部分

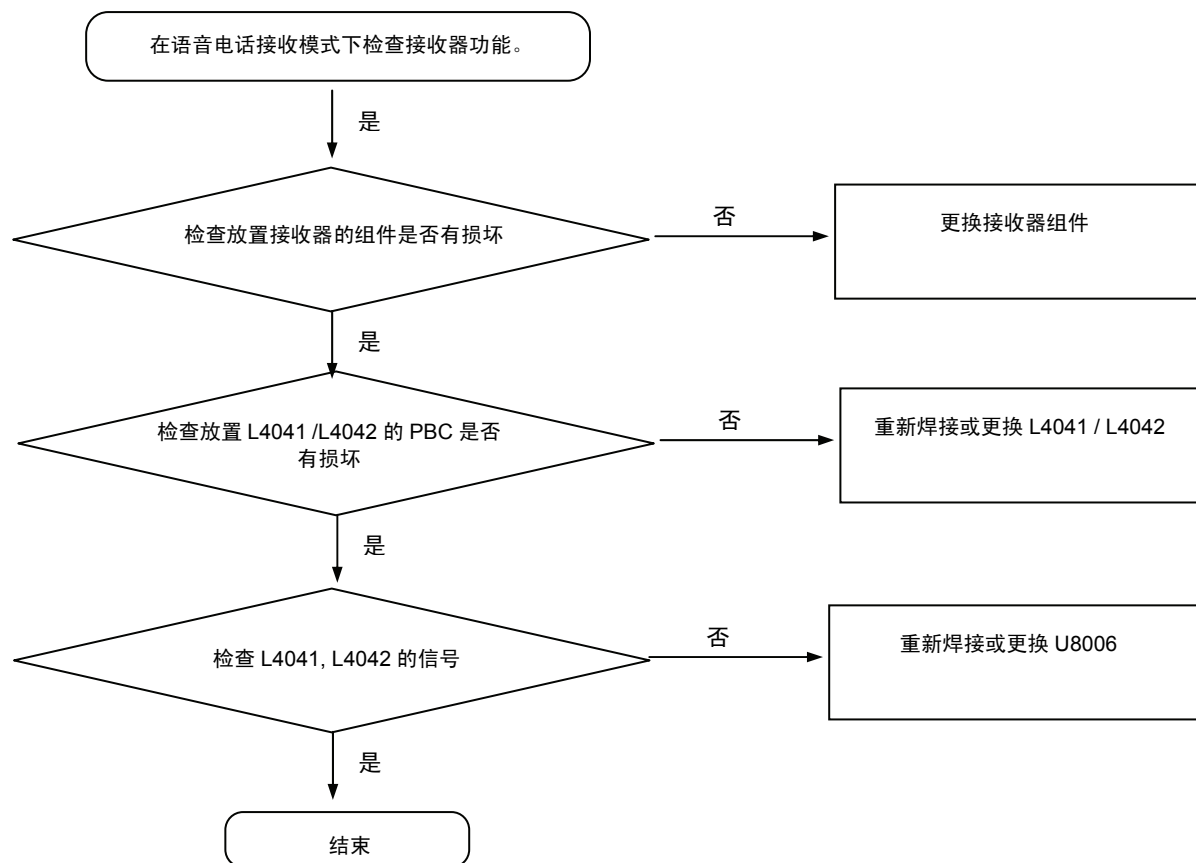


8-3-12. BT/WIFI

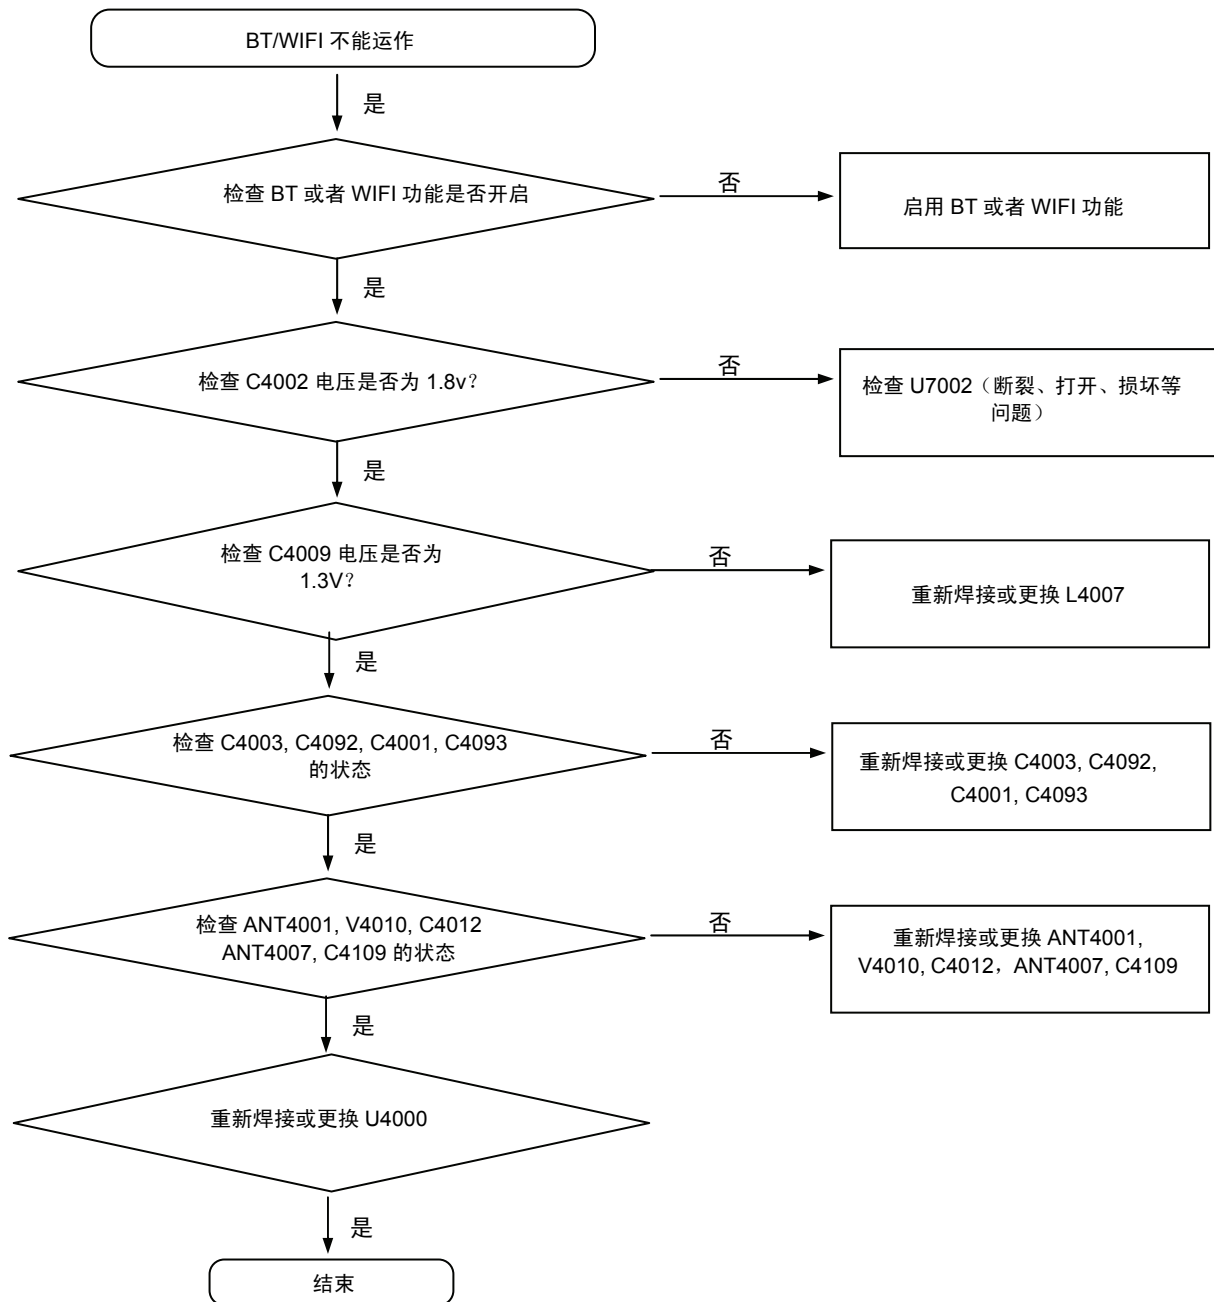


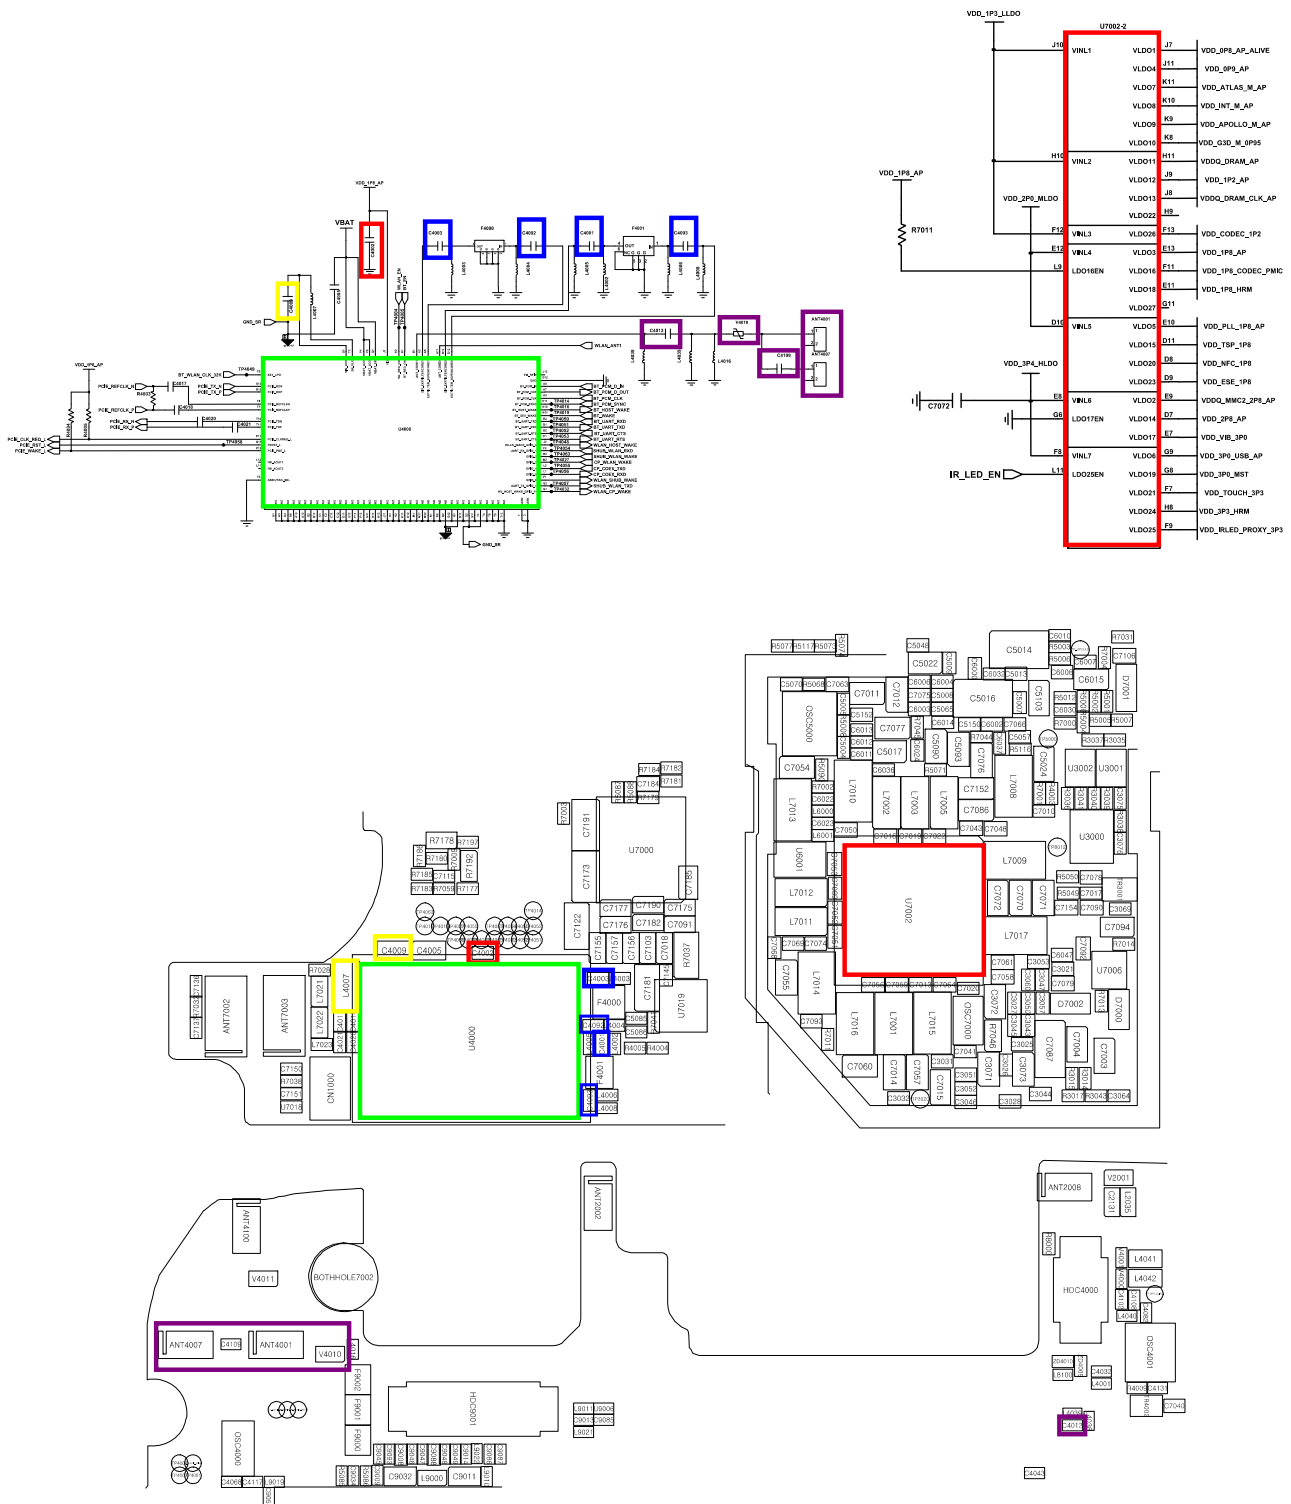


8-3-13. GPS

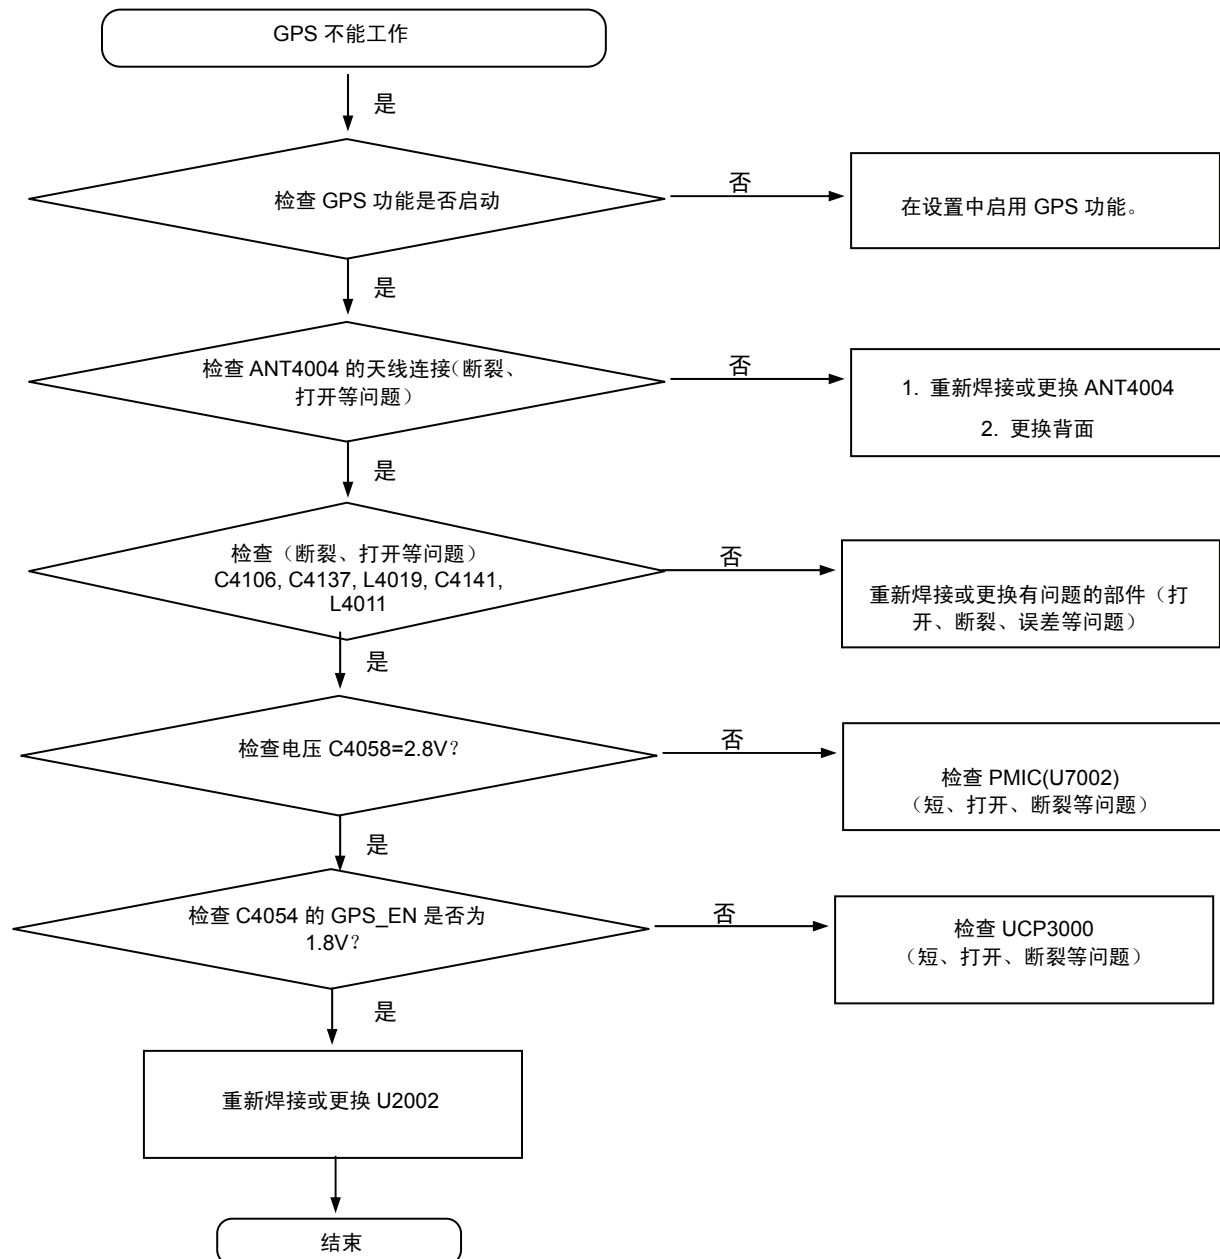


8-3-14. NFC

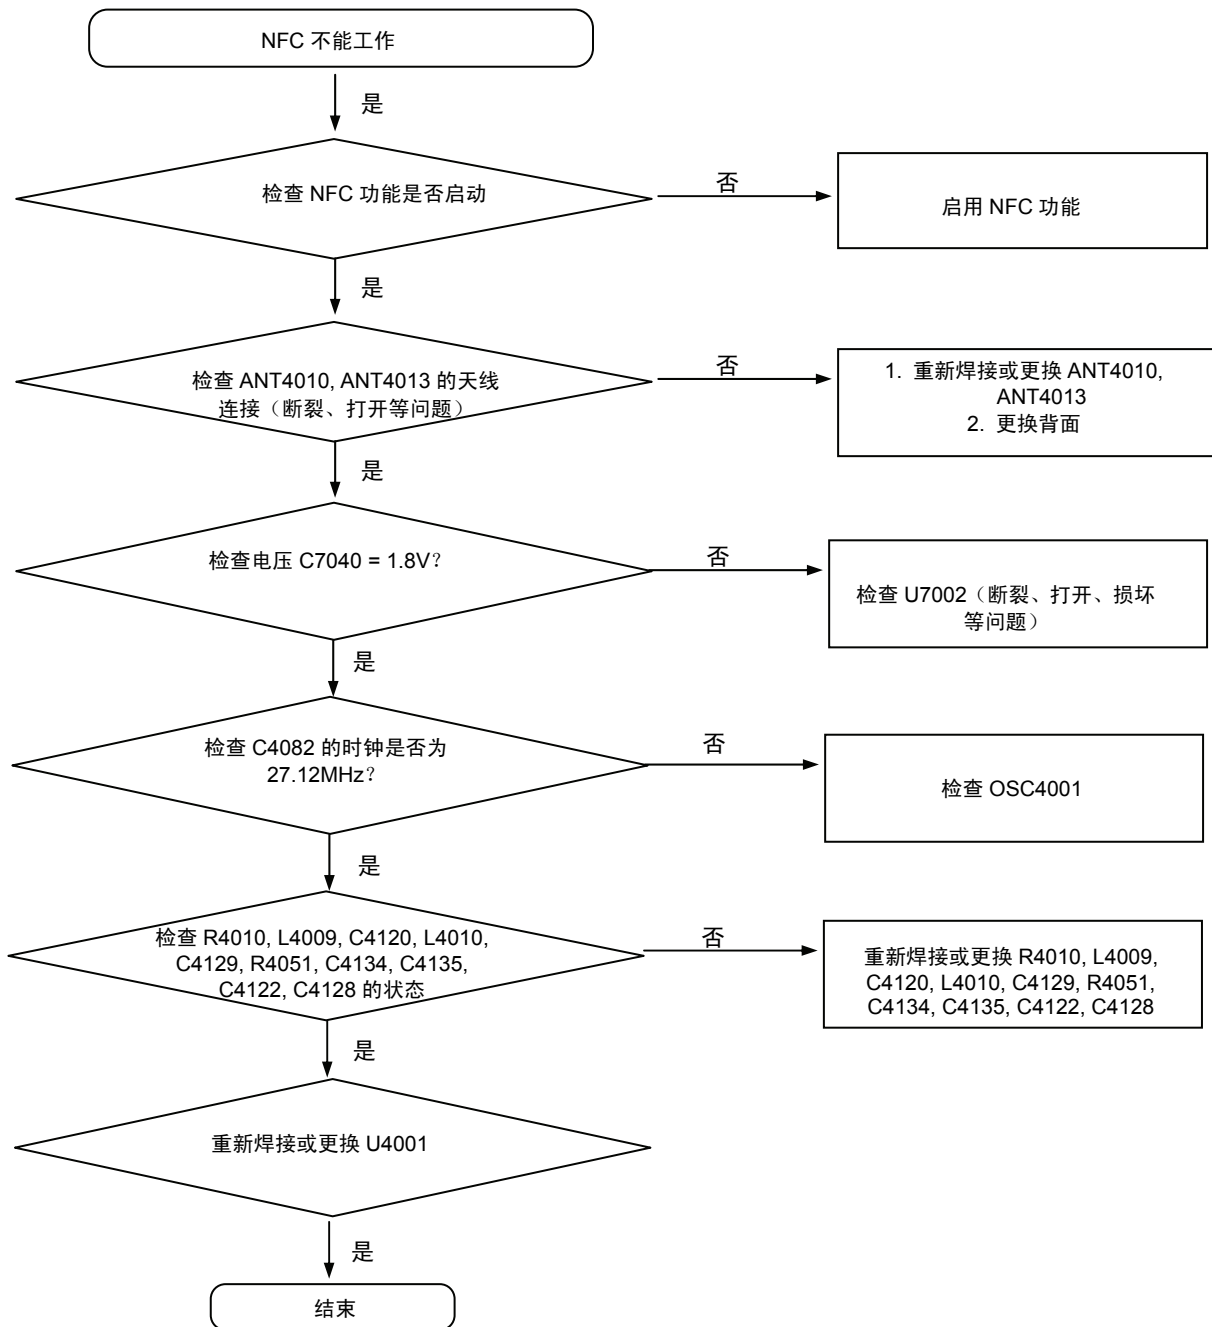



8-3-15. 显示屏

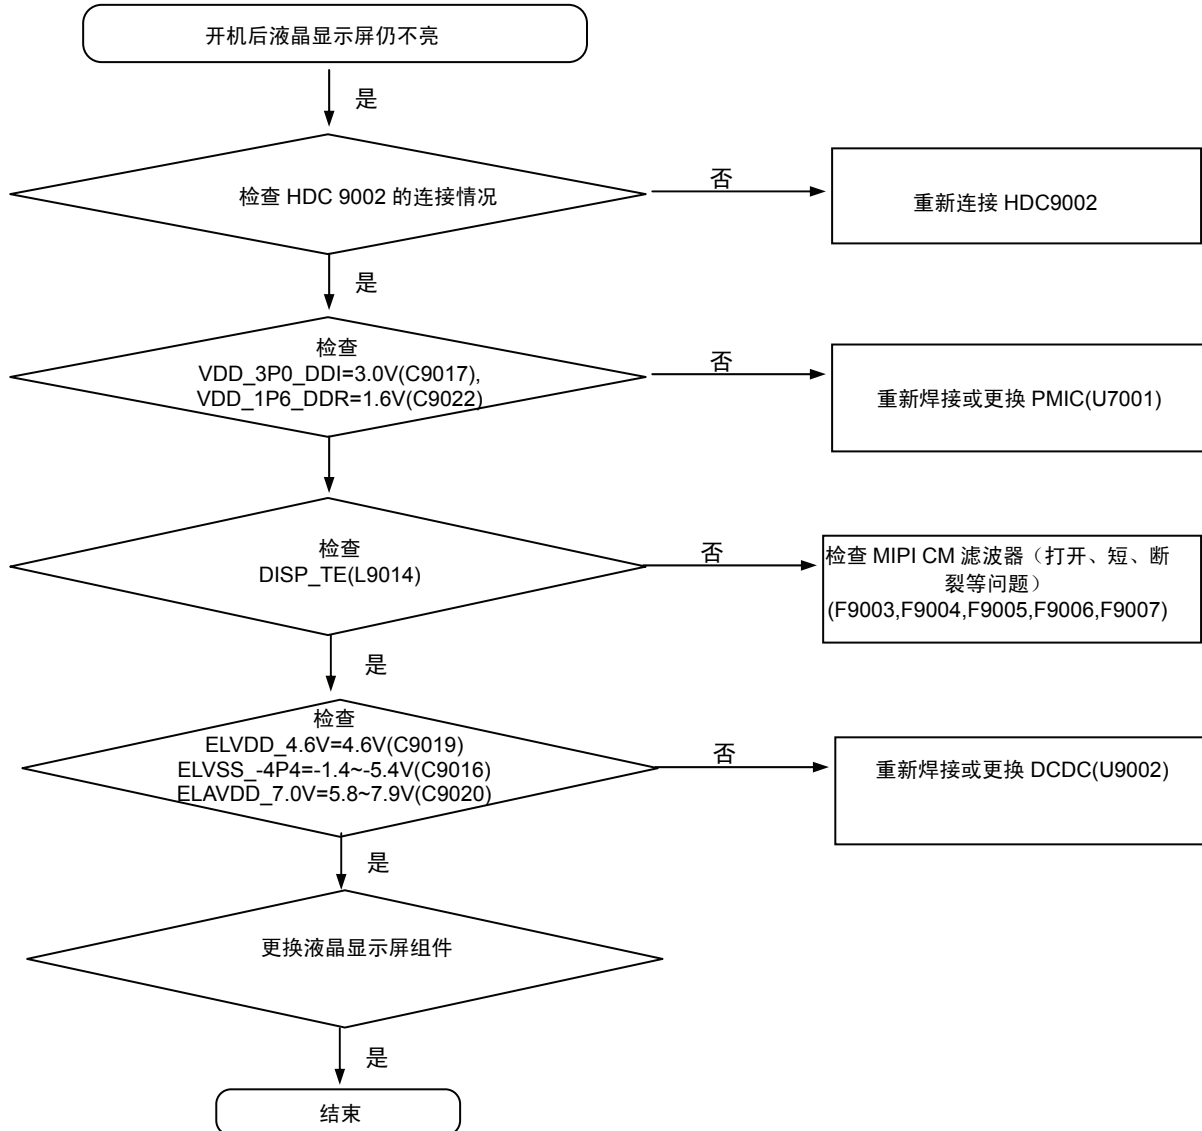


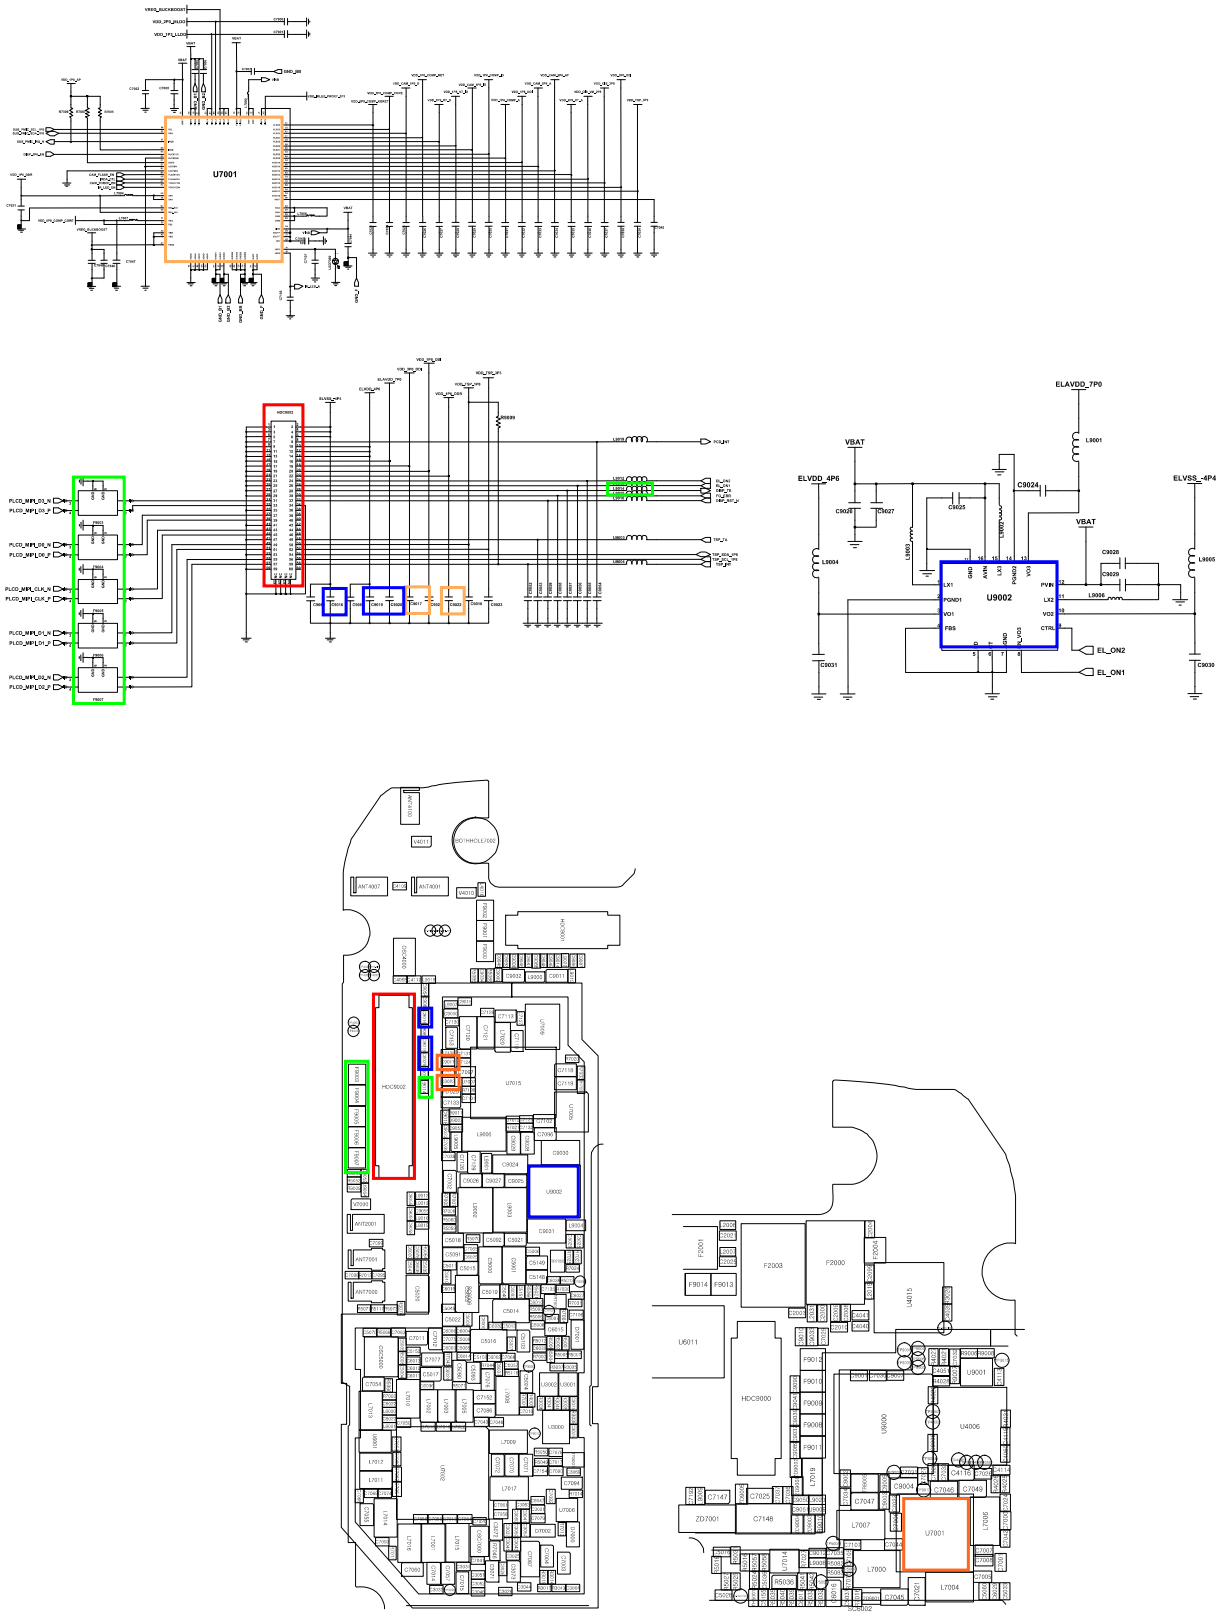


8-3-16. 16M 摄像头

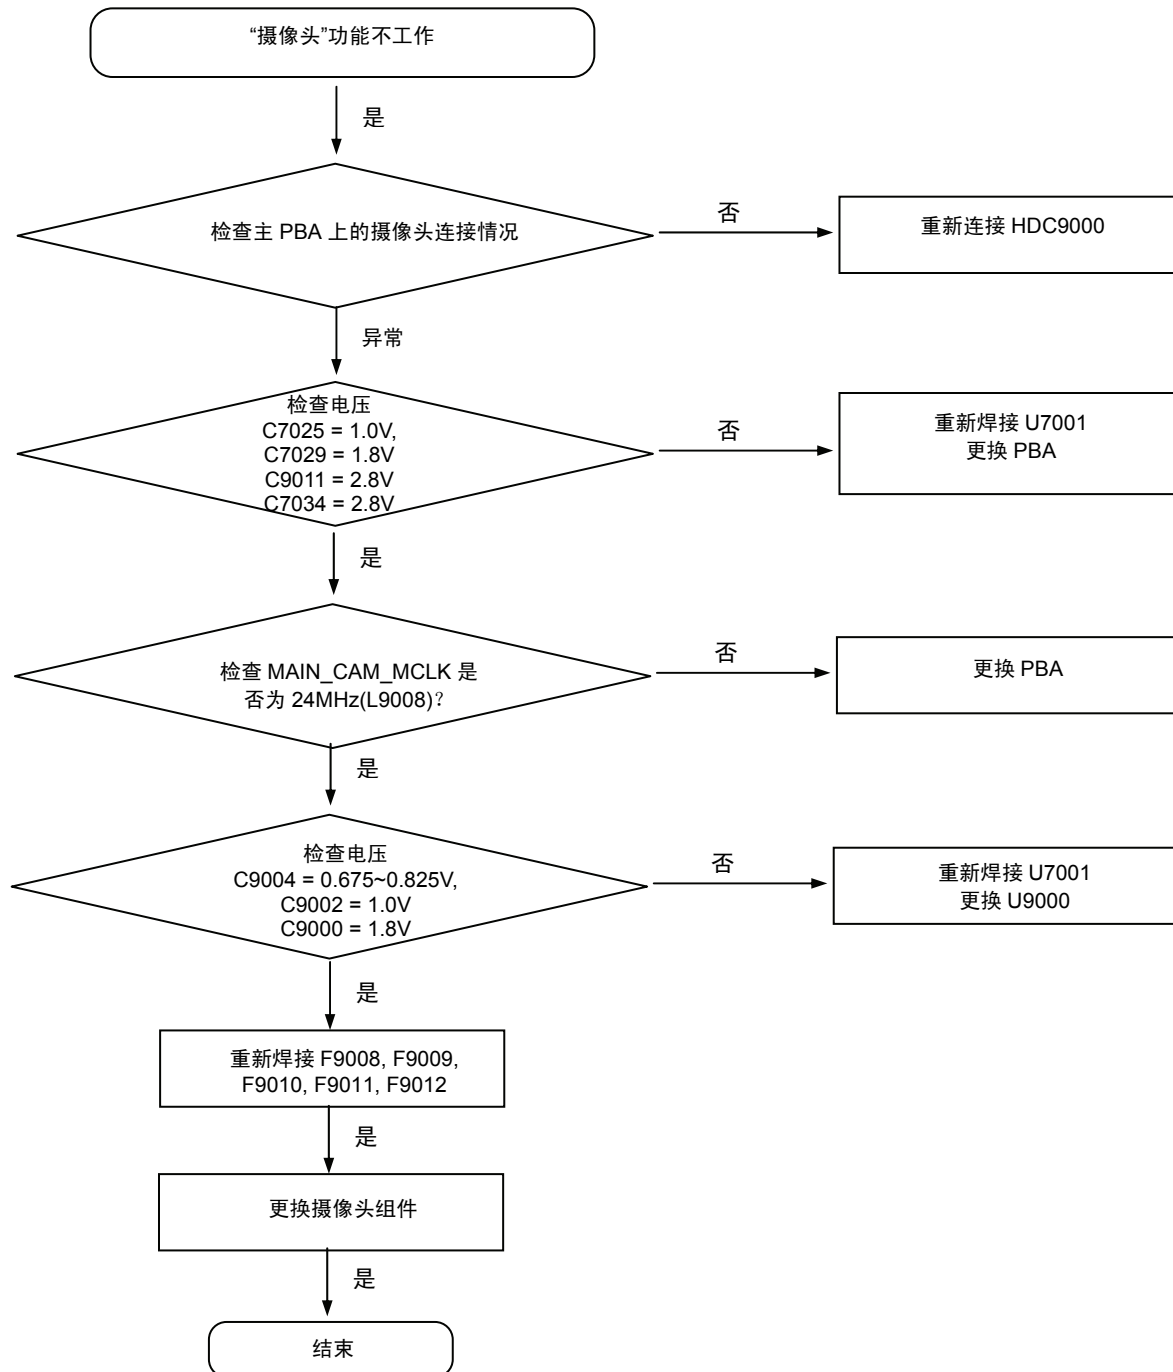


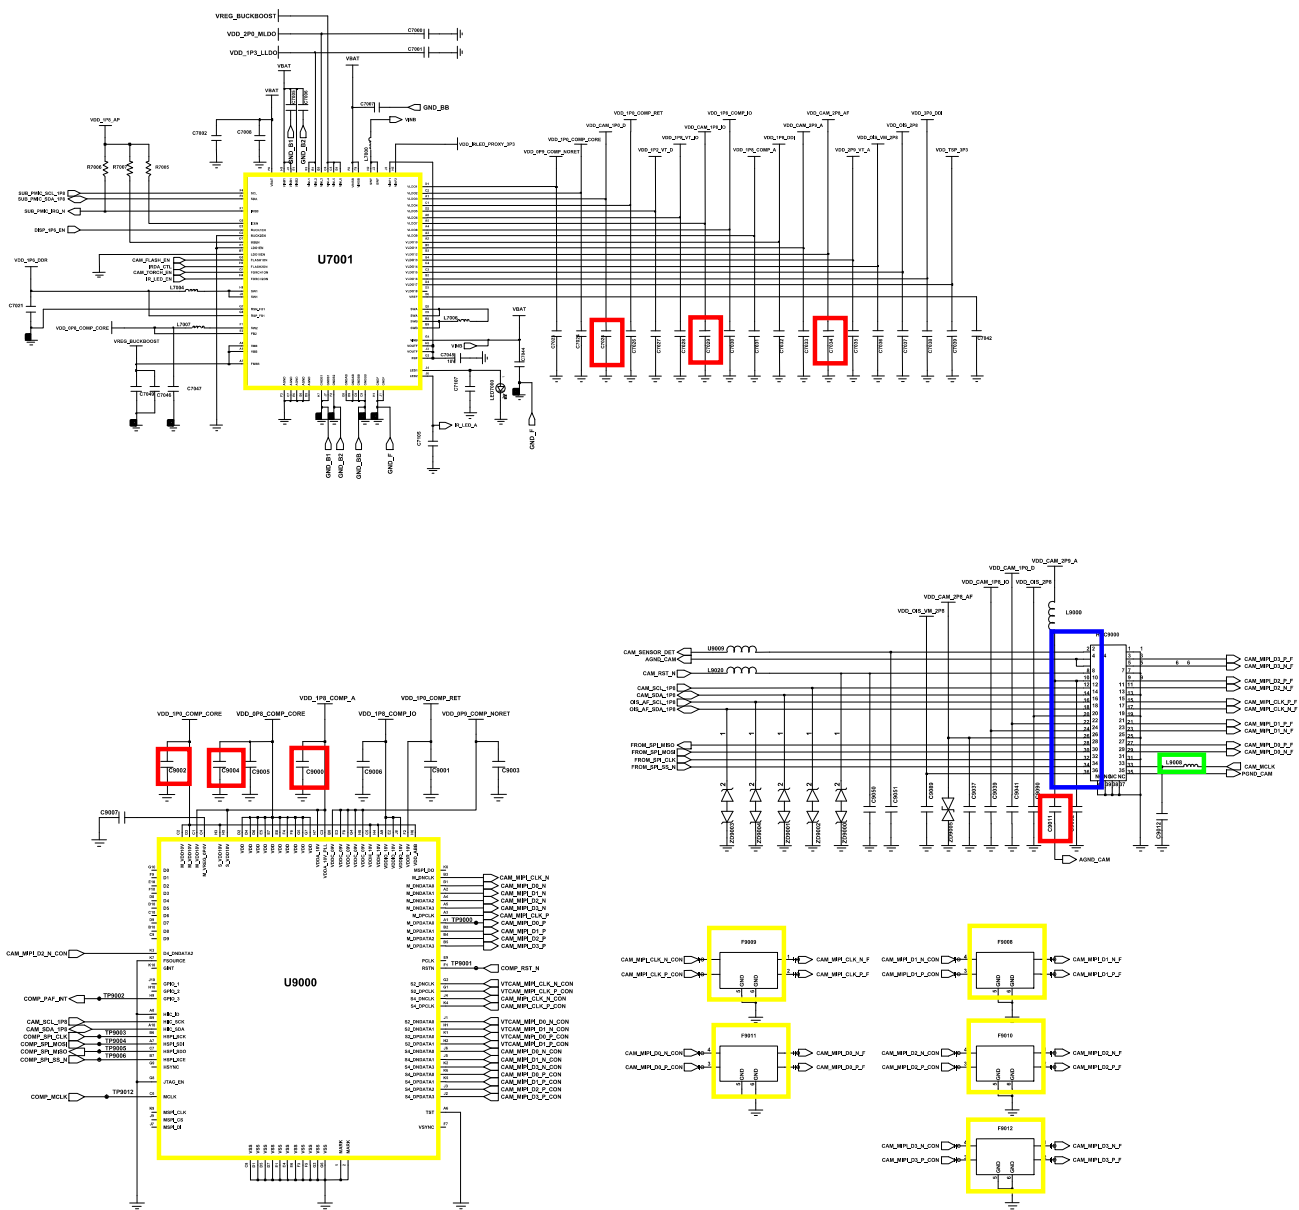

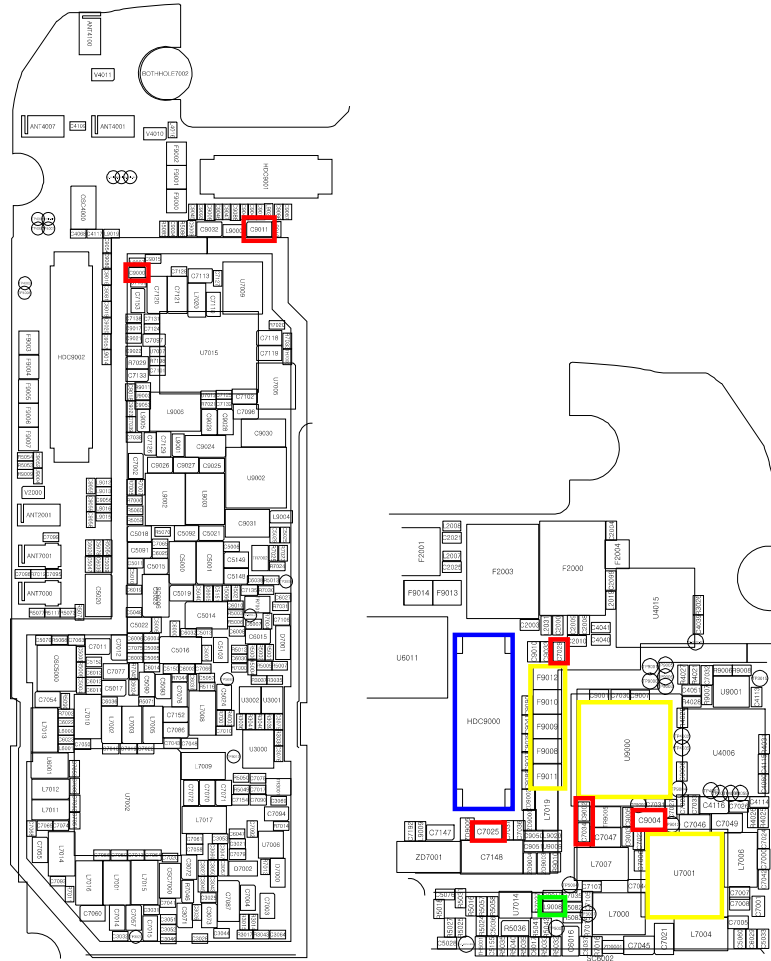


8-3-17. 5M 摄像头

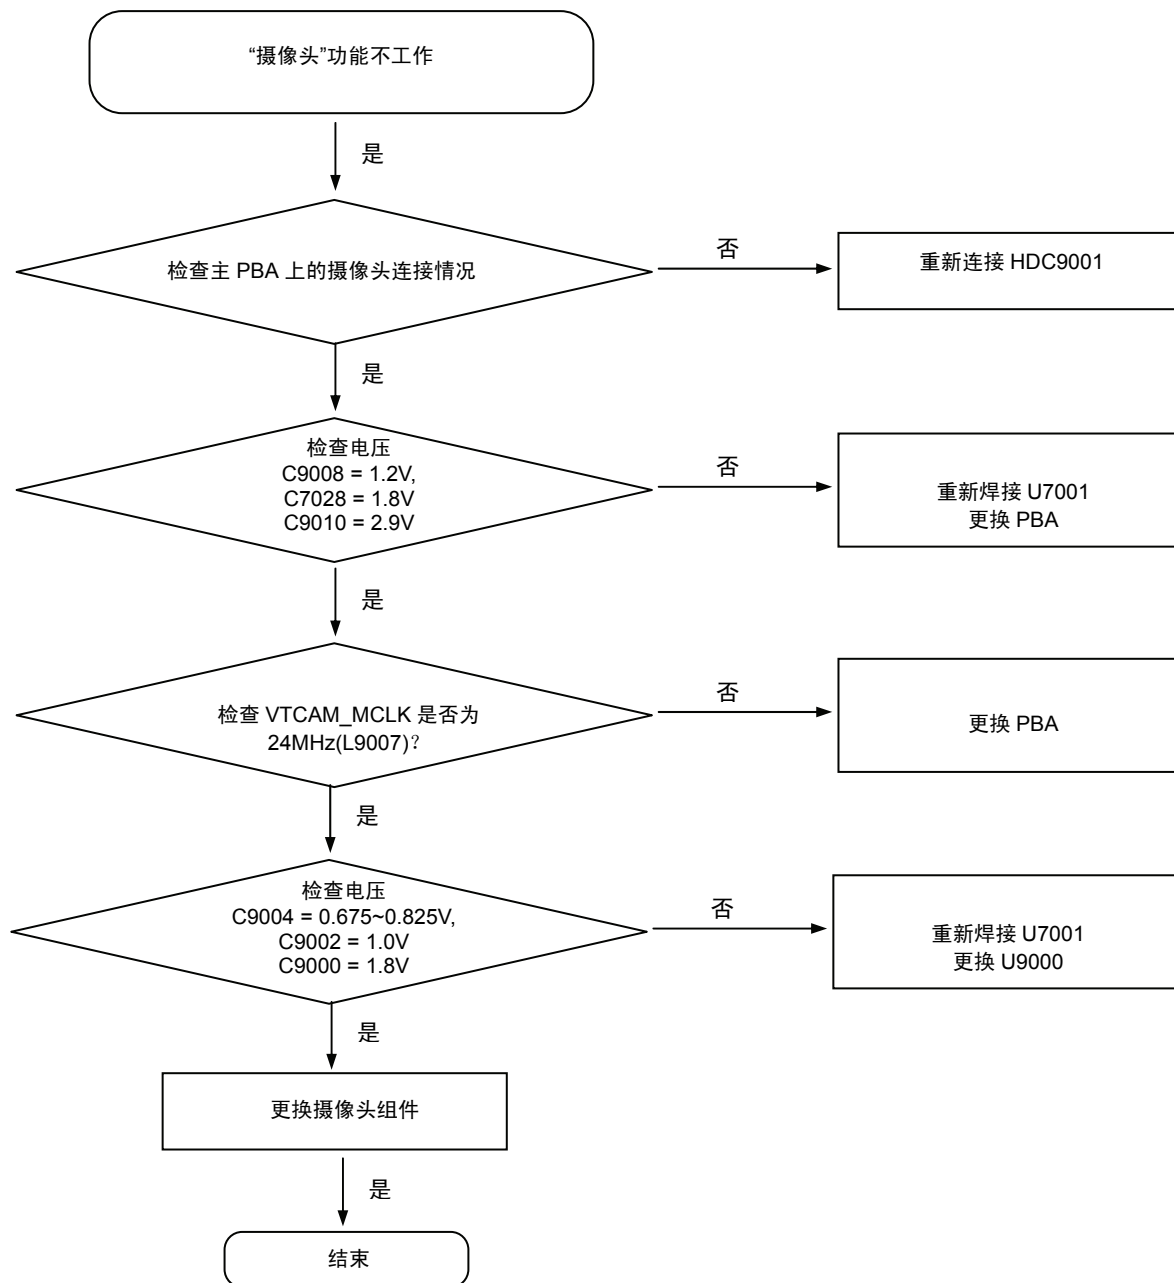


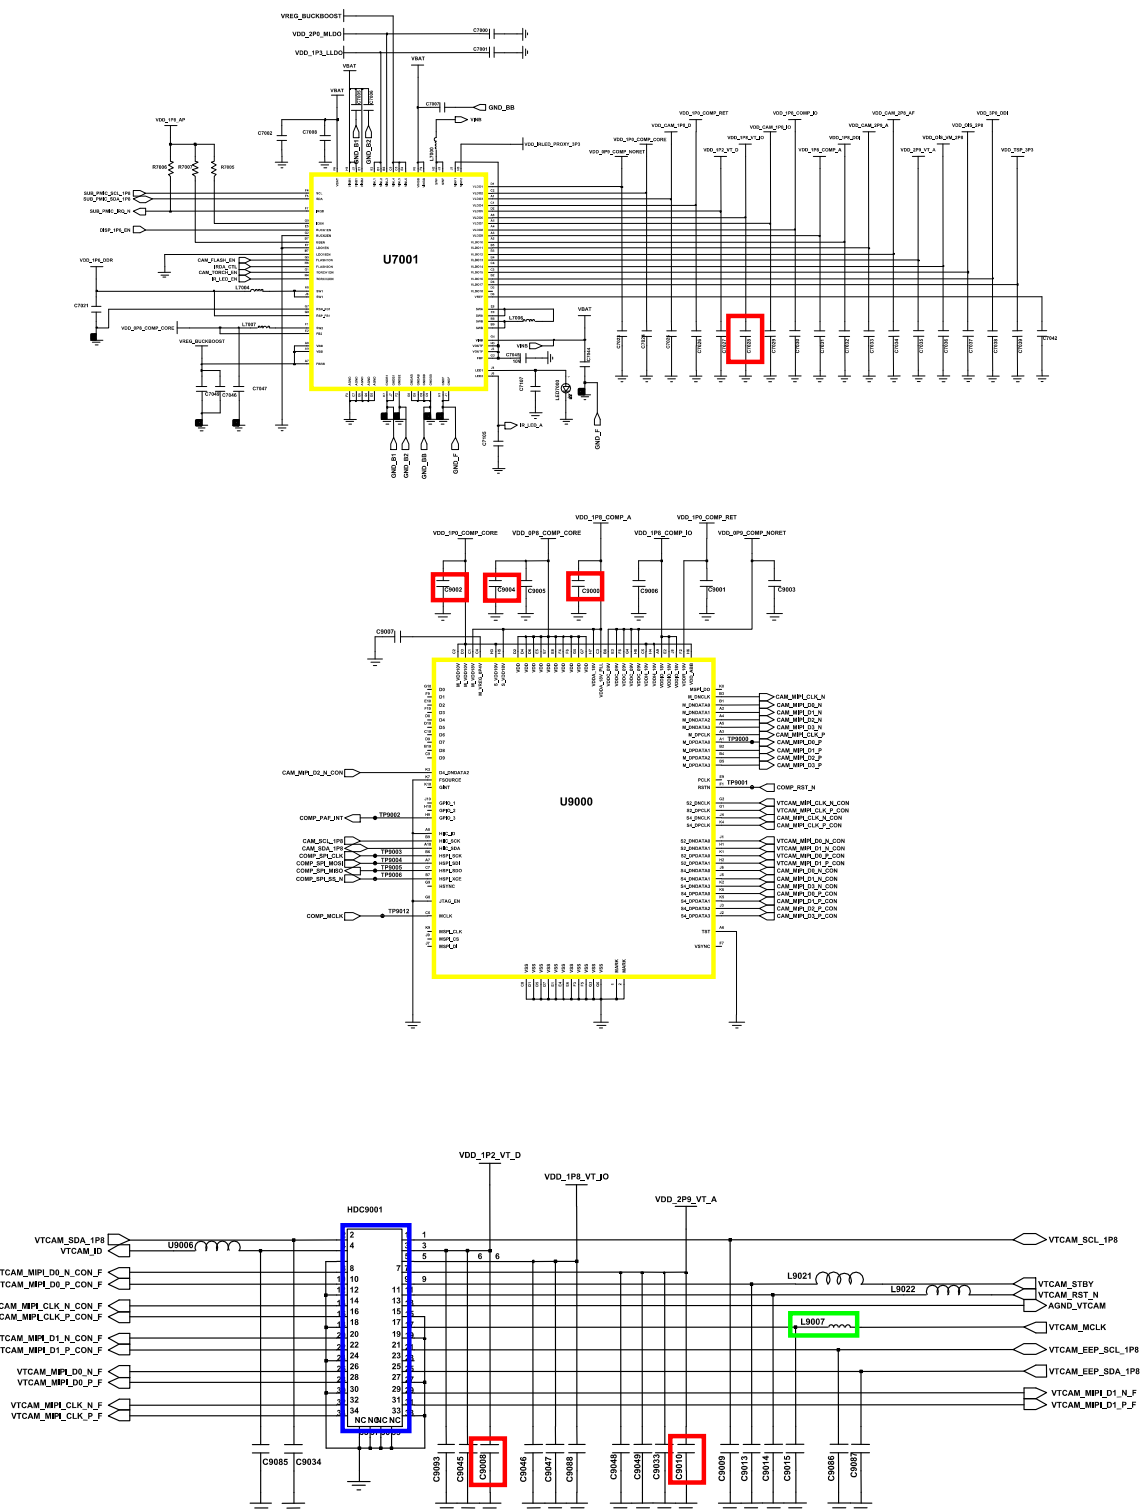

8-3-18. TSP

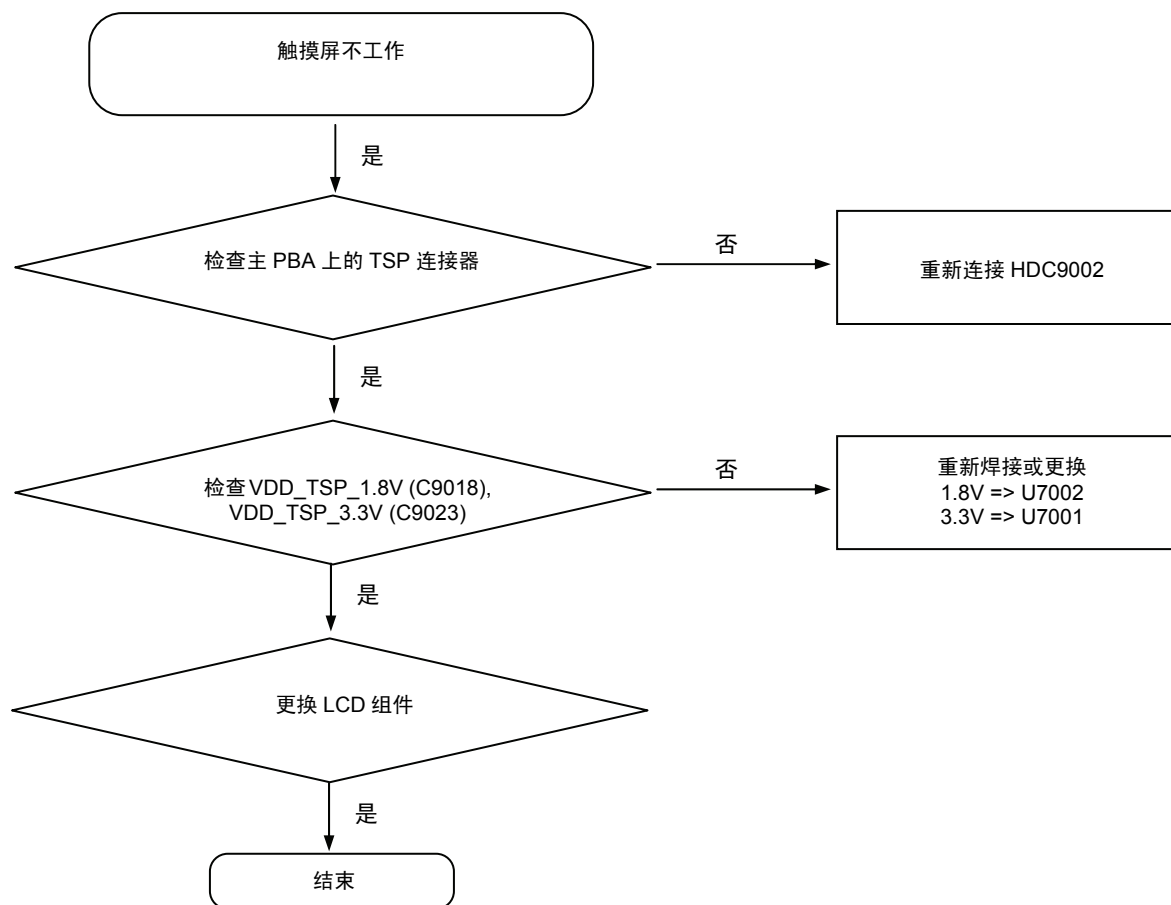





8-3-19. 马达

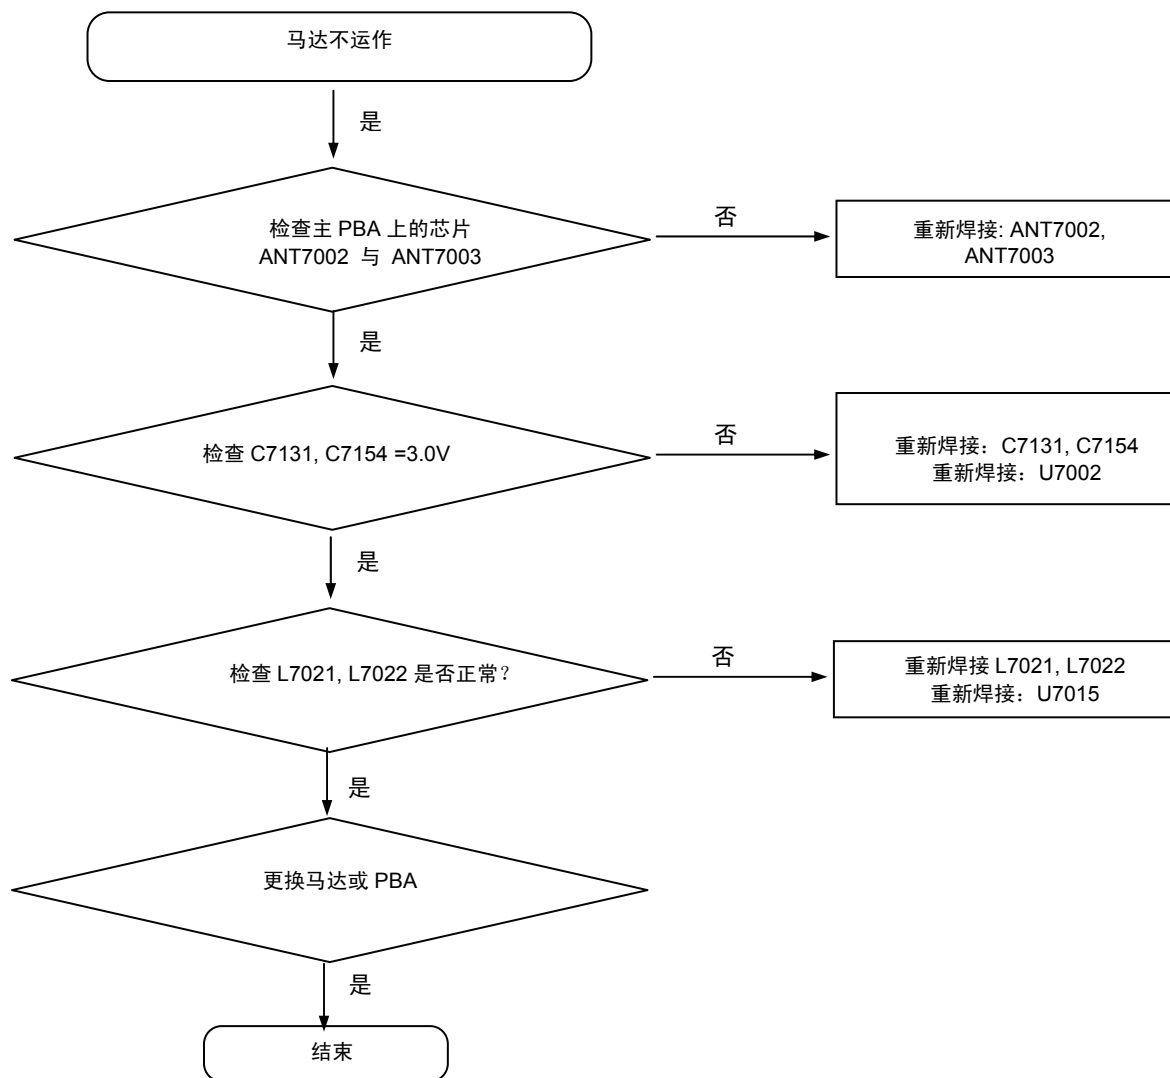




8-3-20. WCDMA 1 / LTE 1 Rx

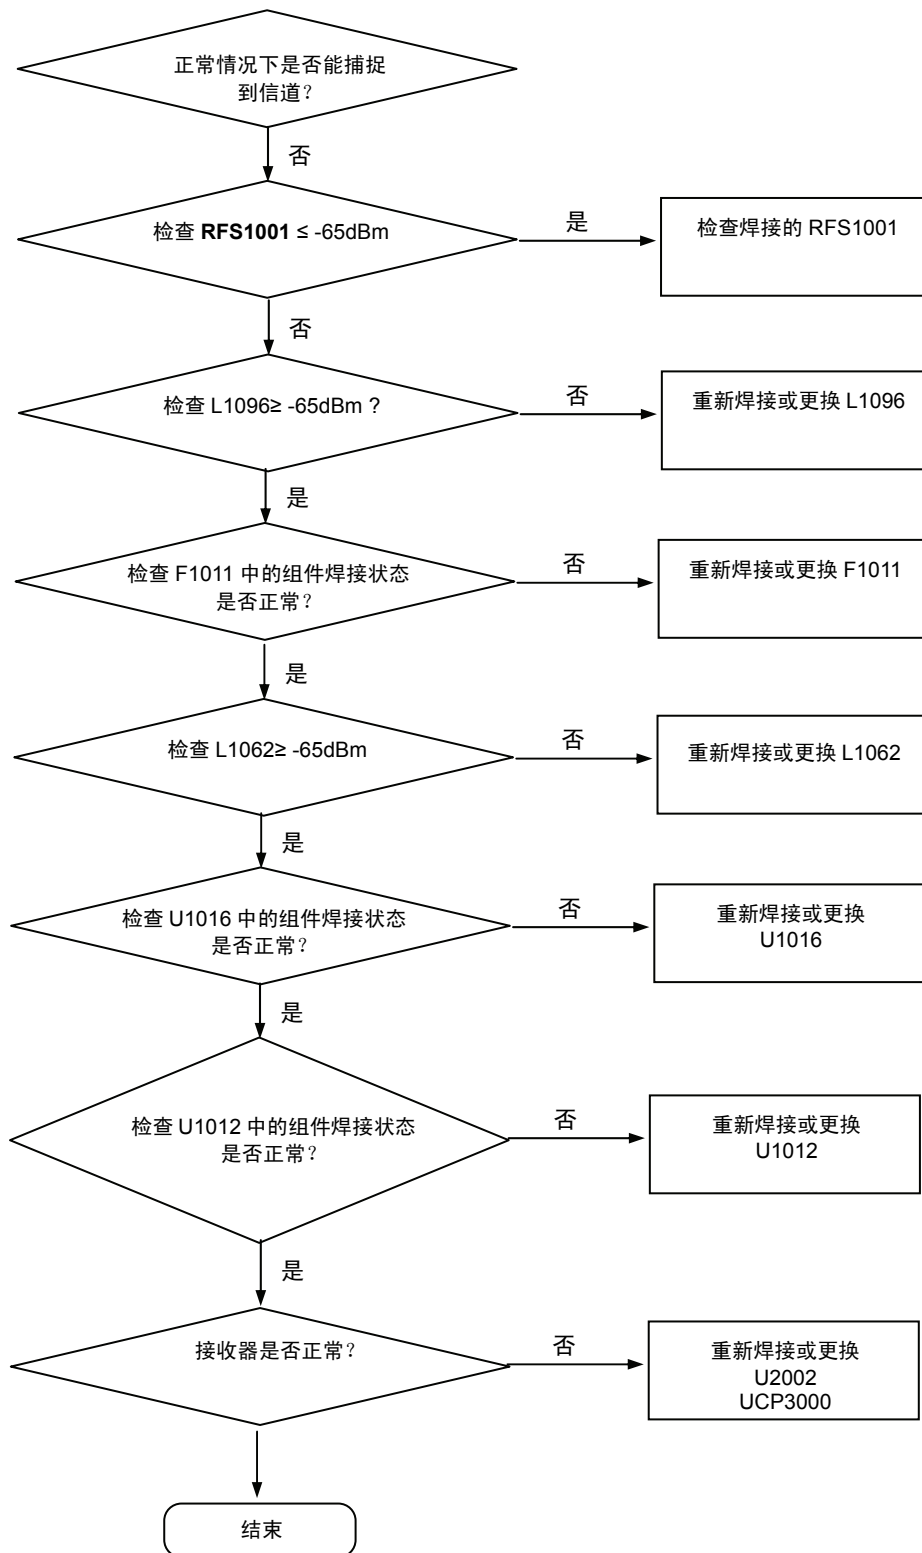


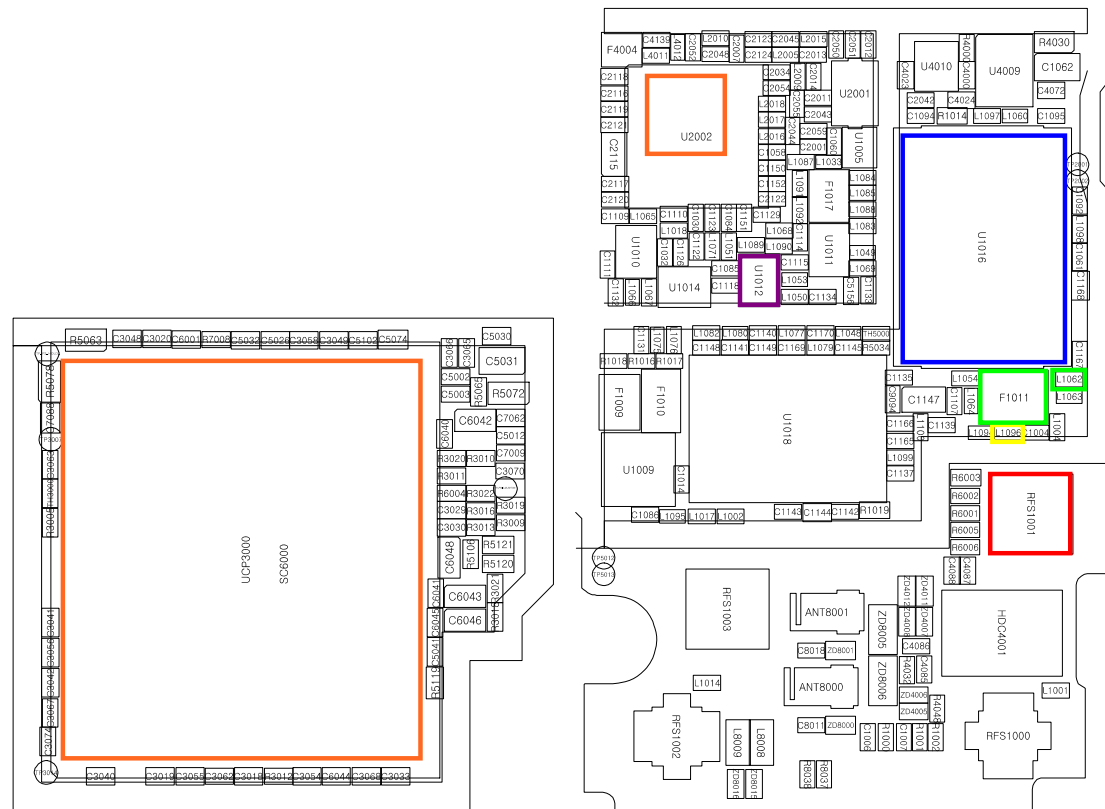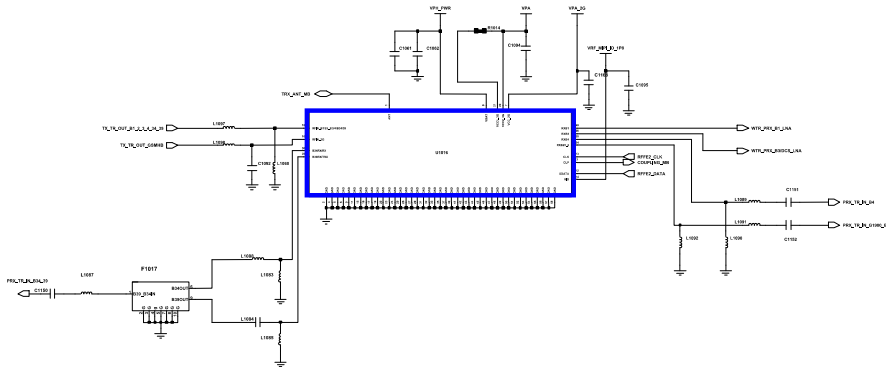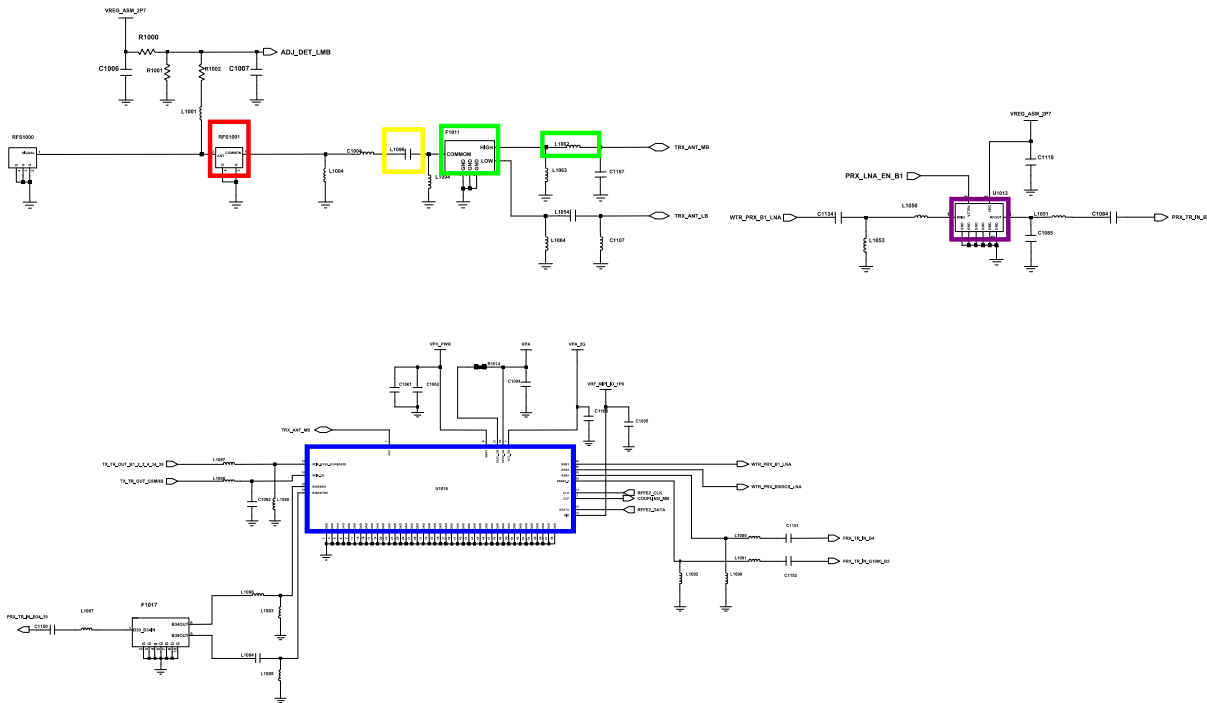


8-3-21. GSM1900 / WCDMA 2 Rx

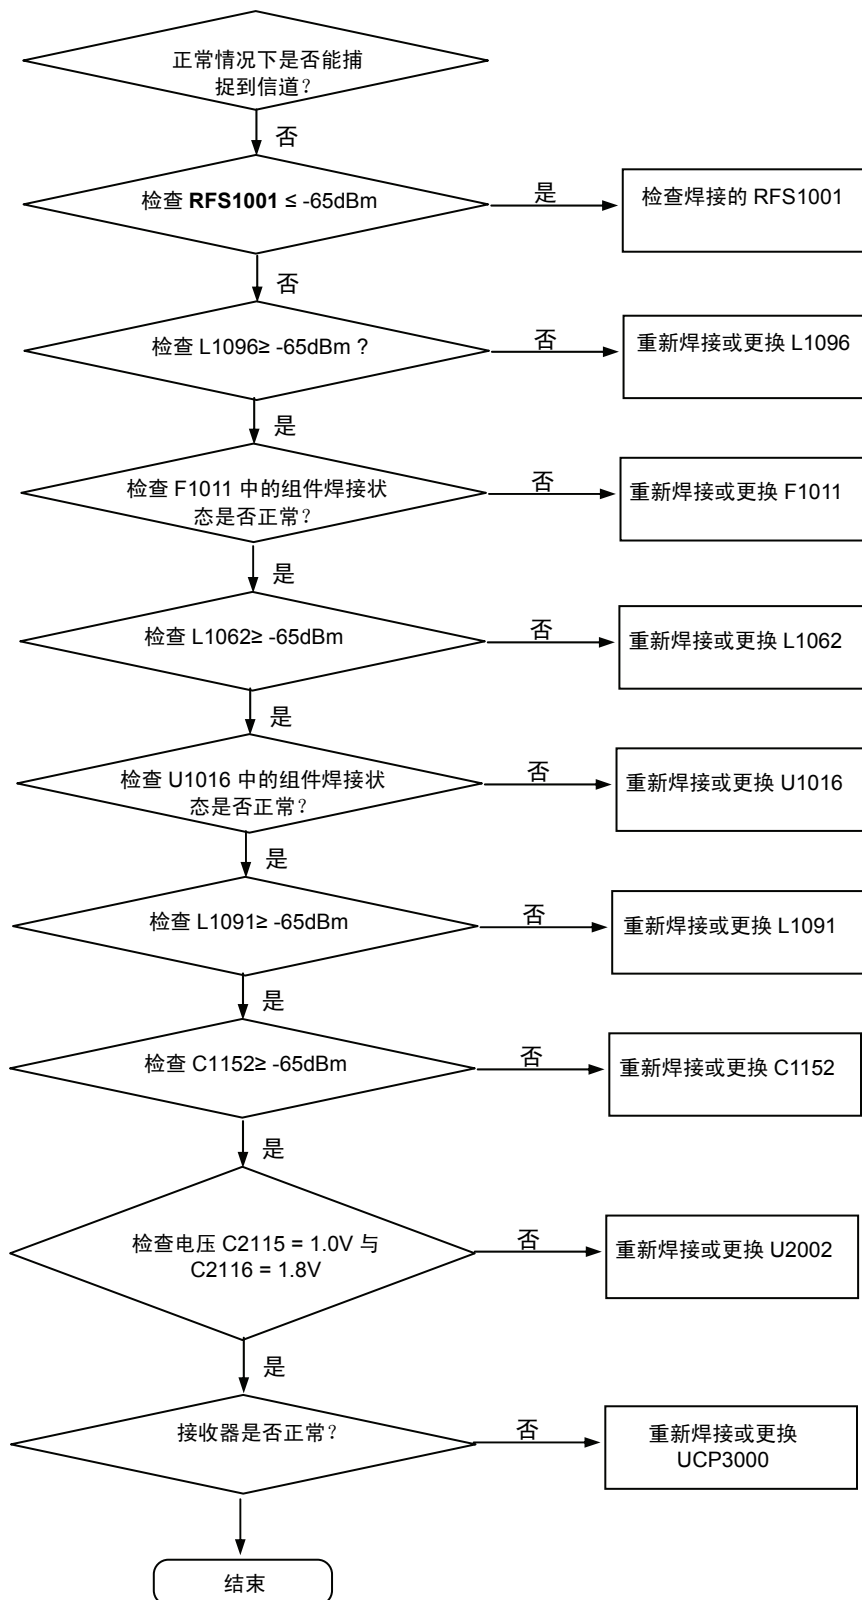



8-3-22. GSM1800 / LTE 3 Rx

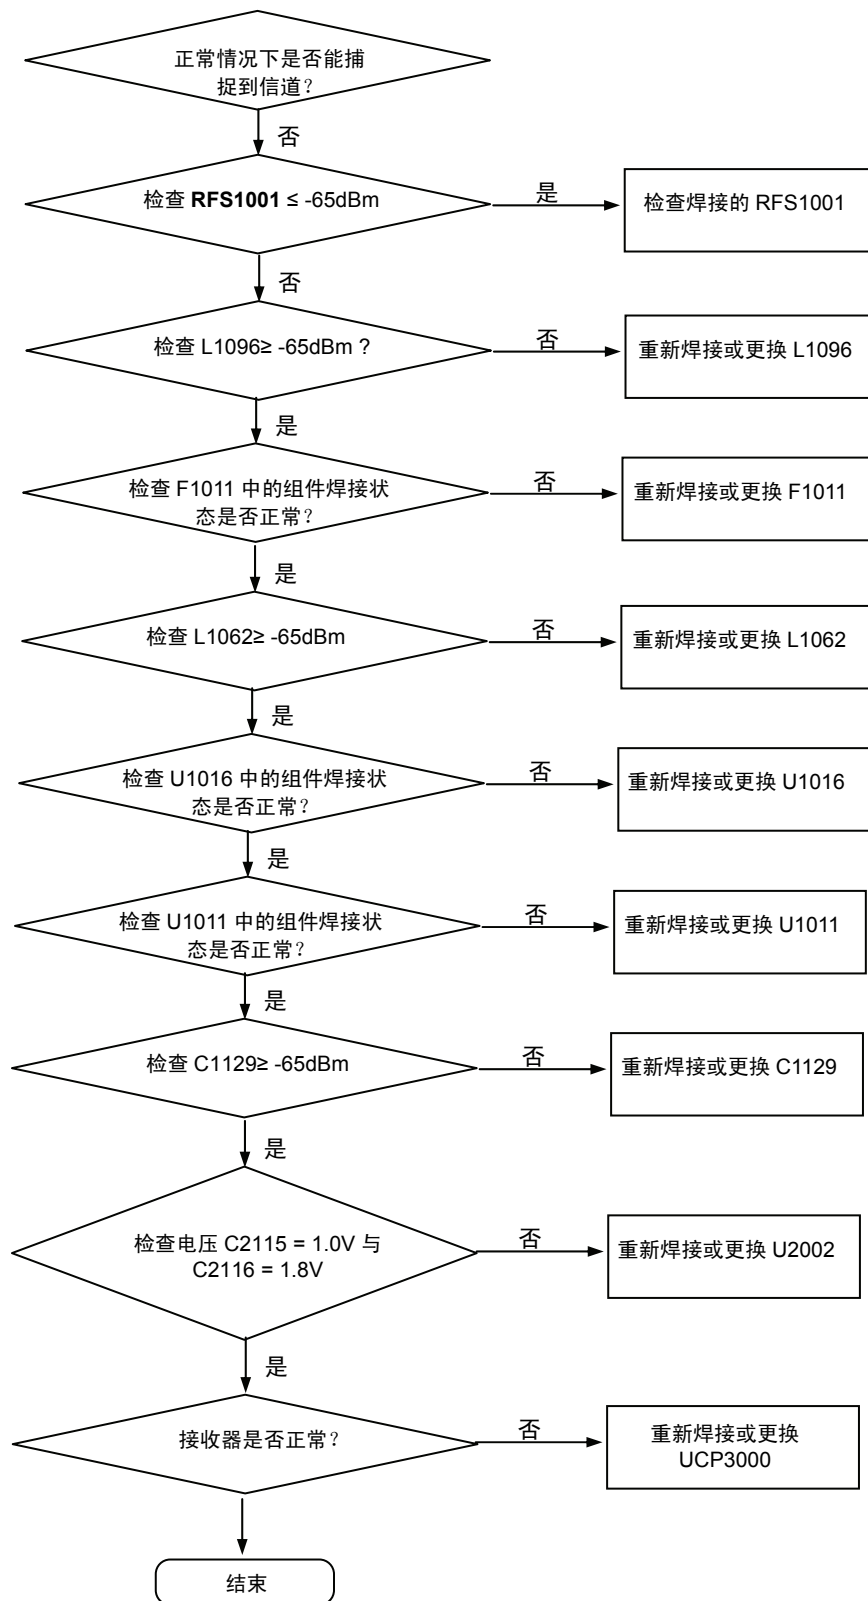

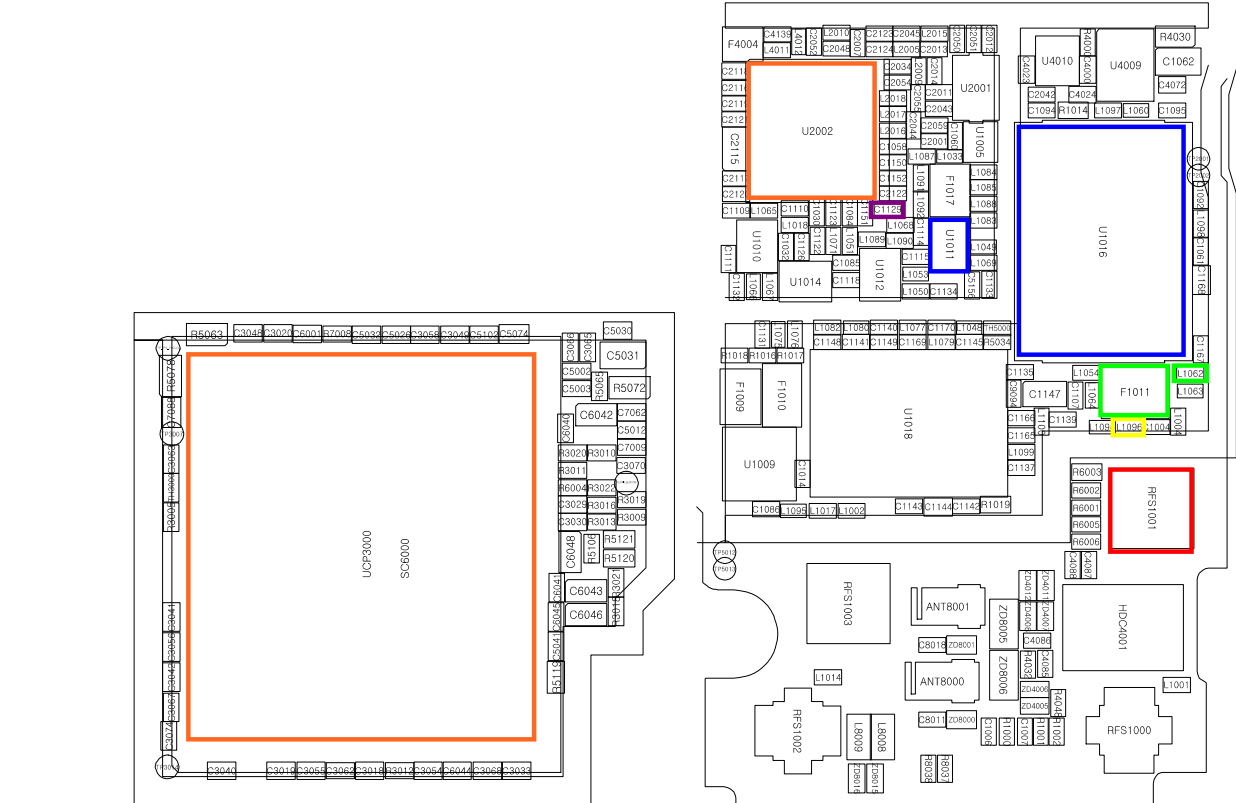



8-3-23. LTE 4 Rx

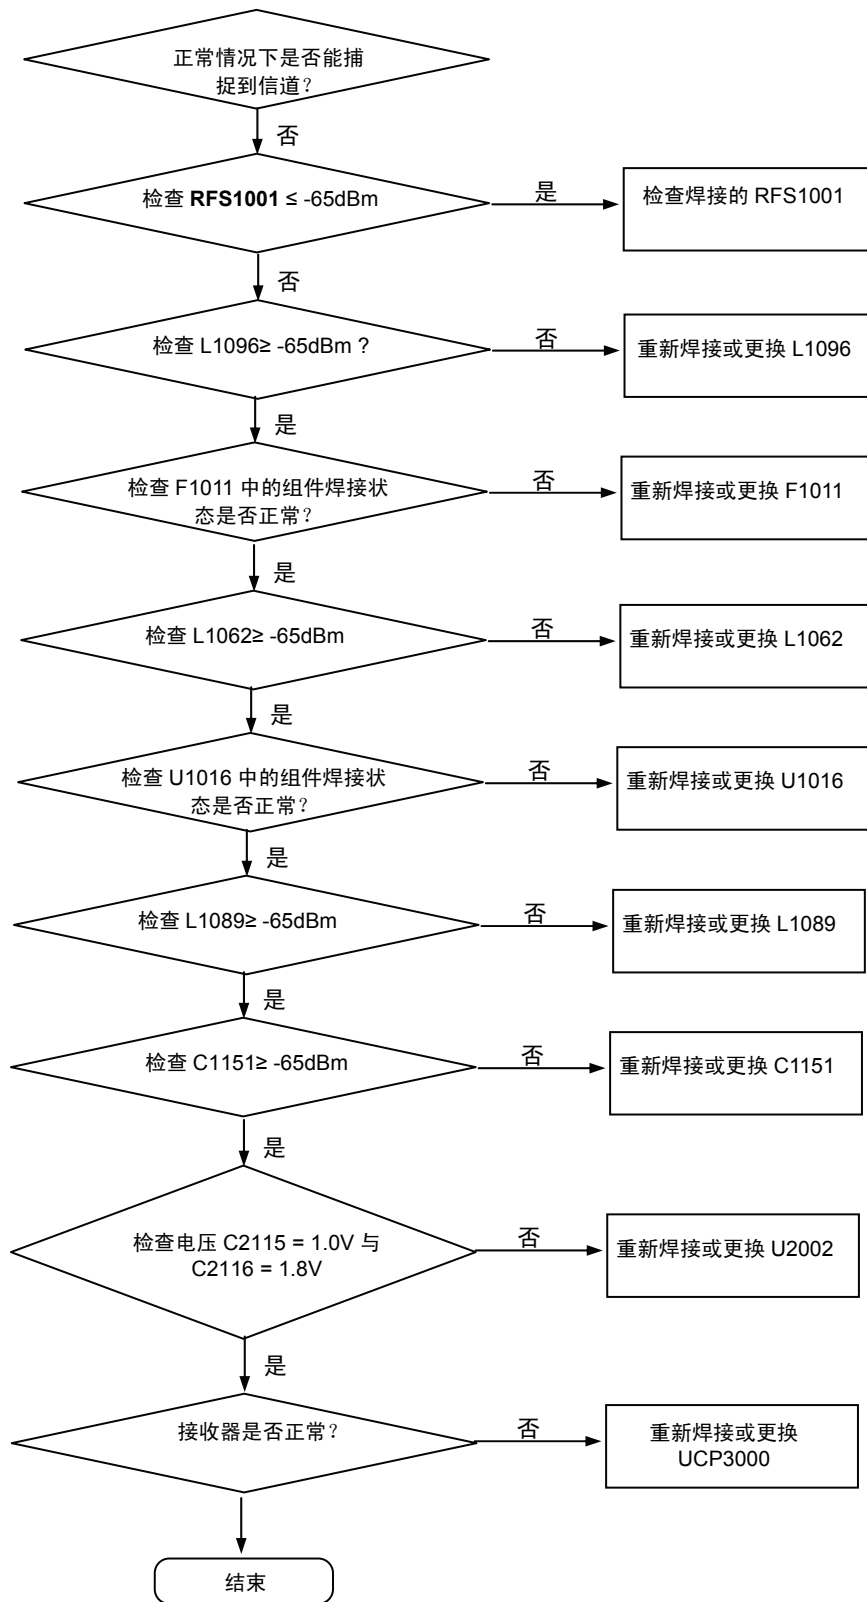

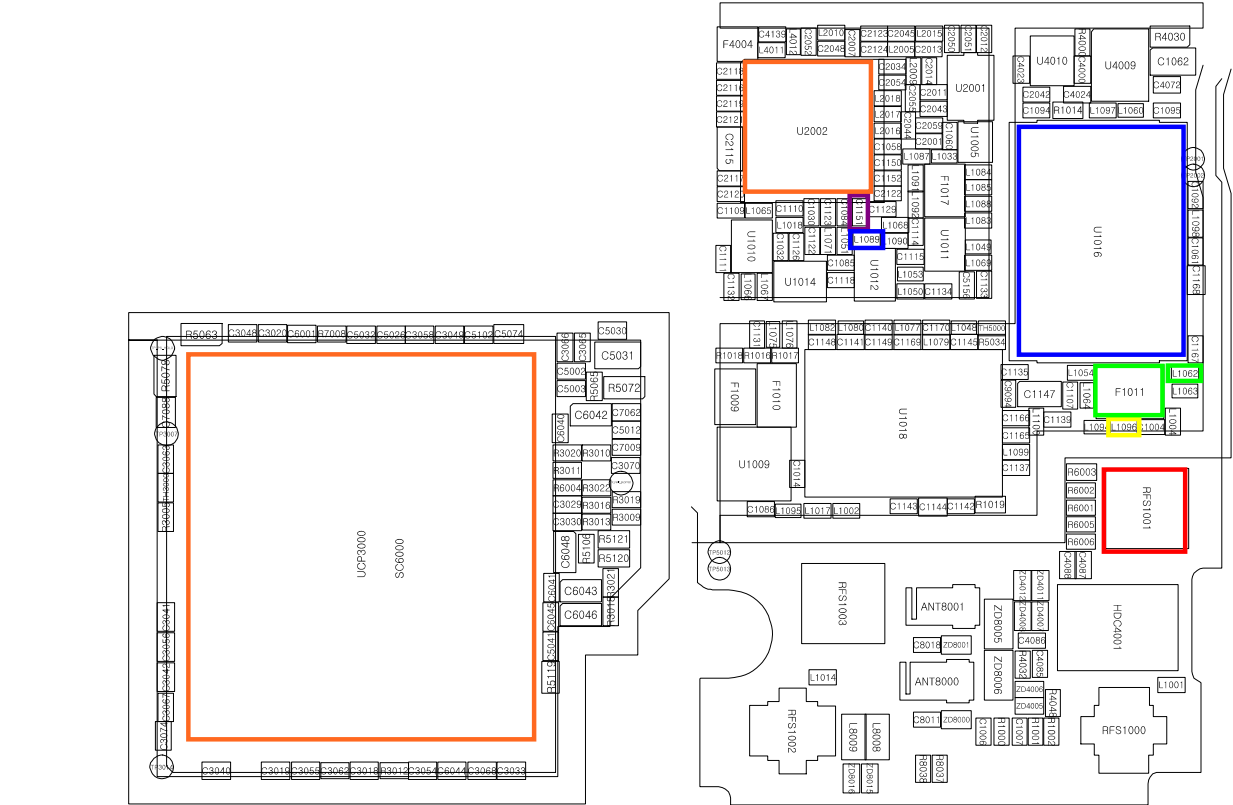



8-3-24. GSM850 / WCDMA 5 / CDMA BC0 Rx

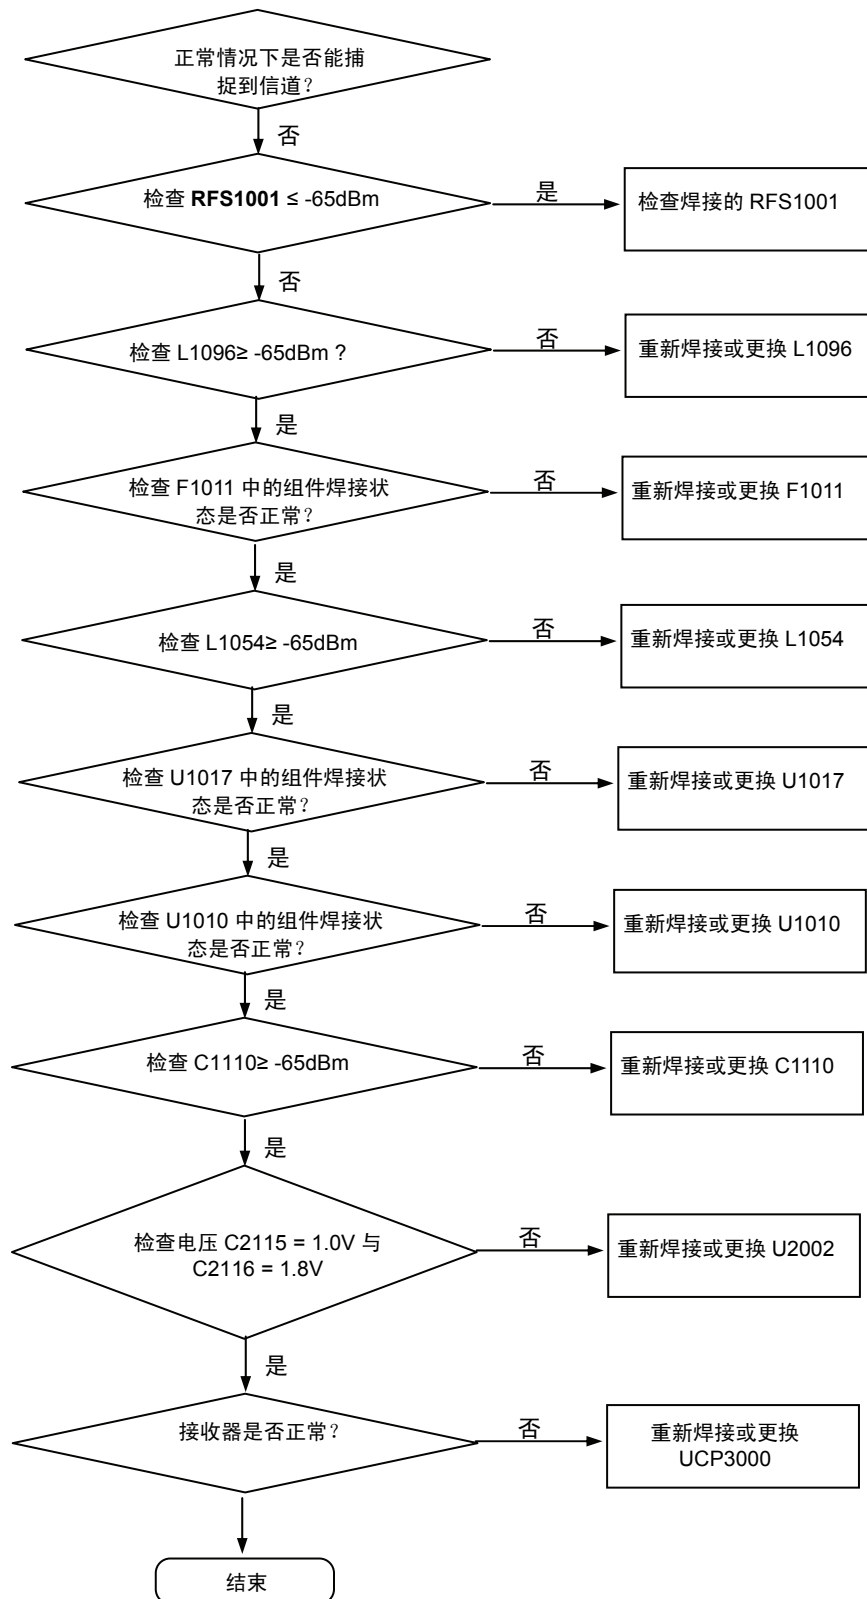





8-3-25. GSM900 / WCDMA 8 / LTE 8 Rx

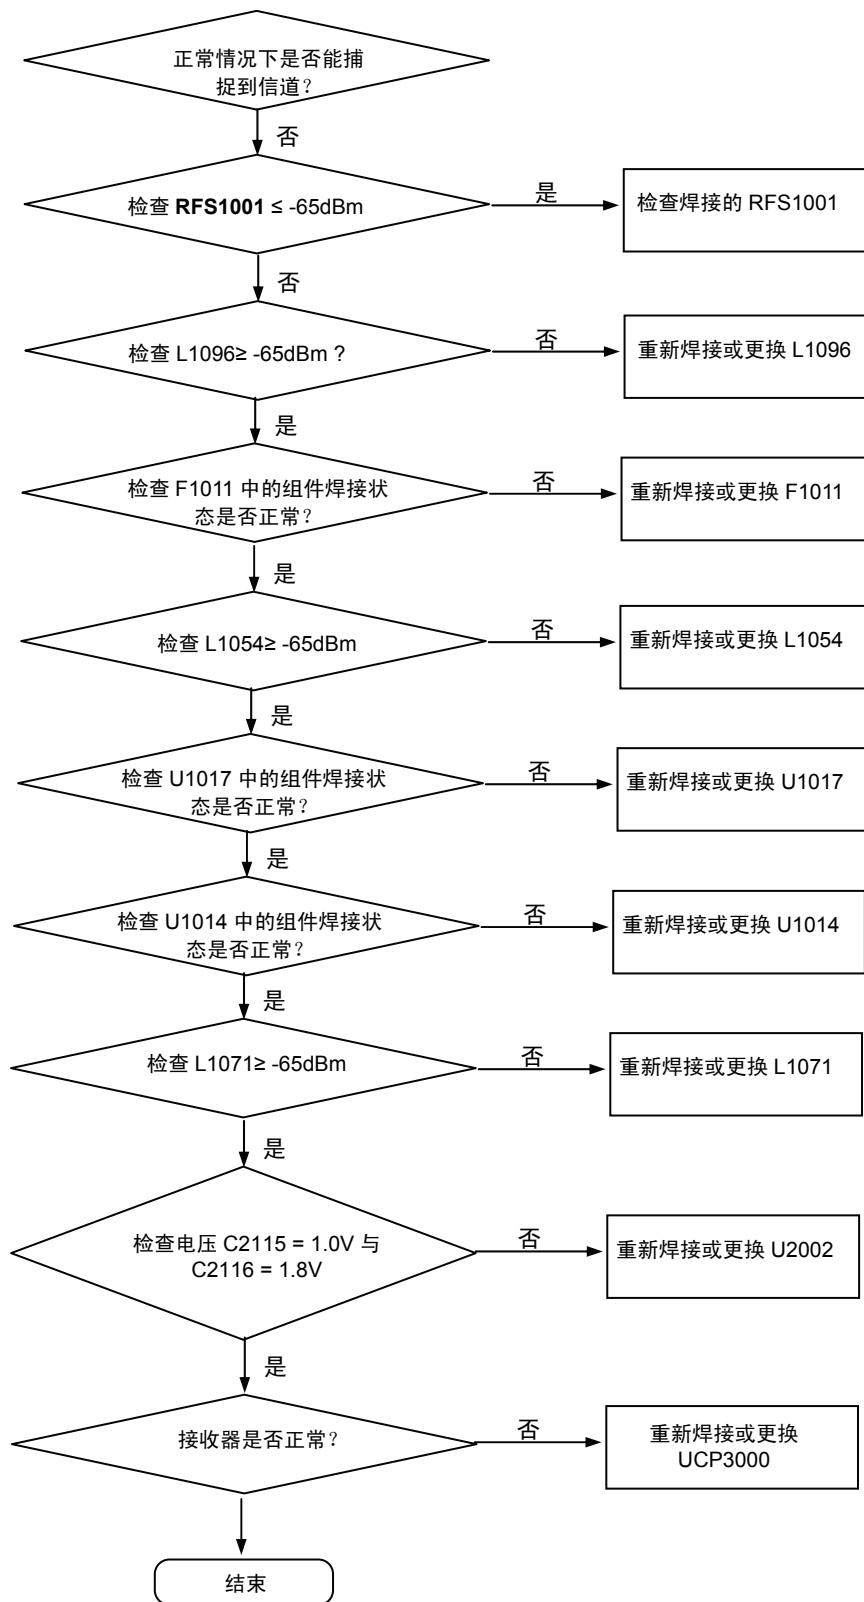

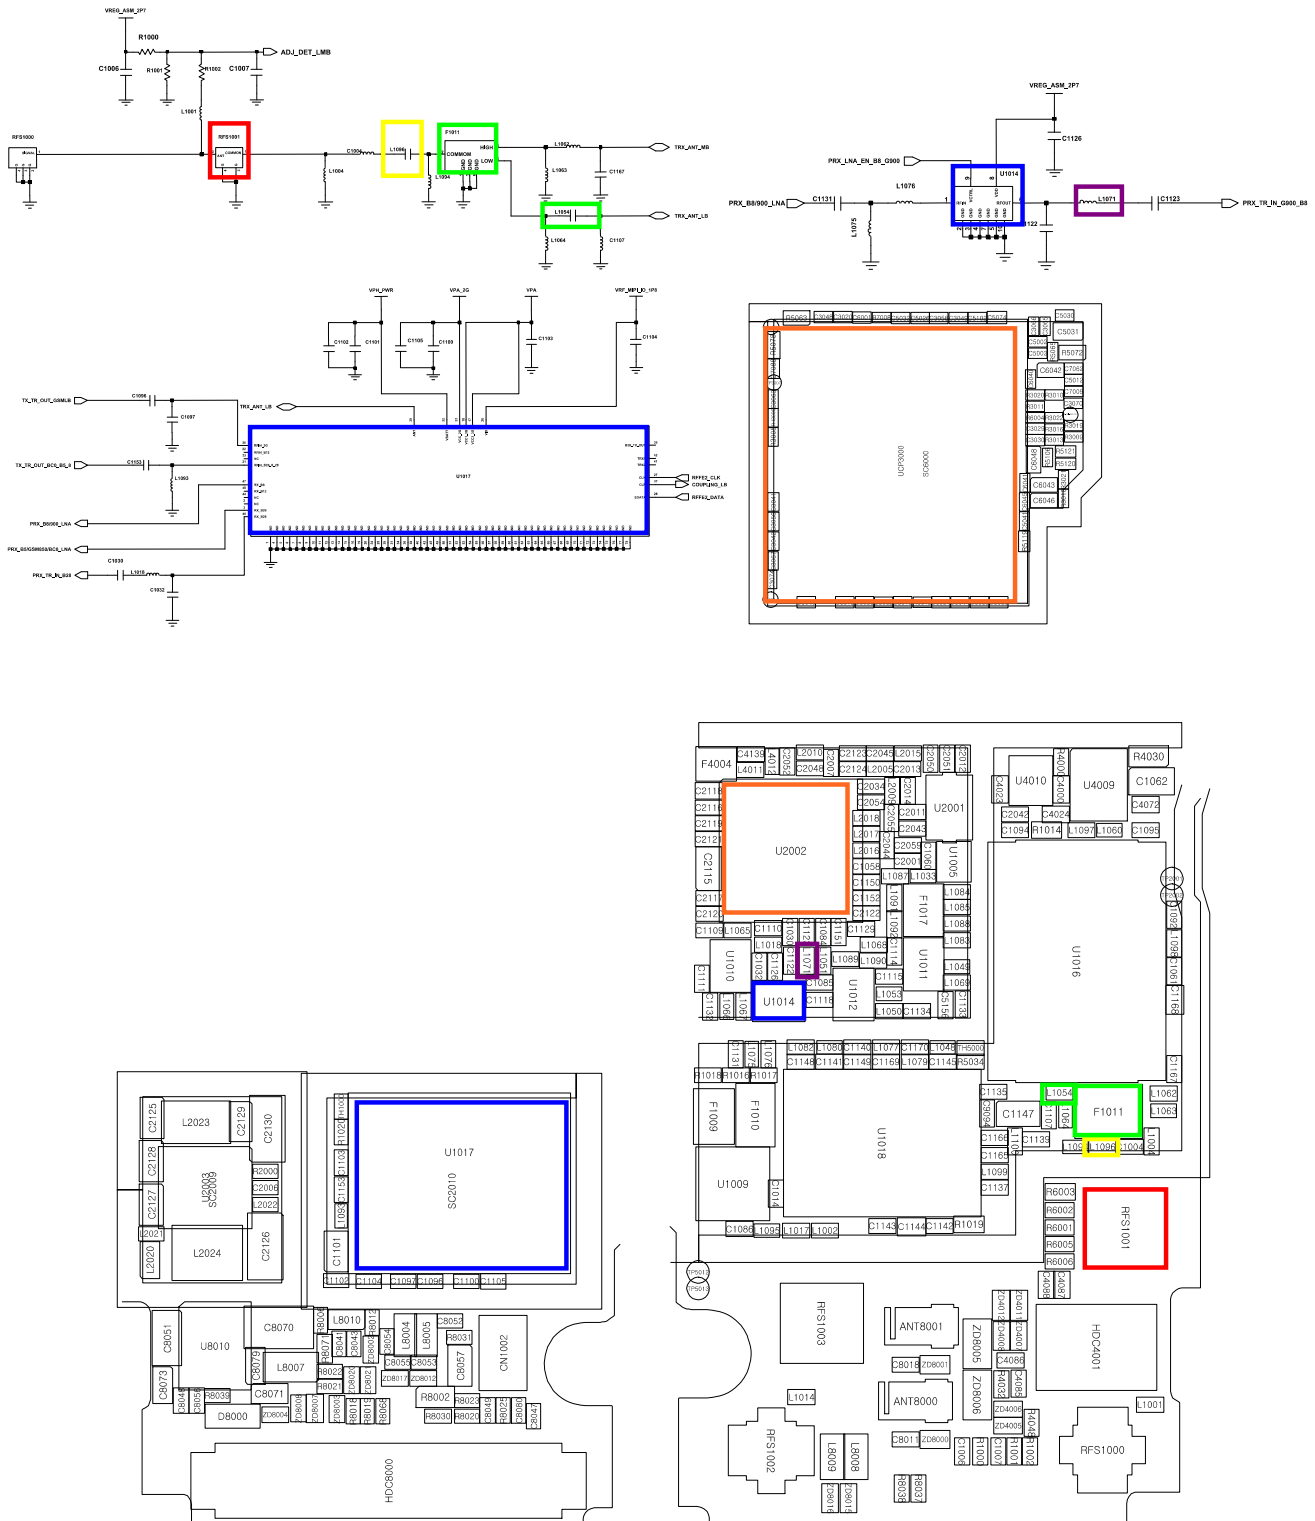






8-3-26. TD-SCMDA 34,39 / LTE 39 Rx

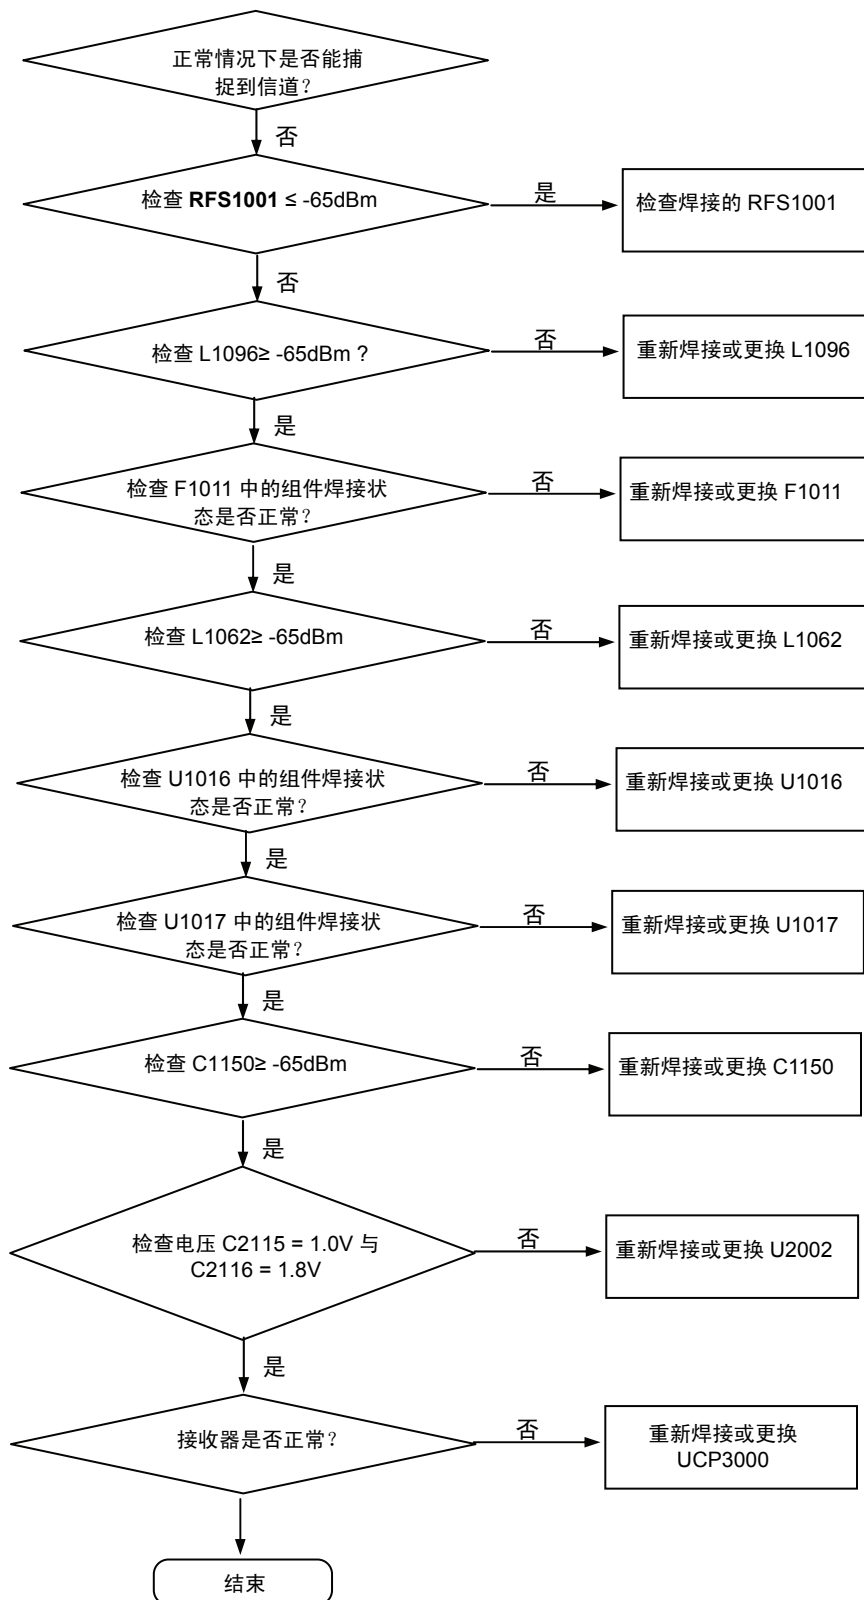

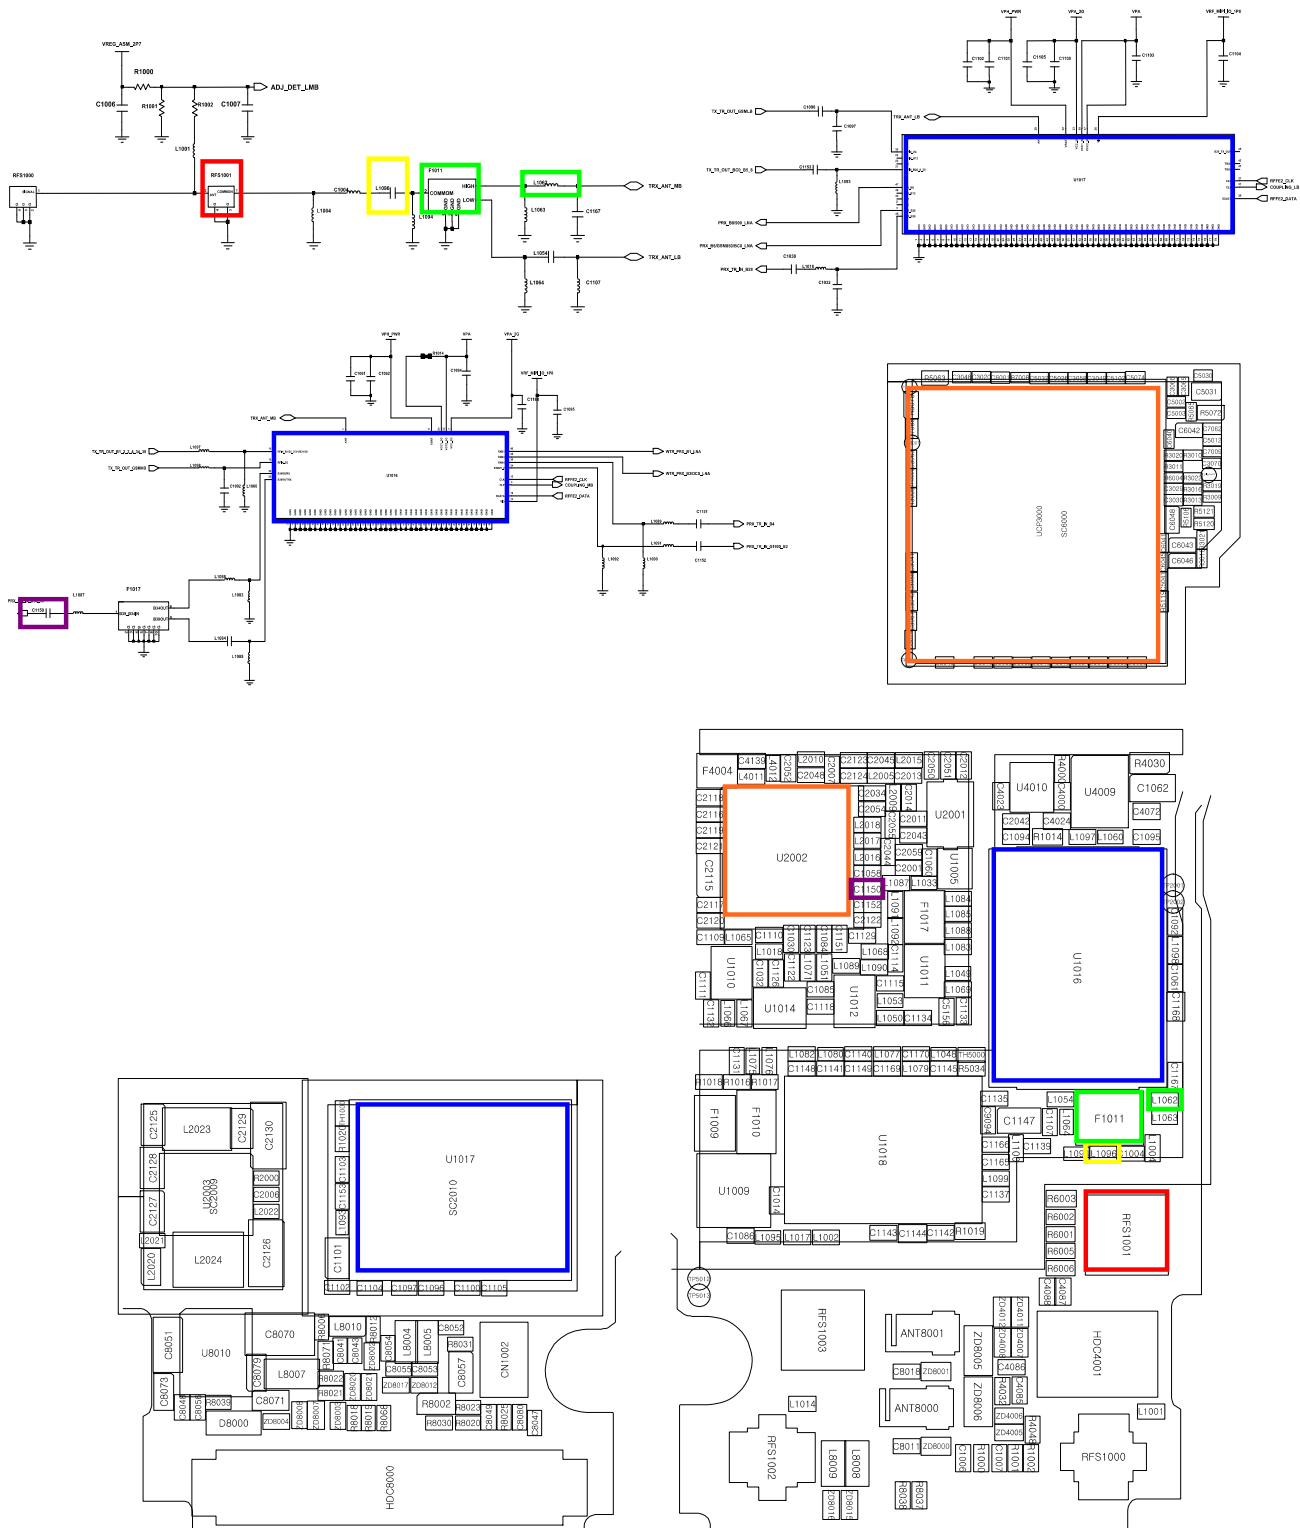


8-3-27. LTE 28 Rx

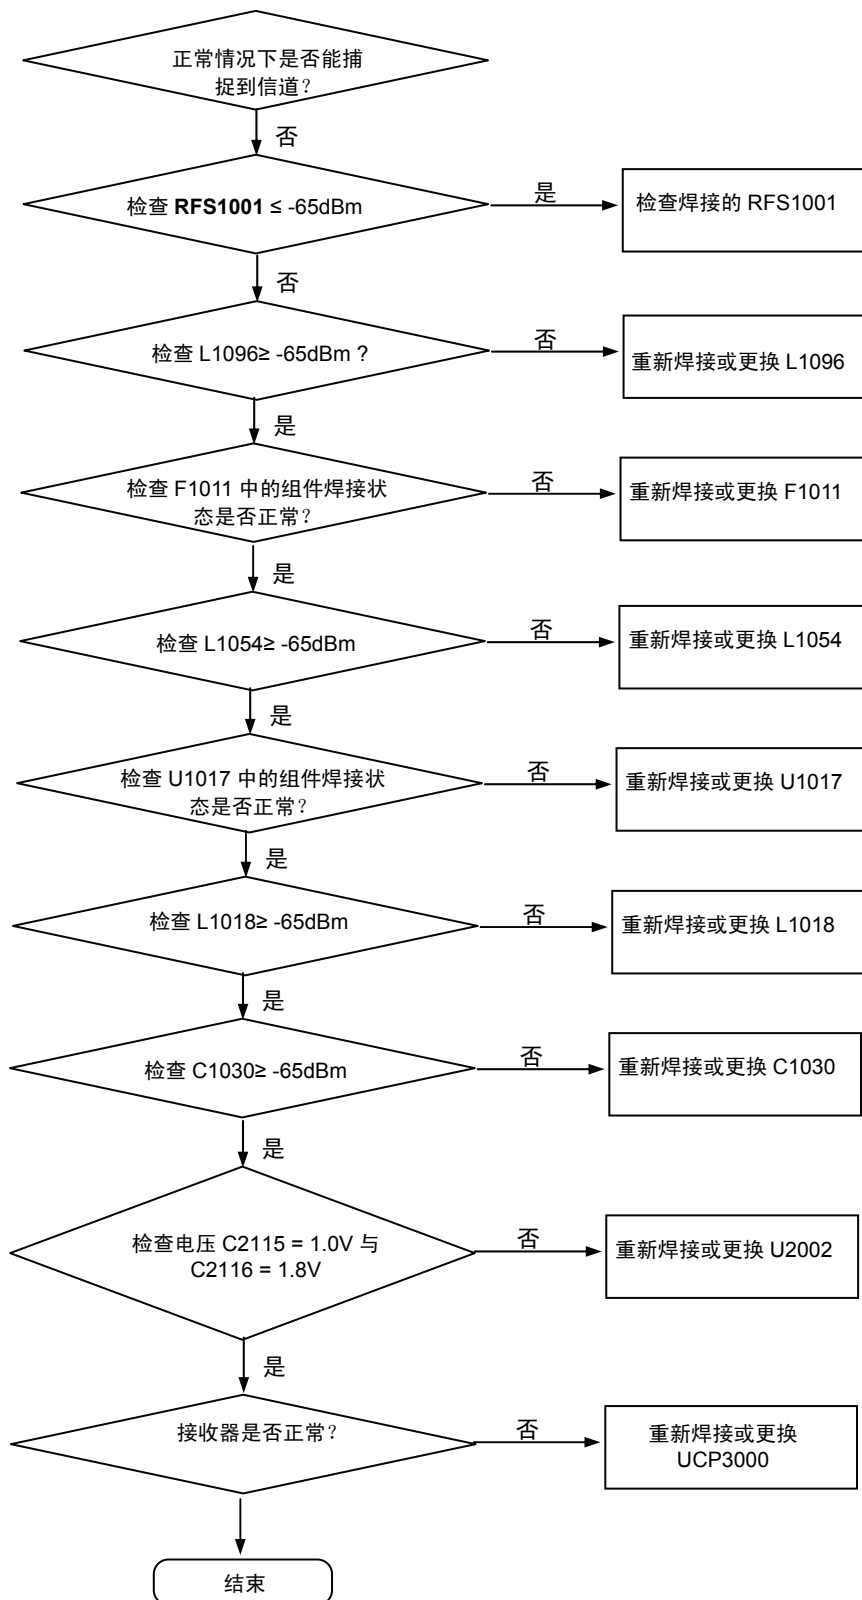


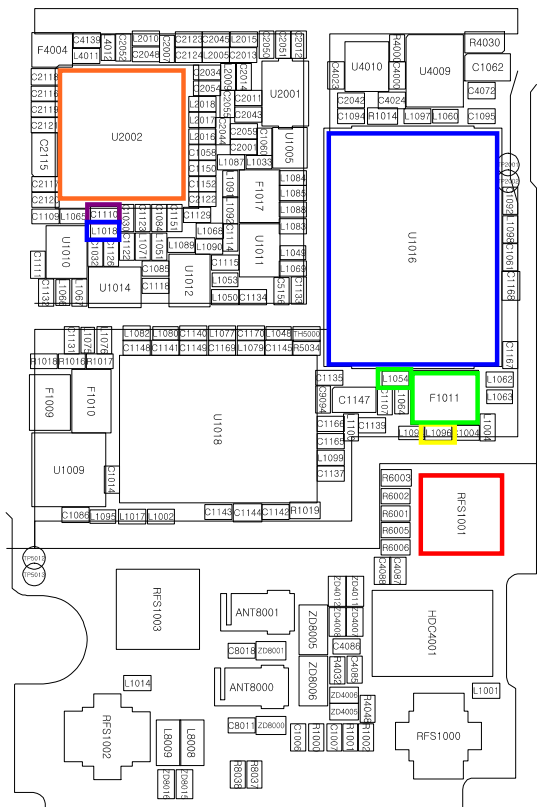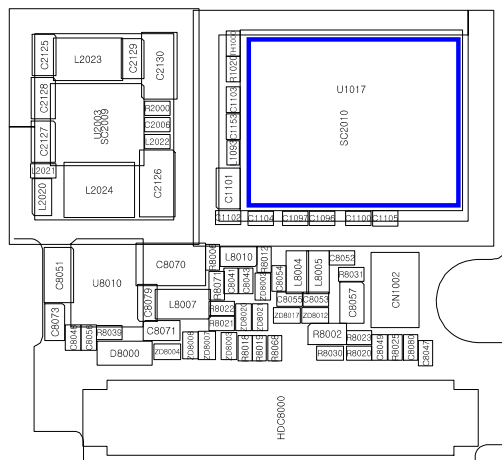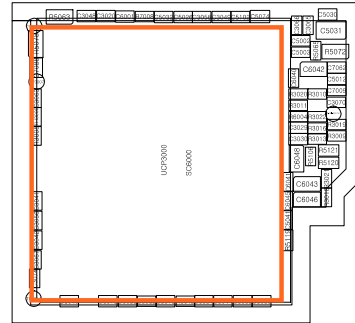
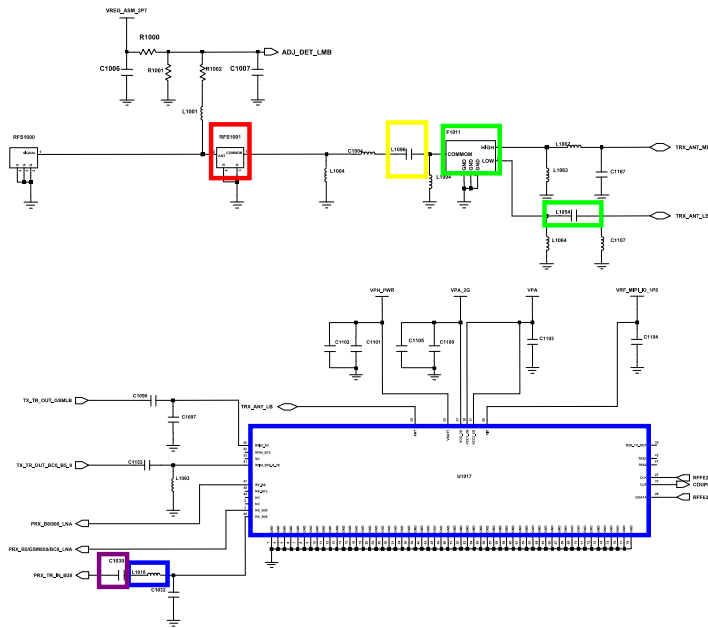


8-3-28. LTE 7 Rx

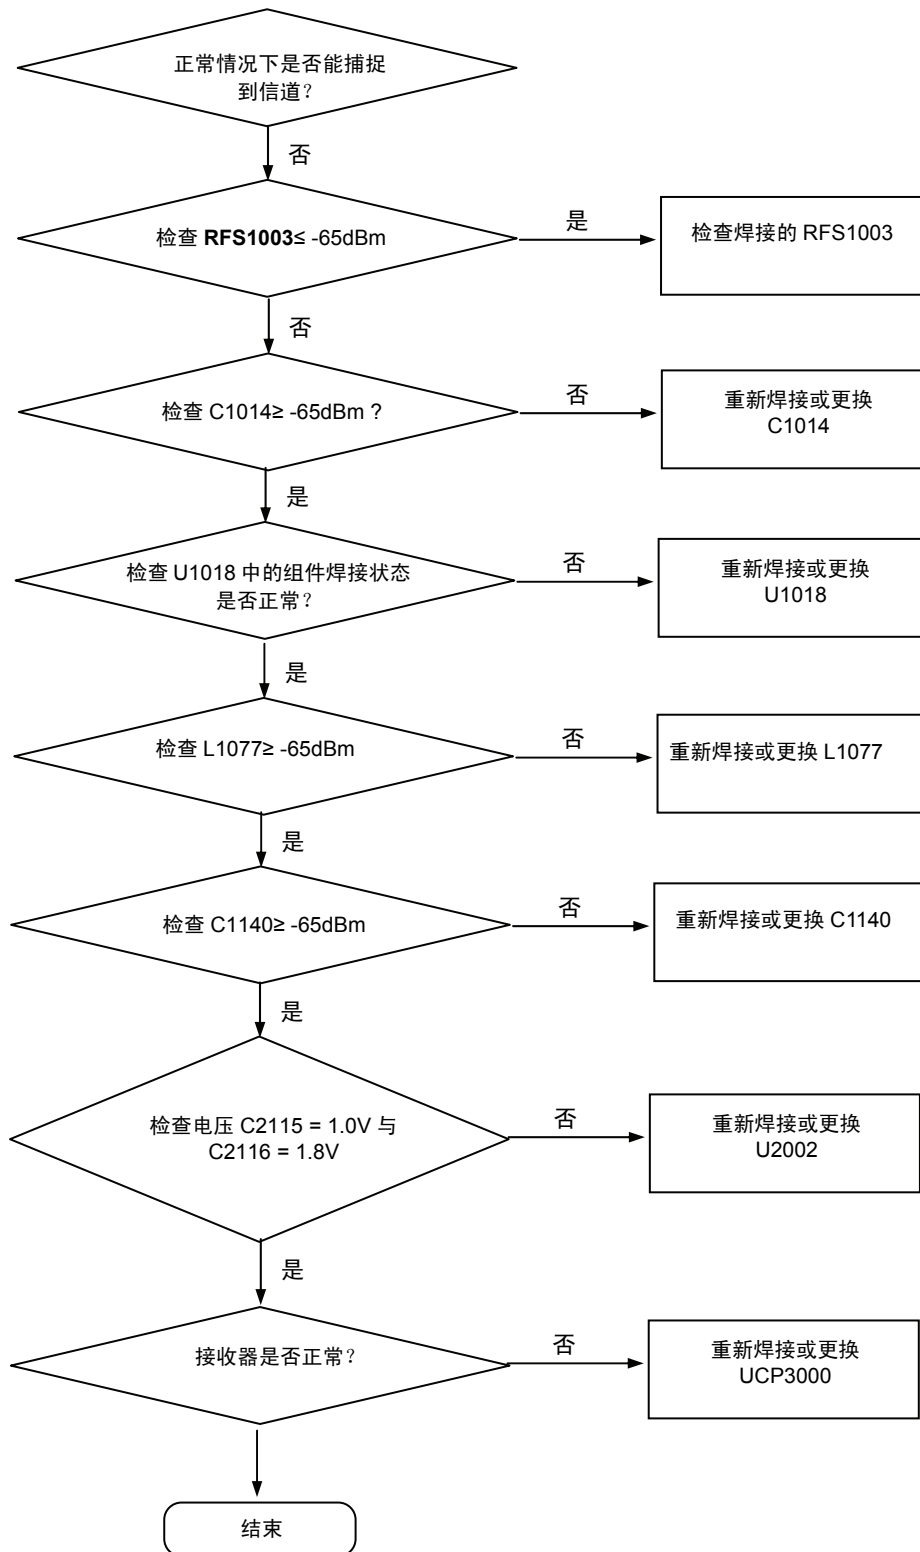


8-3-29. LTE 40 RX

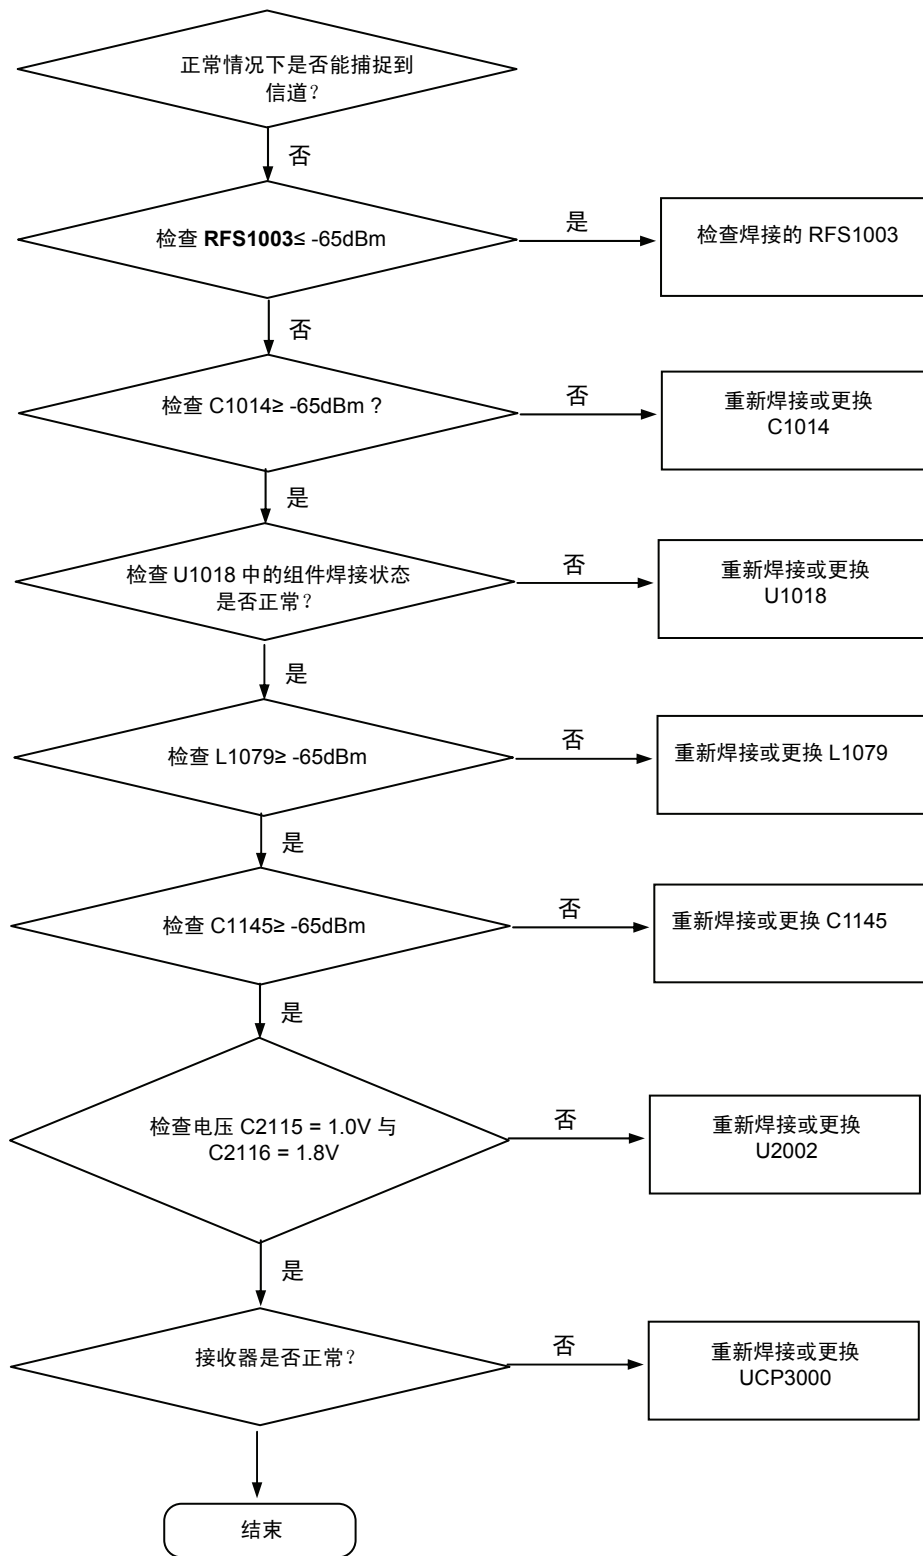

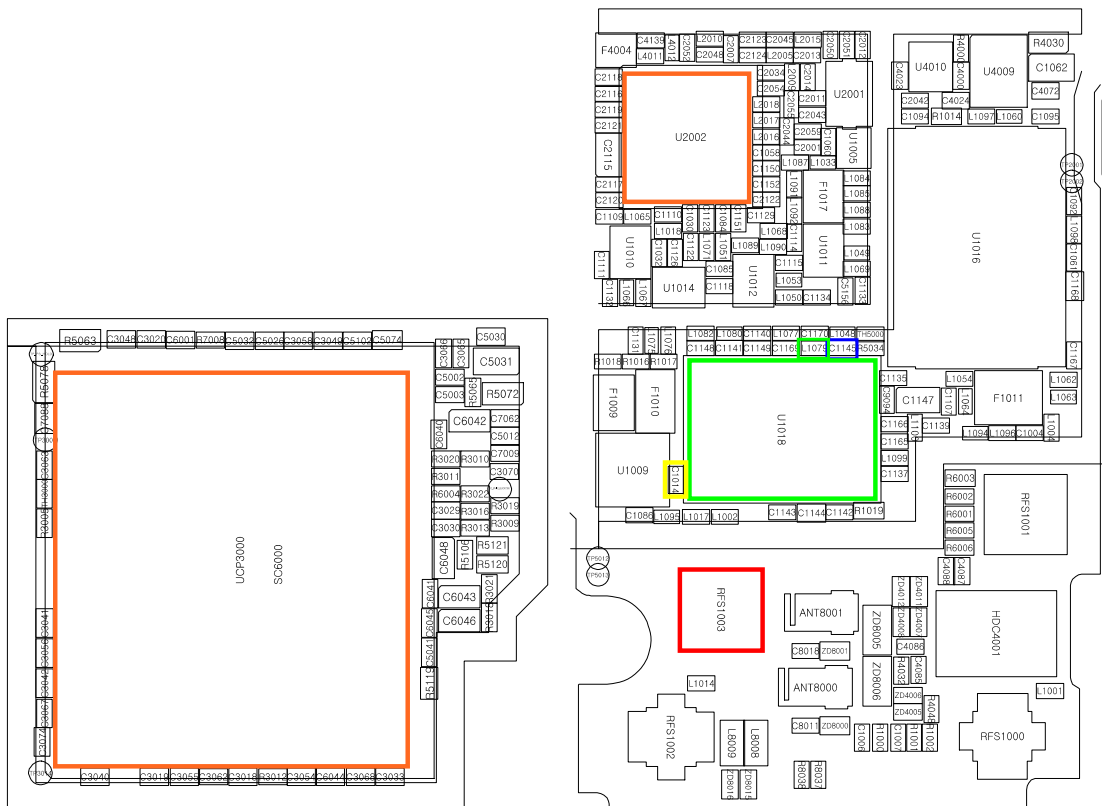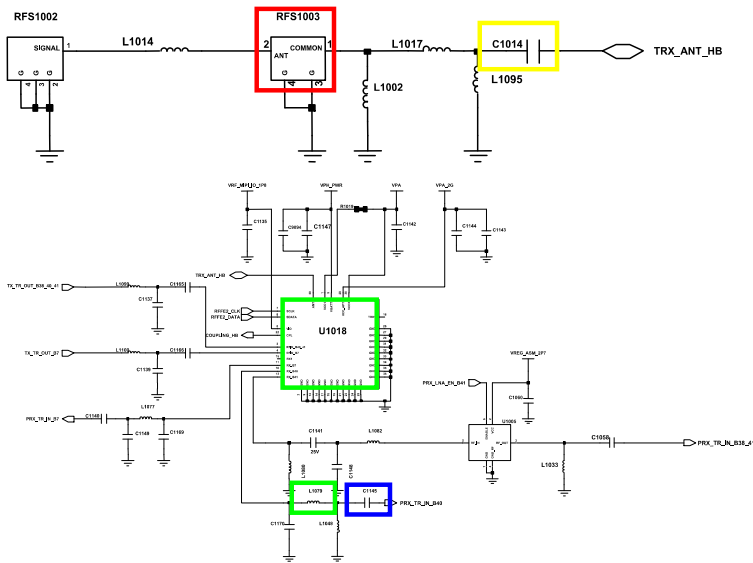



8-3-30. LTE 38 / 41 RX

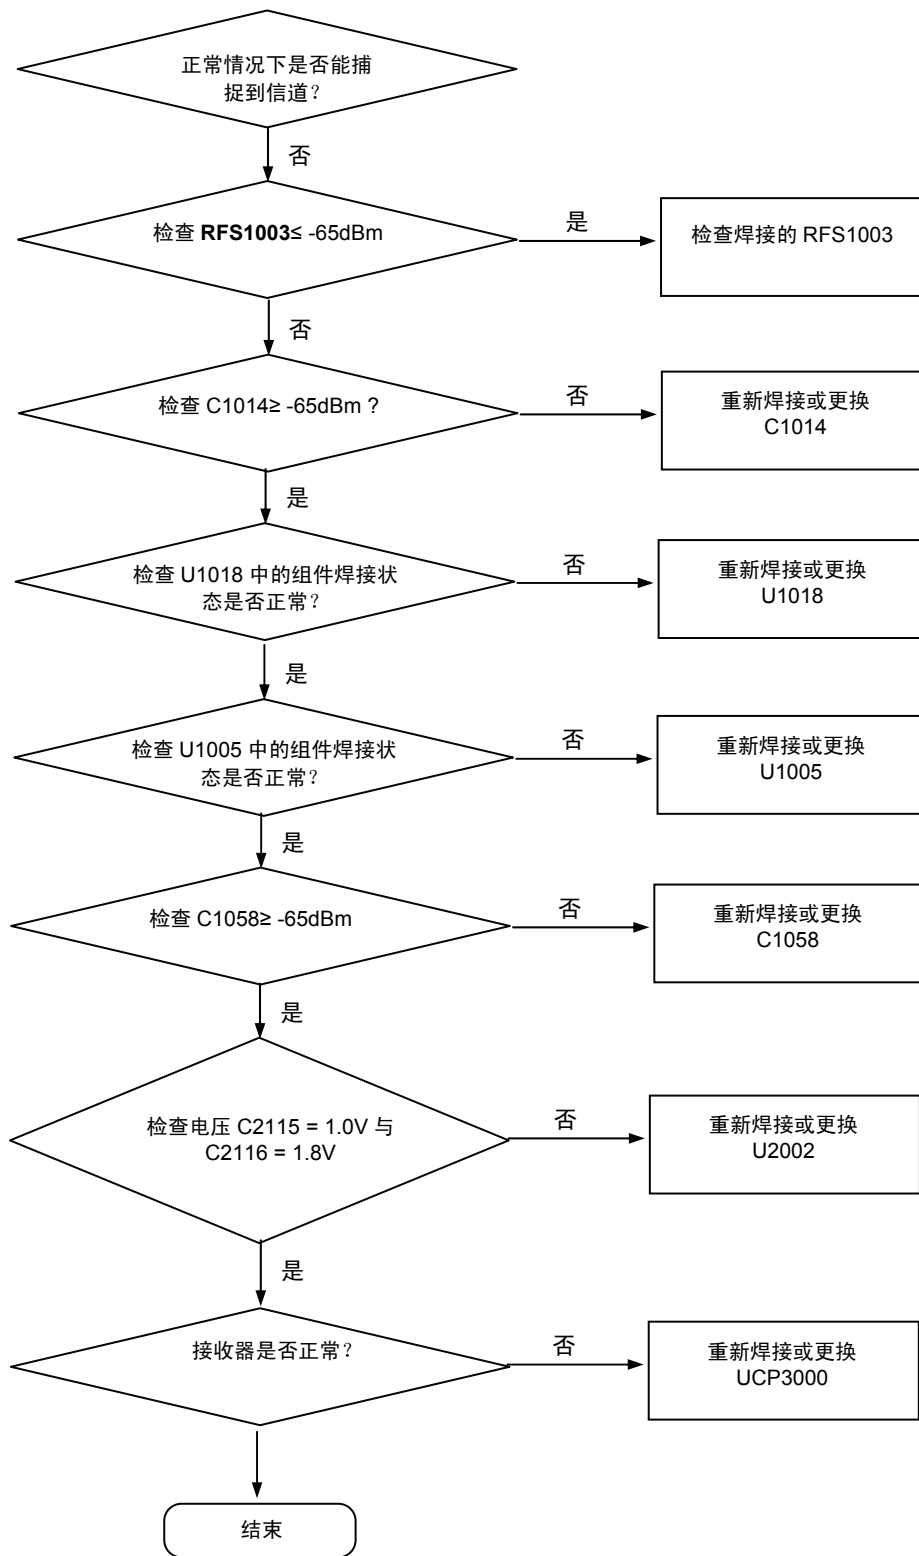


Distribution, transmission, or infringement of any content or data from this document without Samsung's written authorization is strictly prohibited.


8-3-31. WCDMA 1, 2 / LTE 1, 3, 4, 39 / TD-SCDMA 34, 39 TX

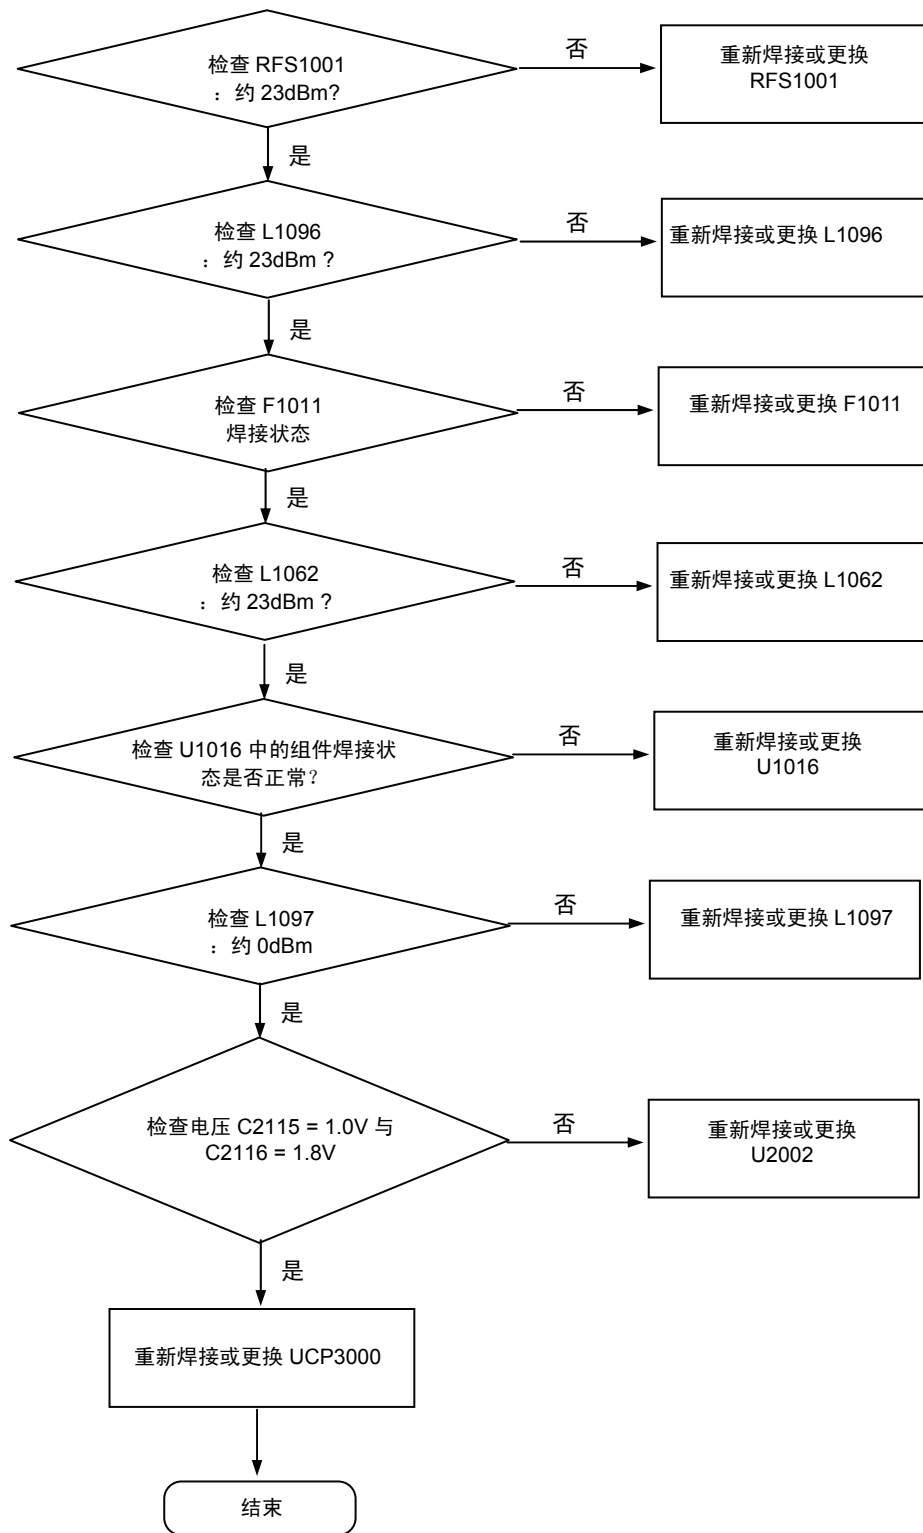

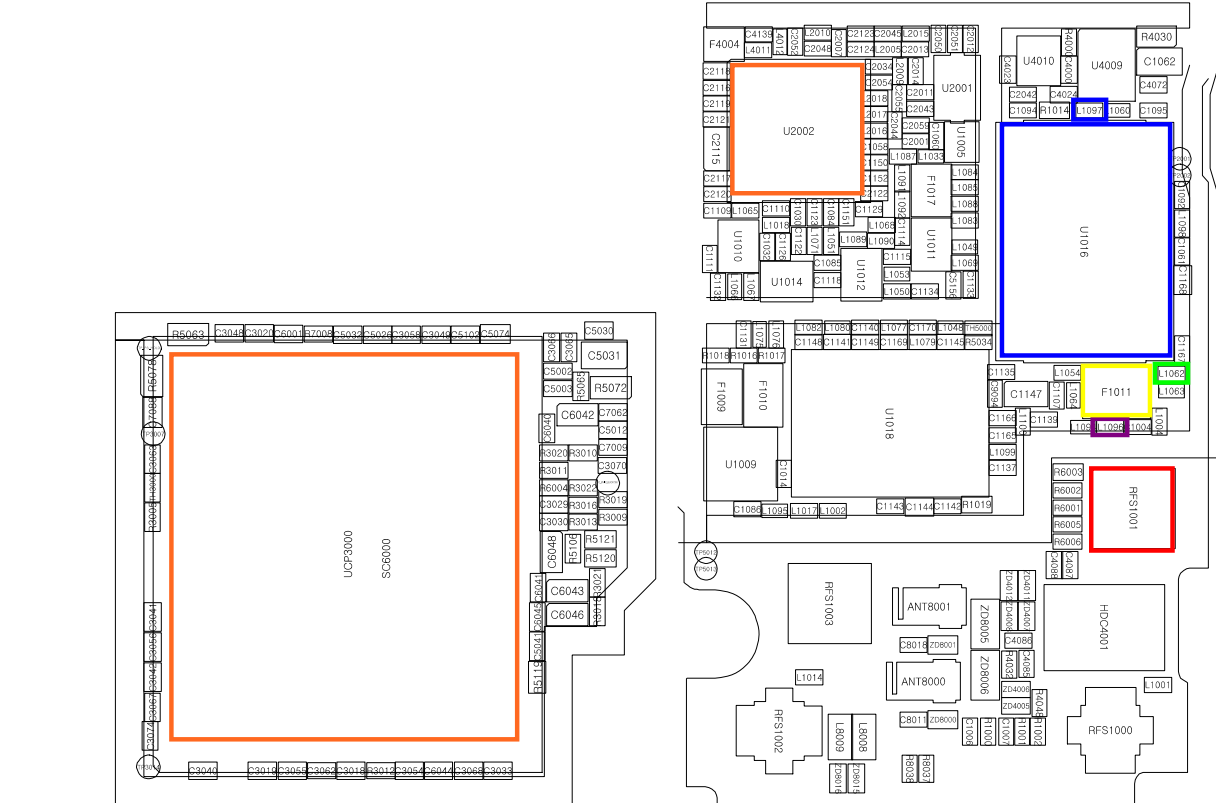




8-3-32. GSM1800, 1900 TX

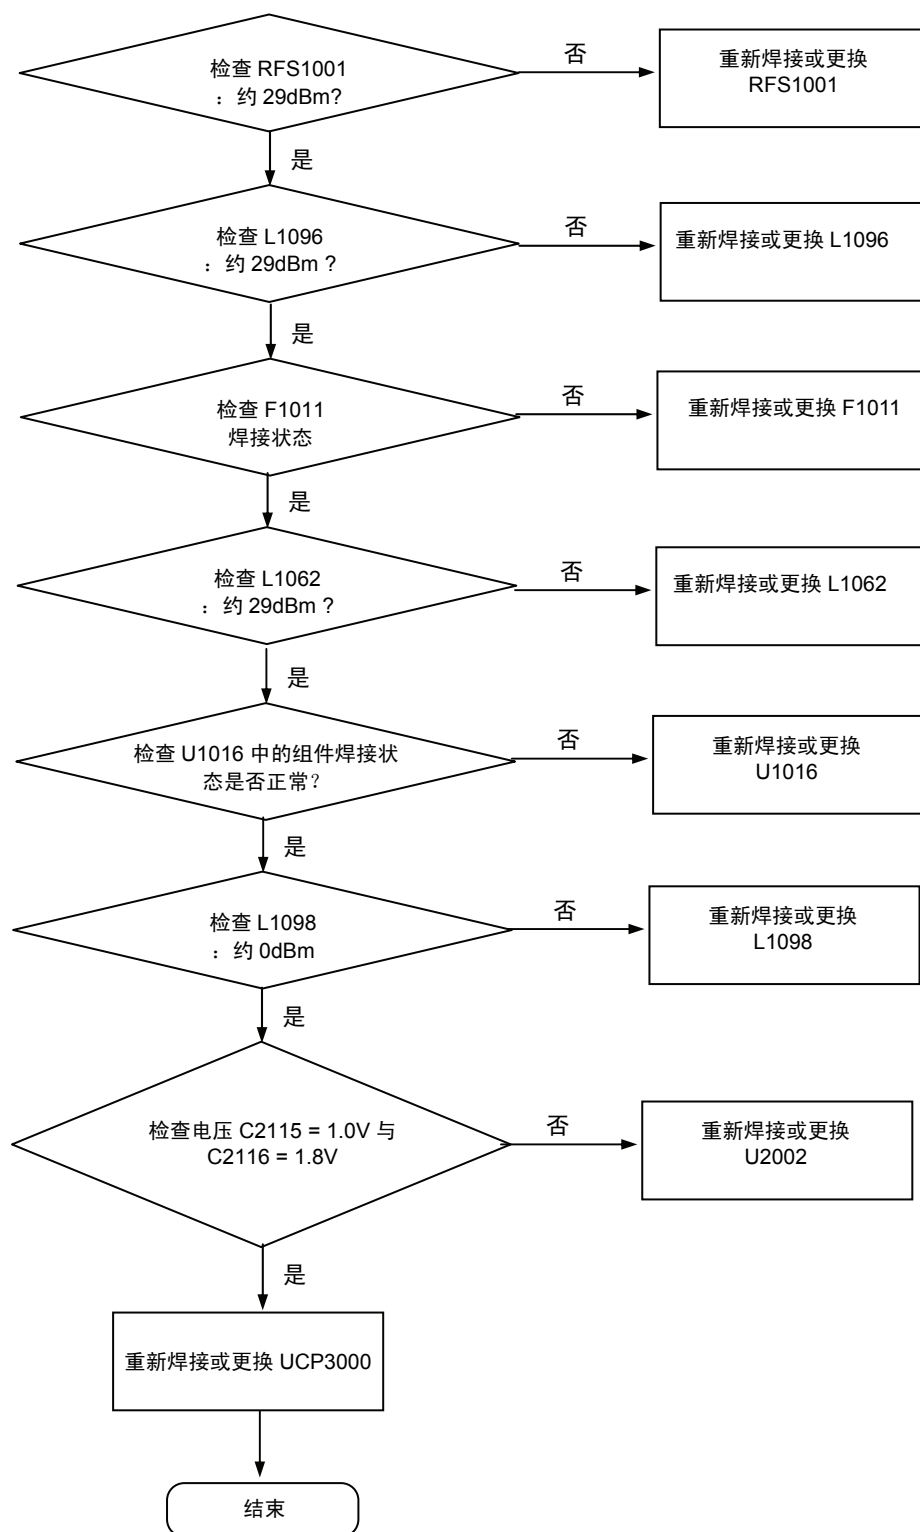

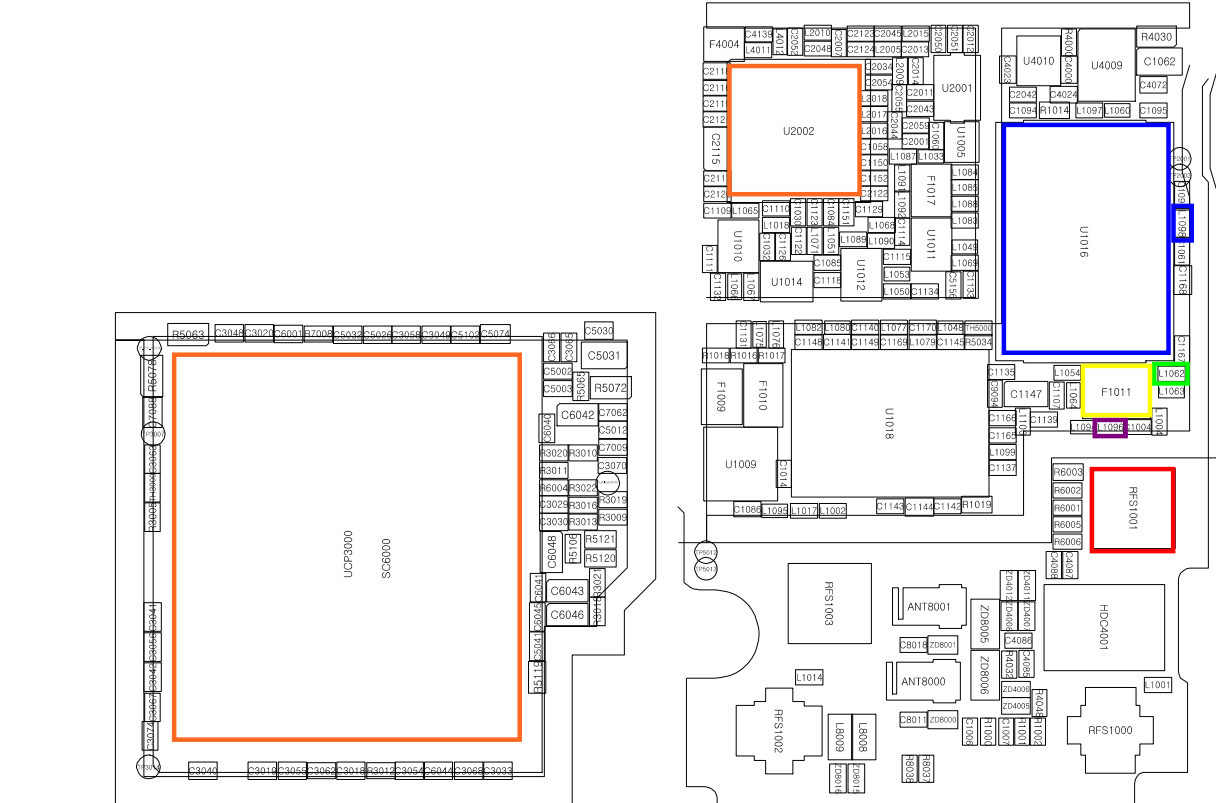


8-3-33. CDMA BC0 / WCDMA 5, 8 / LTE 28 TX

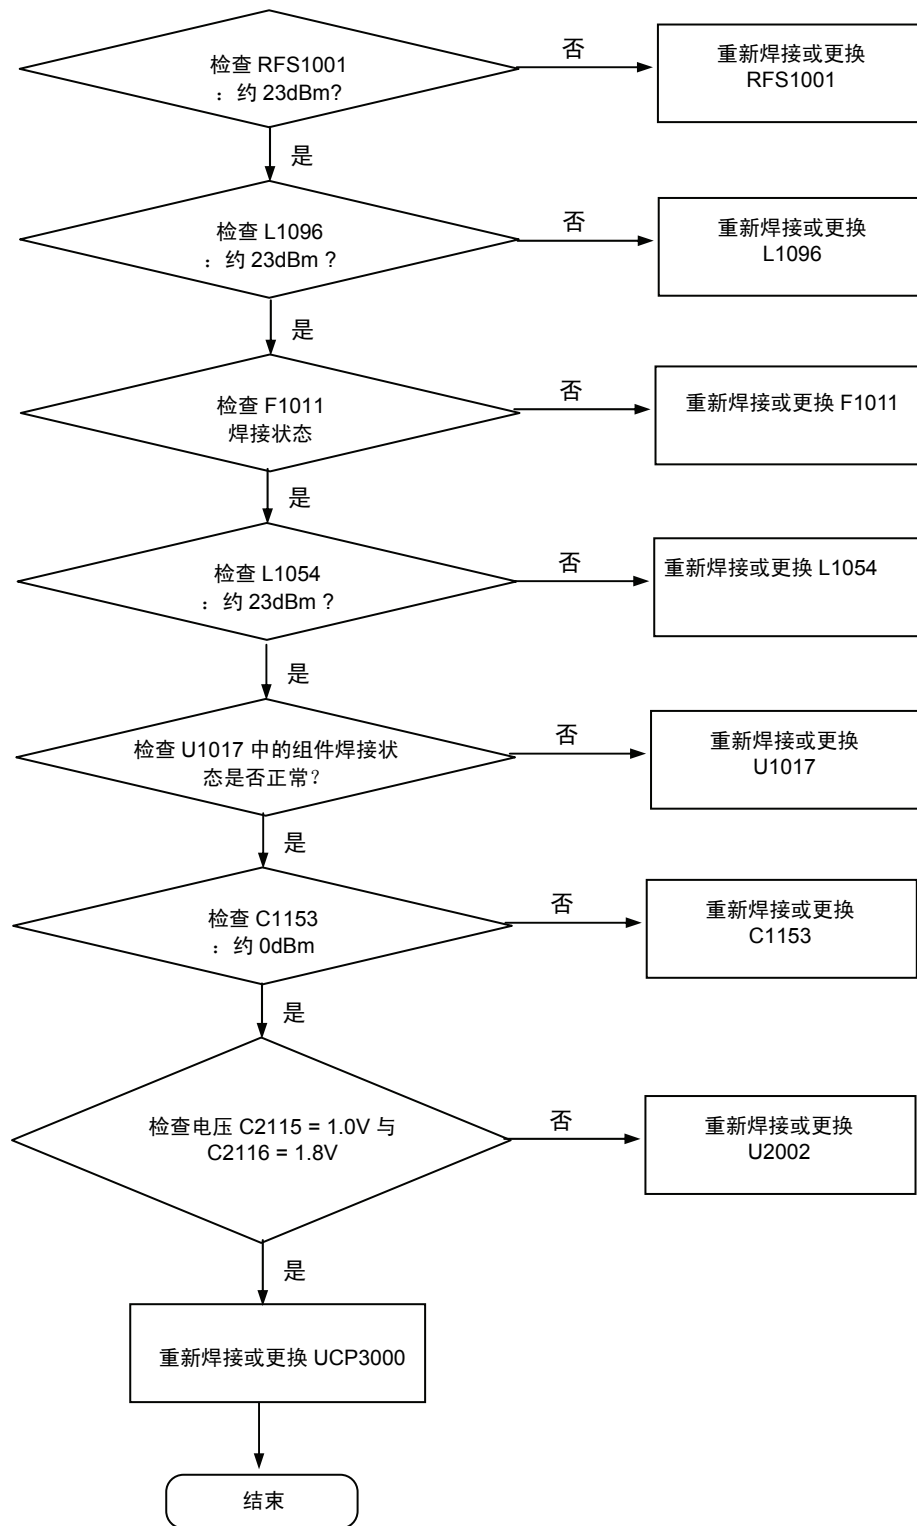


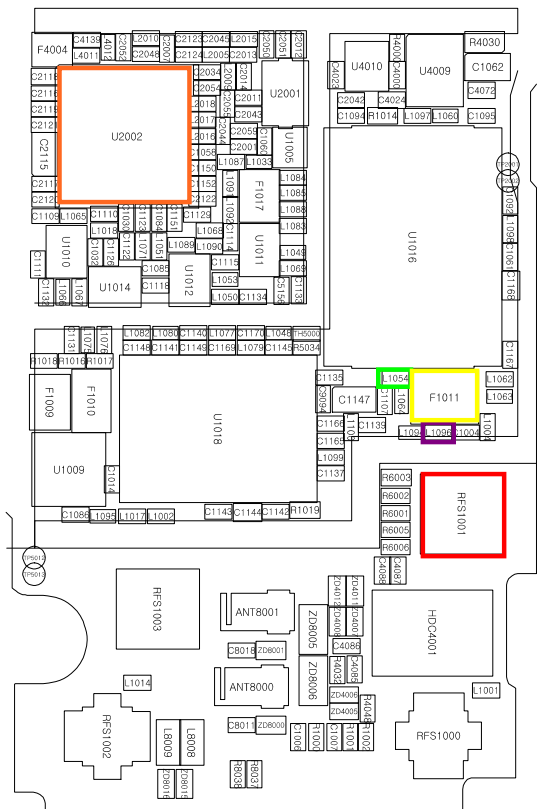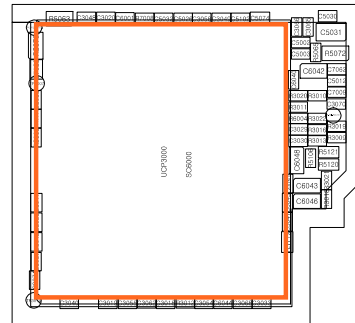


8-3-34. GSM850, 900 TX

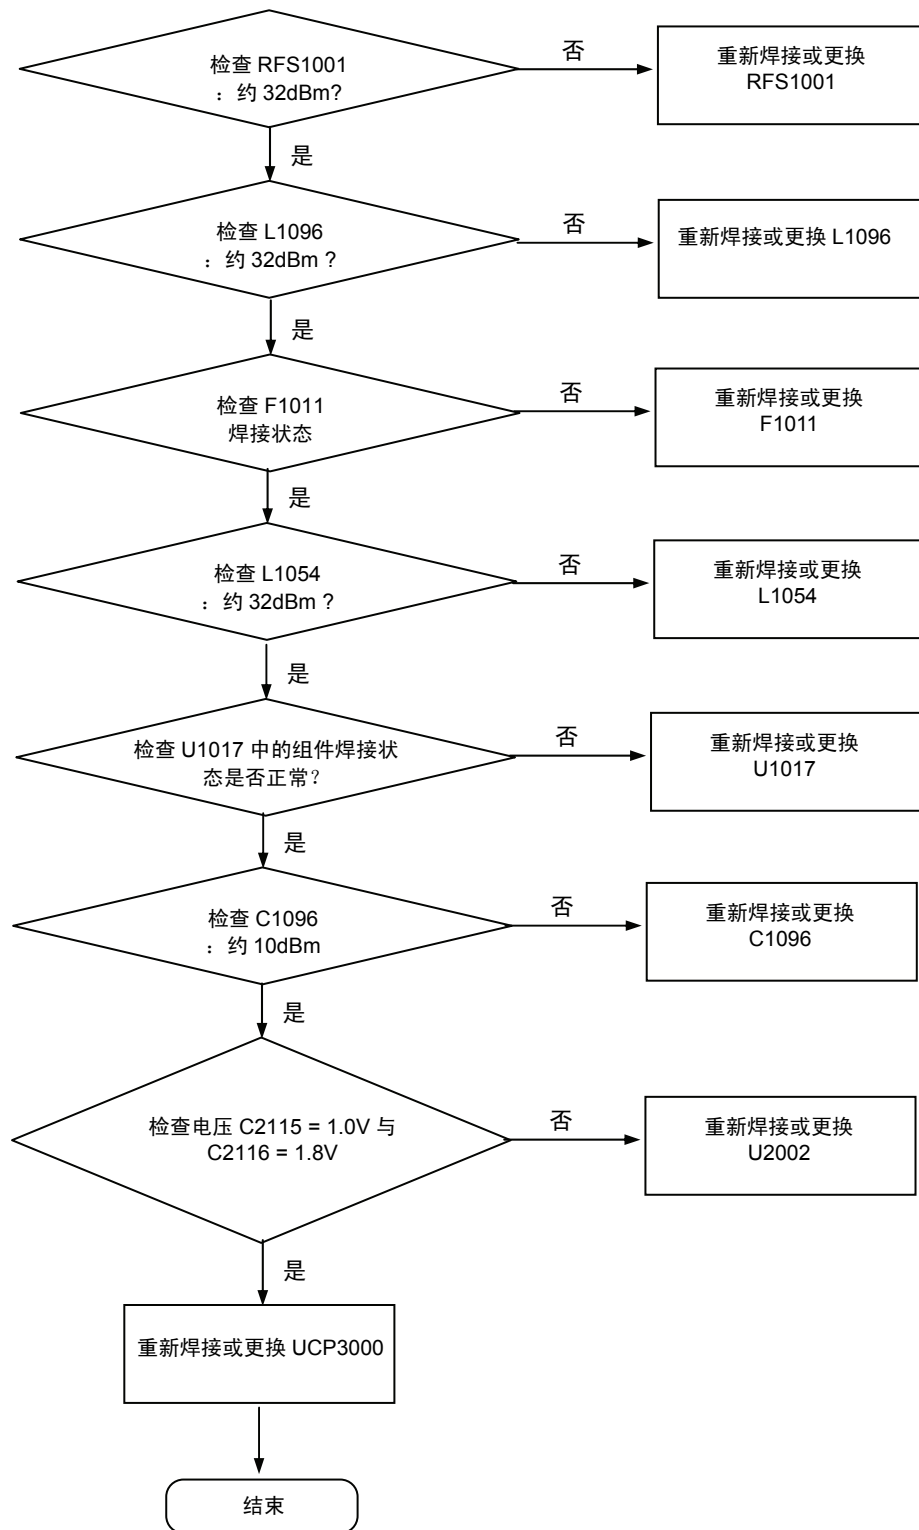


8-3-35. LTE 38, 40, 41 TX

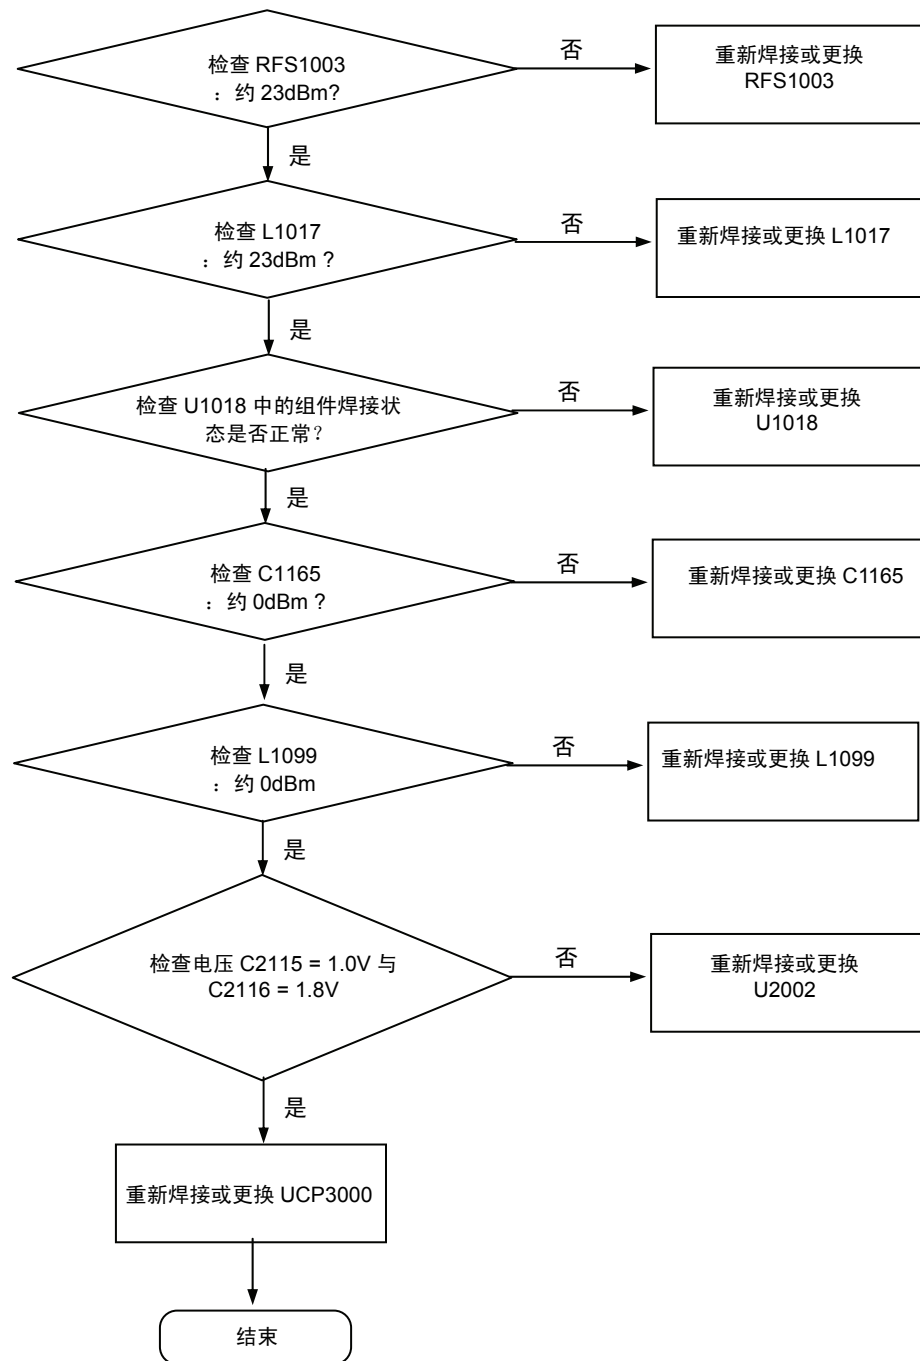

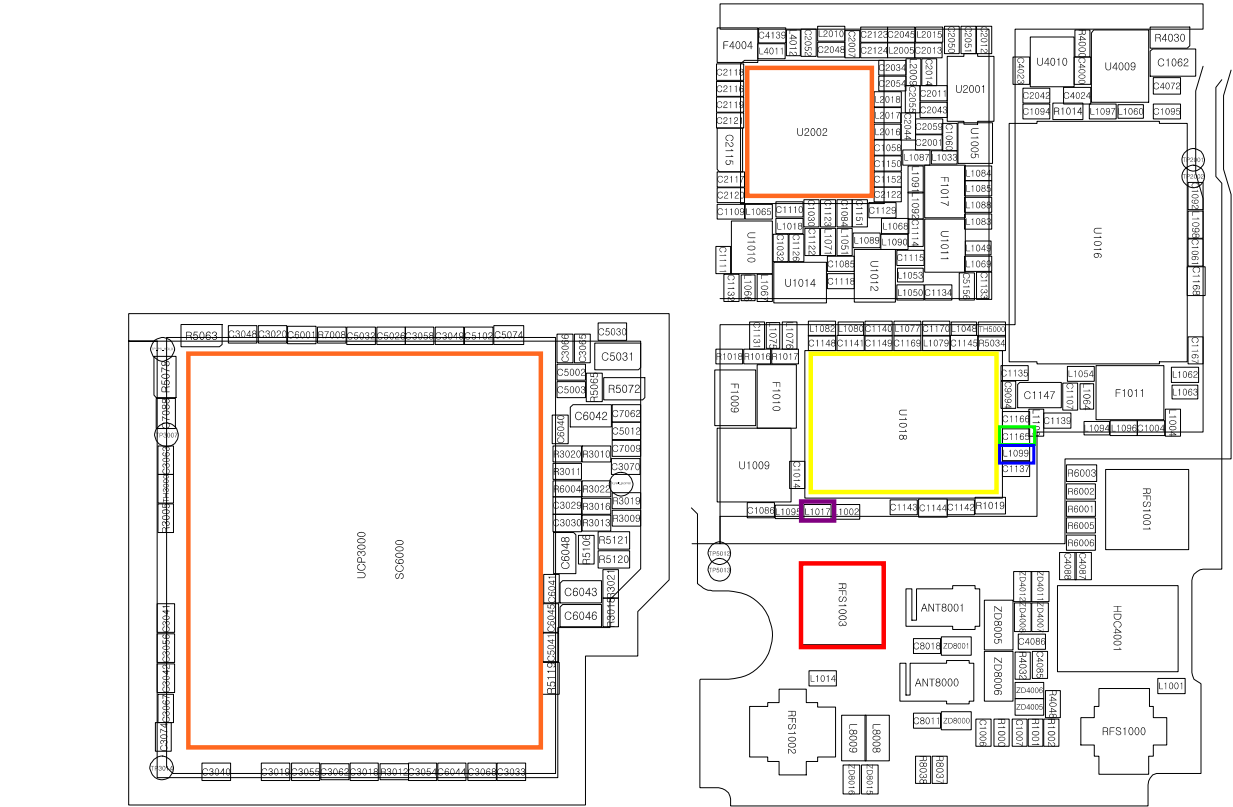

8-3-36. LTE 7 TX

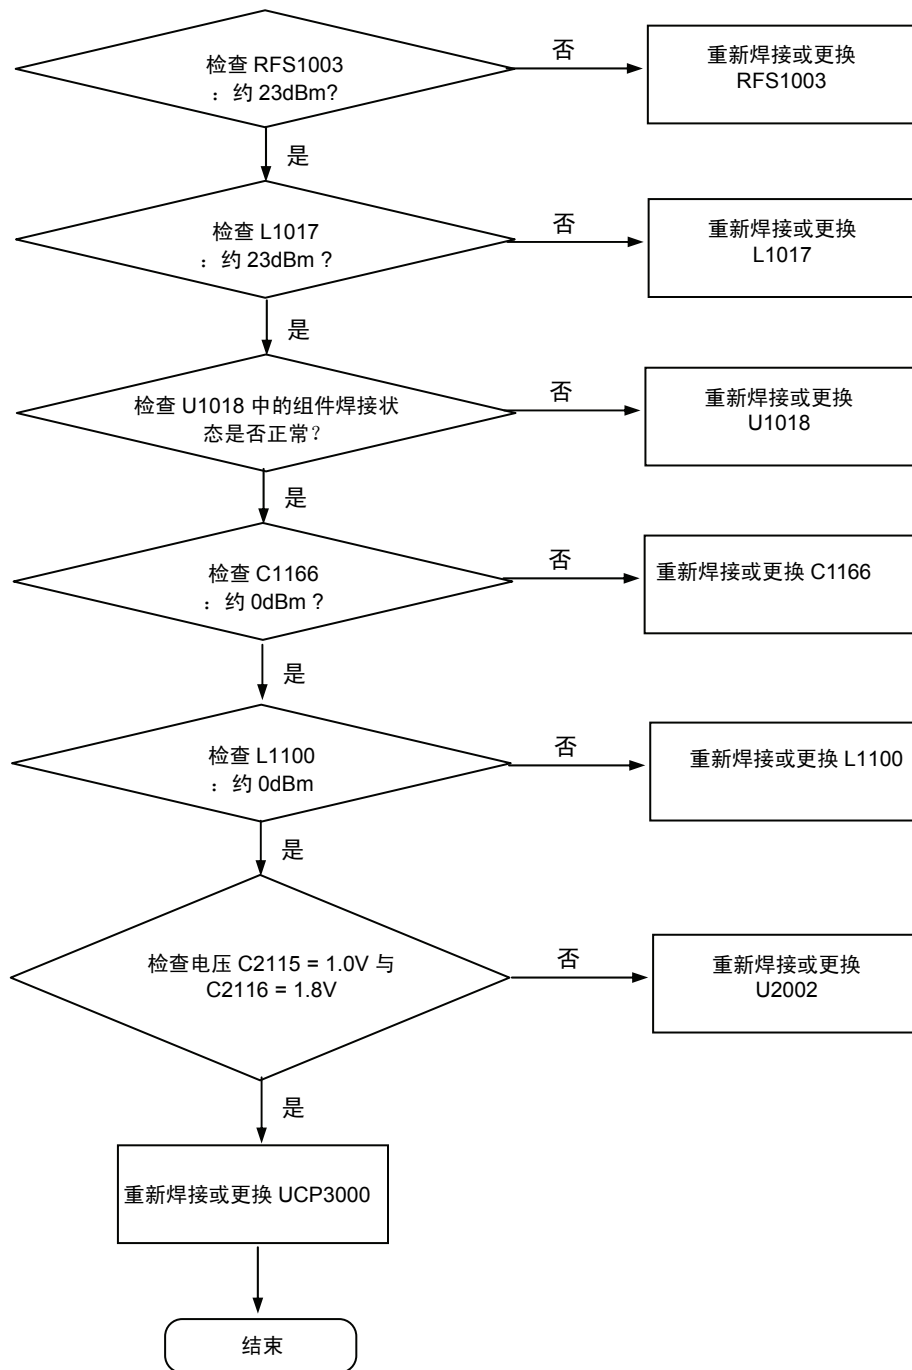

8-4. 维修示意图

-故障处（顶部视图）

UCP5000 (AP)

故障：AT12

[illegible]