



# KTM SUPER DUKE R motorcycle Repair Manual

[Manuals](#) / [Brands](#) / [KTM Manuals](#) / [Motorcycle](#) / [SUPER DUKE R](#) / [User manual](#) / PDF

## Contents

1. Basic information
2. Course of repair / conversion
  - 2.1. 1. Disassembly of lower lower part and control of cable trunk
  - 2.2. 2. Work to be performed depending on the action code
    - 2.2.1. Action code 00 - Finishing lower rear section (cable OK)
    - 2.2.2. Action code 01 - Finishing lower rear part + cable repair
    - 2.2.3. Action code 02 - Finishing lower rear part + replacement of cable trunk
3. Documents / Resources
  - 3.1. Other ManualsLib Projects

### Basic information:

Due to deviations in the assembly process, damage to the cable bundle at the lower rear section cannot be ruled out. Therefore, it must be checked that the cable harness has no damage in three different areas. Due to this, the lower rear part must be dismantled and finished.

### Course of repair / conversion:

Descriptions of general working methods in the workshop are omitted. Likewise, safety rules that apply to general work in the workshop are not addressed. We assume that the repair is carried out by a trained mechanic or by a person with equivalent qualifications. In case of ambiguity, the latest valid repair instructions take precedence.

To clarify the description and explanation, some parts may be disassembled or missing from the picture. It is not always necessary to disassemble the part in order to follow the description. Follow the instructions in the text.

## 1. Disassembly of lower lower part and control of cable trunk

- Remove the lower rear section according to the repair instructions / appendix 1.
- Check the cable harness in the areas below to see if there are any abrasion marks, damage or if cables have melted. See Figures 1 to 3 and Table 1 for more details.
- Photos must always be taken for documentation in the warranty application.

Thereafter, the steps in action code 00 must be performed on each vehicle. Then the correct action code must be selected depending on the cable damage (Table 2):

O In case of damage in area A for the voltage regulator, the cable can be repaired - see action code 01.

O If the cables on the cable harness have been damaged in the area B and C, must cable harness replaced - see action code 02.


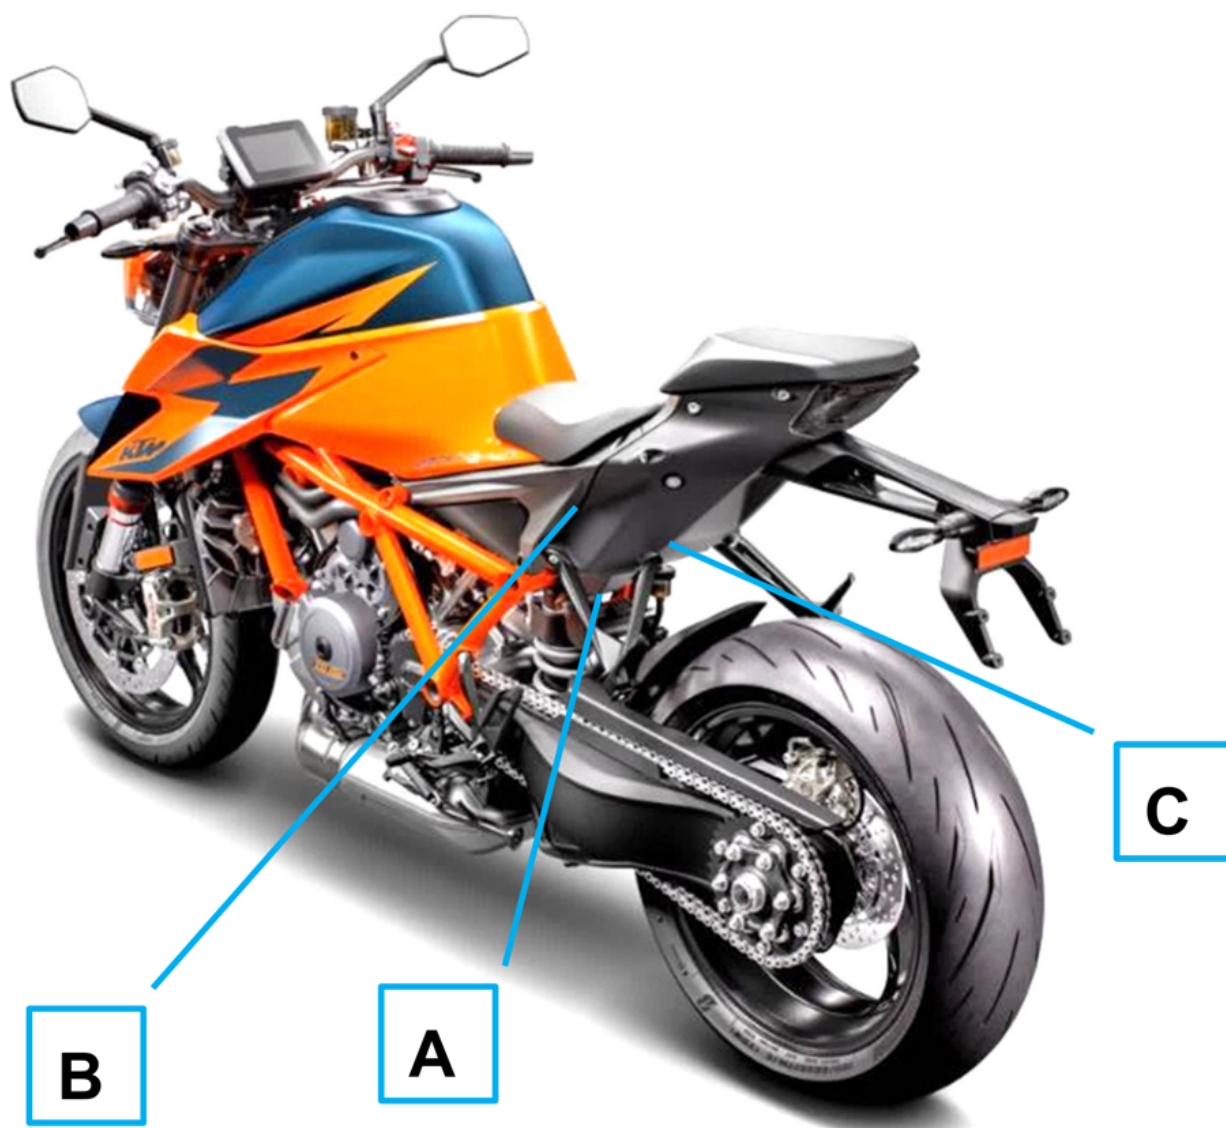



Figure 1 - Overview

Table 1

| Area     | Description                                        | Possible action codes |              |
|----------|----------------------------------------------------|-----------------------|--------------|
|          |                                                    | Cable OK              | Cable NOT OK |
| <b>A</b> | Cable bundle from cable trunk to voltage regulator | 00                    | 01/02        |
| <b>B</b> | Cable harness at the diagnostic connector          | 00                    | 02           |
| <b>C</b> | Cable stem at the seat lock                        | 00                    | 02           |

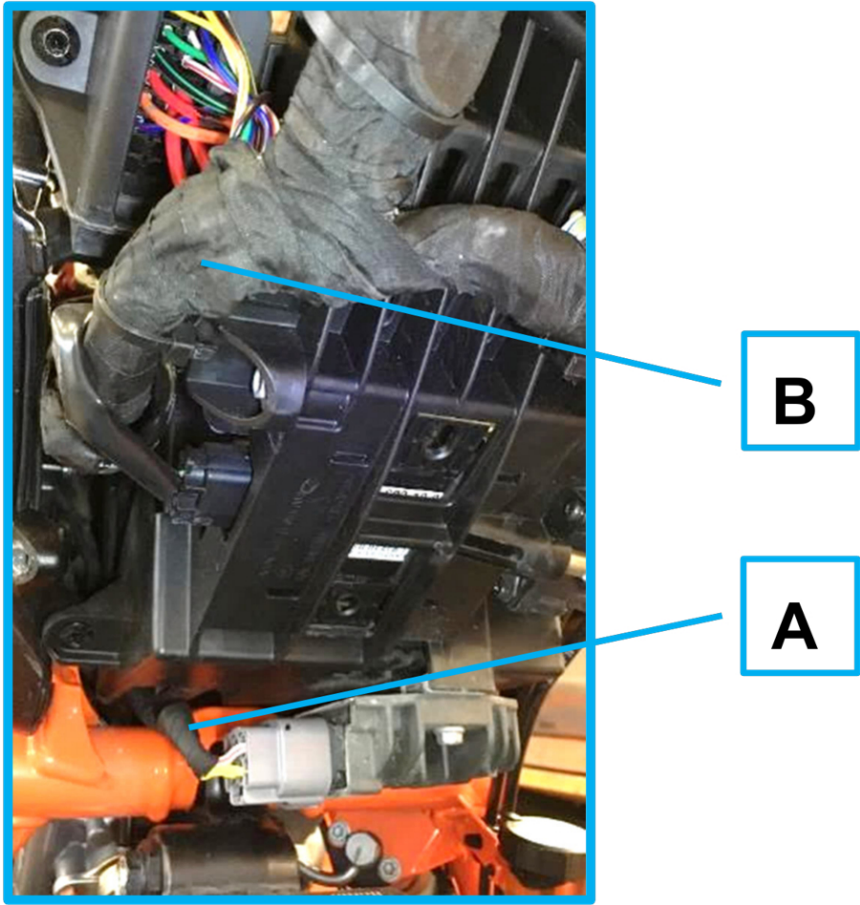

Picture 2 - Detail area A & B

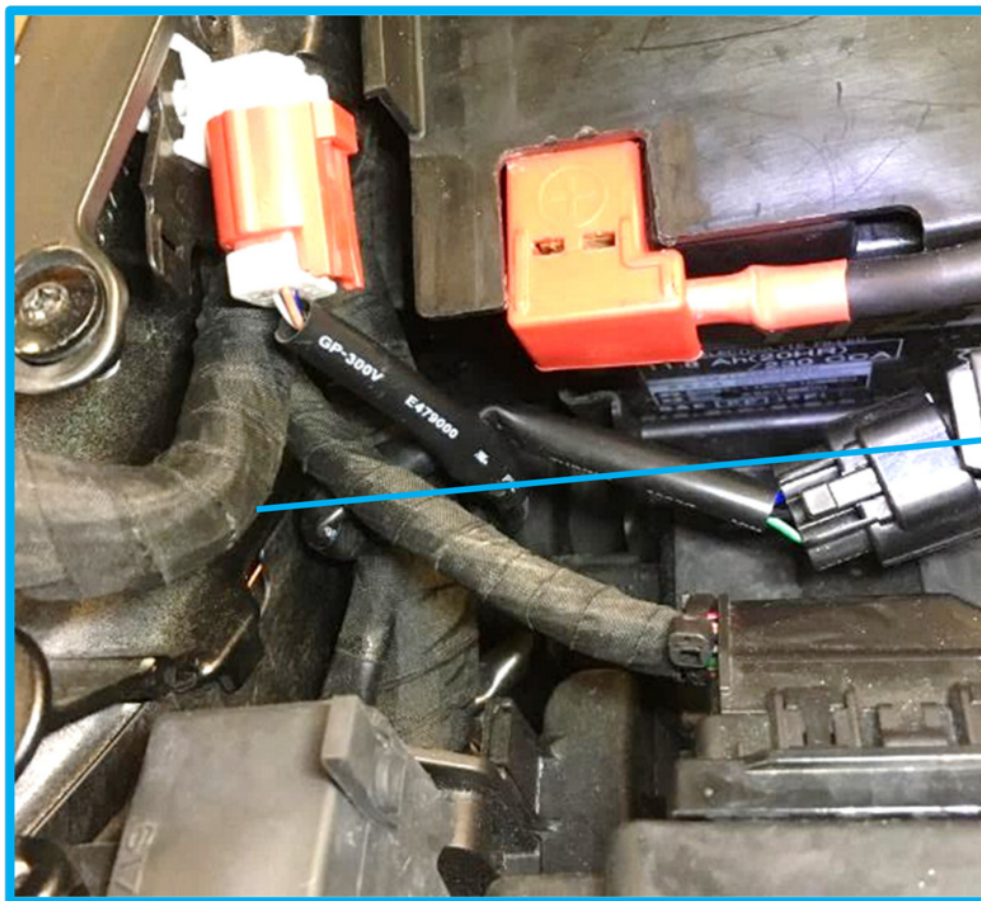

C

Figure 3 - Detail area C


Table 2

| Action code | Extent of damage                                                                                                                                                                                                                                                                                                                            |
|-------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 00          | <ul style="list-style-type: none"> <li>- Wear on the black electrical tape (Fig. 4).</li> <li>- No damage to the cable.</li> </ul>                                                                                                                                                                                                          |
| 01          | <ul style="list-style-type: none"> <li>- The voltage regulator has worn on the cable insulation • copper is visible (Fig. 5).</li> <li>- Damages less than 1 cm.</li> </ul>                                                                                                                                                                 |
| 02          | <p>Melted, broken or cracked cable insulation in an area larger than 1 cm (Fig. 6).</p> <ul style="list-style-type: none"> <li>- The damage extends into the cable trunk.</li> <li>- More than three cables are damaged.</li> </ul> <p><b>Repairs via promotion code 02 must be approved by KTM's current customer service country.</b></p> |





Figure 4 - Slight damage (00)

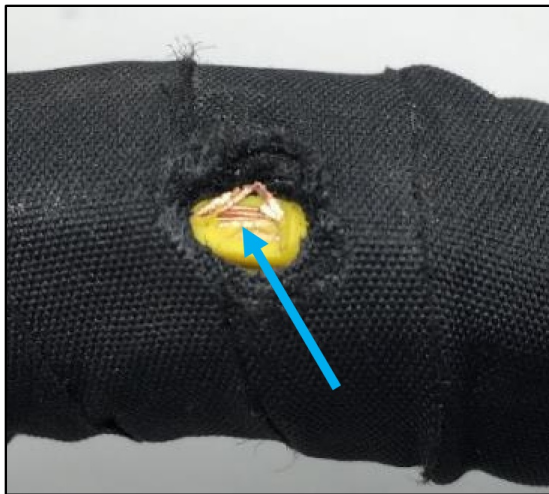

Picture 5 - Copper visible (01)

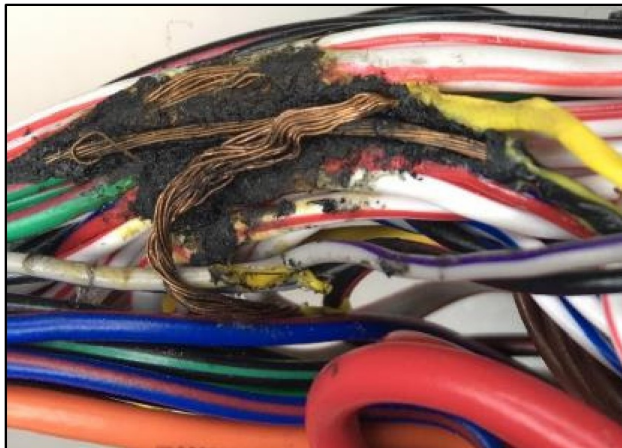


Figure 6 - Severe damage (02)

## 2. Work to be performed depending on the action code

### Action code 00 - Finishing lower rear section (cable OK)

1. Lay the lower rear part on a suitable surface. Mark holes and cut lines according to the presentation in Figure 7-B
2. = 15 mm C = 45 mm. Cover the surrounding area with tape to avoid scratches.

- 3.
  4. Drill the marked hole with a step drill · A = 10 mm (Fig.7).
  5. Saw in from the side with the hand saw and complete the marked recess (pictures 7 and 8). Burr and round off the
  6. cutting edges, remove the tape.
  7. Place the plastic part (61708019025) on the rail on the inside of the lower rear section and fit the edge guard (76003095074) as shown in the picture (picture 9).
  8. If necessary, repair slightly worn insulation on the cable trunk.
  9. Also check the cable harness behind the side cover (Fig. 10) to see if there are contact points and, if necessary, reattach with cable ties.
  10. Attach the voltage regulator cable bundle to the battery holder with 2 cable ties as shown picture 11.
- Note! The voltage regulator cable bundle must not protrude from the contact housing and the wiring to the main frame must be checked to see if there are contact surfaces (picture 12).
11. Install the lower rear section according to the repair instructions / appendix 1 and tighten the screws according to table 3.
  12. Visually check that the assembly has been done correctly and perform a test run.

Table 3

| Component                            | Screw | <u>Tightening torque</u> | Comment                                       |
|--------------------------------------|-------|--------------------------|-----------------------------------------------|
| Screws on passenger footrest bracket | M8    | 25 Nm                    | Medium hard screw locking (eg Loctite® 243 ™) |
| Screws for metal flange outriggers   | M8    | 25 Nm                    | Medium hard screw locking (eg Loctite® 243 ™) |
| Screws for outriggers                | M8    | 28 Nm                    | Medium hard screw locking (eg Loctite® 243 ™) |
| Screw for number plate holder        | M6    | 10 Nm                    |                                               |
| Screw to battery pole                | M6    | 4.5 Nm                   |                                               |

**Note!**

We assume that only a small number of vehicles have damaged cables that need to be repaired and that only a few cable trunks need to be replaced. Therefore, parts for action codes 01 and 02 should not be kept in stock, as this could lead to shortcomings in the spare parts supply.

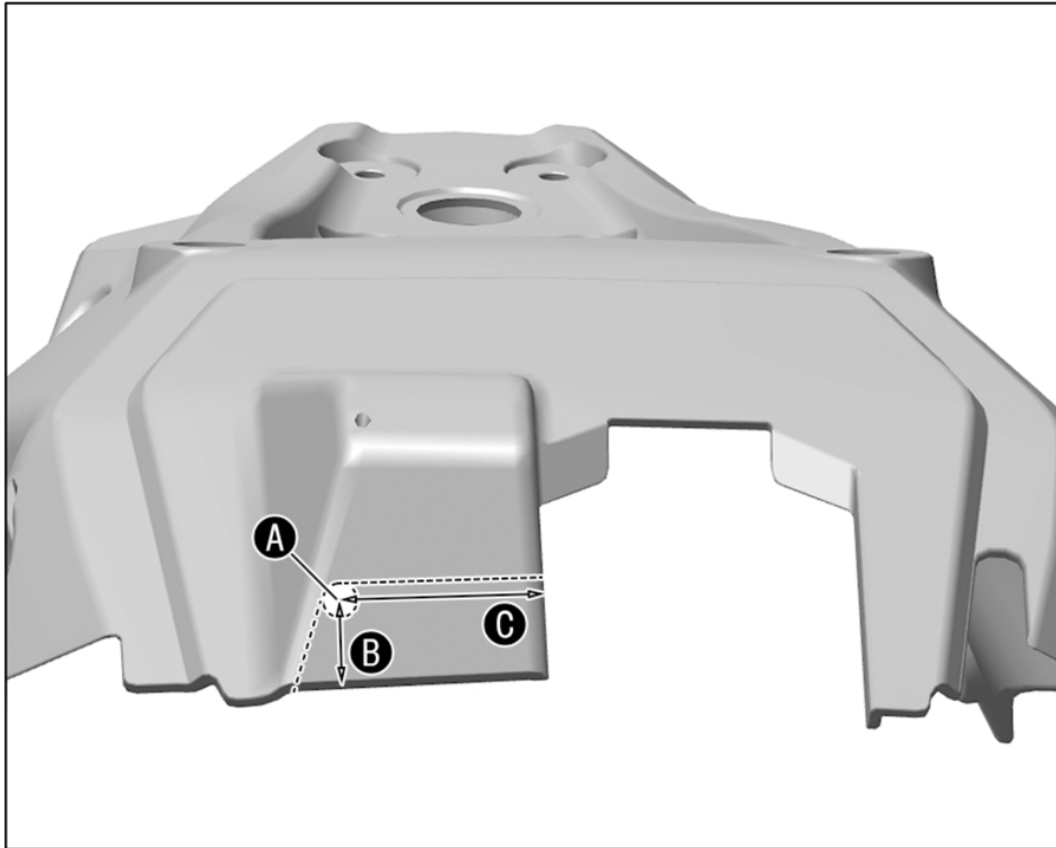


Fig. 7 - Position for holes on the lower rear part B = 15 mm C = 45 mm



Fig. 8 - Remove the lower rear part clearly

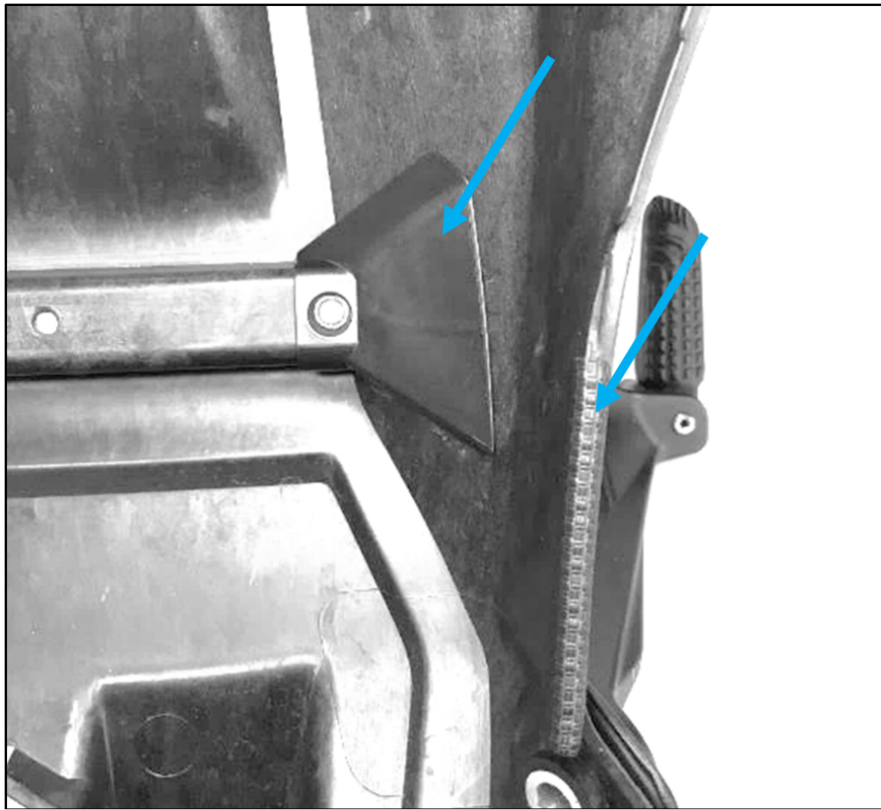


Fig. 9 - Install cable and edge protection inside

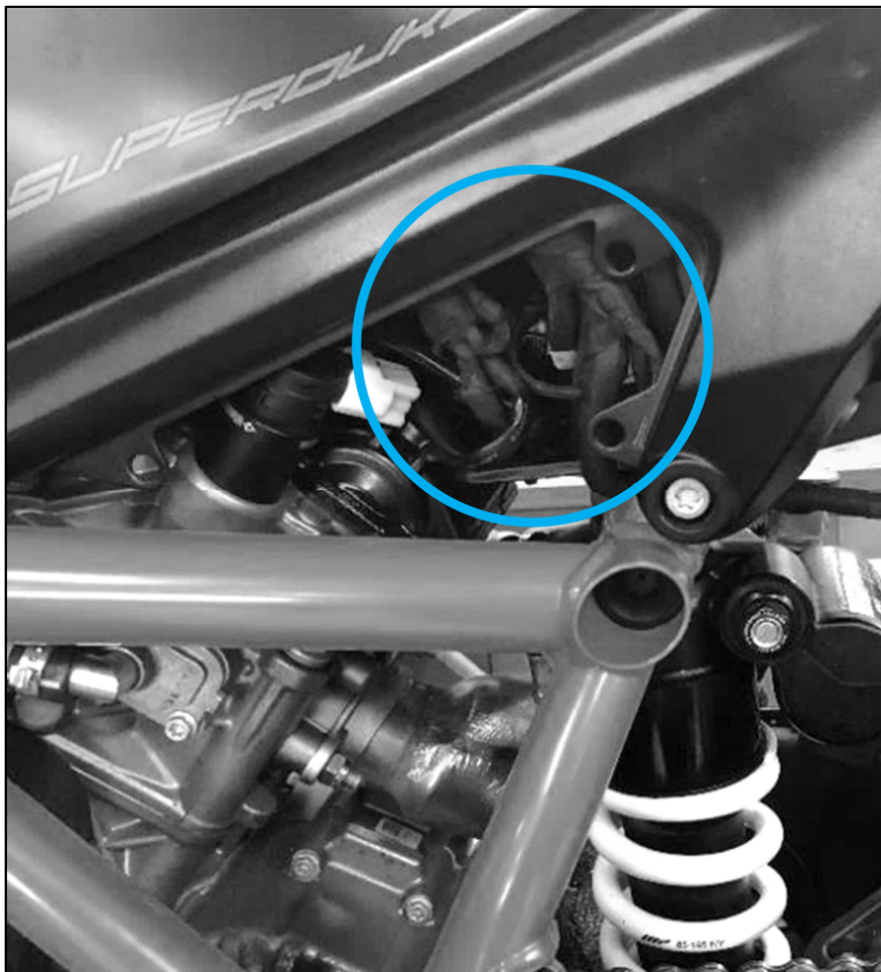


Figure 10 - Area for checking the cable trunk



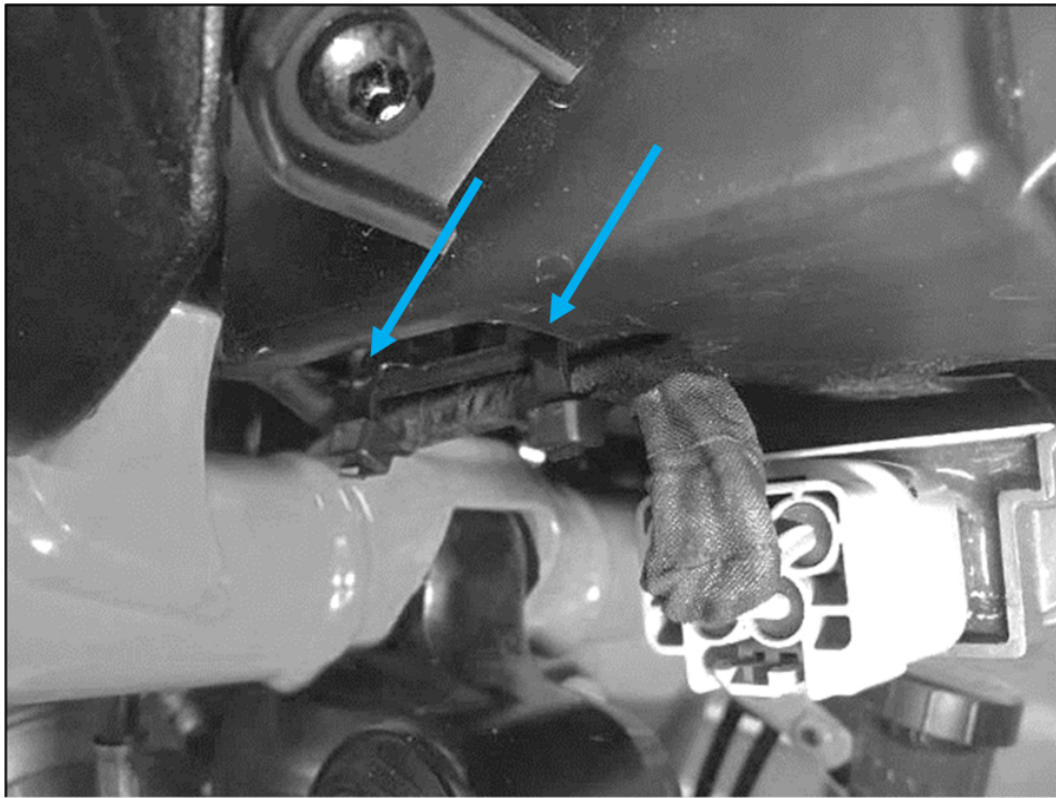


Fig. 11 - Attach the cable bundle with 2 cable ties

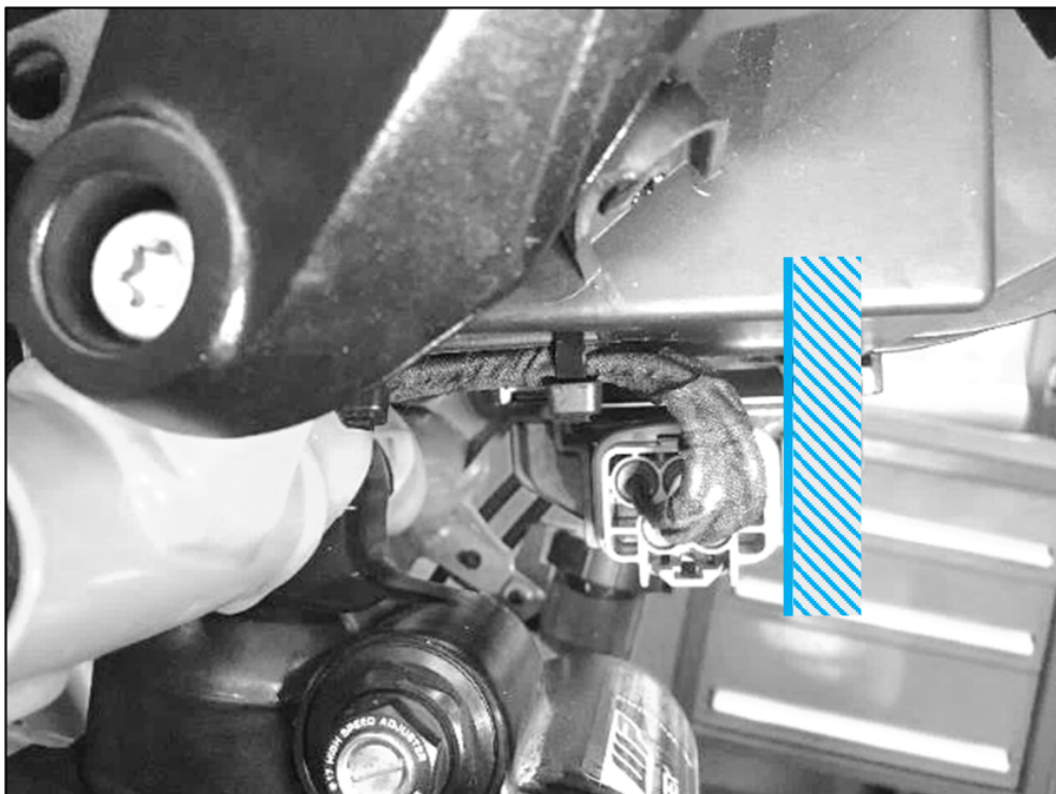


Figure 12 - Align the cable bundle correctly

### **Action code 01 - Finishing lower rear part + cable repair**

Perform steps 1-7 as stated in action code 00. Observe Figure 7-12 and Table 3.

8. Disconnect the cables from the 12 V battery and remove the left cover of the rear frame.

9. Remove the connector housing according to appendix 2. Remove the cable bundle laterally from the rear frame so that there is enough space for the subsequent cable repair.

10. Carry out the cable repair in accordance with Appendix 2.
  11. Re-connect the cable bundle to the voltage regulator and install the contact housing according to appendix 2.
  12. Attach the voltage regulator cable bundle to the battery holder with 2 cable ties as shown in Figure 11.
- Note! The cable bundle must not protrude from the contact housing and the wiring to the main frame must be checked to see if there are contact surfaces (Fig. 12).
13. Also check the cable harness behind the side cover (Fig. 10) to see if there are contact points and, if necessary, reattach with cable ties.
  13. Install the lower rear section according to the repair instructions / appendix 1 and tighten the screws according to table 3.
  14. Connect the cables to the 12 V battery and set the time and date in the instrument cluster.
  15. Check the cable coating on the voltage regulator again according to table 4. Note! The battery is discharged if the positive and negative connections are reverse
  16. Start the engine and check the charging voltage.
  17. Read the error memory with XC\_2 and delete if necessary.
  18. Visually check that the assembly was done correctly and perform a test run.

Table 4

| PIN | Cable color               | Cable cross section | Comment                       |
|-----|---------------------------|---------------------|-------------------------------|
| 1   | Generator (yellow)        | 2.5 mm <sup>2</sup> | Yellow cables can be reversed |
| 2   | Generator (yellow)        | 2.5 mm <sup>2</sup> | Yellow cables can be reversed |
| 3   | Constant plus (red-white) | 2.5 mm <sup>2</sup> |                               |
| 4   | Generator (yellow)        | 2.5 mm <sup>2</sup> | Yellow cables can be reversed |
| 5   | Earth (black)             | 2.5 mm <sup>2</sup> |                               |



### Action code 02 - Finishing lower rear part + replacement of cable trunk

Perform steps 1-7 as stated in action code 00. Observe Figure 7-12 and Table 3.

8. Disconnect the cables from the 12 V battery.
  9. Replace the cable harness.
  10. Attach the voltage regulator cable bundle to the battery holder with 2 cable ties as shown in Figure 11.
- Note! The cable bundle must not protrude from the contact housing and the wiring to the main frame must be checked to see if there are contact surfaces (Fig. 12).
11. Fit the lower rear section according to the repair instructions.
  12. Connect the cables to the 12 V battery and set the time and date.
- Install the lower rear section according to the repair instructions / appendix 1 and tighten the screws according to table 3.
14. Connect the cables to the battery and correct the time and date in the instrument cluster.
  15. Read the error memory with XC\_2 and delete if necessary.
  16. Visually check that the assembly was done correctly and perform a test run.

Note:

All authorized KTM dealers are encouraged to carry out the inspection resp. the replacement of the affected motorcycles in stock (see vehicle history) before these vehicles are delivered to end customers. Therefore, check the vehicle history in KTM Dealer.net for vehicles in stock.

### **Vehicles concerned:**

Before ordering parts and refilling stock, please note: Number and all vehicle identification numbers for dina affected vehicles can be found in the respective Technical Information. Open TI i Inboxes or The archive in Dealer.net below Service and Warranty Messages. The complete list of vehicle identification numbers can be found under the item Affected vehicles.

Note!

We assume that only a small number of vehicles have damaged cables that need to be repaired and that only a few cable trunks need to be replaced. Therefore, parts for action codes 01 and 02 should not be kept in stock, as this may cause defects in the spare parts supply.

|                                             |
|---------------------------------------------|
| Warranty type:                              |
| TI - Guarantee                              |
| Component group:                            |
| 08 - Mask, screen                           |
| Damage code:                                |
| 900 - Damage determined by the manufacturer |
| Component causing the damage:               |
| 61708019000 - Lower back                    |
| Promotion code, spare parts, working hours: |
| Finishing work lower rear part (cable OK)   |
|                                             |

|                                                                                               |
|-----------------------------------------------------------------------------------------------|
| Action code: 08_1806661_00                                                                    |
| Working hours: 75 minutes                                                                     |
| Parts: 2 pcs # 44011076200 - cable ties 200 / 4.8 mm black 1 pc #                             |
| 61708019025 - cable protection lower rear part 1 pc # 76003095074 -                           |
| edge protection 9.5x6.5x74                                                                    |
| Finishing work lower rear part + cable repair                                                 |
| Action code: 08_1806661_01                                                                    |
| Working hours: 95 minutes                                                                     |
| Parts: 2 pcs # 44011076200 - cable ties 200 / 4.8 mm black 1 pc #                             |
| 61708019025 - cable protection lower rear part 1 pc # 76003095074 -                           |
| edge protection 9.5x6.5x74                                                                    |
| 1 pc # 61711075010 - repair kit main cable bundle                                             |
| Finishing lower rear part + replacement of cable trunk                                        |
| Action code: 08_1806661_02                                                                    |
| Working hours: 240 minutes                                                                    |
| Parts: 1 pc # 61711075133 - main cable bundle cpl.                                            |
| 1 pc # 61708019025 - cable protection lower rear part 1 pc #                                  |
| 76003095074 - edge protection 9.5x6.5x74                                                      |
| 15 pcs # 44011076140 - cable ties 140 / 2.5 mm black 15 pcs #                                 |
| 44011076200 - cable ties 200 / 4.8 mm black                                                   |
| Are there parts of the bearing that need to be replaced:                                      |
| Yes                                                                                           |
| Guaranteed compensation within the framework of the guarantee:                                |
| 24 months from the date of delivery of the motorcycle or 18 months from the publication of TI |

F. Kecht

CSO

B. Kenedi

VP Customer Service

P. Habsburg

CTO

O. Göhring

MD

Copyright © 2020 KTM SPORTMOTORCYCLE GmbH. All rights reserved.

All content in this Technical Information is protected by intellectual property laws, in particular copyright.

The contents of this Technical Information may not be used for commercial purposes, in particular not altered, reproduced, handed over to or made available to third parties.

Despite the fact that the technical information has been produced with the greatest possible accuracy, KTM cannot give any guarantee that the information content is correct or complete. KTM disclaims all liability for damages arising from the use of the technical information, unless these are due to at least gross negligence on the part of KTM.

## Documents / Resources

### Other ManualsLib Projects

 [www.manualslib.com](http://www.manualslib.com)

 [www.manualslib.de](http://www.manualslib.de)

 [www.manualslib.es](http://www.manualslib.es)

 [www.manualslib.fr](http://www.manualslib.fr)

 [www.manualslib.nl](http://www.manualslib.nl)

 [www.manualslib.mx](http://www.manualslib.mx)

 [www.manualslib.tech](http://www.manualslib.tech) 30+ languages