



IDENTIFICAÇÃO

Cartão: 600

Nome: WP 0261 ROT

Tarefa: 38100026369

Duração : 1:30

Bater? N

Concor? N

Tipo: INSPEÇÃO

OM: PAMASP

PN: UH-60L

CFF: 78286

Nomenclatura: AERONAVE, ASA ROTATIVA, H-60 BLACK

Identif: 15 300 640

Type: LUBRIFICATION

Categoria:

Publicação: EM 0013

CFF : AL66\$

Seção:

Rev: 2019

Cap: LUBR

CFF:

Nomenclatura:

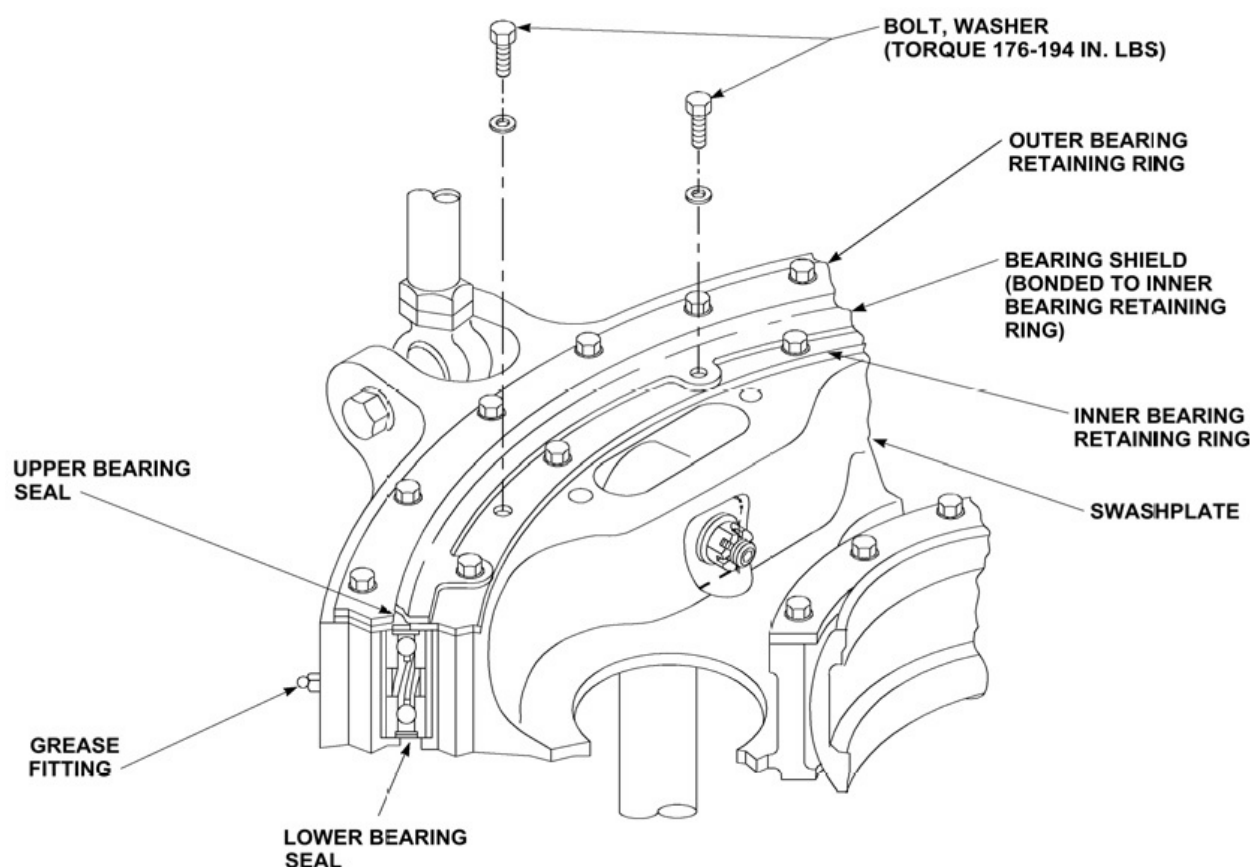
Posição:

Obs: WP CUMPRIDA NA 360H E 12M.

Área: 006 - MAIN ROTOR PYLON SECTION

Zona: 006 - MAIN ROTOR AREA

FIGURA

AK1954A
SA

TEXTO

Every 360 Hours/12 Month (ROT)

CAUTION

. Lubricate swashplate every 360 hours or 12 months, whichever comes first. More frequent lubrication, or using too much grease will not improve bearing life and will cause helicopter to be sprayed with grease.



. Do not try to remove the bearing shield from the bearing retaining ring. Damage to the bearing shield/bearing retaining ring will result.

. If swashplate assembly is not installed on aircraft, the stationary swashplate must be supported prior to removal of the inner bearing retainer ring. Failure to do so will result in separation of the stationary and rotating swashplate.

1. Turn main rotor head until red index marks on rotating and stationary swashplates line up. Engage gust lock.

CAUTION

Damage to swashplate will result if hydraulic power is applied or the flight controls moved while inner bearing retainer assembly is removed. Rotating swashplate will raise above stationary swashplate causing extensive damage to swashplate assembly. Make sure that hydraulic power is off and that cockpit flight controls are tagged as DO NOT MOVE while inner bearing retainer is removed.

NOTE

33 bolts must be removed from inner bearing retainer ring in order bearing seal.

2. Remove bolts and washers holding inner bearing retainer ring to swashplate (Figure 1).

3. Slide retainer ring to one side so upper bearing seal can be seen.

CAUTION

Damage to bearings will result if pressure lubrication system is used to lubricate bearings. Use only hand-operated lubricating gun. (WP 3721, Item 114).

NOTE

For replacement swashplate, assemblies built-up over 12 months prior to installation, lubricate swashplate until approximately 5 cubic 5 cubic inches of grease has been purged from upper and lower bearing seal at each grease fitting (approximately 20 cubic inches total).

4. Lubricate bearings through four fittings on rotating swashplate with hand-operated lubricating gun using aircraft grease (WP 3722, Item 188).



5. Stop lubricating when grease seeps out of either upper or lower bearing seal (normally within 10 inches of fitting).
6. Wipe off extra grease in seal area.
7. Install retainer assembly by aligning red index marks and securing with bolts and washers. Make sure all 9 tabs of shield receive a bolt. TORQUE BOLTS TO 176 - 194 INCH-POUNDS.
8. Release gust lock.

TAREFA ESPECIFICA AOS SEGUINTE EQUIPAMENTOS

Matrícula SN

Aplicada a todos os equipamentos

TAREFA ESPECIFICA AOS SEGUINTE MODELOS

Sigla Descrição

Aplicada a todos os Modelos

RECURSOS HUMANOS

Especialidade/Subespecialidade	Atividade	H/h	Qtde Recursos	Total
ROT - ROTORES	TÉCNICO	1:30	2	3:00

QUALIFICAÇÕES

Código	Descrição
H60L	CURSO DE MECÂNICA GERAL DO HELICÓPTERO H-60 (BLACKHAWK)

INSPEÇÕES ONDE A TAREFA É UTILIZADA

INSPEÇÃO	DESCRIÇÃO	FASE	DESCRIÇÃO
INSP-12M	INSPEÇÃO CALENDÁRICA DE 12 MESES	1	INSPEÇÃO
PMS-360	INSPEÇÃO PERIÓDICA DE 360H	1	INSPEÇÃO

FIM DA TAREFA