V2.1.1 AMS Lift Rack Assembly Instructions for P2/X2 and P1/X1 Printers

Screw the 4 parts of the riser together using the bow ties and BT3x8mm screws.

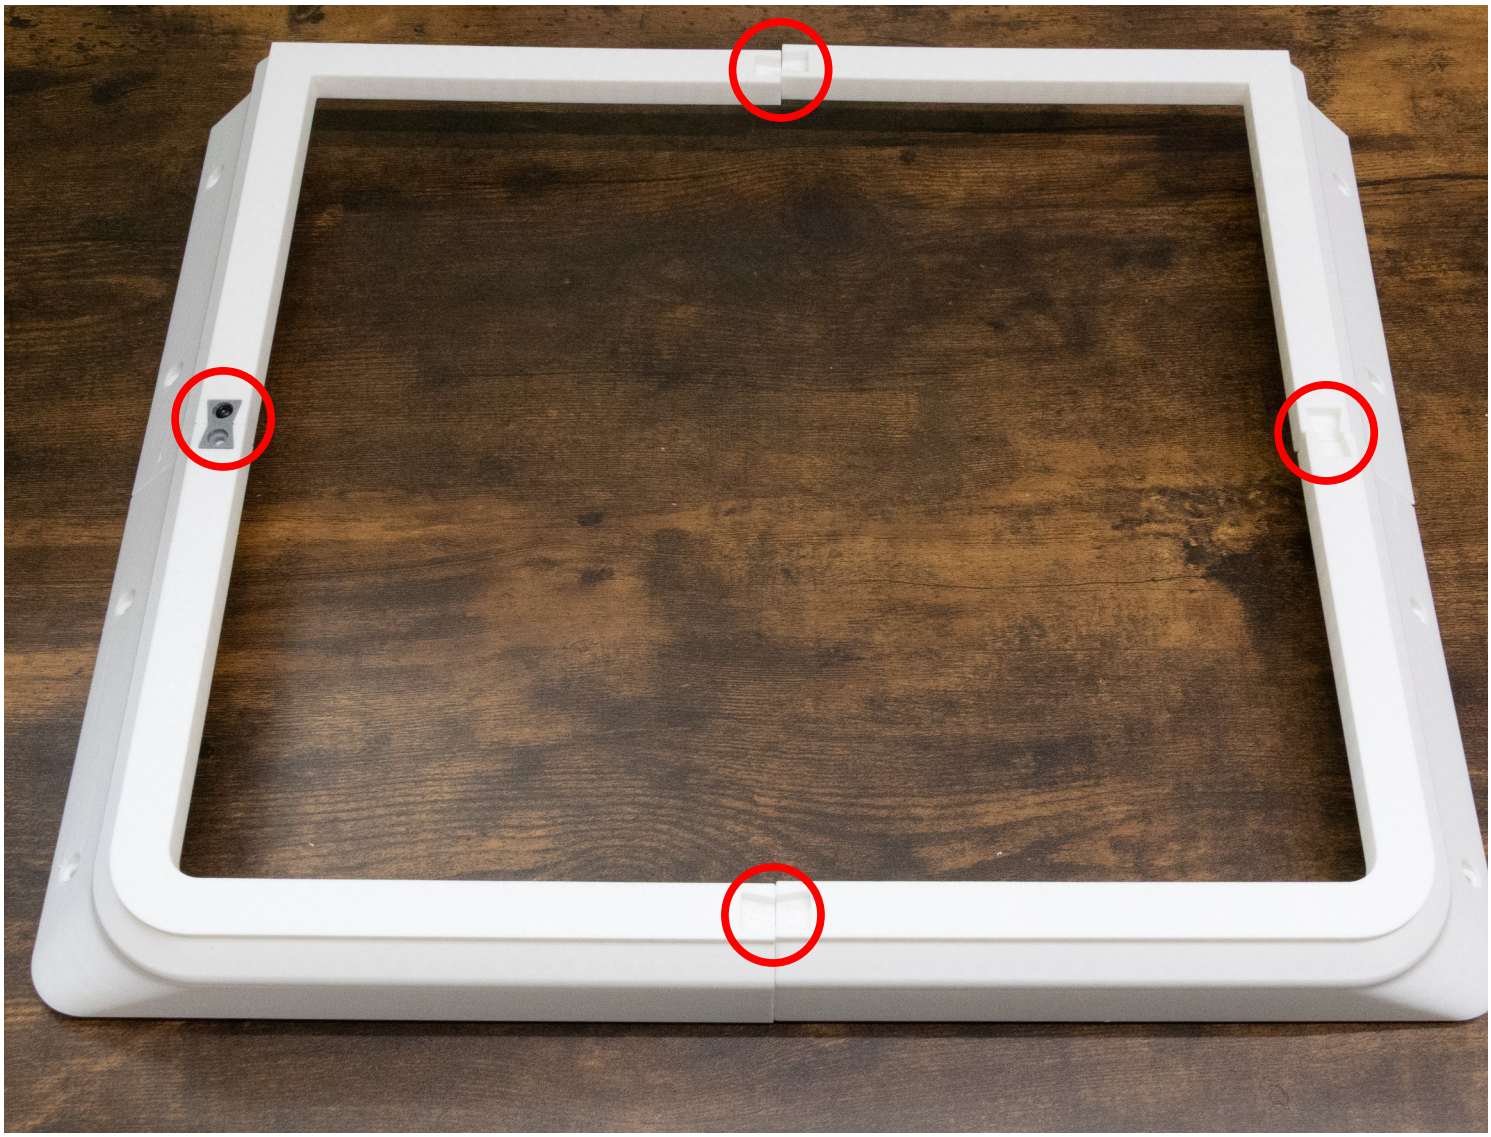

Screw the tops of the riser together using 3 BT3x12 screws.

Install adhesive foam where the top plate will sit and trip as needed.

If installing LEDs Place the cable in the channel and set down the riser on the printer.

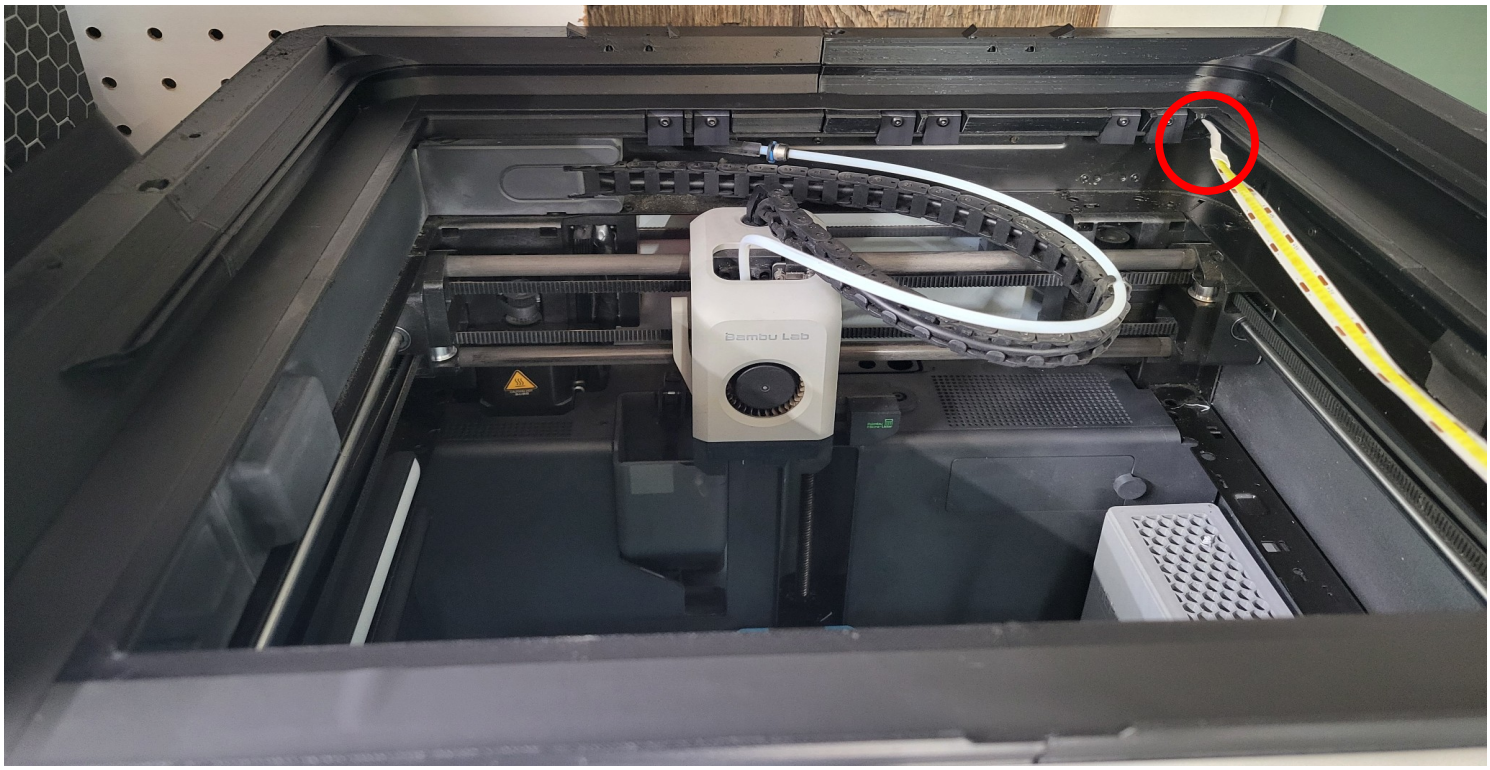

Install riser on printer with the 7 tie down hooks. Use BT3x12 screws. Note the front one is labeled with an F.

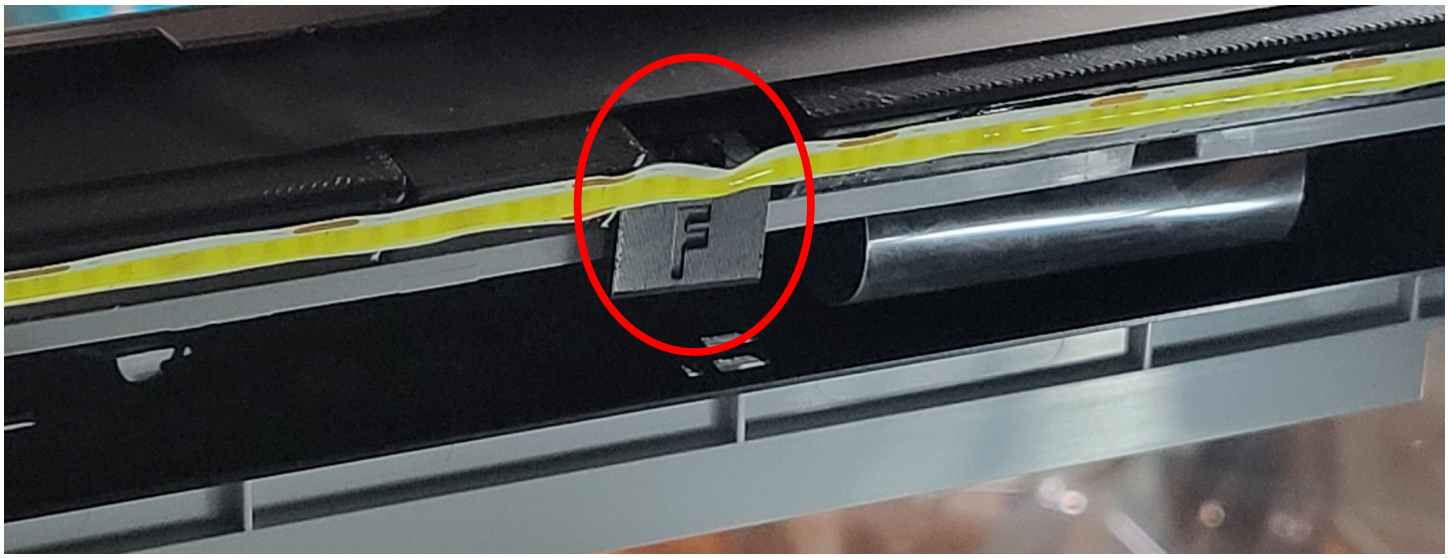

If installing LEDs; install LED strip(s) on the riser on the 12mm wide angled part.

Install the drawer slides onto the bottom AMS holders as shown using the included screws.

Install the bearing shafts to the base using 16 BT3x12 screws.

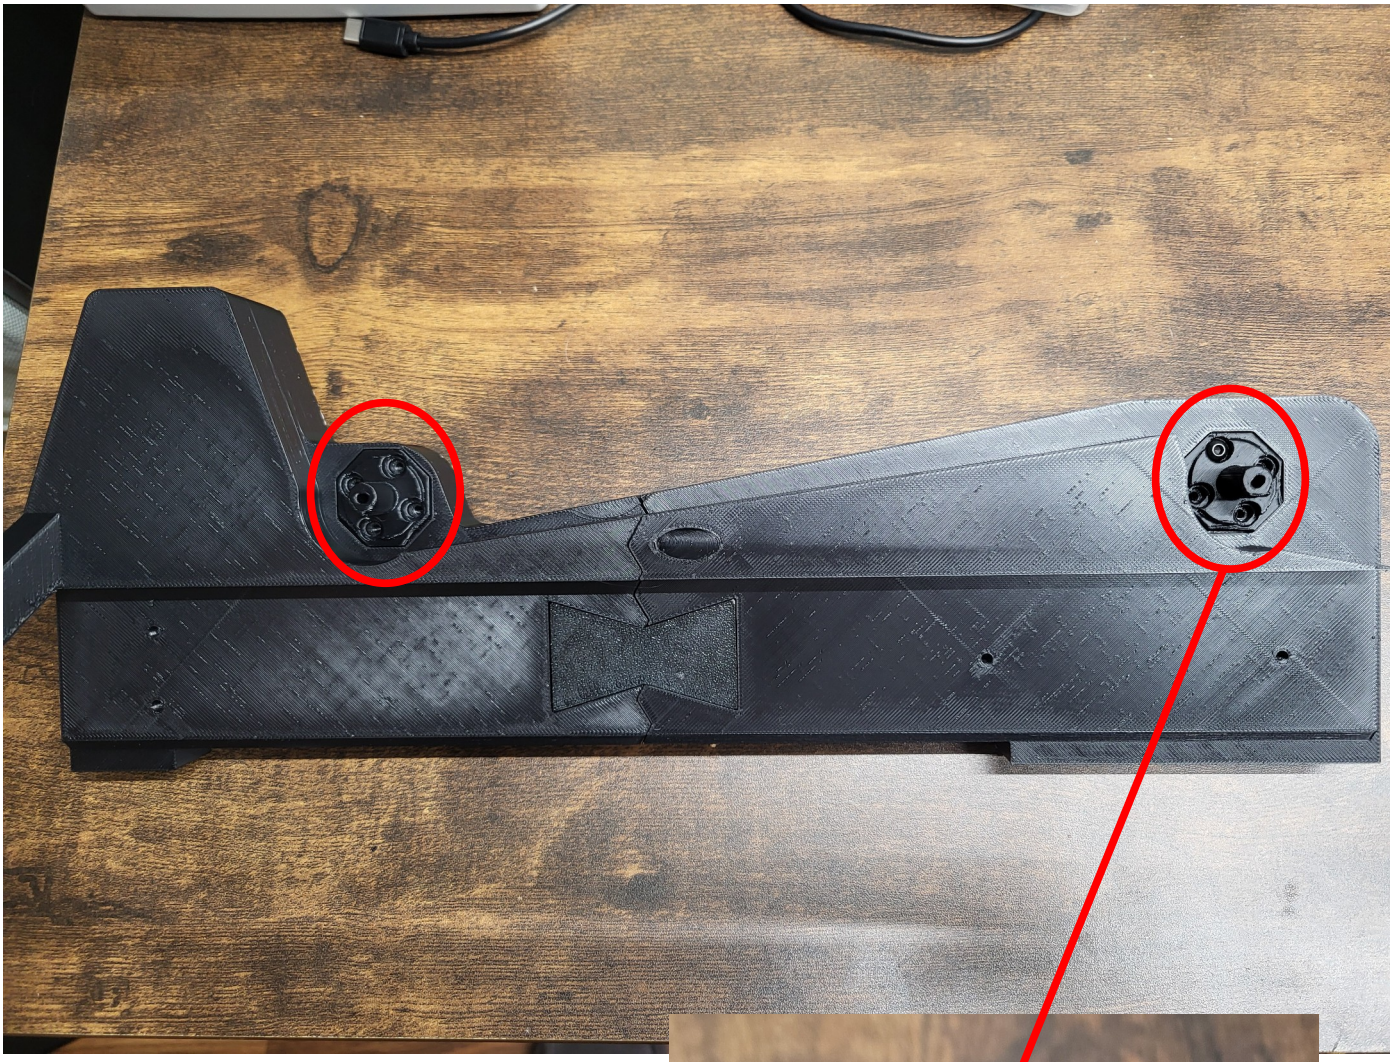

Assemble the two halves of the AMS base together using a BT3x12 screw and the bow tie.

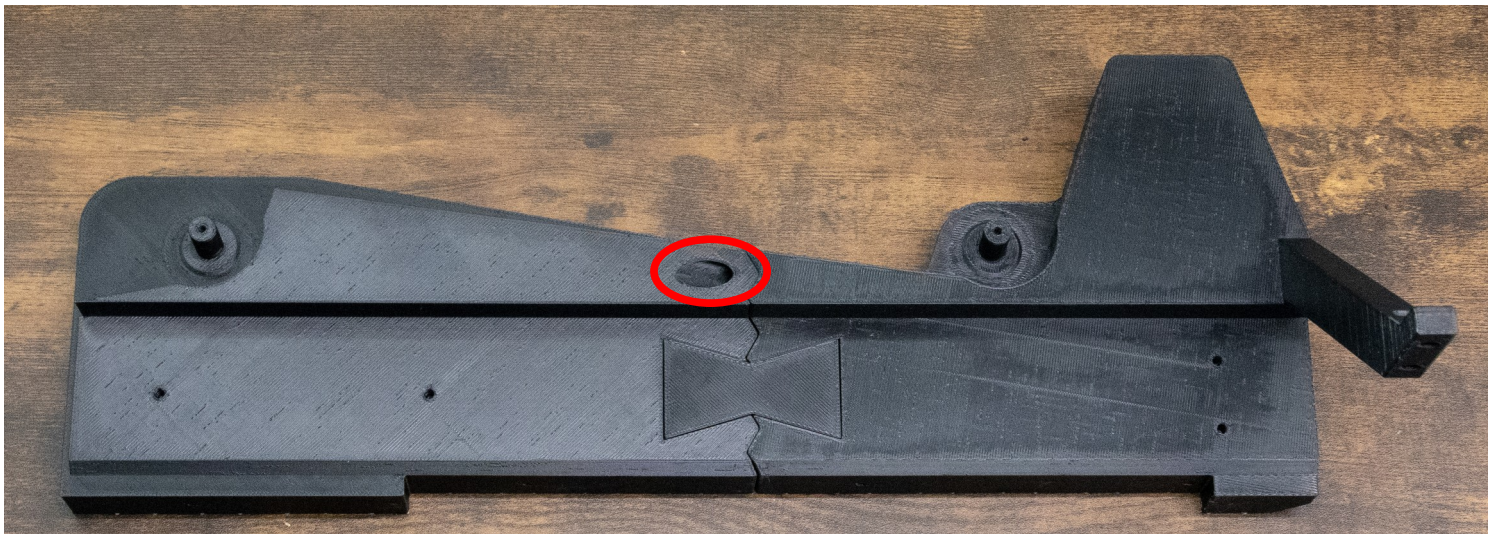

Install the drawer slide on the AMS base using the included screws.

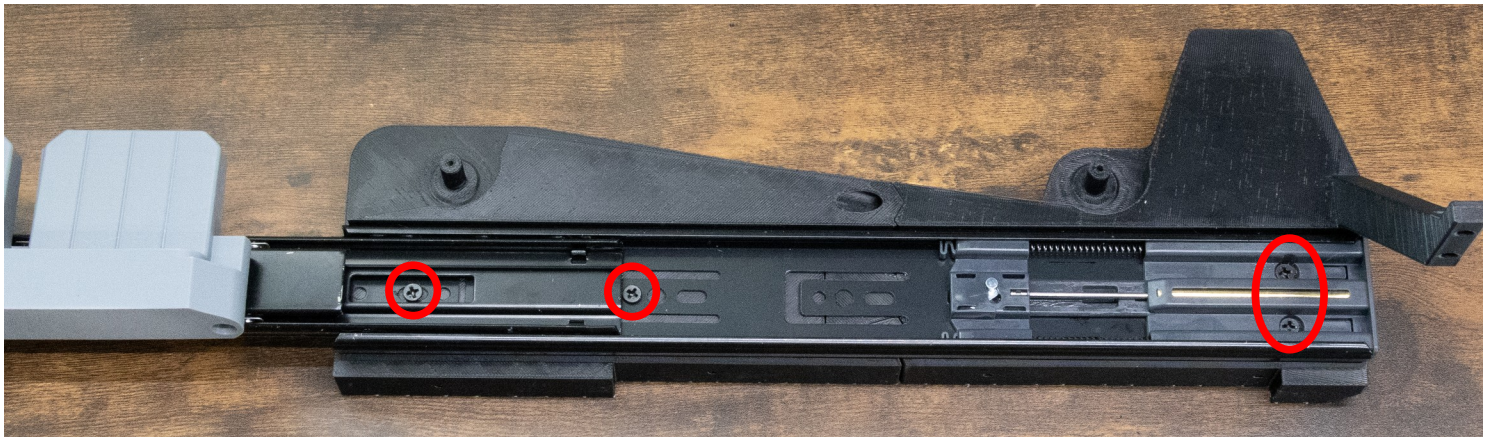

Install the arms on the base with the rear in the rear and the words facing inwards. It may need to be pressed in place with a bench vise, clamp or mallet.

Install the caps over the bearings using BT3x20 screws.

Press lifter bars onto the top AMS holder making sure the orientation is correct. It may need to be pressed in place with a bench vise, clamp or mallet.

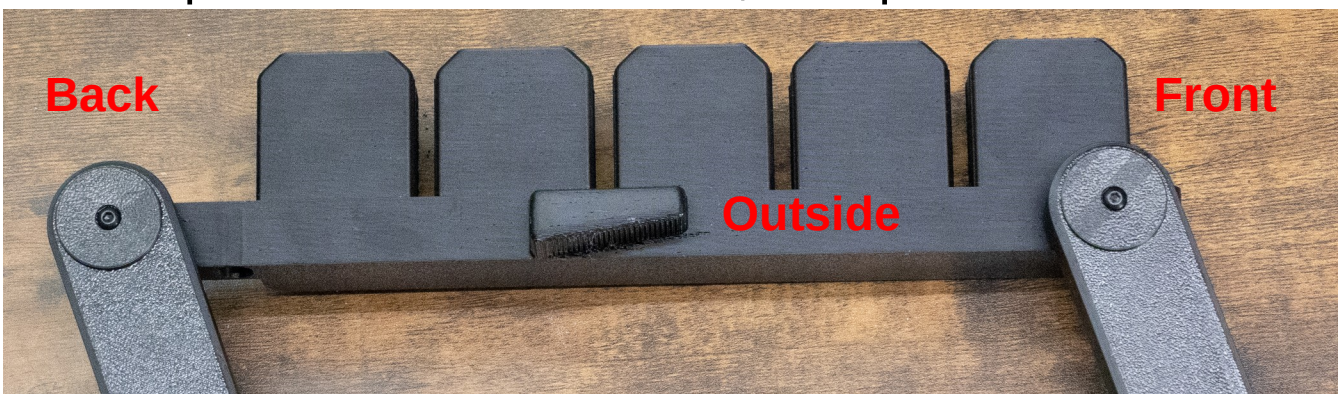

Install the caps over the bearings using BT3x20 screws.

See photo below for orientation reference

Install the gas strut hardware on the rear arm and front of the AMS base using the included screws.

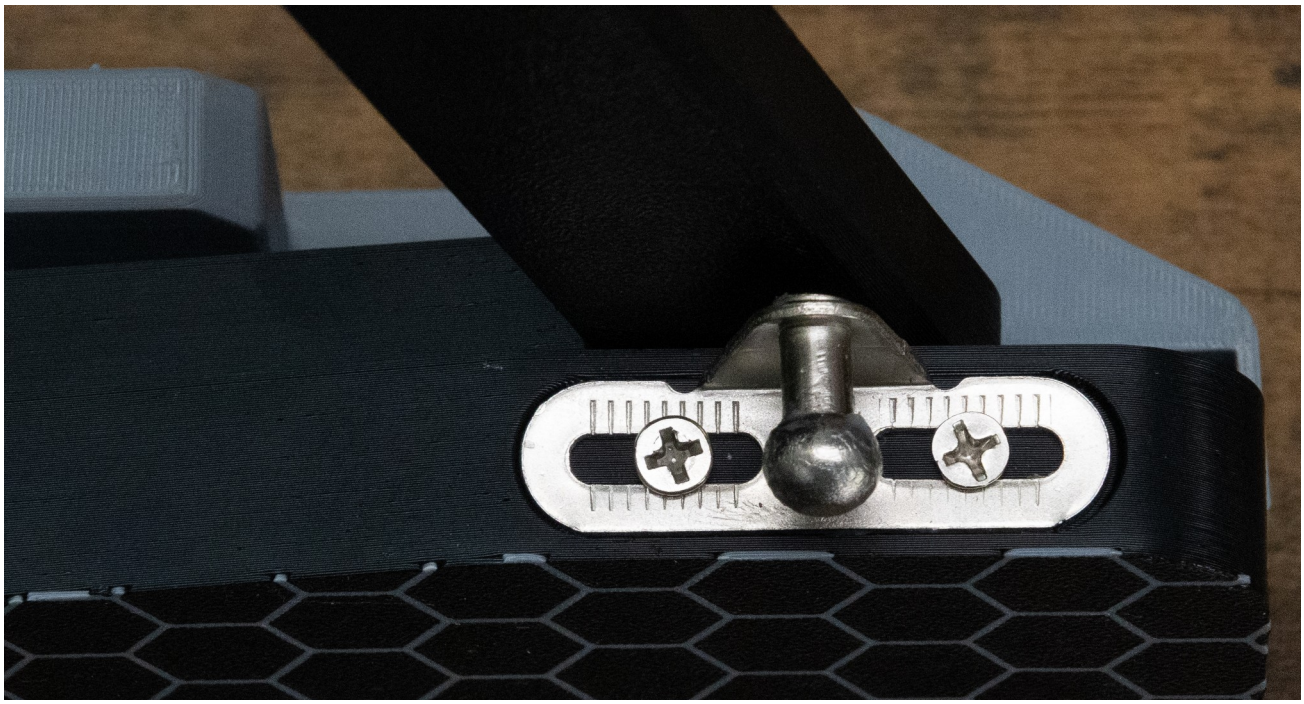

Install the Gas strut on each side.

Place on printer riser and install 4 BT3x12 screws in the back braces.

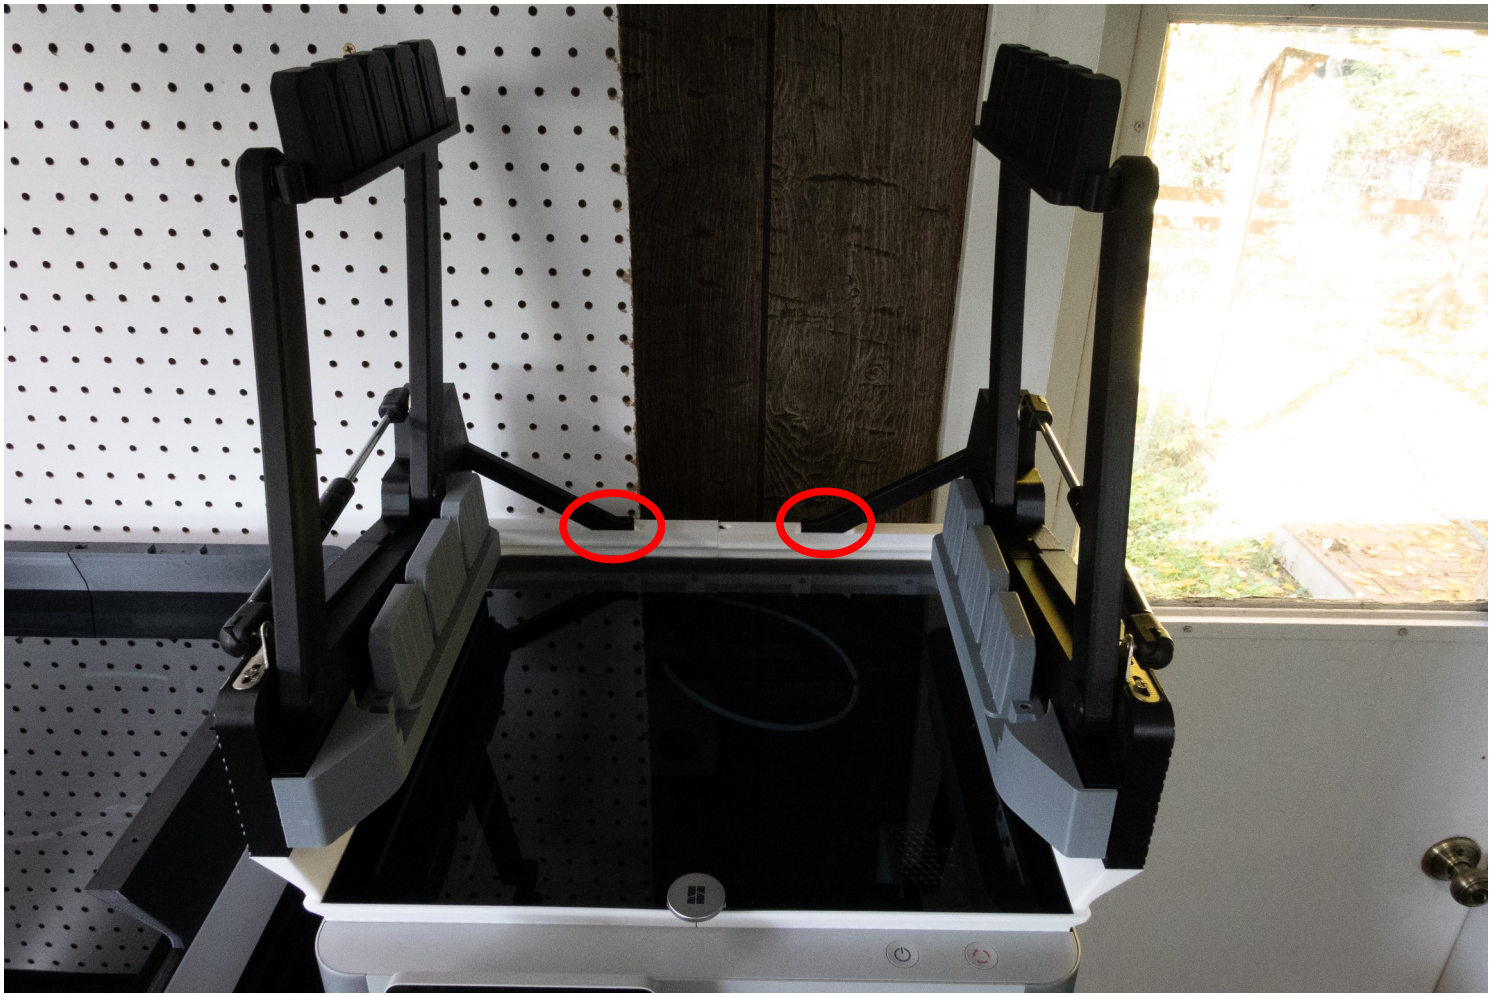

Insert whichever modules you want on the sides.

Using 8 BT3x18 screws screw the AMS base and modules to the risers.

If using AMS HT on either side screw in the top to the base using BT3x12 screws.

Place the bottom AMS on the bottom holders. Then secure it with at least 2 or up to 4 BT3x12 screws.

Place the top AMS on the top mounts and secure it with 4 BT3x12 screws.

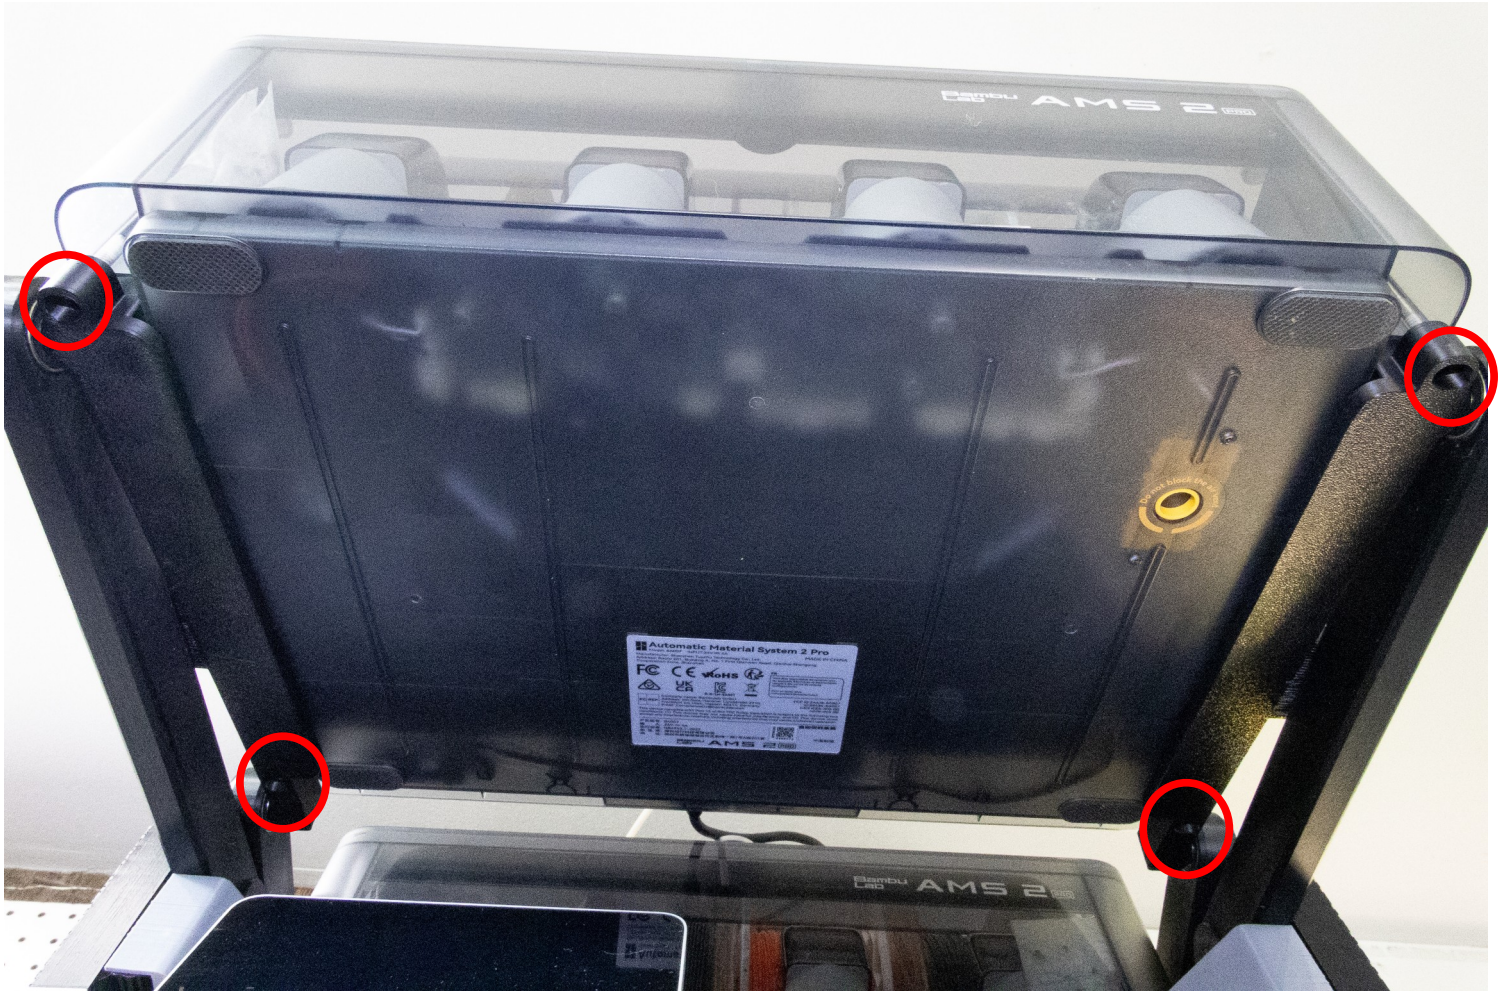

If mounting AMS HT unit(s) place on mount and secure with 3 BT3x12 screws for each one.

Plug in the AMS units as illustrated

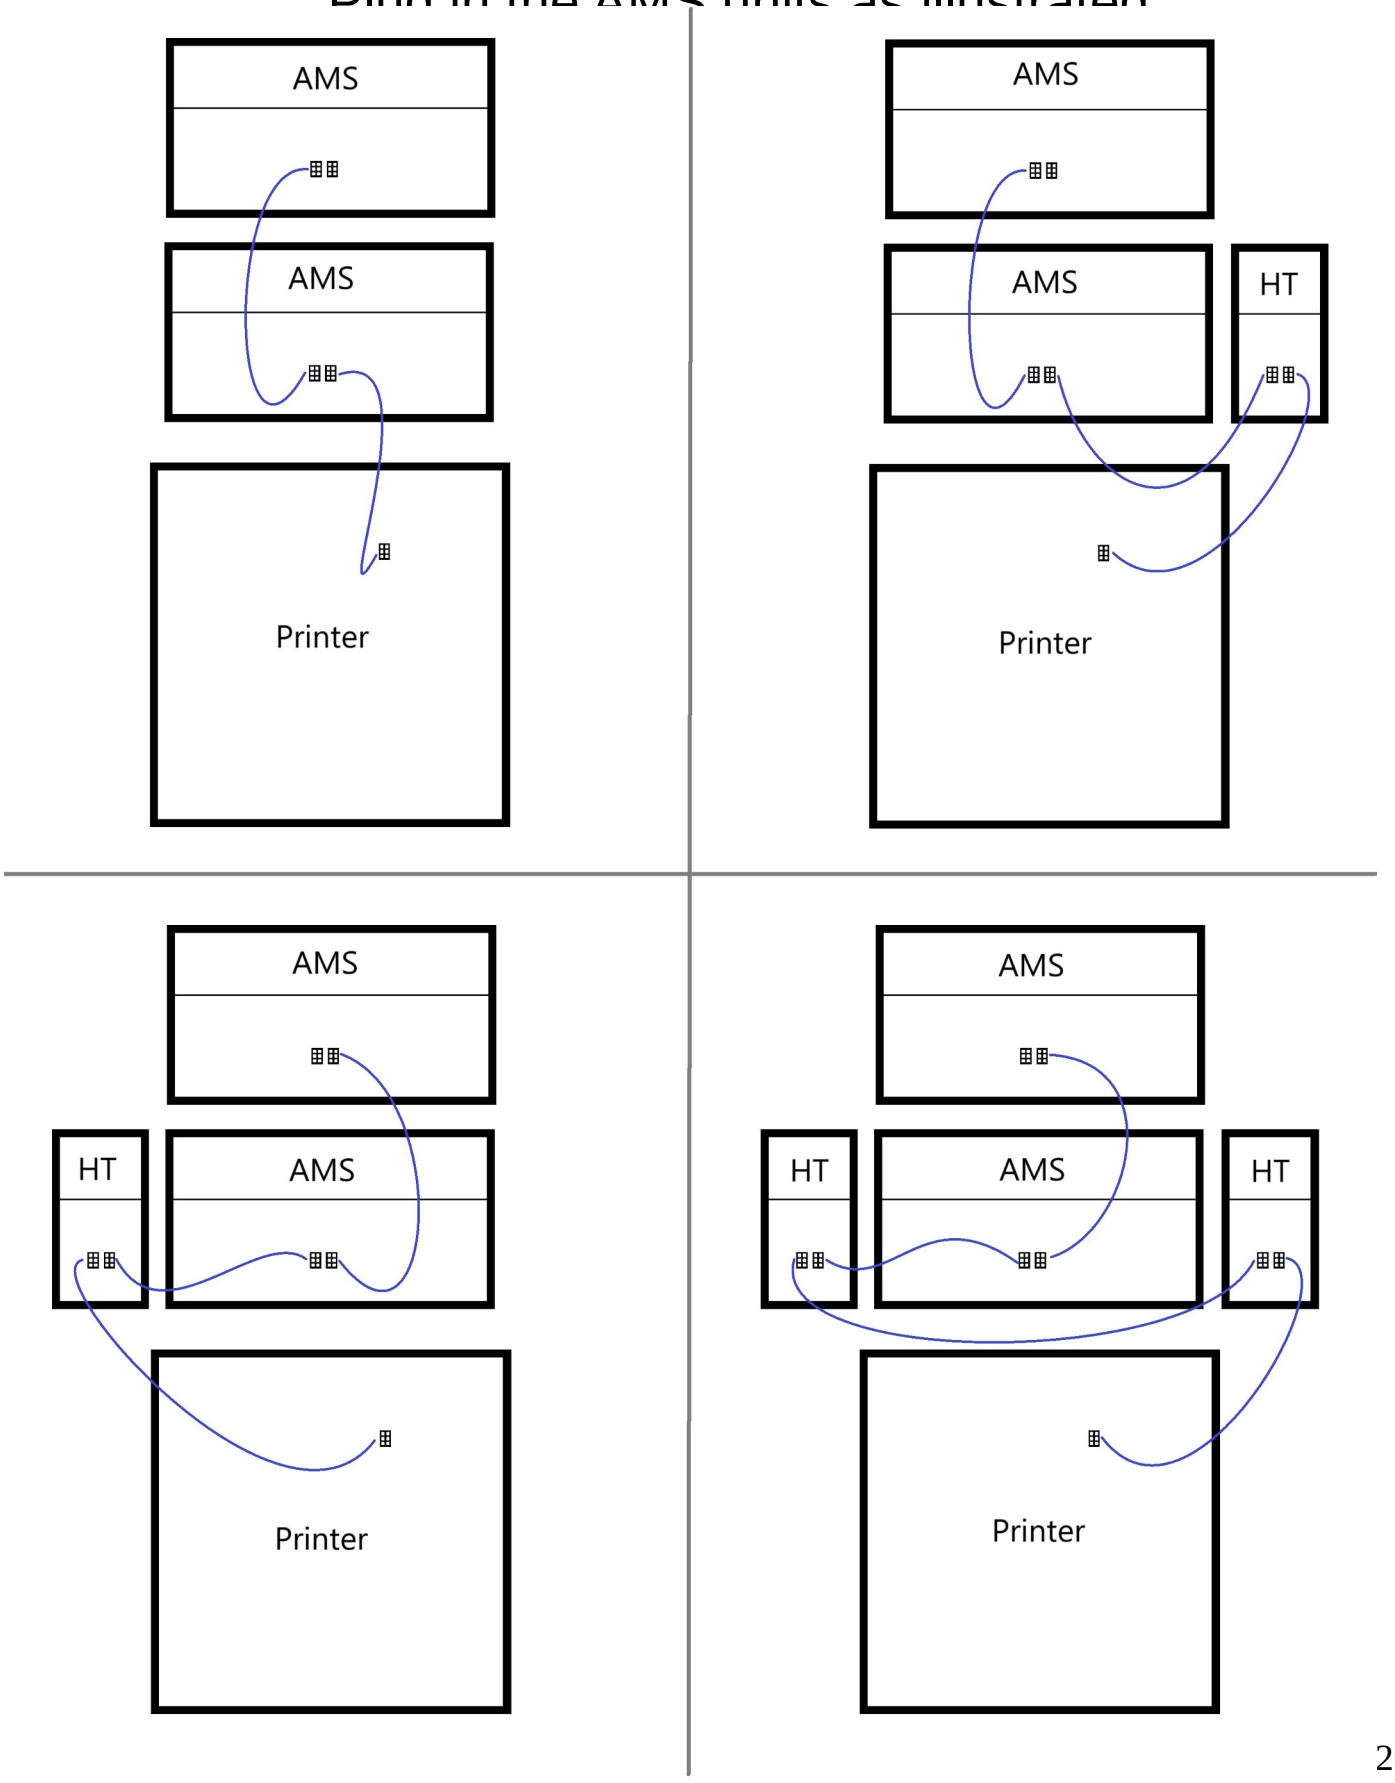

Enjoy!

Please boost me and drop a comment if you like my work!