
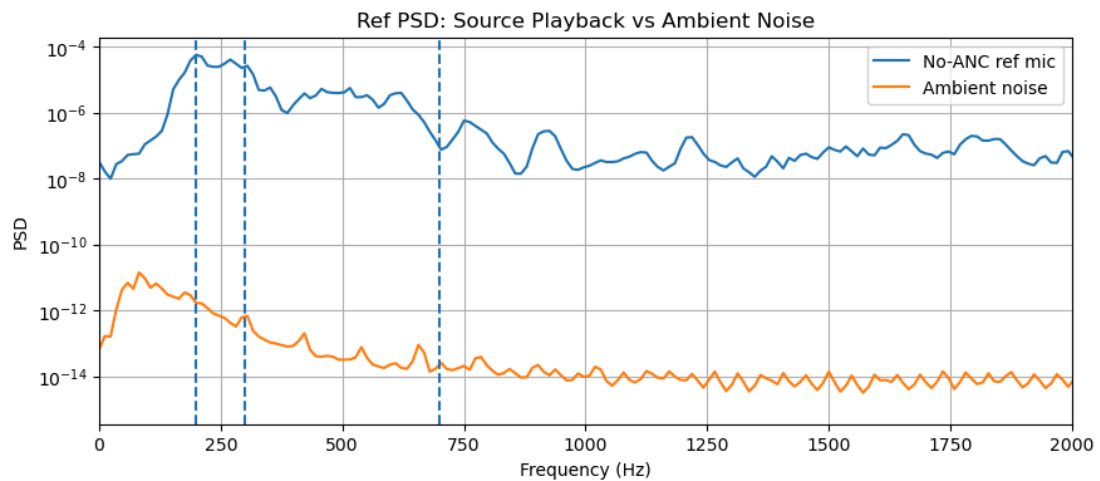
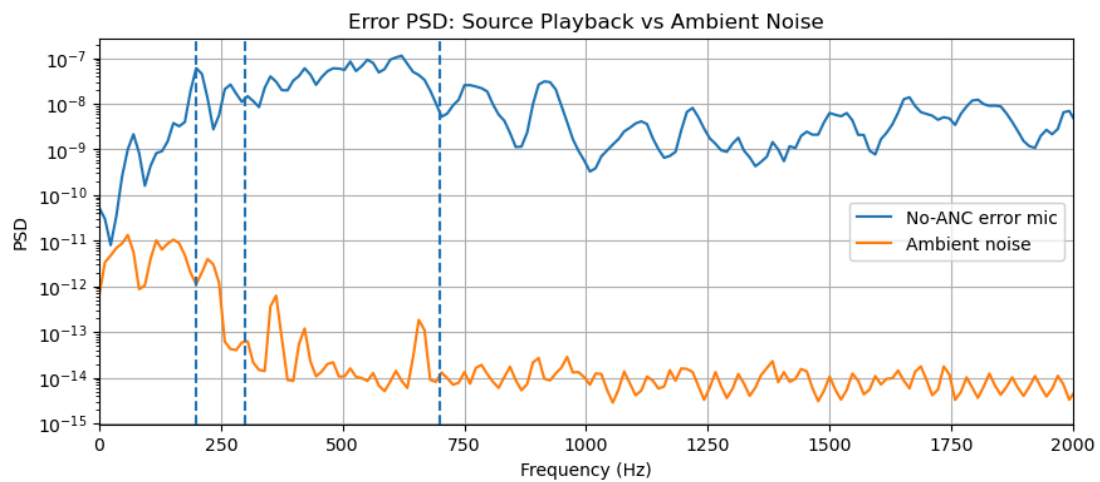


The noise is negligible

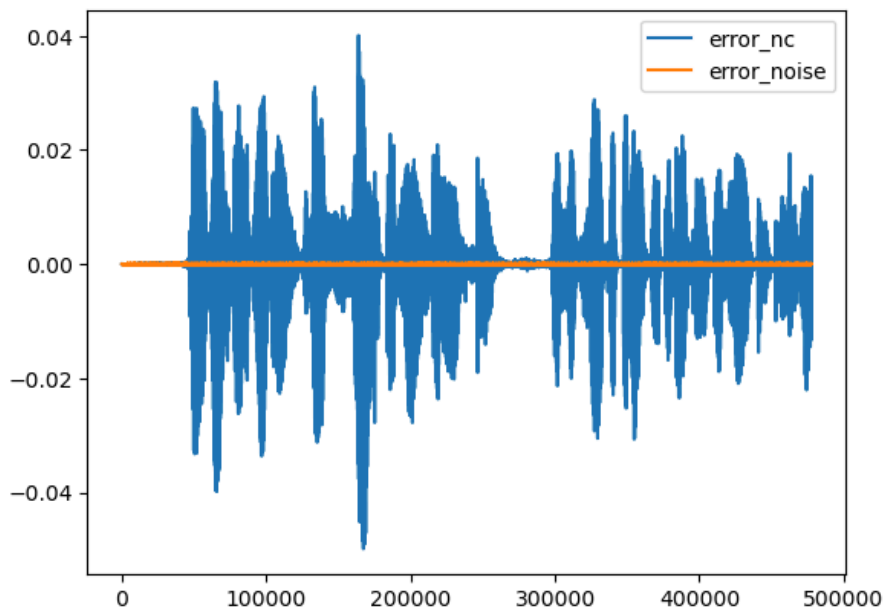

Distorted power distributions

- Ref power distribution is massively skewed from what the error mic records
- Ref mic was like right up next to the cone, possibly causing the skew
- Error mic recordings from the panel also change with distance, but less dramatically

	Played from source speaker					Played from panel		
Band	Error (reverb)	Old ref	Centered ref	Far ref		Error 4.5cm	Error 11cm	Error 29cm
0-200 Hz	1.86	22.24	21.11	13.52		10.64	5.24	2.77
200-300 Hz	11.88	48.03	46.05	33.52		37.12	30.68	43.35
300-700 Hz	62.69	26.98	28.68	41.89		46.77	51.91	38.05
700-1k Hz	8.77	0.91	1.16	2.72		1.39	3.93	10.90
1k-2k Hz	8.49	1.36	2.11	5.56		3.66	7.39	4.44
2k-5k Hz	6.62	0.48	0.89	2.79		0.42	0.85	0.48

Other Findings

- For IR length, 256 > 192 > 384 > 512
- 4.5cm error mic > 11cm
- Fx-LMS > LMS
- mu/leak schedules do help stabilize longer cancellation, more testing needed
- Freezing the weights after 2 iterations gets consistent performance in longer runs

Somehow it's kind of stable now?

-3.72 dB

