FAULT REPORT: 1

PAMAS
Tel: 67560820

Company
STMicroelectronics

Division
AMK 6E


Date
16 Dec 2025

Time
17:02 P.M.


Repair Priority		
	Repair immediately	
	Repair as soon as possible	
	Repair at next Shut-down	✓
	No repair require, continue monitoring	

Emissivity Setting	0.85

Bx1 - max fault temp.	66	°C
Bx2 - max reference temp.	53	
△T = (Bx1 - Bx2)	13	
T_{amb} - Ambient Temp.	22	

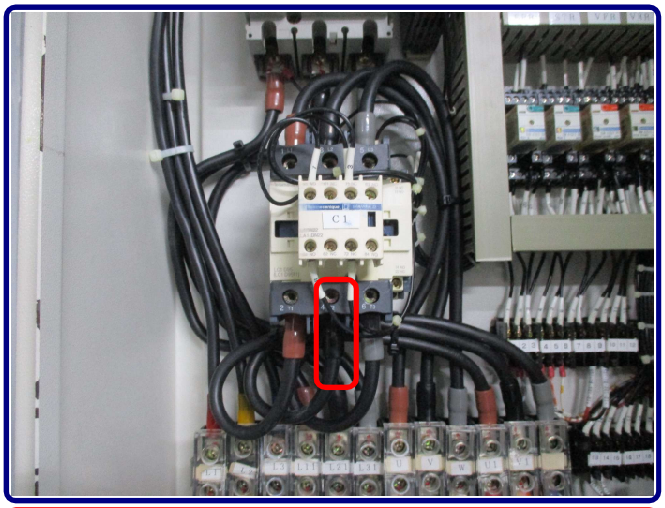

Phase
L2

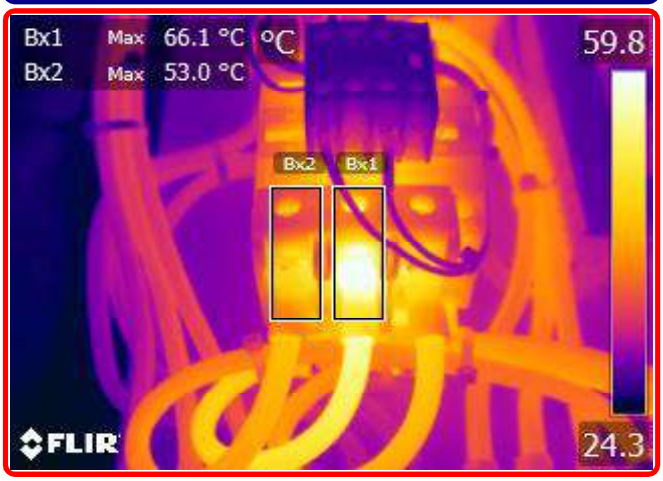

LOAD CURRENT (Amps)		Rated	Measured (Ave.)	% Load
	L1	---	51	-%
	L2		51	-%
	L3		49	-%
	N		-	-

Location
Level 5

Rooftop Electrical Room (LT-6E-5W-1)

Description
6E-EHF-19-301 (100A).
'C1' Contactor (Telemecanique LC1 D95) ,
poor contact at the bottom L2 phase cable / internal terminations.

Recommended corrective action and remarks
Remove all the incoming & outgoing L1, L2 & L3 phase terminations from the contactor. Trim the cables and replace the cable lugs. Clean the contactor terminals. Re-terminate the cables back to the contactor and tighten.