# Q01299 Calibration Card

Patrick Schmitz

October 18, 2010

#### 1 Net Radiometer Calibrations

	Serial	Pos	Neg
1	Q01299	9.50	12.06

Table 1: Fit Calibrations

#### 2 Positive Fluxes

	Estimate	Std. Error	t value	Pr(> t )
Q01299	9.5007	0.0069	1367.72	0.0000

Table 2: Positive Flux Fit Estimates

	Df	Sum Sq	Mean Sq	F value	Pr(>F)
Q01299	1	402225698.07	402225698.07	1870669.45	0.0000
Residuals	6989	1502753.68	215.02		

Table 3: Positive Flux ANOVA

# 3 Negative Fluxes

	Estimate	Std. Error	t value	Pr(> t )
Q01299	12.0633	0.0069	1752.77	0.0000


Table 4: Negative Flux Fit Estimates


	Df	Sum Sq	Mean Sq	F value	Pr(>F)
Q01299	1	27084524.85	27084524.85	3072192.15	0.0000
Residuals	10282	90646.38	8.82		


Table 5: Negative Flux ANOVA

## 4 Fit Plots

## **Reference Measurements**

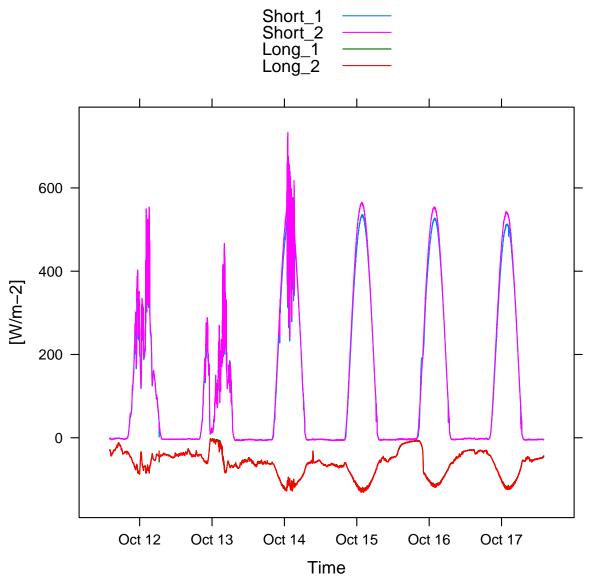

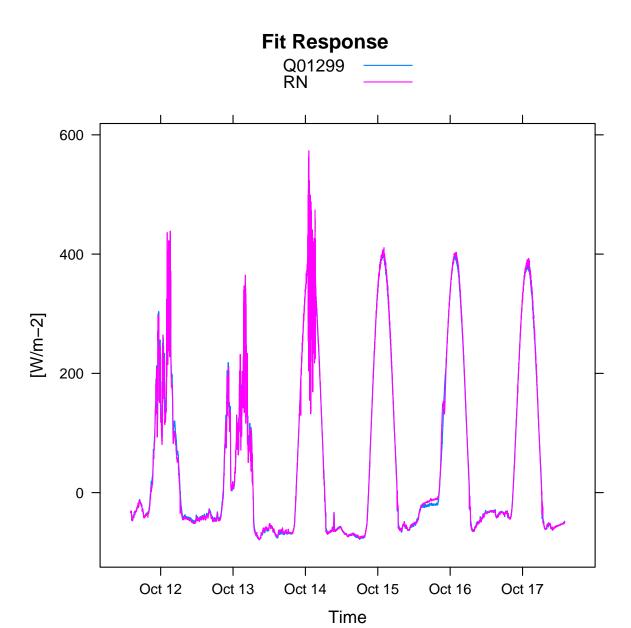

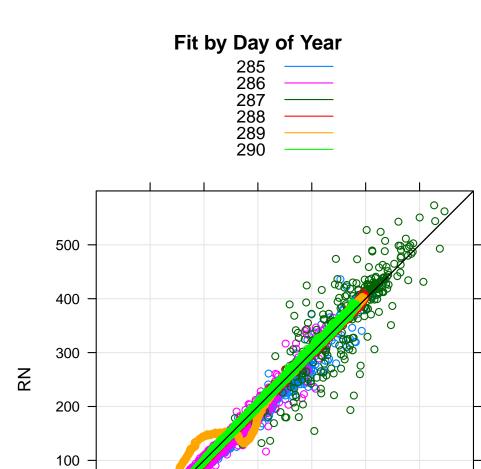

Q01299