

HiSilicon IP Camera Image Quality Test Standards

Issue 00B01

Date 2016-05-20

Copyright © HiSilicon Technologies Co., Ltd. 2016. All rights reserved.

No part of this document may be reproduced or transmitted in any form or by any means without prior written consent of HiSilicon Technologies Co., Ltd.

Trademarks and Permissions

**HISILICON*, and other HiSilicon icons are trademarks of HiSilicon Technologies Co., Ltd.

All other trademarks and trade names mentioned in this document are the property of their respective holders.

Notice

The purchased products, services and features are stipulated by the contract made between HiSilicon and the customer. All or part of the products, services and features described in this document may not be within the purchase scope or the usage scope. Unless otherwise specified in the contract, all statements, information, and recommendations in this document are provided "AS IS" without warranties, guarantees or representations of any kind, either express or implied.

The information in this document is subject to change without notice. Every effort has been made in the preparation of this document to ensure accuracy of the contents, but all statements, information, and recommendations in this document do not constitute a warranty of any kind, express or implied.

HiSilicon Technologies Co., Ltd.

Address: **Huawei Industrial Base**

> Bantian, Longgang Shenzhen 518129

People's Republic of China

Website: http://www.hisilicon.com

Email: support@hisilicon.com

i

About This Document

Overview

- This document defines test standards for the image quality of HiSilicon IP cameras by specifying detailed test methods and test standards of each test item.
 - The standards provide technical guidance for the image quality verification of HiSilicon IP cameras.
 - The standards also describe test requirements of HiSilicon for the image quality of IP cameras, providing a reference for internal decision-making in HiSilicon. Such standards are applicable to the IP camera module in terms of specification formulation, product design, and quality control.
- According to test types, test items related to the image quality of IP cameras as described in this document can be divided into three test categories:
 - Specifications
 - Scenarios
 - Outdoor scenarios
- Test equipment and software that are required by the preceding test items include:
 - Hardware equipment: test light box with multiple light sources, such as D65, TL84, and F; color temperature and illuminance meter; uniform light source with adjustable brightness; various charts, including the Color Checker (24-patch) Chart, ISO12233 Chart (1x, 2x, and 4x), Kodak Gray Scale Chart Q14, and FOV Chart.
 - Software: Imatest, IPOP, Elecard, HYRes, Paint, and others
 - Other tools: triangular support, ruler, spotlight, and others

Product Versions

The following table lists the product versions related to this document.

Product Name	Product Version
Hi3516A	V100
Hi3516D	V100
Hi3518E	V200
Hi3518E	V201
Hi3516C	V200

Product Name	Product Version
Hi3519	V100
Hi3519	V101
Hi3516C	V300

Intended Audience

This document is intended for:

- Technical support engineers
- Software development engineers

Reference Standards and Documents

- Technical Requirements and Test Methods for Visual Transmission Characteristics of Mobile Terminal, Chinese national standards released on October 1, 2007
- *Technical Requirements for Imaging Performance of Camera Phones* released by National Quality Supervision and Testing Center for Cameras in 2006
- *Mobile Imaging Evaluation Process and Standards V1.1* released by OmniVision Technologies Inc. on December 22, 2008
- Test standards for the image quality of IP camera modules, which are formulated by IP camera module manufacturing enterprises, such as BYD and Foxconn
- Test standards for the image quality of terminals, which are formulated by competitors, such as Texas Instruments and Ambarella
- HD TV and Video Camera Measurement Methods for Security Video Surveillance 110329 (CJ)

Acronyms and Abbreviations

The following table lists the acronyms and abbreviations used in this document as well as their full names.

Acronym or Abbreviation	Full Name		
AWB	automatic white balance		
FOV	field of view		
WDR	wide dynamic range		



Change History

Changes between document issues are cumulative. Therefore, the latest document issue contains all changes made in previous issues.

Issue 00B01 (2016-05-20)

This issue is the first draft release.



Contents

1.1 Resolution	
1.1.1 Test Purpose	
1.1.2 Test Equipment	
1.1.3 Test Software	
1.1.4 Test Environment	
1.1.5 Test Procedure	
1.1.6 Resolution Reading	Method
1.1.7 Test Standard	
1.2 Color Reproduction	
1.2.1 Test Purpose	
1.2.2 Test Equipment	
1.2.3 Test Software	
1.2.4 Test Environment	
1.2.5 Test Procedure	
1.2.6 Calculation Method.	
1.2.7 Test Standard	
1.3 White Balance	
1.3.1 Test Purpose	
1.3.2 Test Equipment	
1.3.3 Test Software	
1.3.4 Test Environment	
1.3.5 Test Procedure	
1.3.6 Calculation Method.	
1.3.7 Test Standard	
1.4 Gray Scale	
•	
1.4.3 Test Software	
1.4.4 Test Environment	
1.4.5 Test Procedure	

1.4.6 Calculation Method	11
1.4.7 Test Standard	11
1.5 Wide Dynamic Range	11
1.5.1 Test Purpose	11
1.5.2 Test Equipment	
1.5.3 Test Environment	
1.5.4 Test Procedure	
1.5.5 Calculation Method	
1.5.6 Test Standard	
1.6 Delay	
1.6.1 Test Purpose	
1.6.2 Test Equipment	
1.6.3 Test Software	
1.6.4 Test Environment	
1.6.5 Test Procedure	
1.6.6 Calculation Method	
1.6.7 Test Standard	
1.7 Allowed Lowest Illumination	12
1.7.1 Test Purpose	12
1.7.2 Test Equipment	14
1.7.3 Test Software	14
1.7.4 Test Environment	14
1.7.5 Test Procedure	14
1.7.6 Calculation Method	
1.7.7 Test Standard	
1.8 Bit Rate Control	
1.8.1 Test Purpose	
1.8.2 Test Equipment	
1.8.3 Test Software	
1.8.4 Test Environment	
1.8.5 Test Procedure	16
1.8.6 Calculation Method	16
1.8.7 Test Standard	16
1.9 Signal-to-Noise Ratio	16
1.9.1 Test Purpose	16
1.9.2 Test Equipment	16
1.9.3 Test Software	
1.9.4 Test Environment	
1.9.5 Test Procedure	
1.9.6 Calculation Method	17
1.9.7 Test Standard	
1.10 Brightness Uniformity	18

	1.10.1 Test Purpose	18
	1.10.2 Test Equipment	18
	1.10.3 Test Software.	18
	1.10.4 Test Environment	18
	1.10.5 Test Procedure	18
	1.10.6 Calculation Method	18
	1.10.7 Test Standard	19
	1.11 Distortion or Geometrical Distortion.	19
	1.11.1 Test Purpose	19
	1.11.2 Test Equipment.	19
	1.11.3 Test Software	20
	1.11.4 Test Environment	20
	1.11.5 Test Procedure	20
	1.11.6 Calculation Method	20
	1.11.7 Test Standard	21
	1.12 Field of View	21
	1.12.1 Test Purpose	21
	1.12.2 Test Equipment	21
	1.12.3 Test Software	21
	1.12.4 Test Environment	21
	1.12.5 Test Procedure	21
	1.12.6 Calculation Method	22
	1.12.7 Test Standard	23
2 5	Scenarios	24
	2.1 Image Edge	24
	2.1.1 Test Purpose	24
	2.1.2 Test Equipment	24
	2.1.3 Test Environment	24
	2.1.4 Test Procedure	24
	2.1.5 Key Dimensions	24
	2.2 Static Scenario	24
	2.2.1 Test Purpose	24
	2.2.2 Test Equipment	24
	2.2.3 Test Environment	25
	2.2.4 Test Procedure	25
	2.2.5 Key Dimensions	25
	2.3 Personage Scenario	25
	2.3.1 Test Purpose	25
	2.3.2 Test Equipment	25
	2.3.3 Test Environment	25
	2.3.4 Test Procedure	25

2.3.5 Key Dimensions	26
2.4 Long Shot Scenario	26
2.4.1 Test Purpose	26
2.4.2 Test Equipment	26
2.4.3 Test Environment	26
2.4.4 Test Procedure	26
2.4.5 Key Dimensions	26
2.5 WDR Scenario	26
2.5.1 Test Purpose	26
2.5.2 Test Equipment	26
2.5.3 Test Environment	26
2.5.4 Test Procedure	27
2.5.5 Key Dimensions	27
2.6 Low-Illumination Scenario	27
2.6.1 Test Purpose	27
2.6.2 Test Equipment	27
2.6.3 Test Environment	27
2.6.4 Test Procedure	27
2.6.5 Key Dimensions	28
2.7 Infrared Scenario	28
2.7.1 Test Purpose	28
2.7.2 Test Equipment	28
2.7.3 Test Environment	28
2.7.4 Scenario Selection	28
2.7.5 Key Dimensions	28
2.8 Complex Texture Scenario	29
2.8.1 Test Purpose	29
2.8.2 Test Equipment	29
2.8.3 Test Environment	29
2.8.4 Test Procedure	29
2.8.5 Key Dimensions	29
2.9 Motion Scenario	29
2.9.1 Test Purpose	29
2.9.2 Test Equipment	29
2.9.3 Test Environment	29
2.9.4 Test Procedure	29
2.9.5 Key Dimensions	30
2.10 Light Variation Scenario (AE Convergence)	30
2.10.1 Test Purpose	30
2.10.2 Test Equipment	30
2.10.3 Test Environment	30
2.10.4 Test Procedure	30

2.10.5 Key Dimensions	30
2.11 Highlight Scenario.	32
2.11.1 Test Purpose	32
2.11.2 Test Equipment	32
2.11.3 Test Environment	32
2.11.4 Test Procedure	32
2.11.5 Key Dimensions	33
2.12 Large-Area Single Color Scenario	33
2.12.1 Test Purpose	33
2.12.2 Test Equipment	33
2.12.3 Test Environment	33
2.12.4 Test Procedure	33
2.12.5 Key Dimensions	33
3 Outdoor Scenarios	34
3.1 Open Scenario	34
3.1.1 Test Purpose	34
3.1.2 Test Equipment	34
3.1.3 Test Environment	34
3.1.4 Scenario Selection	34
3.1.5 Key Dimensions	34
3.2 Outdoor AWB Scenario	34
3.2.1 Test Purpose	34
3.2.2 Test Equipment	34
3.2.3 Test Environment	35
3.2.4 Scenario Selection	35
3.2.5 Key Dimensions	35
3.3 Outdoor WDR Scenario	35
3.3.1 Test Purpose	35
3.3.2 Test Equipment	35
3.3.3 Test Environment	35
3.3.4 Scenario Selection	35
3.3.5 Key Dimensions	35
3.4 Outdoor Low-Illumination Scenario	35
3.4.1 Test Purpose	35
3.4.2 Test Equipment	36
3.4.3 Test Environment	36
3.4.4 Scenario Selection	36
3.4.5 Key Dimensions	36
3.5 Outdoor Motion Scenario	36
3.5.1 Test Purpose	36
3.5.2 Test Equipment	36

3.5.3 Test Environment	36
3.5.4 Scenario Selection.	36
3.5.5 Key Dimensions	36
3.6 Outdoor Infrared Scenario	37
3.6.1 Test Purpose	37
3.6.2 Test Equipment	37
3.6.3 Test Environment	37
3.6.4 Scenario Selection.	37
3.6.5 Key Dimensions	37
3.7 Outdoor HLC Scenario	37
3.7.1 Test Purpose	37
3.7.2 Test Equipment	37
3.7.3 Test Environment	37
3.7.4 Scenario Selection.	37
3.7.5 Key Dimensions	38
4 Data Evaluation and Application	39
4.1 KPI Data Summary	39
4.2 Subjective Test Method for the Image Quality Based on Five Points	40
4.3 Subjective Dimension Evaluation Based on Five Points.	42
4.4 Subjective Scenario Evaluation	45
4.5 Data Results and Application	
5 Annondiy	47

Figures

Figure 1-1 Preview image with the 4:3 area of the ISO12233 Chart	2
Figure 1-2 Preview image in the left corner with the 4:3 area of the ISO12233 Chart	3
Figure 1-3 Preview image in the right corner with the 4:3 area of the ISO12233 Chart	3
Figure 1-4 Preview image of the EIA-1956 Resolution Chart	4
Figure 1-5 Preview image of the ISO12233 Chart with highlighted MTF areas where green boxes highlight areas of horizontal MTF values and purple boxes highlight areas of vertical MTF values	
Figure 1-6 Preview image of the Color Checker Chart	7
Figure 1-7 Preview image of the Color Checker Chart	9
Figure 1-8 Preview image of the Kodak Gray Scale Chart Q14	11
Figure 1-9 Example of the time difference.	13
Figure 1-10 Checkerboard test chart	19
Figure 1-11 Picture that is taken with geometrical distortion and used for calculating relevant values	20
Figure 1-12 Diagram 1 for calculating the FOV value	22
Figure 1-13 Diagram 2 for calculating the FOV value	22
Figure 2-1 AE convergence	31
Figure 2-2 AE oscillation	31
Figure 2.2 AWD convergence	32

Tables

Table 1-1 Major resolution KPIs (such as center resolution and horizontal resolution)	5
Table 1-2 Test standard	7
Table 1-3 Test standard	9
Table 1-4 Bit rate control standards for reference.	16
Table 1-5 Test standard	17
Table 1-6 Test standard	19
Table 1-7 Test standard	21
Table 1-8 Test standard	23
Table 4-1 Test table for KPIs of camera tests	39
Table 4-2 Subjective test table for the image quality based on five points	40
Table 4-3 Table of subjective dimension evaluation based on five points	42
Table 4-4 Table of subjective scenario evaluation	45
Table 4-5 Example of data results and application	46
Table 5-1 Equipment and software requirements	47

1 Specifications

1.1 Resolution

1.1.1 Test Purpose

To verify the resolution of an IP camera and an analog camera.

1.1.2 Test Equipment

- IP camera:
 - Light box
 - ISO12233 Chart (1x, 2x, and 4x)
 - Color temperature and illuminance meter with the precision of 1 K and 0.01 lux
- Analog camera:
 - Light source for transmittance tests, such as a transmittance light box produced by Image Quality Labs
 - Resolution transmittance test card for analog cameras
 - Color temperature and illuminance meter with the precision of 1 K and 0.01 lux
 - Specialized A-frame with three-dimensional pan-tilt-zoom (PTZ) control

1.1.3 Test Software

- IP Camera: Imatest
- Analog camera: ResolutionCharRead, which is the self-developed software based on OpenCV

1.1.4 Test Environment

- IP camera:
 - D65 light source is available with the illumination in the range of 600 lux \pm 100 lux.
 - The difference of brightness values on the surface of the ISO12233 Chart is smaller than 20%.
 - Based on the maximum resolution of all products to be tested, the effective pixel of the lens used for verification shall be no lower than this maximum resolution.
- Analog camera:


- The light source produced by Image Quality Labs for transmittance tests is available with the illumination in the range of $80 \text{ lux} \pm 10 \text{ lux}$.
- Based on the maximum resolution of all products to be tested, the effective pixel of the lens used for verification shall be no lower than this maximum resolution.

1.1.5 Test Procedure

IP Camera

- **Step 1** Adjust the drive parameters of the IP camera to optimal settings, which are usually default settings. Set other parameters of the IP camera to normal settings, for example, set the exposure setting to the automatic mode.
- **Step 2** Adjust the light source in the light box following the verification environment requirements and place the ISO12233 Chart in the light box.
 - As specified in this document, the ISO12233 Chart 1x is applicable to 1.3-megapixel and 2-megapixel IP cameras, and the ISO12233 Chart 4x is applicable to IP cameras greater than 3 megapixels.
- **Step 3** Test the center resolution as follows: Place the ISO12233 Chart in the light box. Adjust the position of the IP camera to ensure that its optic axis is perpendicular to the surface of the ISO12233 Chart. Also, ensure that the 16:9 or 4:3 area (based on the length-width ratio of the IP camera resolution) of the ISO12233 Chart falls within the preview image of the IP camera, as shown in the red box in Figure 1-1. The following uses the IP camera resolution of 4:3 as an example.

Figure 1-1 Preview image with the 4:3 area of the ISO12233 Chart

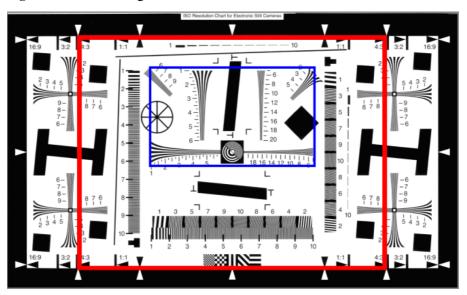

■ NOTE

Focus the camera manually for three times, and capture three pictures or take a 1-min video each time for further analysis.

- **Step 4** Fix the IP camera and take pictures when the preview image is stable.
- **Step 5** Analyze the image in the blue box to get the resolution value, which is the center resolution.

Step 6 Test the corner resolution as follows: Follow the same methods in steps 3 through 5, but remember to adjust the preview area of the IP camera to test the resolution in different corners. Figure 1-2 and Figure 1-3 show the photographed areas.

Figure 1-2 Preview image in the left corner with the 4:3 area of the ISO12233 Chart


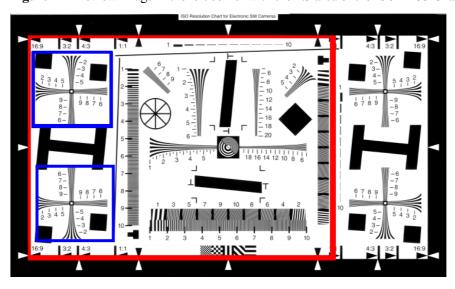


Figure 1-3 Preview image in the right corner with the 4:3 area of the ISO12233 Chart

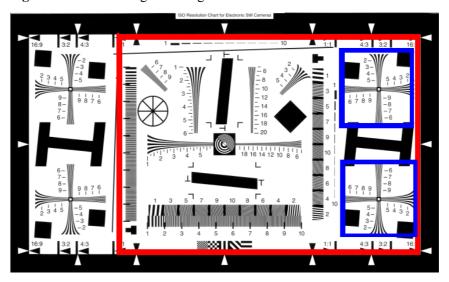


----End

Analog Camera

Step 1 Adjust the drive parameters of the analog camera to optimal settings, which are usually default settings. Set other parameters of the analog camera to normal settings, for example, set the exposure setting to the automatic mode.

- Step 2 Use the transmittance light box with the transmittance test light source produced by Image Quality Labs. Place the resolution test card EIA-1956 Resolution Chart in the card slot of the light box, and then turn on the light source control of the light box. Keep the default settings for the transmittance test light source with the illumination in the range of $80 \text{ lux} \pm 10 \text{ lux}$.
- Step 3 Test the horizontal resolution as follows: Use the specialized A-frame with three-dimensional PTZ control to adjust the position of the analog camera and ensure that its optic axis is perpendicular to the surface of EIA-1956 Resolution Chart. Also, ensure that the EIA-1956 Resolution Chart falls within the preview image of the analog camera, as shown in Figure 1-4.

Figure 1-4 Preview image of the EIA-1956 Resolution Chart

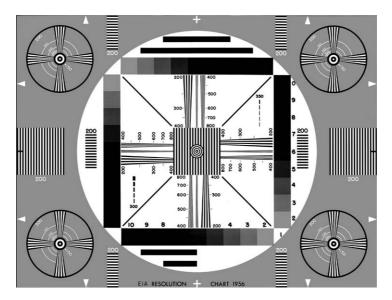


- **Step 4** Fix the analog camera and three-dimensional PTZ. When the preview image is stable, use a video capture card or set up a digital video recorder (DVR) environment to capture the current preview image.
- **Step 5** Adjust the amplitude and focus the camera again for three times. Capture three pictures or take a 1-min video each time for further analysis.

----End

1.1.6 Resolution Reading Method

- IP camera:
 - Read from low-frequency wedge-shaped line pairs, where five line pairs can easily be identified, to the high-frequency level. When five line pairs cannot be identified, the value in that position is the resolution value.
 - Use HYRes to read television lines (TVLs).
 - Use Imatest to analyze the resolution values or Modulation Transfer Function (MTF) values of the photographed area in the red box in Figure 1-5. The green boxes highlight areas of the horizontal resolution values, the purple boxes highlight areas of the vertical resolution values; the boxes in the center highlight areas of the center resolution values, and other boxes highlight areas of the resolution values in different corners.

Figure 1-5 Preview image of the ISO12233 Chart with highlighted MTF areas where green boxes highlight areas of horizontal MTF values and purple boxes highlight areas of vertical MTF values

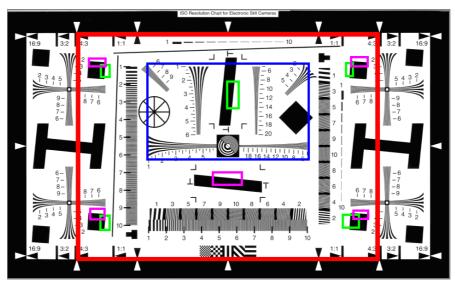

Analog camera:

- Read from low-frequency wedge-shaped line pairs, where four line pairs can easily be identified, to the high-frequency level. When four line pairs cannot be identified, the value in that position is the resolution value.
- Use ResolutionCharRead to read TVLs.
- Read nine values in total and use the maximum value.

1.1.7 Test Standard

NOTE

The resolution can be verified based on MTF and TVL. MTF tends to measure the edge sharpness and TVL focuses on the image resolving power. Although the two KPIs stand for different meanings, they can follow the same value standards in the following verification standard.

The verification standard is based on the identification of line pairs, as listed in Table 1-1.

 Table 1-1 Major resolution KPIs (such as center resolution and horizontal resolution)

Resolution	Horizontal TVL		Vertical TVL		MTF	
	Center	Corner	Center	Corner	MTF50	MTF30
720P (1280 x 720)	700	500	650	500	-	-
1080P (1920 x 1080)	1050	650	900	650	-	-
3M	1100	800	1000	800	-	-
5M	1400	1000	1200	1000	-	-
8M	2100	1200	1500	1200	-	-
D1 (PAL)	540	-	-	-	-	-



Resolution	Horizontal TVL		Vertical TVL		MTF	
	Center	Corner	Center	Corner	MTF50	MTF30
960H (PAL)	720	-	-	-	-	-

1.2 Color Reproduction

1.2.1 Test Purpose

To test the color reproduction capability of an IP camera. As the light filter has a great impact on the test result, its model information shall be mentioned in the test data.

1.2.2 Test Equipment

- Light box
- Color Checker (24-patch) Chart, such as the Gretag Macbeth Color Checker
- Color temperature and illuminance meter

1.2.3 Test Software

Imatest

1.2.4 Test Environment

- The color temperature can be transferred among low, medium, and high, such as A light (2800 K), Day light (5000 K), Day light (6500 K), Day light (7500 K).
- The illumination is adjusted in the range of $600 \text{ lux} \pm 100 \text{ lux}$ to avoid overexposure in the white patch.
- The difference of brightness values on the surface of the chart is smaller than 20%.

1.2.5 Test Procedure

- **Step 1** Adjust the drive parameters of the IP camera to optimal settings. Set other photographing parameters of the IP camera to normal settings, for example, set both the white balance (WB) and exposure settings to the automatic mode.
- **Step 2** Adjust the light source and illumination following the verification environment requirements.
- **Step 3** Place the Color Checker Chart in the center in front of the light box. Adjust the position of the IP camera to ensure that the width of the chart in the preview image ranges from 500 pixels to 1500 pixels, as shown in Figure 1-6.

Chetsoff schools* Color Shecker Safer Flandition Chart

Figure 1-6 Preview image of the Color Checker Chart

- **Step 4** Take pictures when the preview image is stable.
- Step 5 Use Imatest to analyze the pictures that are taken with the color space of sRGB and the exposure error rate smaller than 0.25, and get the saturation value as well as sigma values of ΔC corr and ΔE .

----End

1.2.6 Calculation Method

$$\Delta C = ((a - a^*)^2 + (b - b^*)^2)^{1/2}$$

$$\Delta E = ((L - L^*)^2 + (a - a^*)^2 + (b - b^*)^2)^{1/2}$$
Saturation = 100% x ((a^2 + b^2)^{1/2}) /((a^{*2} + b^{*2})^{1/2})

In the formulas, L, a, and b indicate Lab values of the picture taken by the IP camera, while L^* , a^* , and b^* indicate actual Lab values of the Color Checker Chart.

1.2.7 Test Standard

Table 1-2 Test standard

Test Category	Resolution						
	CIF and D1	720P and 1080P	Greater than 3M				
∠C ₀₀ (avr)	< 5	< 5	< 5				
$\triangle E_{00}$ (max)	< 15	< 15	< 15				
Saturation	100–130	100–130	100-130				

M NOTE

Currently, there are two kinds of expectation towards saturation:

- The first kind is to get closer to true colors, and the corresponding test standard requires the saturation in the range of $100\% \pm N\%$.
- The second kind is to satisfy the subjective visual perception, and the corresponding verification standard requires slightly strong colors.

The first kind is mostly applied to foreign products in foreign countries. As the color saturation just deviates a bit from 100%, such products provide lighter colors and slightly foggy images. The second kind is mostly adopted by home products in China. With high color saturation, such products can ensure bright colors and achieve satisfactory subjective perception. Therefore, the test standard of the second kind is more popular now in China.

1.3 White Balance

1.3.1 Test Purpose

To test the white reproduction capability of an IP camera in different color temperature scenarios.

1.3.2 Test Equipment

- Light box with light sources of low, medium, and high color temperature
- Color Checker (24-patch) Chart, such as the Gretag Macbeth Color Checker
- Color temperature and illuminance meter

1.3.3 Test Software

Imatest

1.3.4 Test Environment

- The color temperature can be transferred among low, medium, and high, such as A light (2800 K), Day light (5000 K), Day light (6500 K), Day light (7500 K).
- The illumination is adjusted in the range of 600 lux \pm 100 lux.

1.3.5 Test Procedure

- **Step 1** Adjust the drive parameters of the IP camera to optimal settings. Set other photographing parameters of the IP camera to normal settings, for example, set both the WB and exposure settings to the automatic mode.
- **Step 2** Place the Color Checker Chart in the center in front of the light box. Adjust the position of the IP camera to ensure that the width of the chart in the preview image ranges from 500 pixels to 1500 pixels, as shown in Figure 1-7.

Gresself return Color Engelor Color Fendilion Chart

Figure 1-7 Preview image of the Color Checker Chart

- **Step 3** Adjust the light source to F (2500 K), in which scenario the illumination does not need to be adjusted. When the preview image is stable, take pictures and record the actual color temperature and illumination.
- **Step 4** Adjust the light source to TL84 (4000 K) and the illumination in the range of 600 lux \pm 100 lux. When the preview image is stable, take pictures and record the actual color temperature and illumination.
- Step 5 Adjust the light source to D65 (6500 K) and the illumination in the range of 600 lux \pm 100 lux. When the preview image is stable, take pictures and record the actual color temperature and illumination.
- **Step 6** Adjust the light source to D75 (7500 K) and the illumination in the range of 600 lux \pm 100 lux. When the preview image is stable, take pictures and record the actual color temperature and illumination.
- **Step 7** Use Imatest to analyze WB of the pictures that are taken, with the color space of sRGB and the exposure error rate smaller than 0.25.

----End

1.3.6 Calculation Method

Use Imatest to analyze the pictures that are taken in different color temperature scenarios to get the WB difference of each color patch. This verification standard is based on the maximum value of color patches 20–23 in the Color Checker (24-patch) Chart, excluding the values of color patches 19 and 24 among six gray patches.

1.3.7 Test Standard

Table 1-3 Test standard

Test Category		Resolution				
		CIF and D1	1.3M and 2M	Greater than 3M		
AWB	D65 and TL84 light sources	⊿S < 0.10	⊿S < 0.10	⊿S < 0.08		

Test Category		Resolution				
		CIF and D1	1.3M and 2M	Greater than 3M		
	F light source	⊿S < 0.15	⊿S < 0.12	⊿S < 0.10		

1.4 Gray Scale

1.4.1 Test Purpose

To test the dynamic range of an IP camera.

1.4.2 Test Equipment

- Light box
- Gray-scale chart of 20 scales, such as the Kodak Gray Scale Chart Q14
- Color temperature and illuminance meter

1.4.3 Test Software

None

1.4.4 Test Environment

- D65 light source is available with the illumination in the range of $600 \text{ lux} \pm 100 \text{ lux}$ on the surface of the chart.
- The difference of brightness values on the surface of the chart is smaller than 10%.

1.4.5 Test Procedure

- **Step 1** Adjust the photographing parameters of the IP camera to optimal settings.
- **Step 2** Place the IP camera in front of the Gray Scale Chart and ensure that the chart takes up at least 50% of the area in the preview image, as shown in Figure 1-8.



Figure 1-8 Preview image of the Kodak Gray Scale Chart Q14

Step 3 Take pictures when the preview image is stable.

----End

1.4.6 Calculation Method

Observe the pictures that are taken. Check whether there are adjacent gray scales that cannot be distinguished by naked eyes. Also, record the corresponding gray-scale level.

1.4.7 Test Standard

The gray-scale level shall be no lower than 18.

Ⅲ NOTE

To a great extent, the gray scale indicates the resolving power of images under various brightness conditions. A higher gray-scale level usually ensures higher resolving power. If the gray-scale level is too low, similar scenarios and objects cannot be distinguished under the corresponding brightness condition, and no object can be seen clearly as the bright region is too bright or overexposed and the dark region is too dark. In general, if the gray-scale level is too high, details in the bright and dark regions can be displayed properly, but the permeability of images is also reduced. Factors that are used in the brightness adjustment algorithm, such as the contrast, brightness, and Gamma, can have a great impact on the gray scales.

1.5 Wide Dynamic Range

1.5.1 Test Purpose

To test the wide dynamic range (WDR) of an IP camera.

1.5.2 Test Equipment

- Light box for testing the WDR. It provides a bright region and a dark region, and the brightness of each region can be adjusted separately.
- Illuminance meter

1.5.3 Test Environment

The IP camera is positioned in the center outside the light box to ensure that one half of the preview image is the bright region and the other half is the dark region.

1.5.4 Test Procedure

- **Step 1** Adjust the drive parameters of the IP camera to WDR settings. If there is no WDR mode, use the default settings.
- **Step 2** Place a Gray Scale Chart in both the bright and dark regions. Then, adjust the illumination in both regions by increasing the illumination in the bright region and decreasing the illumination in the dark region until seven gray scales can be properly distinguished in both regions.
- **Step 3** Record the illumination of the bright and dark regions as *X* and *Y*, respectively.

----End

1.5.5 Calculation Method

WDRA = 20 LogX/Y (dB)

1.5.6 Test Standard

The WDR A shall be no less than 50 dB when the illumination ratio between the bright and dark regions is 350:1.

1.6 Delay

1.6.1 Test Purpose

To test the delay performance of an IP camera.

1.6.2 Test Equipment

PC. If the PC is equipped with N cores, the CPU usage of the video on demand (VOD) progress shall not exceed the result of $1/N \times 80\%$. If the actual CPU usage of the progress is higher than this value, a PC with higher configuration is required.

1.6.3 Test Software

- Stopwatch with the precision of 10 ms
- Paint

1.6.4 Test Environment

The IP camera is connected to the PC. The stopwatch and a VOD progress are started on the PC. Before starting the stopwatch and VOD progress, the personnel need to check Task Manager to ensure that the average CPU usage of the PC is below 10%. If the average CPU usage exceeds 10%, the progresses with high CPU usage need to be shut down.

1.6.5 Test Procedure

- **Step 1** Use the IP camera to take a picture of the PC screen, and take a screenshot of the PC at the same time.
- **Step 2** Copy the screenshot to Paint.
- **Step 3** Calculate the time difference between the time of the stopwatch in the screenshot and the time of the stopwatch in the picture taken by the IP camera, as shown in Figure 1-9.

Figure 1-9 Example of the time difference



----End

1.6.6 Calculation Method

Observe the picture taken by the IP camera and the screenshot of the PC screen. Record the time of the stopwatch in the former as A and the time of the stopwatch in the latter as B. Then, calculate the delay (denoted by T) of the IP camera as follows: T = A - B.

1.6.7 Test Standard

The delay shall be no longer than 200 ms.

1.7 Allowed Lowest Illumination

1.7.1 Test Purpose

To test the lowest illumination that an IP camera allows to ensure that it can take distinguishable pictures.

1.7.2 Test Equipment

- Light box
- ISO12233 Chart (1x, 2x, and 4x)
- Color temperature and illuminance meter

1.7.3 Test Software

None

1.7.4 Test Environment

- A fixed-focus lens is used with the maximum aperture of F1.2.
- D65 light source is available with the lowest illumination lower than 0.05 lux.
- The difference of brightness values on the surface of the ISO12233 Chart is smaller than 20%.

1.7.5 Test Procedure

Based on the Resolution

- **Step 1** Read the current resolution by referring to section 1.1.5 "Test Procedure" under section 1.1 "Resolution."
- **Step 2** Adjust the light source illumination without changing the light source. When the resolution of the output image reaches 70% of the resolution in Step 1, measure the illumination φ on the chart by using the illuminance meter.

M NOTE

If the light source of the light box cannot provide lower illumination as required, use shade cloths to cover left and right sides of the light box to ensure uniform light transmission on both sides. Then, adjust the light transmission amount to satisfy the verification environment requirements.

----End

Based on the Gray Scale

- **Step 1** Read the current gray-scale level by referring to section 1.4.5 "Test Procedure" under section 1.4 "Gray Scale."
- **Step 2** Adjust the light source illumination without changing the light source. When the gray-scale level of the output image is lowered to N, measure the illumination φ on the chart by using the illuminance meter.



■ NOTE

The *N* value indicates the requirements of low illumination for video identification. A smaller *N* value provides lower resolving power. Currently, the minimum *N* value of 2 is adopted.

----End

1.7.6 Calculation Method

- φ is the lowest illumination of the IP camera.
- If the measured lens aperture cannot meet the requirement of F1.2, convert it as follows: $(F)^2/(F1)^2 = \varphi/\varphi x$

In the formula:

- F indicates the nominal aperture value.
- F1 indicates the actual aperture value.
- φ indicates the measured lowest illumination.
- φx indicates the lowest illumination.

1.7.7 Test Standard

- For color images: $\varphi < 1 \text{ lux/F1.2}$
- For black and white images: $\varphi < 0.1 \text{ lux/F1.2}$

1.8 Bit Rate Control

1.8.1 Test Purpose

To test the bit rate control of an IP camera.

1.8.2 Test Equipment

Light box

1.8.3 Test Software

Tools that can be used to collect the traffic statistics of a network adapter, such as the IPOP or Windows Task Manager.

1.8.4 Test Environment

The bit rate control mode of the IP camera is set to constant bit rate (CBR) and the bit rate of the IP camera is set to A. The test is conducted in three scenarios with the low bit rate, medium bit rate, and high bit rate, respectively. Table 1-4 lists the bit rate control standards for reference.

Resolution	Low Bit Rate (kbit/s)	Medium Bit Rate (kbit/s)	High Bit Rate (kbit/s)	Remarks
D1	512	1024	2048	-
CIF	256	512	1024	-
1080P30	2048	4096	8192/6144	-
720P30	1024	2048	4096	-
720P60	1536	3072	6144	-

Table 1-4 Bit rate control standards for reference

1.8.5 Test Procedure

- **Step 1** Use the IP camera to film moving objects (such as waving arms in front of the lens), and read the maximum instantaneous bit rate *B* and average bit rate *C* by using the IPOP.
- **Step 2** Place the IP camera in the light box, frequently adjust the brightness in the light box, and read the maximum instantaneous bit rate *B* and average bit rate *C* by using the IPOP.

----End

1.8.6 Calculation Method

Calculate the fluctuation between the actual value and set value as follows:

• Maximum bit rate =
$$\frac{|B - A|}{A} \times 100\%$$

• Average bit rate = $\frac{IC - AI}{A}$ x 100%

1.8.7 Test Standard

The fluctuation of the maximum instantaneous bit rate and average bit rate shall be no greater than 10% and 5%, respectively.

1.9 Signal-to-Noise Ratio

1.9.1 Test Purpose

To test the noise level of an IP camera.

1.9.2 Test Equipment

- Light box
- Color Checker (24-patch) Chart, such as the Gretag Macbeth Color Checker

Color temperature and illuminance meter

1.9.3 Test Software

Imatest

1.9.4 Test Environment

- D65 light source is available with the illumination in the range of 600 lux \pm 100 lux.
- The difference of brightness values on the surface of the chart is smaller than 10%.

1.9.5 Test Procedure

- **Step 1** Adjust the drive parameters of the IP camera to optimal settings. Set other photographing parameters of the IP camera to normal settings, for example, set both the WB and exposure settings to the automatic mode.
- **Step 2** Adjust the light source and illumination following the verification environment requirements.
- **Step 3** Place the Color Checker Chart in the center in front of the light box. Adjust the position of the IP camera to ensure that the chart takes up about 70% of the area in the preview image, as shown in Figure 1-6.
- **Step 4** Take pictures when the preview image is stable.
- **Step 5** Use Imatest to analyze the pictures that are taken and get the noise level. Note that if a video is taken, capture five different key frames from a video and get the average value of the noise level.

----End

1.9.6 Calculation Method

 $SNR = 20 \log_{10}((S_{19} - S_{24})/N_{22})$

In the formula, S_{19} and S_{24} indicate the signal brightness values of color patches 19 and 24, respectively; and N_{22} indicates the noise level of color patch 22.

In Imatest (3.8) or later versions, if **Noise display** is set to **Pixel SNR(dB)(20*log10(S/N))**, the SNR can be calculated directly.

1.9.7 Test Standard

Table 1-5 Test standard

Test Category	Resolution						
Cutegory	CIF	D1	720P	1080P	Greater than 3M	5M	2160P
SNR (dB)	≥ 35	≥ 48	≥ 45	≥ 48	≥ 48	≥ 46	≥ 46



M NOTE

According to General Technical Requirements for Cameras Used in Security Video Surveillance-2011[1][1].3.16, the SNR of 720P shall be no less than 45 dB.

1.10 Brightness Uniformity

1.10.1 Test Purpose

To test the imaging uniformity of an IP camera. The shadow is usually introduced by the lens.

1.10.2 Test Equipment

- Uniform light source
- Color temperature and illuminance meter

1.10.3 Test Software

Imatest

1.10.4 Test Environment

- Requirements for the background material are as follows:
 - D65/10° Lab values: 56.8, -0.6, and 0.7
 - Neutral 5 with the reflectivity of 0.70
 - RGB values: 122, 122, and 121
- The illumination of the uniform light source is adjusted in the range of 600 lux \pm 100 lux.

1.10.5 Test Procedure

- **Step 1** Ensure that the uniform light source is not affected by other light sources. Adjust the drive parameters of the IP camera to optimal settings.
- **Step 2** Place the IP camera in front of the luminous surface of the uniform light source with a distance ranging from 2 cm to 5 cm and ensure that the preview image of the IP camera is the luminous surface of the uniform light source.
- **Step 3** Take pictures when the preview image is stable.
- **Step 4** Use Imatest to analyze the brightness uniformity values.

----End

1.10.6 Calculation Method

Shading value = (Brightness value of the darkest in four corners Y/Brightness value of the brightness in the center) x 100%

1.10.7 Test Standard

Table 1-6 Test standard

Test Category	Resolution						
	CIF	D1	720P and 1080P	Greater than 3M			
Shading	≥ 70%	≥ 75%	≥ 80%	≥ 85%			

1.11 Distortion or Geometrical Distortion


1.11.1 Test Purpose

To test the imaging geometrical distortion of an IP camera. Distortion is usually introduced by the lens.

1.11.2 Test Equipment

- Light box
- Color temperature and illuminance meter
- Geometrical distortion test chart, such as the Checkerboard Distortion Test Target for Microsoft© LyncTM Certification, as shown in Figure 1-10.

Figure 1-10 Checkerboard test chart

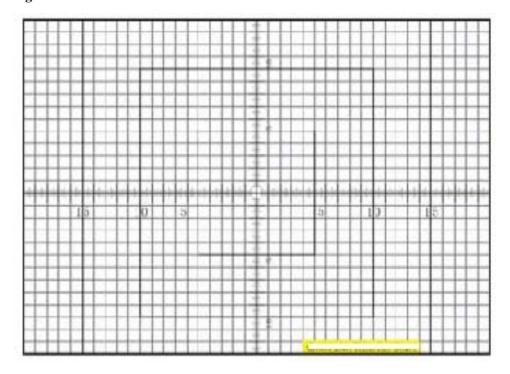

1.11.3 Test Software

Imatest

1.11.4 Test Environment

- D65 light source is available with the illumination in the range of 600 lux \pm 100 lux on the surface of the chart.
- The difference of brightness values on the surface of the chart is smaller than 10%.

1.11.5 Test Procedure


- **Step 1** Place the chart in front of the light box and ensure that the optic axis center of the IP camera is aligned at the center of the geometrical distortion test chart.
- **Step 2** Take pictures when the preview image is stable.
- **Step 3** Use Imatest to analyze the geometrical distortion values.

----End

1.11.6 Calculation Method

If geometrical distortion occurs, the relevant values can be calculated based on the picture that is taken with geometrical distortion, as shown in Figure 1-11.

Figure 1-11 Picture that is taken with geometrical distortion and used for calculating relevant values

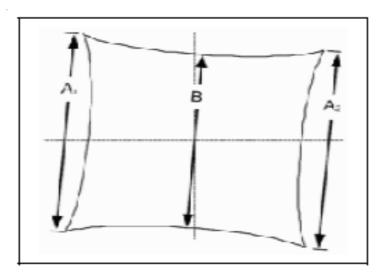

Formulas are as follows:

- A = (A1 + A2)/2
- Distortion = 100 x (A B)/B



1.11.7 Test Standard

Table 1-7 Test standard

Test Category	Resolution						
	CIF	D1	720P	1080P	Greater than 3M		
Distortion	< 3%	< 2%	< 2%	< 1.50%	< 1%		

1.12 Field of View

M NOTE

This test item shall draw attention during product tests, but the result is used as a reference not as a KPI.

1.12.1 Test Purpose

To test the maximum field of view (FOV) of an IP camera.

1.12.2 Test Equipment

- Light box
- Color temperature and illuminance meter
- FOV Chart
- Ruler

1.12.3 Test Software

None

1.12.4 Test Environment

- D65 light source is available with the illumination in the range of 600 lux \pm 100 lux on the surface of the chart.
- The difference of brightness values on the surface of the chart is smaller than 10%.

1.12.5 Test Procedure


- **Step 1** Place the FOV Chart in front of the light box and ensure that the optic axis center of the IP camera is aligned at the center of the FOV Chart.
- **Step 2** Take pictures when the preview image is stable.
- **Step 3** Measure the distance *L* between the IP camera and chart, and the diagonal length *C* of the chart in the picture that is taken. Then, calculate the FOV value based on the measured values.

----End

1.12.6 Calculation Method


• As shown in Figure 1-12, the area where the picture is taken is plane *a*; the line perpendicular to plane *a* is *L*, which is the distance between the IP camera and FOV Chart; *A* and *B* indicate the maximum width and length of the picture that is taken, respectively; and *o* indicates the center of the FOV Chart.

Figure 1-12 Diagram 1 for calculating the FOV value

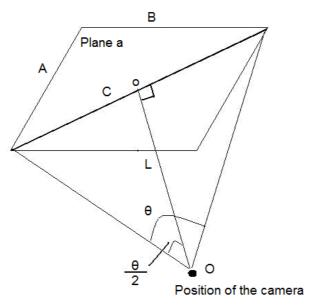

• Figure 1-13 shows the picture that is taken. Measure the diagonal length *C* of the chart in the picture, or calculate this length by using a formula. Also, measure the actual distance *L* between the IP camera and FOV Chart.

Figure 1-13 Diagram 2 for calculating the FOV value

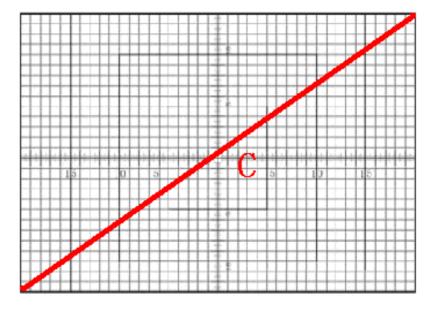

• Assume that the FOV value is θ , formulas are as follows:

$$C = sqrt (A^2 + B^2)$$

$$\theta = 2atan (C/2L)$$

1.12.7 Test Standard

Table 1-8 Test standard

Test Category	Resolution					
	CIF	D1	720P	1080P	Greater than 3M	
FOV (degree)						

M NOTE

As the FOV requirement may vary in different application scenarios of products, FOV values are not specified in this standard.

2 Scenarios

2.1 Image Edge

2.1.1 Test Purpose

To test whether the preview image of an IP camera is normal.

2.1.2 Test Equipment

- Normal light source
- Object in a bright color, such as red, blue, or yellow

2.1.3 Test Environment

Use the IP camera to capture pictures of the object in a bright color, and then observe the image quality of edges.

2.1.4 Test Procedure

- **Step 1** Observe the pictures of the object in a bright color that are taken by the IP camera.
- **Step 2** Observed the pictures to check whether the up, down, left, and right edges of these pictures contain any color that is inconsistent with the color of the object.

----End

2.1.5 Key Dimensions

Black edge and white edge

2.2 Static Scenario

2.2.1 Test Purpose

To test the image quality of an IP camera in a static scenario.

2.2.2 Test Equipment

Normal light source

Still and colorful static model, such as flowers and plants, dolls, and color cloths

2.2.3 Test Environment

Use the IP camera to film the static model, and then observe the image quality.

2.2.4 Test Procedure

- **Step 1** Observe the color saturation of the static model filmed by the IP camera.
- **Step 2** Check whether colors of the static model are properly reproduced, and whether colors are reproduced with correct RGB proportions and accordingly can be properly distinguished.
- **Step 3** Use the IP camera to film straight edges at a small angle to check whether aliasing occurs.
- Step 4 Check whether the edges contain mixed colors.
- **Step 5** Change the color temperature to check whether color deviation occurs.

----End

2.2.5 Key Dimensions

- Definition, color reproduction, permeability, noise, aliasing, flare, blocking artifact, breathing, and false color.
- Whether blocking artifact easily occurs in black and flat regions, such as a black display screen or black clothes.
- Whether aliasing easily occurs at tilt angles.

2.3 Personage Scenario

2.3.1 Test Purpose

To test the image quality of an IP camera in a personage scenario.

2.3.2 Test Equipment

- Normal light source
- Person

2.3.3 Test Environment

Use the IP camera to film the person, and then observe the image quality.

2.3.4 Test Procedure

Step 1 Observe under the uniform light source and normal illumination to check whether the person's complexion is natural or distorted, whether the brightness is controlled properly, whether there is any overexposure, and whether upper and lower arms in the image are affected by the ringing effect.

Step 2 Observe whether the person's complexion is soft, whether details are clear, and whether the person looks stereoscopic.

----End

2.3.5 Key Dimensions

Definition, color reproduction, and permeability

2.4 Long Shot Scenario

2.4.1 Test Purpose

To test the image quality of an IP camera in a long shot scenario.

2.4.2 Test Equipment

No special equipment is required.

2.4.3 Test Environment

Use the IP camera to film in a long shot scenario, such as a long and narrow passageway. Then, observe the image quality.

2.4.4 Test Procedure

Observe the filming capability of the IP camera in the long shot scenario. Check whether the depth of field (DoF) is appropriate and whether distant details can be seen clearly.

2.4.5 Key Dimensions

Definition, permeability, DoF, and color reproduction

2.5 WDR Scenario

2.5.1 Test Purpose

To test the image quality of an IP camera in a WDR scenario.

2.5.2 Test Equipment

No special equipment is required.

2.5.3 Test Environment

• Use the IP camera to film in a region with significant brightness difference, such as a window, outside which the light is strong and inside which the light is weak. Then, observe the image quality.

• Place a strong light directly towards a solid object, and use the IP camera to monitor this object from another side to observe the image quality under bright and dark conditions.

WDR is typical in two types of application scenarios: one includes office buildings, office areas, and doorways of halls; the other includes hotel corridors and passageways. The former type is characterized by the larger bright region and brighter light source, while the bright region of the latter has a smaller area and lower brightness.

2.5.4 Test Procedure

- **Step 1** Observe the image quality with the WDR mode enabled and disabled to compare whether scenes in the bright and dark regions change, whether changes are great, and whether the overall brightness and brightness in the dark region are appropriate.
- Step 2 Observe whether edges of the bright region contain purple edges.

----End

2.5.5 Key Dimensions

- Bright region detail, dark region detail, color reproduction, purple edge or green edge, permeability, noise, and smearing
- In WDR scenarios, the most important dimensions include faces and clothes details (including the color and texture), as well as smearing and following noise of the moving personage.

2.6 Low-Illumination Scenario

2.6.1 Test Purpose

To test the image quality of an IP camera in a low-illumination scenario.

2.6.2 Test Equipment

- Light box
- Small object to be placed in the light box
- Movable object, such as a pendulum

2.6.3 Test Environment

Use the IP camera to film in the light box, and then observe the image quality.

2.6.4 Test Procedure

- **Step 1** Adjust the illumination of the light box to 5 lux and observe the image quality of the IP camera. Then, lower the illumination to 1 lux, 0.5 lux, 0.2 lux, 0.1 lux, 0.01 lux, and lower. In the meantime, observe the image quality of the IP camera under conditions with different illumination values.
- **Step 2** Observe the overall brightness of the image to check whether the noise control takes effect and whether the image is obviously affected by blocking artifact and breathing.

Step 3 Record whether objects are distinguishable under specified illumination values, the quantity of noise, the size of granular noise, and whether the motion noise and smearing exist around the moving object.

----End

2.6.5 Key Dimensions

Brightness, definition, permeability, noise, blocking artifact, breathing, color reproduction, and smearing

2.7 Infrared Scenario

2.7.1 Test Purpose

To test the image quality of an IP camera in an infrared scenario.

2.7.2 Test Equipment

- Color temperature and illuminance meter
- Infrared lamp
- Laser rangefinder

2.7.3 Test Environment

Turn on the infrared lamp in an indoor low-illumination scenario and ensure that both the infrared lamp and IP camera face towards the same object. Use the IP camera to film the object and observe the image quality.

MAIOTE

- In this scenario, the day/night mode of the product to be tested shall be set to the automatic mode or the night mode.
- It shall be determined whether the frame loss mode is adopted in low-illumination scenarios.
 Generally, this test shall adopt the test mode without frame loss.

2.7.4 Scenario Selection

Indoor low-illumination scenario where the object is filmed by using the IP camera and infrared lamp

2.7.5 Key Dimensions

Definition, permeability, noise, brightness, bright region quality, dark region quality, exposure, and smearing

2.8 Complex Texture Scenario

2.8.1 Test Purpose

To test the image quality of an IP camera in a complex texture scenario.

2.8.2 Test Equipment

Object with complex texture, such as a piece of striped clothes, a stripe test chart, or a board.

2.8.3 Test Environment

Use the IP camera to film the object with complex texture, and then observe the image quality.

2.8.4 Test Procedure

Observe the image to check whether Y/C separation occurs and whether the image is blurry.

2.8.5 Key Dimensions

Definition and false color

2.9 Motion Scenario

2.9.1 Test Purpose

To test the image quality of an IP camera in a motion scenario.

2.9.2 Test Equipment

Moving object, such as a person or a pendulum

2.9.3 Test Environment

Use the IP camera to film the moving object, and then observe the image quality. The object can move in the following modes:

- The object moves from far to near.
- The object moves using two motion types: translation and rotation.
- The object moves at different speeds: fast and slow.

□ NOTE

If the IP camera is equipped with the stabilization function, the motion of the IP camera can also be tested.

2.9.4 Test Procedure

- **Step 1** Observe the definition and edge sharpness of the moving object.
- **Step 2** Observe whether the motion noise exists around the moving object and whether color retention occurs after the object moves.

----End

2.9.5 Key Dimensions

Subject definition, background definition, color retention, continuity, noise, smearing, blocking artifact, breathing, and edge flare

2.10 Light Variation Scenario (AE Convergence)

2.10.1 Test Purpose

To test the automatic exposure (AE) convergence capability of an IP camera, including the AE convergence speed and stability.

2.10.2 Test Equipment

- Light box or luminance box
- Spotlight or car lamp
- Baffle plate in a dark color

2.10.3 Test Environment

- Use the IP camera to film in the light box. Adjust the brightness of the light source to make it brighter or darker, and then observe the image quality.
- Use the IP camera to film in a normal scenario. When the preview image is stable, put a baffle plate in front of the lens to completely cover the image for about three seconds, and then remove the baffle plate. In the meantime, observe the image quality.
- Use the IP camera to film in an indoor scenario with the normal illumination. Turn off the light and wait until AE is stable. Then, turn on the light and wait until AE is stable.

2.10.4 Test Procedure

- **Step 1** Observe the duration that the image recovers after the light source of the light box changes or the baffle plate is removed from the lens.
- **Step 2** After the image recovers, observe whether oscillation (or brightness variation) occurs.


----End

2.10.5 Key Dimensions

AE convergence speed, AE convergence stability, AWB convergence speed, AWB convergence stability, blocking artifact, smearing, and bit rate fluctuation


• Figure 2-1 shows an example of AE convergence.

Figure 2-1 AE convergence

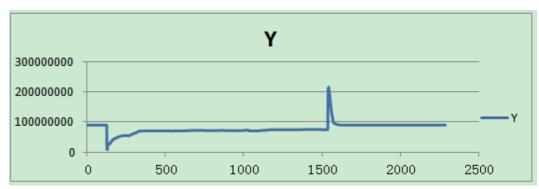


• Figure 2-2 shows an example of AE oscillation.

Figure 2-2 AE oscillation

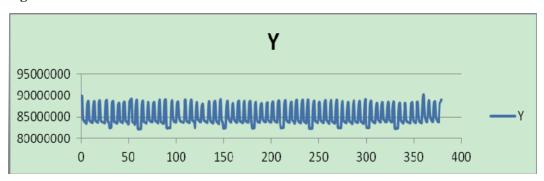

• Figure 2-3 shows an example of AWB convergence.

Figure 2-3 AWB convergence

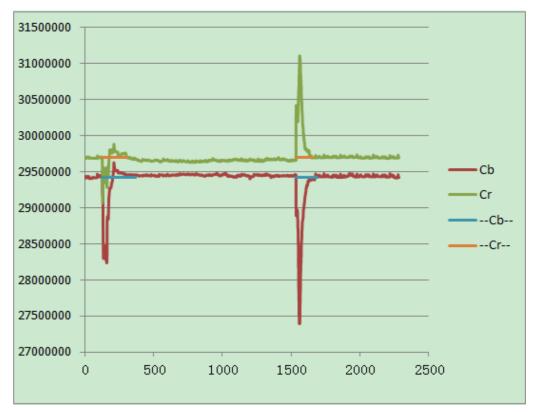

2.11 Highlight Scenario

2.11.1 Test Purpose

To test the image quality of an IP camera in a highlight scenario.

2.11.2 Test Equipment

Spotlight or car lamp

2.11.3 Test Environment

Use the IP camera to film objects around the highlight and ensure that the angle between the IP camera and highlight remains unchanged. Then, observe the image quality.

2.11.4 Test Procedure

Observe whether the objects around the highlight are distinguishable to check the highlight compensation (HLC) effect.

2.11.5 Key Dimensions

- Bright region quality, dark region quality, purple edge, permeability, halo size, and color reproduction
- Large-area single color scenario

2.12 Large-Area Single Color Scenario

2.12.1 Test Purpose

To test whether color deviation occurs in the neutral color region with the background in a large-area single color.

2.12.2 Test Equipment

Shade cloths in different colors, such as red, green, blue, yellow, light yellow, and gray

2.12.3 Test Environment

Place a large-area gray roller shutter in a position in parallel with the top of a desk. Place a Color Checker (24-patch) Chart vertically on the desk and ensure that the chart is not affected when the roller shutter is pulled down.

2.12.4 Test Procedure

- **Step 1** Select a shade cloth in a neutral color (such as gray) as the background. Pull down the large-area gray roller shutter to cover 30%, 50%, and 80% of the preview image and last for about three minutes each time. In the meantime, observe whether color deviation occurs in color patches 19–23 in the Color Checker (24-patch) Chart, and record the code stream in real time.
- **Step 2** Each time the roller shutter is removed, observe whether the image can quickly recover and turn gray.
- **Step 3** Change to another shade cloth in a different color and repeat steps 1 and 2.
- **Step 4** Use Imatest and the Color Checker (24-patch) Chart to analyze the color deviation level.

----End

2.12.5 Key Dimensions

Color reproduction

3 Outdoor Scenarios

3.1 Open Scenario

3.1.1 Test Purpose

To test the image quality of an IP camera in an open scenario.

3.1.2 Test Equipment

- Color temperature and illuminance meter
- Laser rangefinder

3.1.3 Test Environment

Use the IP camera to film in an open scenario, and then observe the image quality.

3.1.4 Scenario Selection

Square, rooftop of a low-rise building, tree, flower, and crowd, where the scenario is filmed by the IP camera under different weather conditions

3.1.5 Key Dimensions

Definition, brightness, permeability, DoF, color reproduction, noise, and aliasing

3.2 Outdoor AWB Scenario

3.2.1 Test Purpose

To test the image quality of an IP camera in an outdoor AWB scenario.

3.2.2 Test Equipment

Color temperature and illuminance meter

3.2.3 Test Environment

Use the IP camera to film in an outdoor scenario, and then observe the image quality.

3.2.4 Scenario Selection

Scenario with rich colors and various objects, such as roads, flowers and plants, and buildings, where the scenario is filmed by the IP camera in the daytime, generally from 6:00 to 20:00

3.2.5 Key Dimensions

Definition, permeability, and color reproduction

3.3 Outdoor WDR Scenario

3.3.1 Test Purpose

To test the image quality of an IP camera in an outdoor WDR scenario.

3.3.2 Test Equipment

Color temperature and illuminance meter

3.3.3 Test Environment

Use the IP camera to film in an outdoor WDR scenario, and then observe the image quality.

3.3.4 Scenario Selection

- In the daytime with strong light outdoors, place the IP camera in a lobby with the light turned off and use the IP camera to film the doorway where people enter the lobby from the outside.
- Place the IP camera in an outdoor scenario with bright light and film the indoor scenario where the light is darker through a glass door.

3.3.5 Key Dimensions

Bright region quality, dark region quality, purple edge, color reproduction, permeability, noise, and smearing

3.4 Outdoor Low-Illumination Scenario

3.4.1 Test Purpose

To test the image quality of an IP camera in an outdoor low-illumination scenario.

3.4.2 Test Equipment

Color temperature and illuminance meter

3.4.3 Test Environment

Use the IP camera to film in an outdoor low-illumination scenario, and then observe the image quality. In this scenario, the infrared lamp is not required by default and the test only verifies the processing effect of the product itself.

3.4.4 Scenario Selection

Three outdoor scenarios in the nighttime with the illumination ranging from 0.1 lux to 1 lux, where the light is uniform and objects are moving, for example, people are walking.

MOTE

Low-illumination conditions include:

- Moonlight level: literally means scenarios with only the moonlight, and generally refers to conditions with the illuminations higher than 0.5 lux.
- Astral level: literally means quite dark scenarios with only the starlight, and generally refers to
 conditions with the illuminations lower than 0.5 lux.

3.4.5 Key Dimensions

Definition, permeability, brightness, noise, color reproduction, and aliasing

3.5 Outdoor Motion Scenario

3.5.1 Test Purpose

To test the image quality of an IP camera in an outdoor motion scenario.

3.5.2 Test Equipment

Color temperature and illuminance meter

3.5.3 Test Environment

Use the IP camera to film moving objects in an outdoor scenario, and then observe the image quality.

3.5.4 Scenario Selection

Objects move at a high, medium, or low speed:

- High speed: vehicles passing an overpass on a highway
- Medium speed: vehicles accessing the entrance and exit of a company
- Low speed: pedestrians walking at normal speeds

3.5.5 Key Dimensions

Definition, edge flare, smearing, color retention, noise, and blocking artifact

3.6 Outdoor Infrared Scenario

3.6.1 Test Purpose

To test the image quality of an IP camera in an outdoor infrared scenario.

3.6.2 Test Equipment

- Color temperature and illuminance meter
- Infrared lamp

3.6.3 Test Environment

Turn on the infrared lamp in an outdoor scenario and ensure that both the infrared lamp and IP camera face towards the same object. Use the IP camera to film the object and observe the image quality.

3.6.4 Scenario Selection

Outdoor scenario in the nighttime with the astral level and the illuminations lower than 0.5 lux, where the object is filmed by using the IP camera and infrared lamp

3.6.5 Key Dimensions

Definition, permeability, noise, brightness, bright region quality, dark region quality, overexposure, and smearing

3.7 Outdoor HLC Scenario

3.7.1 Test Purpose

To test the image quality of an IP camera in an outdoor HLC scenario.

3.7.2 Test Equipment

- Color temperature and illuminance meter
- Car
- Strobe light

3.7.3 Test Environment

Use the IP camera to film in an outdoor HLC scenario, and then observe the image quality.

3.7.4 Scenario Selection

In an outdoor scenario in the nighttime, turn on headlights of the car and use the IP camera to film the license plate. Properly adjust the aperture of the lens and brightness of the headlights. The car can move or stay still. If the car is moving, use the strobe light to produce some light for the license plate.

3.7.5 Key Dimensions

Bright region detail, dark region detail, halo size, color reproduction, and blocking artifact

4 Data Evaluation and Application

4.1 KPI Data Summary

KPI tests shall be carried out following the relevant procedures and the test data shall be recorded in the corresponding table cells. After each KPI test, the test result shall be compared with the corresponding standard. If the test result is qualified, this test item can be marked as passed. Table 4-1 provides an example of the test table.

Table 4-1 Test table for KPIs of camera tests

Test Item	KPI	Unit	Qualification Standard	Test Result	Conclusion
Resolutio	TVL	TVL	720P (center): ≥ 700	-	Passed
n	IVL	IVL	1080P (center): ≥ 1050	-	Passed
Color	Saturation	-	110%–120% 100%–130%	-	Passed
reproducti on	ΔC	-	≤ 10%	-	Passed
	ΔΕ	-	≤ 15%	-	Passed
WB	S	-	≤ 0.10	-	Passed
Gray scale	Gray-scale level	Scale	≥ 18	-	Passed
WDR	Comparison between the bright and dark regions	dB	≥ 50 dB	-	Passed
Delay	Time difference	ms	≤ 200 ms	-	Passed
Low illuminati	φ	lux	Color images: φ < 1 lux/F1.2	-	Passed
on			Black and white		

Test Item	KPI	Unit	Qualification Standard	Test Result	Conclusion
			images: φ < 0.1 lux/F1.2		
Bit rate control	-	-	Fluctuation of the maximum instantaneous bit rate: $\leq 10\%$ Fluctuation of the average bit rate: $\leq 5\%$	-	Passed
SNR	SNR	dB	≥ 35 dB	-	Passed
Brightnes s uniformit y	Shading	-	≥ 80%	-	Passed
Geometri cal distortion	Distortion	-	< 1.50%	-	Passed
FOV	FOV	Degree	-	-	Passed

4.2 Subjective Test Method for the Image Quality Based on Five Points

Table 4-2 Subjective test table for the image quality based on five points

Point	Level	Five-Level Quality Standard (Positive)	Five-Level Damage Standard (Negative)
5	Excelle nt	The image quality is excellent and very satisfactory.	The image contains no detectable damage or interference.
4	Good	The image quality is good and satisfactory.	The image contains slightly detectable damage or interference, but not annoying.
3	Mediu m	The image quality is common and acceptable.	The image contains obvious and detectable damage or interference, which is annoying.
2	Bad	The image quality is bad and barely acceptable.	The image contains less severe damage or interference, which is very annoying.
1	Poor	The image quality is poor and unacceptable.	The image contains severe damage or interference, which totally blocks

Point	Level	Five-Level Quality Standard (Positive)	Five-Level Damage Standard (Negative)
			the image.

An expert team consisting of professionals and non-professionals shall be set up to conduct the evaluation. It is recommended that the number of participants range from five to twelve. During the evaluation, the test personnel can discuss only the test process but not the test results, that is, they can discuss the test items but not the image quality. Then, the test personnel need to score each test item based on five points. During the scoring, the test personnel shall score the image quality based on the preceding positive and negative standards, and extend the score to one decimal point for further correction. The positive or neutral test dimensions, such as the definition and color reproduction, can be scored based on the five-level quality standard in Table 4-2. The negative test dimensions, such as the denoising effect, deinterlacing effect, and Y/C crosstalk, can be scored based on the five-level damage standard in Table 4-2.

The test personnel can also correct the test results after scoring the test items based on Table 4-2, as the test scores are extended to one decimal point. For example, after checking a video, the test personnel consider that the image quality is common and score it 3 out of 5. Then, after checking several videos, the test personnel may consider that the score of the former video can be higher and correct the score to 3.2. During the correction, the test personnel need to take into account the importance of scenarios in practical application and correct the scores properly.

During the subjective evaluation of the image quality, if the test personnel discover any obvious defect, such as aliasing, blurring, or discontinuity at the edges for the image of moving objects, they need to reduce the score of the corresponding test dimension based on the defect and even reduce the score to the lowest point.

The test personnel can score a test item accurate to one decimal point and keep two decimal points for the final score.

Black box testing is required for all products to be tested. The test personnel cannot specify or imply any product or product module during the evaluation, but shall name the products to be tested using codes, such as A, B, and C. After the evaluation, the test personnel can then discuss the specific products and product models.

The evaluation can be summarized as follows:

- Products in black boxes
- Test personnel, including five to twelve participants of professionals and nonprofessionals
- Five points in total based on rough impression
- Score correction based on specific scenarios with the score accurate to 0.1
- Average score summary with the score accurate to 0.01 (Note that the test result is the final evaluation result.)



4.3 Subjective Dimension Evaluation Based on Five Points

Table 4-3 Table of subjective dimension evaluation based on five points

No.	Test Dimension	Key Dimension Reference	Initial Point	Scoring Standard Reference Based on Five Points Ranging from 0 to 5
1	Definition	Texture of still and moving objects in the bright and dark regions	3	 Clear image texture: +2. Blurry image texture: -2. Image aliasing with clear but overlapping lines and the original image content cannot be seen: -1. Sharpen image: -2. There is no plus. For moving objects, the moving object is blurry: -2. For moving objects, the still background is blurry: -3. The opposite effect is used as a plus, and the corresponding point is added. Good and visible details in the bright region: +1. Good and visible details in the dark region: +1. The opposite effect is used as a minus, and the corresponding point is deducted. Edge aliasing (including white edges): -2. There is no plus. Totally undistinguishable image: -5 (Special item) Undistinguishable or hardly distinguishable face: -2. Distinguishable face: +2. Undistinguishable license plate: -1. Distinguishable license plate: +1. Other factors, which need to be submitted for standard modifications in time before standard application.
2	Permeability	Contrast and sharpness	3	 High contrast with the bright region sufficiently bright and the dark region sufficiently dark: +2. Low contrast: -2. The dark region sufficiently dark can be found based on subjective perception: +1. The dark region sufficiently dark cannot be found based on subjective perception: -1. Still image with sharp edges: +1. Image with blurry edges: -1. Totally invisible image: -5
3	Denoising	Image noise size	5	 The background image cannot be distinguished due to noise: -4. Obvious granular noise: -2. Scattered noise: -1. Striped chrominance noise: -2 (Special item for coding) Cross noise: -2 Large quantity of noise: -1 Clean image: +1

No.	Test Dimension	Key Dimension Reference	Initial Point	Scoring Standard Reference Based on Five Points Ranging from 0 to 5
4	Color reproduction	WB (reproduction of gray), saturation, and color deviation	5	 Overall color deviation: -5 Other colors in the gray region (WB): -2 Color deviation of gray due to a large-area pure color: -0.5 for each spot Color deviation due to mixed light sources: -1 Colors too light: -1 Color deviation that can be distinguished by eyes: complexion, -3; sky, -2; leaves, -3.
5	Aliasing	Edge smoothness	5	The pixels of aliasing can be distinguished by visual inspection: –1 for each pixel
6	Flare	Bright and dark changes in the whole image or at the edges of the image	5	 Obvious AE flare: -5 Obvious AWB flare: -5 Severe flare of edges or lines: -3
7	False color	Colors that the original image does not contain appear among dense stripes. Excluding the purple edge	5	 Full-screen moire: -5 False color flare: -2 The proportion of color lines to texture lines is 1:1: -5
8	Blocking artifact	Image quality loss due to a large quantization step, especially referring to the mosaic effect in a single or suspended static image	5	 Large size of blocks: -3 A large number of blocks: -2
9	Breathing	Accumulative damage due to image inter-fame reference. Differen t from blocking artifact, breathing is a dynamic effect, such as dynamic refresh in the continuously played image.	5	 The image takes up the full screen: -3 Blocks are frequently refreshed in the image: -3
10	Smearing	Color retention in the background after an object moves; or the edge	5	 Background edge or line on the moving object: – Color retention behind the moving object: –3



No.	Test Dimension	Key Dimension Reference	Initial Point	Scoring Standard Reference Based on Five Points Ranging from 0 to 5
		or texture of the background image appears on the moving object		 Color retention: -2 Large quantity of noise that appears only after the object moves: -1
11	Complexion reproduction	A special item of color reproduction, especially referring to reproduction of complexion	5	 Complexion distortion and color deviation: -5 Complexion too light or too saturated: -2
12	Bright region detail	A special item of definition, exclusively used for evaluation of the bright region detail	3	 The bright region is too bright and objects are undistinguishable: -3 The slightly bright region can be suppressed and objects are distinguishable: +2 The slightly bright region losses some details and objects are hardly distinguishable: -2
13	Dark region detail	A special item of definition, exclusively used for evaluation of the dark region detail	3	 The dark region is too dark and objects are undistinguishable: -3 The slightly dark region can be improved and objects are distinguishable: +2 The slightly dark region losses some details and objects are hardly distinguishable: -2
14	Purple edge	Purple that appears at the edges of the bright region	5	 Point light source, the purple edge of which is wider than the light source diameter based on visual inspection: -1 for every 20% Area light source, the purple edge width of which is checked based on visual inspection: -1 for every two pixels Object under direct radiation of the highlight, the purple edge width of which is checked based on visual inspection: -1 for each pixel Large-area purple that appears in the image: -3
15	DoF	A special item referring to clear focus on objects in the far and near regions in the image	3	 Clear far region: +1. Blurry far region: -1. Clear near region: +1. Blurry near region: -1. Blurry medium region: -2. Clear medium region: +0.
16	Brightness	A special item of definition, exclusively used for the brightness in the slightly dark region	3	 The brightness of the whole image is close to the scenery that can be seen by eyes with the normal illumination: +2 The brightness of the image is slightly low and some objects are invisible: -1. The image is too dark: -3. The image is too bright: -1

No.	Test Dimension	Key Dimension Reference	Initial Point	Scoring Standard Reference Based on Five Points Ranging from 0 to 5
17	Halo size	Transition region around the slightly bright region, such as the highlight	5	 Point light source, the halo size of which is wider than the light source diameter based on visual inspection: -1 for every 20% Area light source, the halo edge width of which is checked based on visual inspection: -1 for every two pixels Object under direct radiation of the highlight, the halo edge width of which is checked based on visual inspection: -1 for each pixel Large-area halo that appears in the image: -5

4.4 Subjective Scenario Evaluation

During the evaluation of subjective dimensions, the test personnel need to score each dimension separately in each scenario, average the scores of all dimensions in a scenario, and use this average score as the test result of this scenario. Then, they can apply weighting to the average score of all scenarios and get the weighted score of the full scenarios, which is also the total score. Table 4-4 provides an example of the evaluation table that can be used by the test personnel.

Table 4-4 Table of subjective scenario evaluation

Test Dimension	Product A	Product B	Remarks
Static scenario	5.0	5.0	-
Personage scenario	5.0	5.0	-
Long shot scenario	5.0	5.0	-
WDR scenario	5.0	5.0	-
Low-illumination scenario	5.0	5.0	-
Complex texture scenario	5.0	5.0	-
Motion scenario	5.0	5.0	-
Light variation scenario (AE convergence)	5.0	5.0	-
Highlight scenario	5.0	5.0	-
Open scenario	5.0	5.0	-
Outdoor AWB scenario	5.0	5.0	-
Outdoor low-illumination scenario	5.0	5.0	-

Test Dimension	Product A	Product B	Remarks
Outdoor motion scenario	5.0	5.0	-
Outdoor HLC scenario	5.0	5.0	-
Weighted averaging of key dimensions	-	-	-

4.5 Data Results and Application

Table 4-5 Example of data results and application

Result Rating	Conclusion	Single Dimension	Weighting of All Dimensions	Weighting of Key Dimensions	Remarks
Grade A: competitive product	Passed	≥ 3.0	Higher than the benchmark	Higher than the benchmark	All standards are met.
Grade B: qualified product in terms of the image quality	Passed	≥ 3.0	Higher than the benchmark	-	All standards are met.
Grade C: unqualified or uncompetiti ve product	Failed	-	Lower than the benchmark	Lower than the benchmark	Only one standard is met.

- The corresponding benchmark is formulated based on version test strategies before the evaluation.
- The single dimension refers to each subjective dimension of the evaluation.

5 Appendix

Table 5-1 lists the equipment and software requirements.

Table 5-1 Equipment and software requirements

Equipment or Software	Requirement	Remarks
Imatest	Recommended versions: Imatest 3.6 and later versions	-
Light box	Light sources: D50, D65, D75, and A/F	-
Chart	ISO12233, Gretag Macbeth Color Checker, Kodak Gray Scale Chart Q14, and Checkerboard Distortion Test Target	-
Luminance box	LV0-LV17 and 0.1 step	-
Color temperature and illuminance meter	CL200 and T10	-