VIEW FROM THE ETCH FACE - SCALE 1:5 - DO NOT SCALE: USE THE DXF FOR ALL GEOMETRY

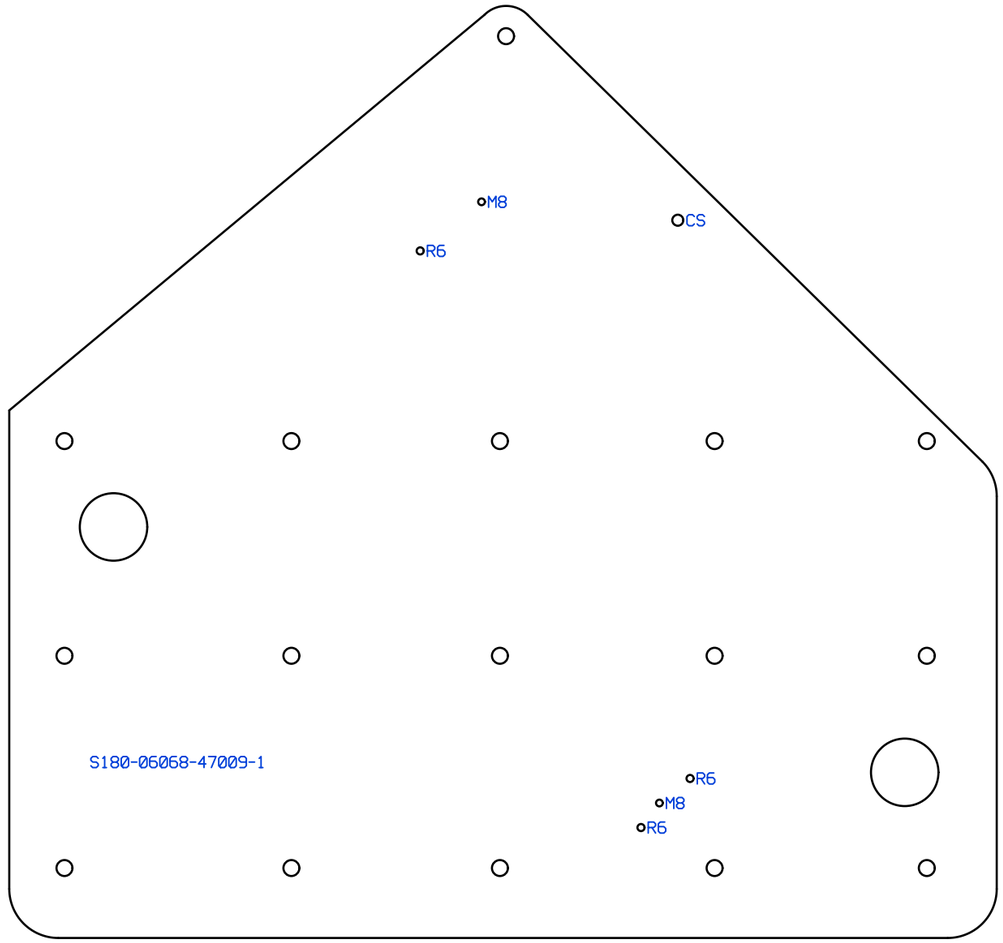


## LASER CUTTING NOTES

1. Cut the profile and all holes from the DXF file S180-06068-47009-1.dxf (layer CUT).
2. **ETCH ALL TEXT ON LAYER ETCH (shown blue on this sheet): the part number S180-06068-47009-1 and every hole label. Do not omit any etching.**
3. Etch on the face shown - this view is from the etch side.
4. Material: MILD STEEL 6 mm thick.
5. Remove all burrs and sharp edges.

**HOLE LABELS (etched next to each hole, shown blue):**

M8 x2 - M8 tapped hole - drill and tap after cutting (laser cut Ø5.5)
CS x1 - countersunk hole - countersink after cutting (laser cut Ø9)
R6 x3 - 6 mm reamed dowel hole - ream after cutting (laser cut Ø5.8)

| POLAR | LASER CUTTING INSTRUCTION | |
|---|---|---|
| DESCRIPTION: RING SUPPORT - JIG | | |
| PART No: S180-06068-47009 | | REV: 1 |
| MATERIAL: MILD STEEL | | THICKNESS: 6 mm |
| QTY: | SCALE: 1:5 | SHEET: A3 |
| DRAWN: | DATE: 16/10/2026 | DXF FILE: S180-06068-47009-1.dxf |