
USER MANUAL

ChArUco targets · ceramic · supplement

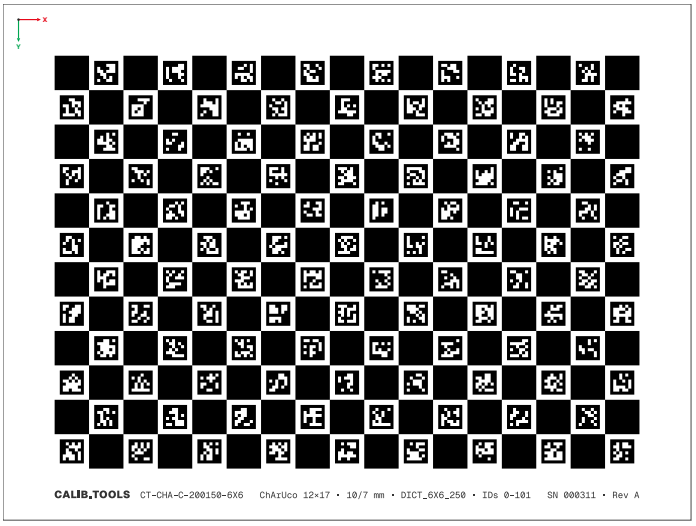

Rendering · CT-CHA-C-200150-6X6

APPLIES TO

Applies to	CT-CHA-C-200150-6X6
Substrate	ceramic
Size	200 × 150 × 4.0 mm
Pattern	12 × 17 ChArUco · 10 / 7 mm

> READ FIRST
> Read CT-UM-GEN before handling or using the target. This supplement states the ceramic-specific differences only.

1 Material care

- **Protect edges.** Technical ceramic is rigid; edges can chip under impact. Do not drop the target or place it on a hard, uneven surface.
- **Keep hard tools away.** Do not scrape, lever or probe the pattern or its edges with metal tools.
- **Clean gently.** Use isopropanol and a clean lint-free cloth. Wipe without abrasive pads, powders or pastes.

2 Mounting

- **No mounting holes.** Do not drill, machine or modify this ceramic target.
- Support the target on 3 points, or use the optional fixture. The supports must sit outside the pattern area.
- Do not clamp across the pattern. Avoid bending stress from twisted, non-coplanar or point-loaded supports.

3 Temperature

After transport, leave the target in the measurement environment for about 2 h before use. Avoid direct heat, cold airflow and handling that creates a local temperature gradient.

> WORKED EXAMPLE
> 170 mm × 7 ppm/K × 5 K ≈ 6 µm
> This is greater than a ±2 µm tolerance; measure near 20 °C.

4 Storage

- Store clean, dry and supported over its full protected area in the supplied packaging or equivalent rigid packaging.
- Keep the target separated from hard objects; do not stack loads on it or rest items on the pattern face.

5 Differences from CT-UM-GEN

GENERAL MANUAL SECTION	CERAMIC-SPECIFIC DIFFERENCE
4 · Handling & mounting	No holes; support on 3 points or the optional fixture. Do not clamp across the pattern; avoid bending stress.
8 · Care & storage	Ceramic edges are brittle. No drops, hard tools or abrasives; clean with isopropanol and a lint-free cloth.
9 · Re-inspection	If an edge is chipped, the target is dropped or bending is suspected, stop use and arrange re-inspection before precision work.

Family manuals contain only what differs from the general manual CT-UM-GEN.

calib.tools/files/CT-UM-CHA-C

SAMPLE