



10500 kg

昇迅活动房（上海）有限公司 **SPEEDYHOUSE (SHANGHAI) CO., LTD.**

地址: 上海市青浦区练塘镇工业园区蒸夏路 1851 号 电话: 021-59815802 传真: 021-59815900 邮编: 201715
Address: 1851, Zhengxia Road, Liantang Industrial Area, Qingpu District Shanghai China
Tel: 021-59815802 Fax: 021-59815900 Postal Code: 201715

TEST REPORT STACKING TEST

FOR ACCOMMODATION CONTAINER MODEL MH101

Document released April 28th, 2011.


Test carried on on April 27th, 2011

On April 27th, 2011, a stacking test has been carried on in Speedy House facility in order to evaluate the stacking capacity of an assembled standard 20' accommodation container, model MH101.

Test procedure

Preparation of the test:

1. A standard 20' accommodation container, model MH101 has been assembled and put on the ground on 6 supports (4 under each corner and 2 under the middle of each long side) . The weight and put on 6 supports as the drawing.

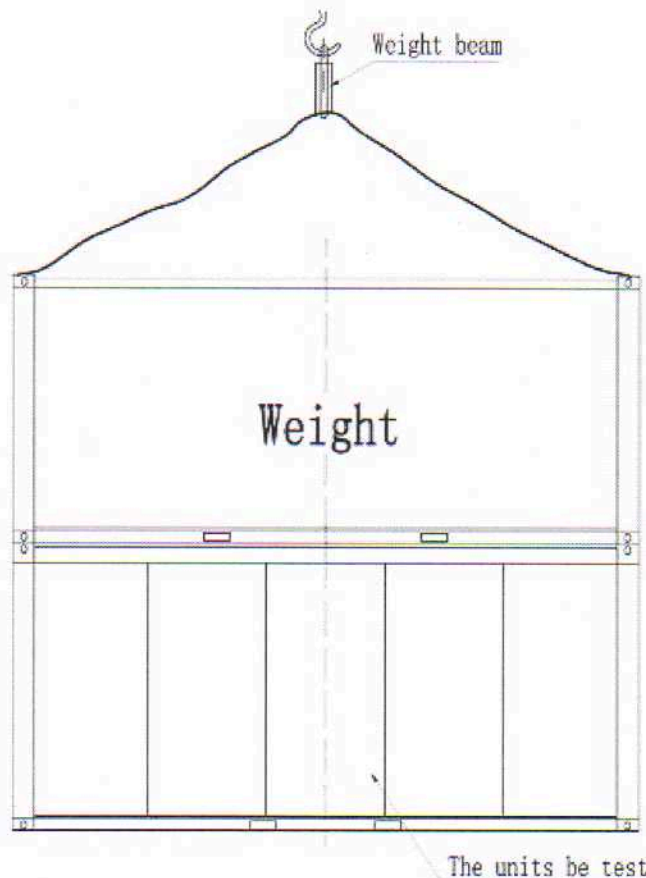




昇迅活动房（上海）有限公司 *SPEEDYHOUSE (SHANGHAI) CO., LTD.*

地址: 上海市青浦区练塘镇工业园区蒸夏路 1851 号 电话: 021-59815802 传真: 021-59815900 邮编: 201715

Address: 1851, Zhengxia Road, Liantang Industrial Area, Qingpu District Shanghai China

Tel: 021-59815802 Fax: 021-59815900 Postal Code: 201715

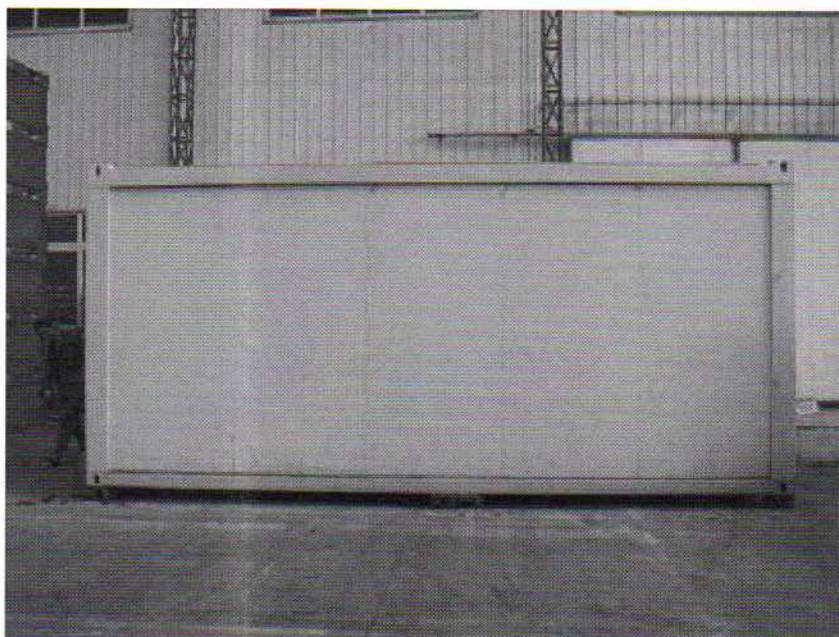

2. A cord has been fixed between the top of the corner post and bottom of the corner post, as per below images.



3. It has been measured the initial distance between the cord itself and the corner post surface, the details as per below images.







昇迅活动房（上海）有限公司 *SPEEDYHOUSE (SHANGHAI) CO., LTD.*

地址: 上海市青浦区练塘镇工业园区蒸夏路 1851 号 电话: 021-59815802 传真: 021-59815900 邮编: 201715

Address: 1851, Zhengxia Road, Liantang Industrial Area, Qingpu District Shanghai China

Tel: 021-59815802 Fax: 021-59815900 Postal Code: 201715

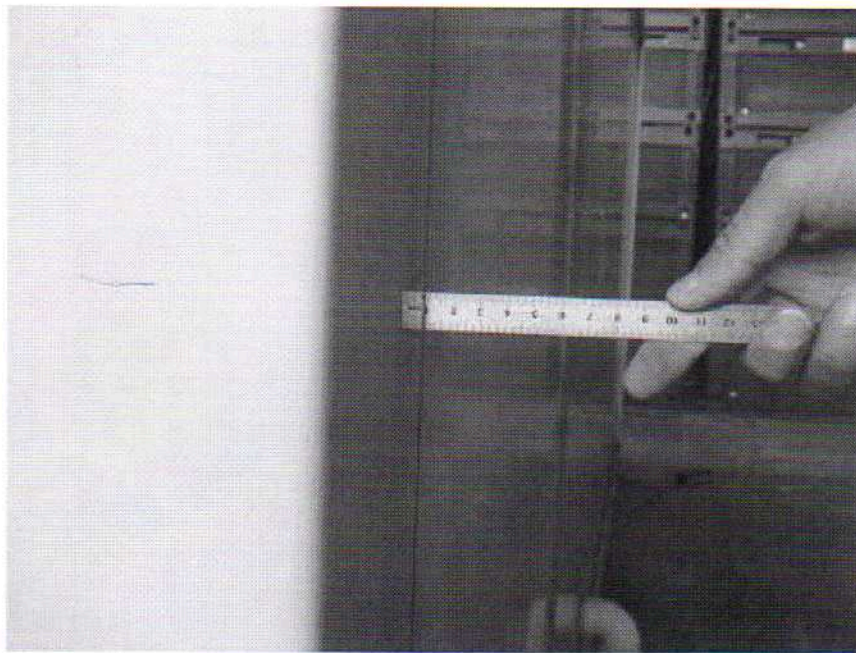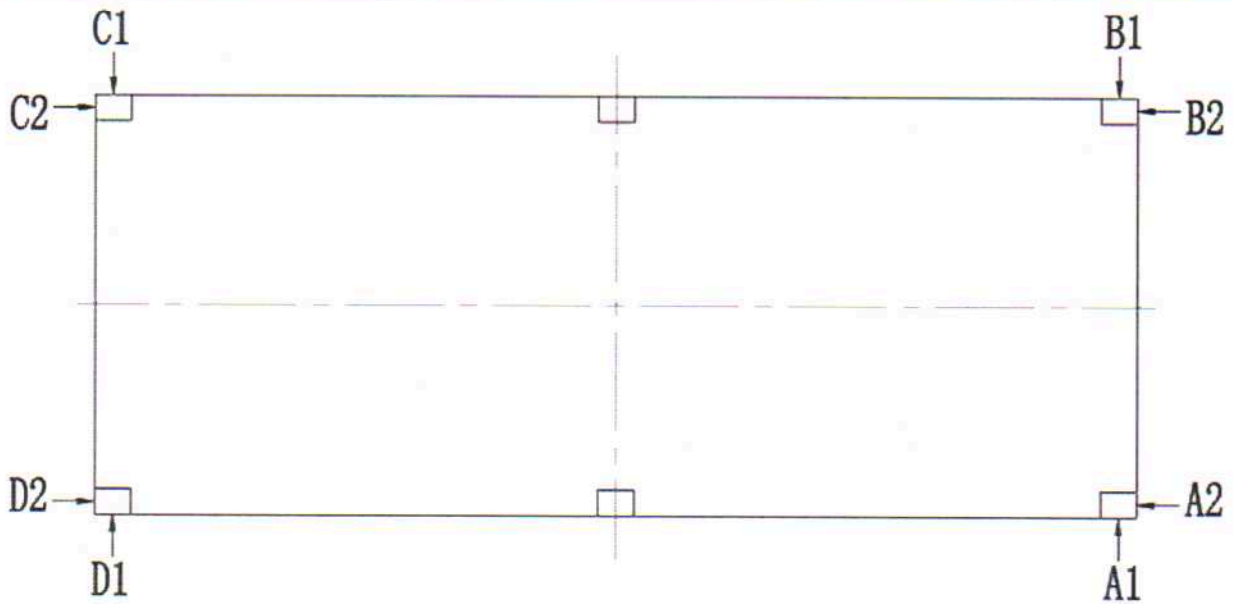

Measure from middle of the corner post, 8 points "A1 to D2"

The result of measurement was :

- A1 = 9 mm , A2 = 9 mm , B1 = 8 mm , B2 = 9 mm , C1 = 10 mm , C2 = 9 mm , D1 = 9 mm , D2 = 7 mm ;

4. A weight of 8000 Kg has been put on the whole units as per below images; measurement has been repeated with the following results:

- A1 = 8 mm , A2 = 9.5 mm , B1 = 8 mm , B2 = 9 mm , C1 = 10 mm , C2 = 8.5 mm , D1 = 9 mm , D2 = 7 mm ;







昇迅活动房（上海）有限公司 *SPEEDYHOUSE (SHANGHAI) CO., LTD.*

地址: 上海市青浦区练塘镇工业园区蒸夏路 1851 号 电话: 021-59815802 传真: 021-59815900 邮编: 201715

Address: 1851, Zhengxia Road, Liantang Industrial Area, Qingpu District Shanghai China

Tel: 021-59815802 Fax: 021-59815900 Postal Code: 201715

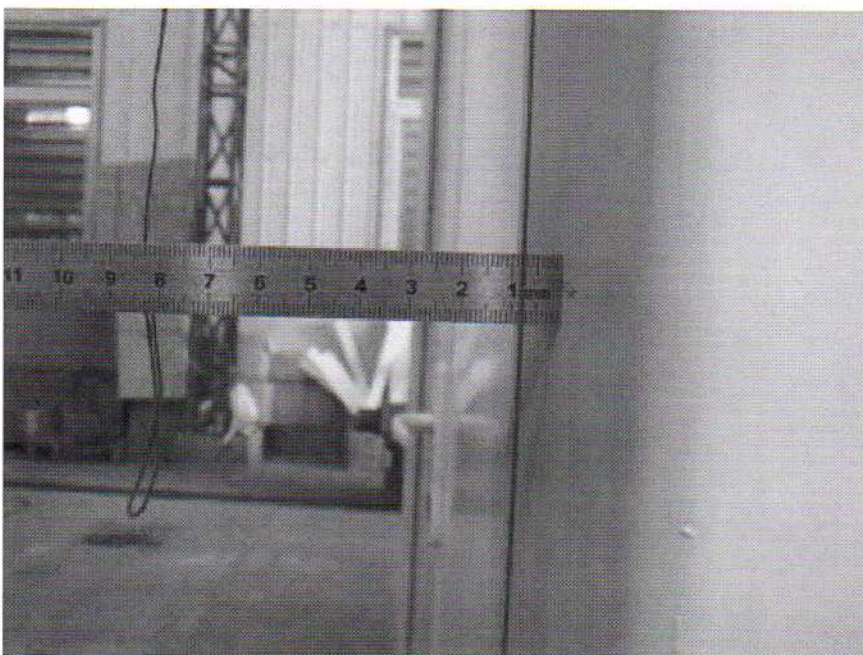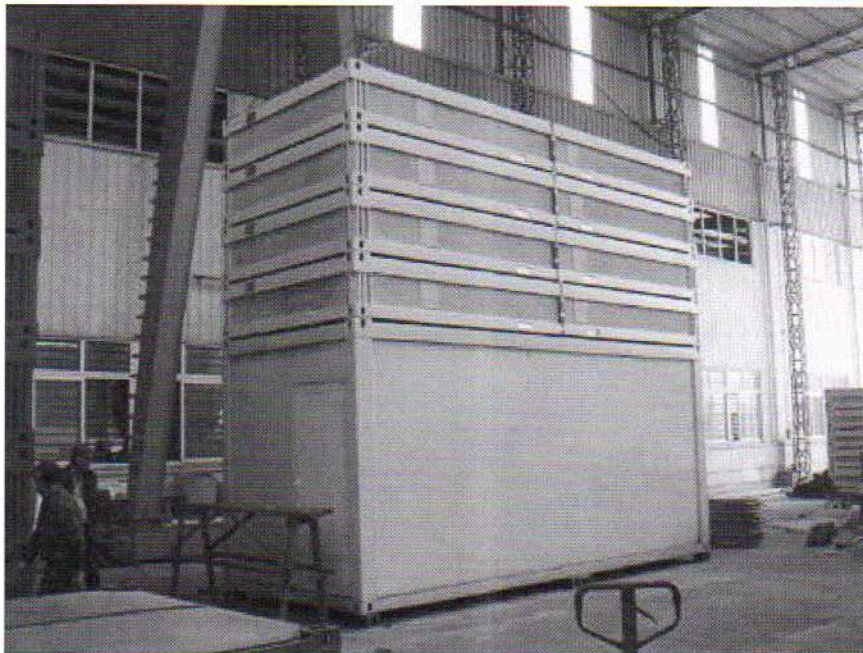

5. The weight has been kept on the unit for 5 minutes; after its removal a measurement has been made, with the following results:

A1 = 8 mm , A2 = 9 mm , B1 = 8 mm , B2 = 9 mm , C1 = 9.5 mm , C2 = 8.5 mm , D1 = 9 mm , D2 = 7 mm;






昇迅活动房（上海）有限公司 *SPEEDYHOUSE (SHANGHAI) CO., LTD.*

地址: 上海市青浦区练塘镇工业园区蒸夏路 1851 号 电话: 021-59815802 传真: 021-59815900 邮编: 201715

Address: 1851, Zhengxia Road, Liantang Industrial Area, Qingpu District Shanghai China

Tel: 021-59815802 Fax: 021-59815900 Postal Code: 201715

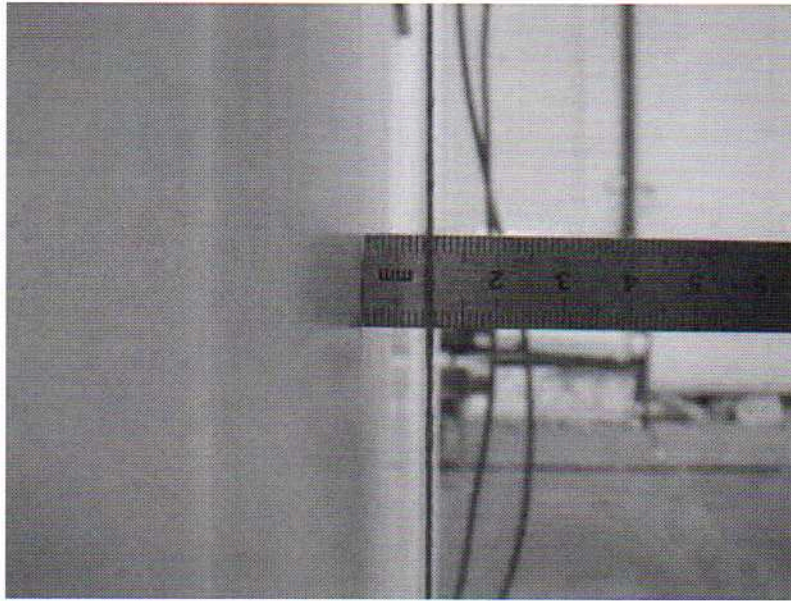

6. A weight of 10915 Kg has been put on the whole units as per pictures; a measurement has been made again with the following results:

- A1 = 9 mm , A2 = 9 mm , B1 = 8 mm , B2 = 9 mm , C1 = 10 mm , C2 = 8 mm , D1 = 9 mm , D2 = 7 mm;






昇迅活动房（上海）有限公司 *SPEEDYHOUSE (SHANGHAI) CO., LTD.*

地址: 上海市青浦区练塘镇工业园区蒸夏路 1851 号 电话: 021-59815802 传真: 021-59815900 邮编: 201715


Address: 1851, Zhengxia Road, Liantang Industrial Area, Qingpu District Shanghai China

Tel: 021-59815802 Fax: 021-59815900 Postal Code: 201715

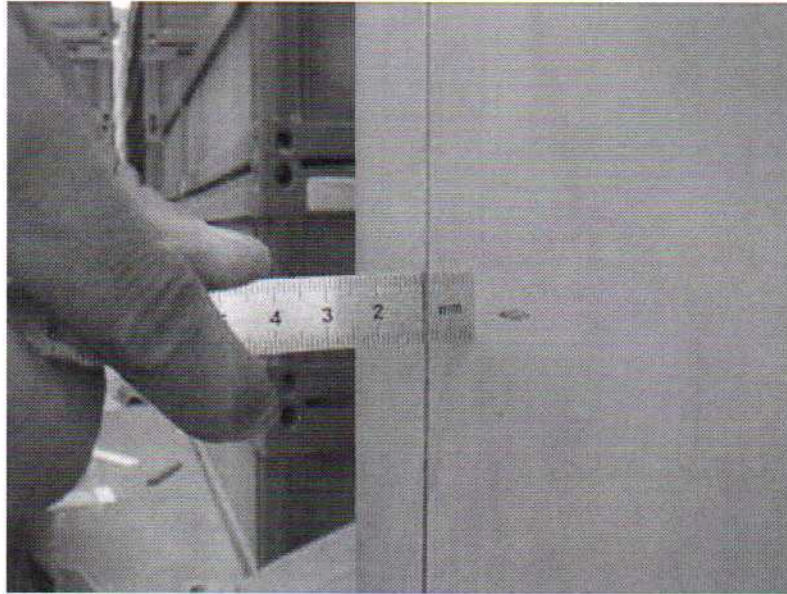

7. The weight has been kept on the panel for 5 minutes; after its removal a measurement has been made, with the following results:

A1 = 9 mm , A2 = 9 mm , B1 = 8 mm , B2 = 8.5 mm , C1 = 10 mm , C2 = 8.5 mm , D1 = 8 mm , D2 = 7.5 mm;

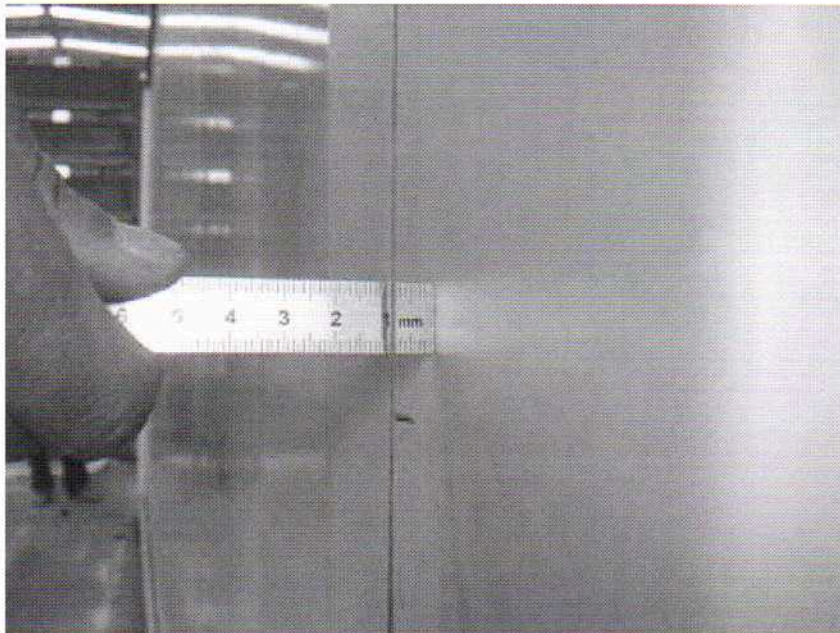



昇迅活动房（上海）有限公司 *SPEEDYHOUSE (SHANGHAI) CO., LTD.*

地址: 上海市青浦区练塘镇工业园区蒸夏路 1851 号 电话: 021-59815802 传真: 021-59815900 邮编: 201715

Address: 1851, Zhengxia Road, Liantang Industrial Area, Qingpu District Shanghai China

Tel: 021-59815802 Fax: 021-59815900 Postal Code: 201715

loading	A1	A2	B1	B2	C1	C2	D1	D2
before loading (0kg)	9	9	8	9	10	9	9	7
after weight removal (0kg)	9	9	8	8.5	10	8.5	8	7.5
bending	0	0	0	0.5	0	0.5	1	0.5

So there was no major plastic deformation of the corner post under the load of 10915kg

