


TOP VIEW (into cavity, dashed: cavity at Z=6)

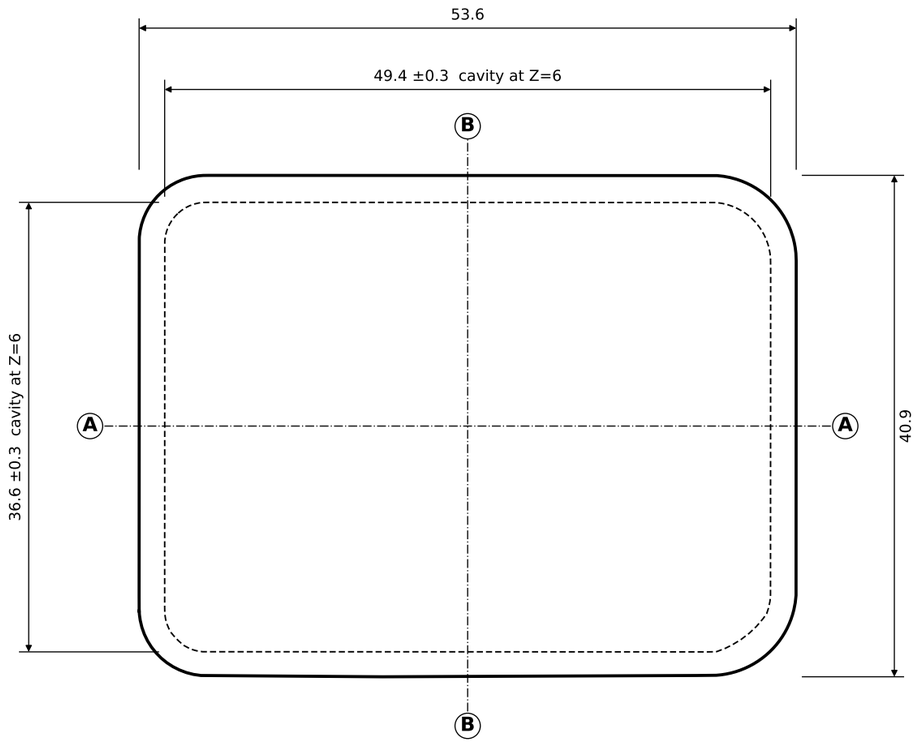

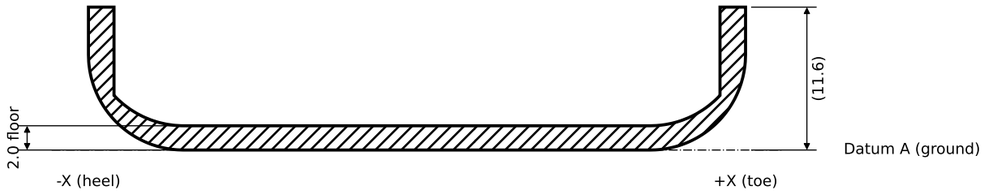


SECTION A-A (plane Y=0, seen from -Y; (11.6): rim at the toe, ref.)

Rim top is 4.9 deg to the ground face (ref.)

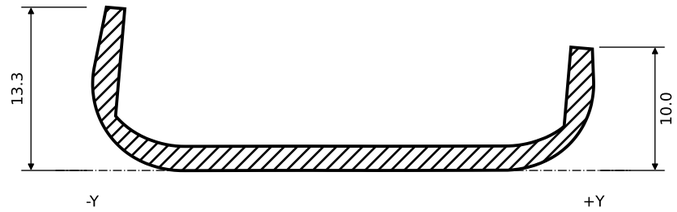

SECTION B-B (plane X=0, seen from +X)

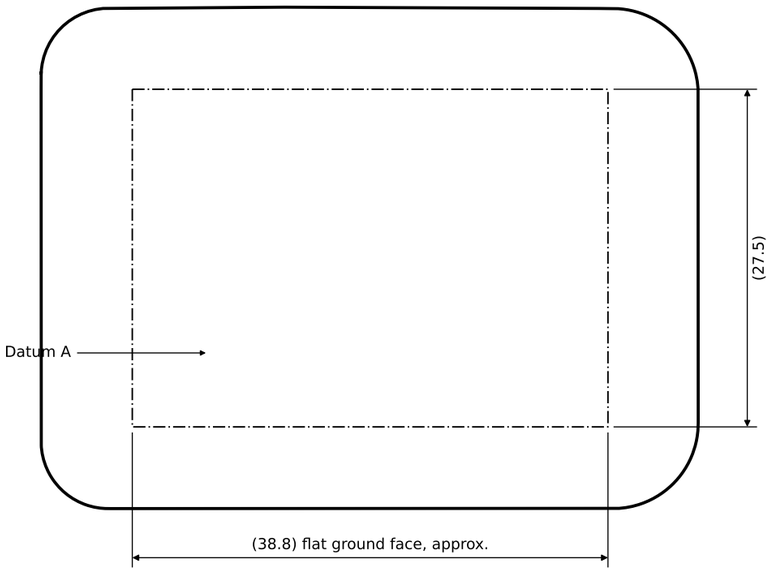


BOTTOM VIEW (ground face; dash-dot: flat area, edges blend up)

NOTES


1. The STEP file is the master geometry. This drawing gives the critical dimensions and tolerances only.
2. General tolerance +-0.3 mm (Yellowhammer standard vacuum casting accuracy: +-0.3 %, min +-0.3 mm).
3. The STEP is the finished sole: it is already 0.8 % smaller than the foot, so the soft sole stretches over the rigid foot and grips it. Add only your usual casting-shrinkage compensation, no other scaling.
4. Wall as modelled: 1.8-2.1 mm above Z=7; 1.2-1.5 mm in a band at Z=3-7 all round, where the cavity chamfer meets the rounded outside (thinnest at the toe). Wall +0.3/-0.2 mm and never under 1.0 mm. Floor 2.0 +-0.3 mm. No voids or bubbles.
5. Hardness Shore 60A +-5 (ISO 48-4 / ASTM D2240 type A, at 23 C, after full post-cure). Hardness not to be changed without written agreement.
6. Ground face (datum A): matte as-cast finish, no gloss, no release-agent film, no gate, vent, flash or parting line.
7. Gates and vents on the rim top face (it sits under the foot edge). Trim flash flush, max 0.2 mm.
8. Right sole = mirror image of the left sole about the XZ plane. Separate files: sole_left.step, sole_right.step.
9. Pack left and right soles in separate labelled bags, not compressed or folded.

TITLE: **Foot sole, LEFT shown, RIGHT is mirror image**						
PART NO.: DB-FOOT-SOLE-L / DB-FOOT-SOLE-R						
MATERIAL: Cast PU elastomer, Shore 60A +-5, bright orange (e.g. RAL 2004)						
SCALE: 2:1	UNITS: mm	PROJECTION: Views as labelled	REV: A	DATE: 2026-11-07	DRAWN: Rafael Caricio	SHEET: 1 OF 2


TOP VIEW (dashed: section at Z=12)

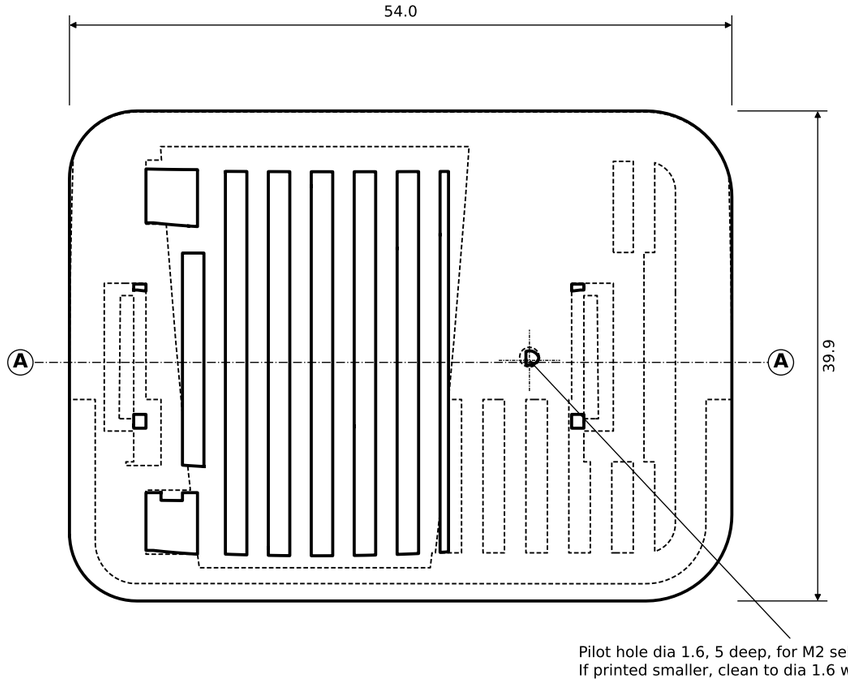

Pilot hole dia 1.6, 5 deep, for M2 self-tapping screw.
If printed smaller, clean to dia 1.6 with a drill. Do not enlarge.

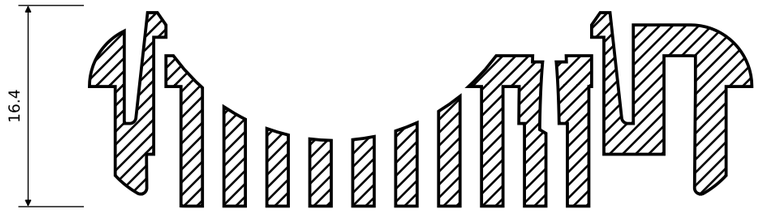

SECTION A-A

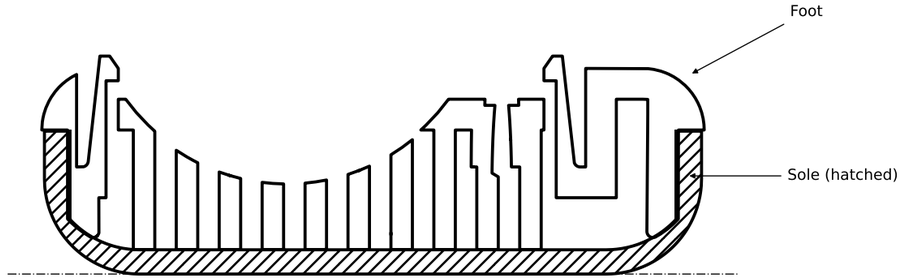

ASSEMBLY, SECTION A-A (for reference)

The sole is 0.8 % smaller than the foot (stretch fit), so the outlines overlap.

NOTES

1. The STEP file is the master geometry. Make the part as modelled, no changes to holes, slots, lugs or ribs.
2. General tolerance +-0.3 mm or the printing process standard, whichever is tighter.
3. Outer surfaces below the foot edge go into the sole cavity, which is made 0.8 % smaller (stretch fit). Do not add material on these surfaces (no thick coating).
4. Finish: as printed, bead blasted or vapour smoothed. Colour: bright orange, the same shade as the soles, dyed or pigmented through.
5. Right foot = mirror image of the left foot about the XZ plane. Separate files: foot_left.step, foot_right.step.
6. The foot is an optional line item. Quote it separately from the soles.

TITLE	**Foot (rigid), LEFT shown, RIGHT is mirror image**
PART NO.	DB-FOOT-L / DB-FOOT-R
MATERIAL	PA12 (SLS, dyed), bright orange (e.g. RAL 2004)

SCALE	UNITS	PROJECTION	REV	DATE	DRAWN	SHEET
2:1	mm	Views as labelled	A	2026-11-07	Rafael Caricio	2 OF 2