



L = 471 mm when d = 17.53 mm; set yours from Table 3
3
4
stage knob
pinhole at s = 50
pinhole
travel
50 mm
5
2
1
6
beam row: one row of table holes
pinhole at s = 0
slit (u = 0)
fiber
100 mm
7

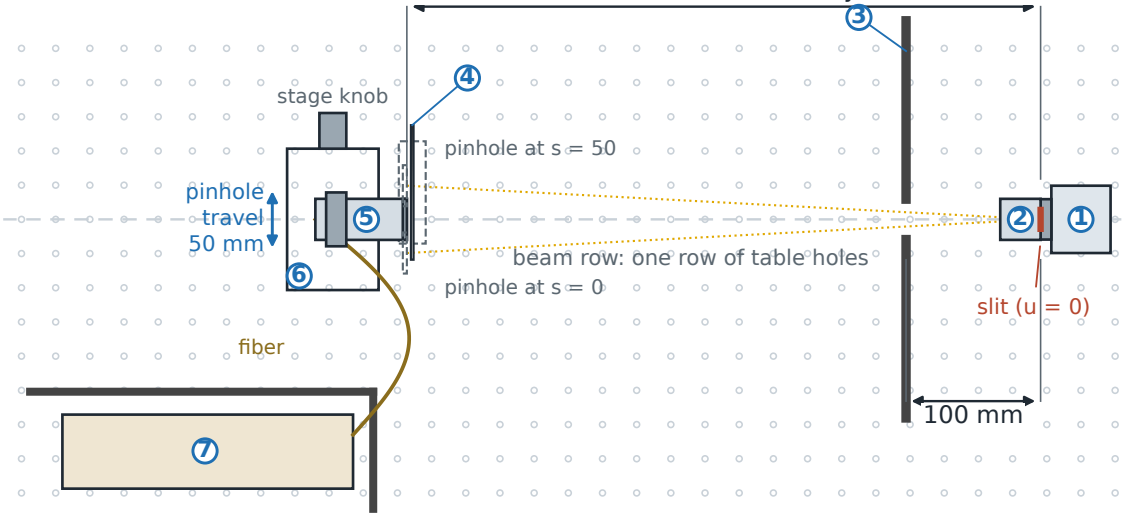

Side views, to scale. Heights in mm above the table. Blue dashes: the beam at 140 mm. Camera height 56 mm is the manual's drawing; measure yours.


Exploded view, not to scale. The slit goes inside the hood, at its far (threaded) end; the SM1A9 stays empty.

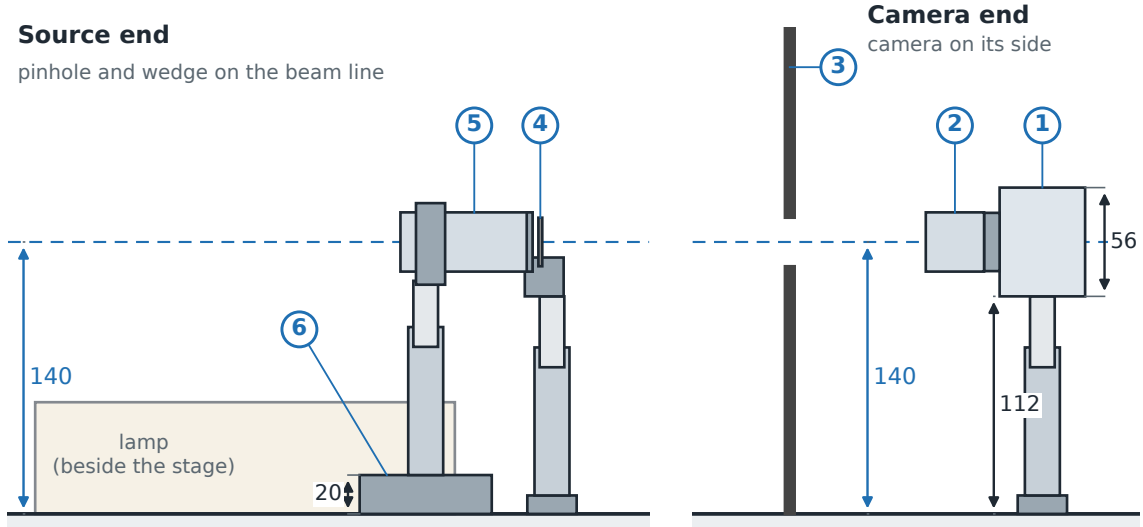

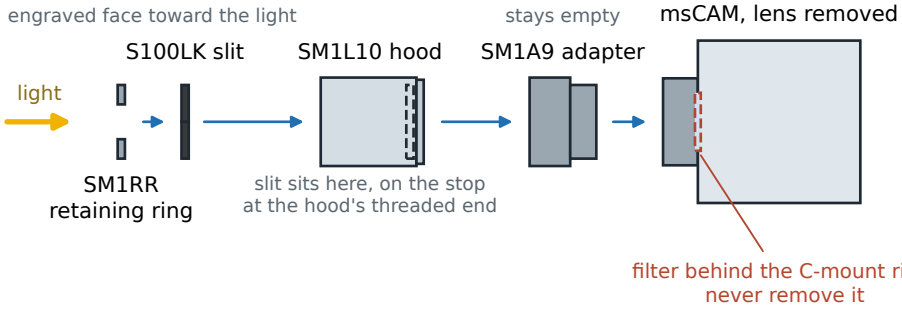


Looking into the hood from the source side: the camera lies on its side and the slit stands vertical, along the camera's 2,048-pixel direction. Step A1 finds which side to lay the camera on.

Step A3: before fitting the adapter

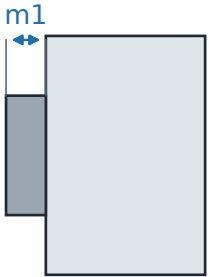


m1 = how far the C-mount holder face stands out from the panel

Step A6: adapter, hood and slit fitted

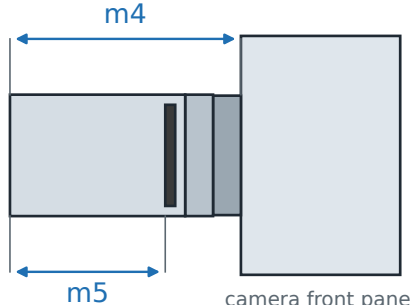

m4 = hood face to panel. m5 = depth from the hood face down to the slit's engraved face.
Slit-to-sensor distance d = 17.53 + m4 − m5 − m1 (mm)

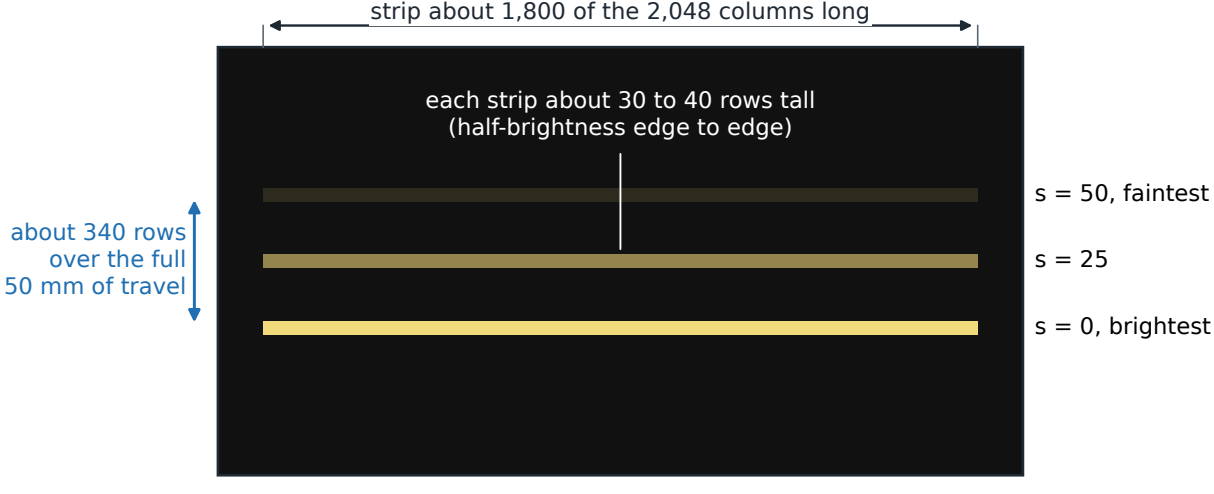

What the viewer should show (full sensor). Counts assume 5.5 µm pixels on a 2,048 × 1,088 sensor; Step E measures them. The strip may move up or down as s rises; either is correct. Brightness may also step where the strip crosses a color band.