

MANAGEMENT REVIEW

Management without theatre.

OPERATIONS

POKA-YOKE: THE MISTAKE NOT ALLOWED TO HAPPEN

Two springs on a dish, 112 devices and what they cost, three kinds of inspection, why warnings go unheard, shape, count and sequence, and a card for one poka-yoke.



112

poka-yoke devices from Japanese plants in Shigeo Shingo's book, each one with its cost.

SHINGO, 1986

INSIDE

COVER STORY

Two springs on a dish

PAGE 03

THE MODEL

Find, reduce, eliminate

PAGE 05

TOOL OF THE ISSUE

The poka-yoke card

PAGE 08

NO. 46 · OPERATIONS

In this issue

Telling people to be more careful works for a while. This issue is about the other way: building the check into the work, so that a slip is caught before it becomes a defect, or cannot be made at all.

In 1961 Shigeo Shingo watched a worker leave a spring out of a switch and solved it with a small dish. His book of 1986 describes 112 such devices; more than half cost \$100 or less, in 1986 dollars. Shingo separates inspections that find defects, reduce them and eliminate them, and he prefers a device that stops the work to one that only warns. Hospital alarms show why: in 98 events reported to the Joint Commission, the factor named most often among those listed was an alarm turned off.

Stiven Janaqi EDITOR · STIVEN CATALYST

03 COVER STORY
Two springs on a dish

04 THE NUMBERS
112 devices, most of them cheap

05 THE MODEL
Find, reduce, eliminate

06 WHAT THE RESEARCH SAYS
When the warning goes unheard

07 HOW IT IS MEASURED
Shape, count, sequence

08 TOOL OF THE ISSUE
The poka-yoke card

09 SOURCES
Sources and method

HOW TO READ THIS ISSUE

Figure

Every figure has its source and year at the foot of its page.

Our reading

Where the editors interpret rather than the research, it says so.

Practice

The steps and the card are proposals to try, not research results.

COVER STORY

Two springs on a dish

In 1961 Shigeo Shingo visited Yamada Electric in Nagoya. The plant made a simple switch with two buttons for its parent company, Matsushita Electric, with a small spring under each button. Now and then a worker left a spring out, and each time Yamada had to send an inspector to Kyushu to check every switch delivered.

Telling workers to be careful helped for a while, then it happened again. On the floor Shingo saw a worker skip a spring, and asked the department chief:

“What does it mean for a human being to 'forget' something?”

The answer was a dish. At the start, the worker took two springs from a box of hundreds and put them on it; a spring left on the dish showed that one had been left out. No more springs went missing, Shingo writes. Around 1963 he renamed such devices: “foolproofing” made a worker cry, so he chose poka-yoke, proofing against inadvertent mistakes.

OUR READING

The dish does not ask anyone to remember better. It shows the forgetting before the switch leaves the bench.

Source: Shigeo Shingo, translated by Andrew P. Dillon, Productivity Press, 1986


Shingo's own account, in *Zero Quality Control* (Japanese 1985, English 1986); we found no independent record. It is the first device he describes, not the first ever: foolproofing for safety came earlier.

THE NUMBERS

112 devices, most of them cheap

Shingo's book ends with 112 poka-yoke examples from Japanese plants, each with its cost. In 2007 John Grout sorted the costs in a report for the US Agency for Healthcare Research and Quality:

SHINGO'S EXAMPLES BY COST, IN US DOLLARS OF 1986

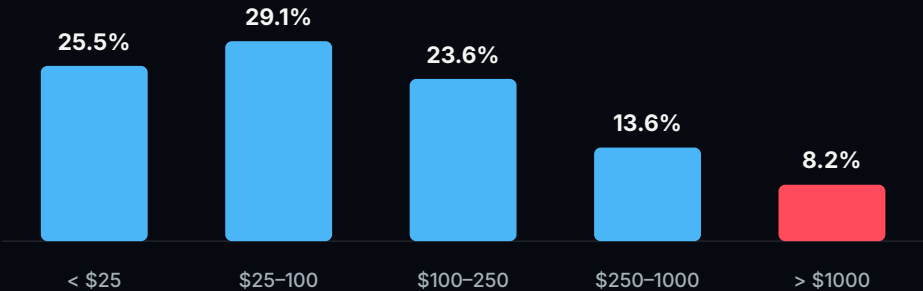

83 of 112

stop the work when an error occurs; the other 29 only warn

3.5% →
0.01%

defect rate at Arakawa Auto Body within two years, mainly through poka-yoke

OUR READING

When a device costs less than the hour spent arguing about it, the question is no longer money. It is whether anyone goes looking for the error.

Sources: John Grout, Agency for Healthcare Research and Quality, 2007; Shigeo Shingo, translated by Andrew P. Dillon, Productivity Press, 1986

Shares of the examples, as tabulated by Grout; the median is about \$100. The count of 83 is the sum of Shingo's own grouping. Arakawa is his account, with no year given.

THE MODEL

Find, reduce, eliminate

Shingo sorts inspections by what they do to defects. Errors, he argues, cannot be removed from human work. But an error becomes a defect only if nothing happens at the stage where it is made.

01**Judgment inspection**

sorts finished products into good and bad: it protects the customer, but does not lower the defect rate

02**Informative inspection**

uses the defects found to correct the process: statistical control, checks at the next step, self-checks

03**Source inspection**

checks the conditions that give rise to defects and acts at the error, before it becomes a defect

At Matsushita's Moriguchi television plant in 1963, statistical control had cut a 15% defect rate to 6.5%, where it stuck. Three months after checks at the next step began, it was 0.65%. Around 1967 Shingo arrived at source inspection. His Zero QC adds: check every item, not a sample, and act at once.

OUR READING

A defect found at the end is a report on yesterday. An error caught at the source is a defect that never existed.

Source: Shigeo Shingo, translated by Andrew P. Dillon, Productivity Press, 1986


The three inspections and the Moriguchi rates are Shingo's account (1986). The reading is the editors'.

WHAT THE RESEARCH SAYS

When the warning goes unheard

Shingo ranks devices that stop the work above those that only light a lamp or sound a buzzer: a warning works only if someone notices. In 2013 the Joint Commission counted 98 alarm-related events reported to it from 2009 to mid-2012; 80 ended in death.

CONTRIBUTING FACTORS IN THE 98 EVENTS, NUMBER OF EVENTS

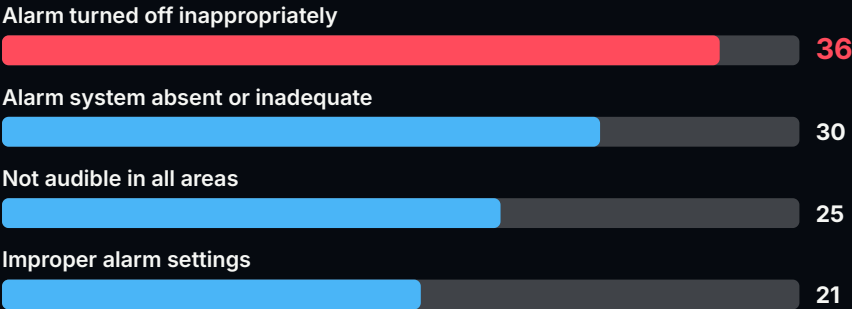

The alert estimates that 85 to 99% of alarm signals need no clinical action; a 2013 review puts false alarms at 72 to 99%. In 2026 the Institute for Safe Medication Practices ranked forcing functions highest, warnings and checklists in the middle, and reminders to “be more careful” among the lowest.

OUR READING

An alarm that sounds all day becomes noise. Before adding one, ask whether the step could be stopped.

Sources: Shigeo Shingo, translated by Andrew P. Dillon, Productivity Press, 1986; The Joint Commission, 2013; Sue Sendelbach & Marjorie Funk, AACN Advanced Critical Care, 2013 (via PubMed abstract); Institute for Safe Medication Practices, ISMP Medication Safety Alert! Acute Care 31(1), 2026

Reporting is voluntary and covers a small share of events; one event can have several factors. The counts show kinds of failure, not frequency.

HOW IT IS MEASURED

Shape, count, sequence

Shingo names three ways for a device to detect an error. Then it either stops the work, the stronger response, or warns with a light or a sound.

01	Contact	checks shape or size: the part fits the guide or touches the sensor, or it does not
02	Fixed value	checks that a step was repeated the set number of times, like six nuts welded on one part
03	Motion step	checks that the standard motions were done, in their order

HYPOTHETICAL EXAMPLE, A LOADING RAMP FOR HOME DELIVERIES

Fixed value	bags scanned against the order; the trolley is not released until the count matches
Test	once a shift, a trolley with one bag missing: does the block hold?

A device nobody tests can fail unseen. The case is invented.

Sources: Shigeo Shingo, translated by Andrew P. Dillon, Productivity Press, 1986; Lean Enterprise Institute, 2014; John Grout, Agency for Healthcare Research and Quality, 2007

The three methods and the six nuts are Shingo's. The Lean Enterprise Institute calls the stopping kind shutdown devices, the most powerful. Grout's advice: mistake-proof the mistake-proofing.

More in the essay

Where part of the order goes missing

TOOL OF THE ISSUE

The poka-yoke card

One card for one recurring error. Start where the error is made, not where the defect is found, and ask what in the work makes the slip possible before you ask for more attention. Incomplete Control shows where orders go out short.

01 The error what is left out, swapped or done backwards; how often

02 Where it starts the step where it is made, not where it is found

03 Inspection today judgment, informative or at the source

04 Method contact, fixed value or motion step

05 Stop or warn if it only warns: who reacts, and how fast

06 Test and owner how often the device is tested, by whom, what happens when it fails

Sources: Shigeo Shingo, translated by Andrew P. Dillon, Productivity Press, 1986; John Grout, Agency for Healthcare Research and Quality, 2007

A practice proposed by the editors, after Shingo (1986) and Grout (2007).

Open the tool: **Incomplete Control**

stivencatalyst.com/tools/incomplete-control/

SOURCES AND METHOD

Every figure has a source.

The figures in this issue come from the sources below. The year shows how recent each one is.

Zero Quality Control: Source Inspection and the Poka-yoke System

Shigeo Shingo, translated by Andrew P. Dillon, Productivity Press, 1986

<https://www.routledge.com/Zero-Quality-Control-Source-Inspection-and-the-Poka-yoke-System/Shingo/p/book/9780915299072>

Mistake-Proofing the Design of Health Care Processes (AHRQ Publication No. 07-0020)

John Grout, Agency for Healthcare Research and Quality, 2007

https://www.govinfo.gov/content/pkg/GOVPUB-HE20_6500-PURL-gpo3107/pdf/GOVPUB-HE20_6500-PURL-gpo3107.pdf

Lean Lexicon: Poka-yoke

Lean Enterprise Institute, 2014

<https://www.lean.org/lexicon-terms/poka-yoke/>

Sentinel Event Alert, Issue 50: Medical device alarm safety in hospitals

The Joint Commission, 2013

<https://digitalassets.jointcommission.org/api/public/content/f65e5c9df2b94000a99445e0a7877007>

Alarm fatigue: a patient safety concern

Sue Sendelbach & Marjorie Funk, AACN Advanced Critical Care, 2013 · via PubMed abstract

<https://doi.org/10.1097/NCI.0b013e3182a903f9>

Implement High-Leverage and Layered Risk-Reduction Strategies Using ISMP's Hierarchy of Effectiveness

Institute for Safe Medication Practices, ISMP Medication Safety Alert! Acute Care 31(1), 2026

<https://home.ecri.org/blogs/ismp-alerts-and-articles-library/implement-high-leverage-and-layered-risk-reduction-strategies-using-ismp-s-hierarchy-of-effectiveness>

EDITORIAL METHOD

Each figure was checked for its year, its publisher and what exactly it measures. Where the publisher's page could not be opened, the figure was checked against independent summaries and is marked “via”. The editors' interpretation is marked “Our reading”. Figures that could not be confirmed are not in the issue.



MANAGEMENT REVIEW

Management without theatre.

Every issue, one management question, checked against the best research.

ALL ISSUES

stivencatalyst.com/magazine/management-review.html