密级状态:	绝密()	秘密()	内部	资料()	公开	f()	
Security Clas	ss: Top-Seci	ret ()	Secret () I	nternal ()	Public	c (√)

Rockchip_Android7.1_WIFI 配置说明

$Rock chip_Android 7.1_WIFI_Configuration_Introduction$

(第二系统产品部)

(Technical Department, R & D Dept. II)

	文件标识:	RK-SM-YF-246		
	File No.:			
文件状态:	当前版本:	V1.2		
Status:	Current Version:	V 1.2		
[] 草稿	作 者:	赵子初		
[] Draft	Author:	Zhao Zichu		
[]正在修改	完成日期:	2017-12-15		
[] Modifying	Finish Date:	2017-12-13		
[√] 正式发布	审核:			
[√] Released	Auditor:			
	审核日期:			
	Finish Date:			



免责声明

本文档按"现状"提供,福州瑞芯微电子股份有限公司("本公司",下同)不对本文档的任何陈述、信息和内容的准确性、可靠性、完整性、适销性、特定目的性和非侵权性提供任何明示或暗示的声明或保证。本文档仅作为使用指导的参考。

由于产品版本升级或其他原因,本文档将可能在未经任何通知的情况下,不定期进行更新或修改。

Disclaimer

This document is provided "as is" and Fuzhou Rockchip Electronics Co. Ltd ("the company") makes no express or implied statement or warranty as to the accuracy, reliability, completeness, merchantability, specific purpose and non-infringement of any statement, information and contents of the document. This document is for reference only.

This document may be updated without any notification due to product version upgrades or other reasons.

商标声明

"Rockchip"、"瑞芯微"、"瑞芯"均为本公司的注册商标,归本公司所有。 本文档可能提及的其他所有注册商标或商标,由其各自拥有者所有。

Brand Statement

Rockchip, RockchipTM icon, Rockchip and other Rockchip trademarks are trademarks of Fuzhou Rockchip Electronics Co., Ltd., and are owned by Fuzhou Rockchip Electronics Co., Ltd.

All other trademarks or registered trademarks mentioned in this document are owned by their respective owners.

版权所有 © 2019 福州瑞芯微电子股份有限公司

超越合理使用范畴,非经本公司书面许可,任何单位和个人不得擅自摘抄、复制本文档内容的部分或全部,并不得以任何形式传播。

Copyright © 2019 Fuzhou Rockchip Electronics Co., Ltd.

Beyond reasonable use, without the written permission, any unit or individual shall not extract or copy part or all of the content of this document, and shall not spread in any form.

福州瑞芯微电子股份有限公司

Fuzhou Rockchip Electronics Co., Ltd.

地址: 福建省福州市铜盘路软件园 A 区 18 号

网址:www.rock-chips.com客户服务电话:+86-4007-700-590客户服务传真:+86-591-83951833客户服务邮箱:fae@rock-chips.com

Fuzhou Rockchip Electronics Co., Ltd.

Address: No. 18 Building, A District, No.89,software Boulevard Fuzhou,Fujian,PRC

Website: www.rock-chips.com
Customer service tel.: +86-4007-700-590
Customer service e-mail: fae@rock-chips.com

版本历史 Revision History

版本号	作者	修改日期	修改说明	备注
Version no.	Author	Revision Date	Revision description	Remark
V1.0	ZZC	2017-08-15	发布初稿	
		2017-08-13	Initial version release	
V1.1	ZZC	2017-12-05	增加 wifi ko 方式加载 wifi	
		2017-12-03	Add wifi ko way to load wifi	
V1.2	ZZC		修改内核自动编译 wifi ko	
		2017-12-15	Modify the kernel to automatically	
			compile wifi ko	

目 录 Contents

1	目的	J PURPOSE	1
	1.1	KERNEL 注意事项 KERNEL NOTICES	1
	1.2	ANDROID 注意事项 ANDROID NOTICES	3
2	WIF	T 兼容原理简要说明 BRIEF INTRODUCTION OF WIFI COMPATIBILITY PRINCIPLE.	3
	2.1	WIFI 芯片识别流程 WIFI CHIP RECOGNITION PROCESS	3
3	如何	引新增 WIFI 模块的支持 HOW TO ADD NEW WIFI MODULE SUPPORT	4
	3.1	WIFI 驱动移植 WIFI DRIVER PORTING	4
	3.2	添加 WIFI 兼容 ADD WIFI COMPATIBILITY	5
	3.3	启动不同的 WPA_SUPPLICANT START DIFFERENT WPA_SUPPLICANT	7
4	WIF	TI 兼容软硬件注意事项 WIFI COMPATIBILITY SOFTWARE/HARDWARE NOTICES	8
5	WIF	TI KO 编译注意事项 WIFI KO COMPILING NOTICES	8
6	WIF	T 驱动加载方式说明 WIFI DRIVER LOADING METHOD INTRODUCTION	9
7	WIF	T 无法打开问题排查 ISSUE ANALYSIS OF FAILING TO OPEN WIFI	9
8	SDI	O 问题排查 SDIO ISSUE ANALYSIS	12
	8.1	硬件部分 HARDWARE PART	12
	8.2	软件部分 SOFTWARE PART	14
	8.3	错误典型示例 TYPICAL ERROR EXAMPLE	17

1 目的 Purpose

明确 android 7.1 平台上 wifi 自动兼容原理和注意事项,按照本文档 wifi 提供的完全自动兼容说明生成固件后,即可支持相应的 wifi 模块,并且一套固件可以支持多个 WIFI 模块。

To introduce wifi auto compatibility principle and notices based on Android7.1 platform. After generating images according to the wifi complete auto compatibility instruction provided in this document, it can support the corresponding wifi module and one set of images can support multiple WIFI modules.

按照本文提供的方法, android 7.1 平台 wifi 可实现完全自动兼容, android 和 kernel 无需任何额外配置。

Using the method provided in this document, Android 7.1 platform Wi-Fi can achieve complete auto compatibility without any additional configuration of Android and kernel.

1.1 Kernel 注意事项 Kernel notices

wifi 完全自动兼容方案,AP6xxx 系列 wifi 和 Realtek 系列 wifi 驱动必须采用 module 方式,不能 build in 到内核 kernel.img 中;如果希望采用 build in 驱动到内核,参考第7章节进行;采用自动兼容方案需要确认各 andorid 7.1 平台内核使用的 conifig;确认 defconfig 是将 wifi 驱动编译成 ko modules 的配置,defconfig 参考如下配置,如下配置基于 SDK 对外最新内核代码:

For Wi-Fi complete auto compatibility solution, the drivers of AP6xxx series wifi and Realtek series wifi must use module method and cannot be built in kernel.img. If want to build in the driver to kernel, perform referring to chapter 7. Using the auto compatibility solution requires to confirm the conifig used by kernel on Android7.1 platforms. Confirm defconfig is the configuration compiling the wifi driver as ko modules. Defconfig refers to the following configuration which is based on SDK latest kernel code released:

CONFIG_WL_ROCKCHIP=y

CONFIG_WIFI_BUILD_MODULE=y

CONFIG_WIFI_LOAD_DRIVER_WHEN_KERNEL_BOOTUP=y

CONFIG_AP6XXX=m

CONFIG_RTL_WIRELESS_SOLUTION=y

CONFIG_RTL8188EU=m

CONFIG_RTL8188FU=m

CONFIG_RTL8189ES=m

CONFIG_RTL8189FS=m

CONFIG_RTL8723BS=m

CONFIG RTL8723BU=m

CONFIG RTL8723CS=m

CONFIG_RTL8723DS=m

```
Device Drivers --->
[*] Network device support --->
[*] Wireless LAN --->
[*] Rockchip Wireless LAN support --->
```

```
Rockchip Wireless LAN support
      build wifi ko modules
[*]
      Wifi load driver when kernel bootup
[*]
      ap6xxx wireless sdio cards support
<M>
[*]
      Realtek Wireless Device Driver Support
<M>
      Realtek 8188E USB WiFi
<M>
      Realtek 8188F USB WiFi
<M>
      Realtek 8189E SDIO WiFi
      Realtek 8189F SDIO WiFi
<M>
      Realtek 8723B SDIO or SPI WiFi
<M>
<M>
      Realtek 8723B USB WiFi
      Realtek 8723C SDIO or SPI WiFi
<M>
      Realtek 8723D SDIO or SPI WiFi
<M>
```

板级 dts 无需配置 WIFI 芯片类型(配置了也可以),因为加载 wifi 驱动不依赖 wifi_chip_type 节点,如果 WIFI 没有根据 RK 发布的硬件参考设计,板级 dts 先确认如下信息:

Board level dts doesn't need to configure WIFI chip type (also ok if configured), because wifi driver loading is not dependent on wifi_chip_type node. If WIFI is not designed according to the hardware reference design published by RK, board level dts should confirm the following information first:

```
(注意 kernel4.4 的内核 wifi power 脚改到 sdio 中配置 reset-gpios)
(Note: for kernel4.4, wifi power pin should be configured in sdio and then filled to reset-gpios)
sdio_pwrseq: sdio-pwrseq {
                  compatible = "mmc-pwrseq-simple";
                  clocks = < &rk818 1>;
                  clock-names = "ext_clock";
                  pinctrl-names = "default";
                  pinctrl-0 = <&wifi enable h>;
                   * On the module itself this is one of these (depending
                   * on the actual card populated):
                   * - SDIO_RESET_L_WL_REG_ON
                   * - PDN (power down when low)
                   */
                  reset-gpios = <&gpio3 4 GPIO ACTIVE LOW>; //wifi power
         };
wireless-wlan {
       compatible = "wlan-platdata";
```

```
wifi_chip_type ="ap6255"; //或者配置为 or configured as wifi_chip_type = "";
WIFI,host_wake_irq = <&gpio0 GPIO_D4 GPIO_ACTIVE_HIGH>;
status = "okay";
};
```

说明:目前 WIFI 完全兼容方案,基于 RK 发布的 WIFI 参考设计,WIFI 上电管脚默认高电平有效,具体项目需要确认 WIFI 供电管脚和高低有效情况。

Note: current WIFI complete compatibility solution, based on WIFI reference design published by RK, WIFI power pin is high active by default. Need to confirm the WIFI power pin and high/low active configuration for the specific projects.

如果一套固件要做到全部兼容 RK support list 中的 WIFI, 硬件板型的 WIFI 供电管脚(所有板子硬件型号要保持一致)以及 SDIO 电平都需要提前确认,在本文第四章节有详细介绍硬件注意事项。

If one set of images should be compatible with all WIFI modules in RK support list, WIFI power pin of the hardware board (the hardware type of all boards should keep consistent) and SDIO level should be confirmed in advance. There is elaboration on the hardware notices in chapter 4.

1.2 Android 注意事项 Android notices

编译 kernel 时会自动编译 wifi ko 文件,生成固件的时候会自动将 wifi ko 文件拷贝到 vendor.img中,存放在/vendor/lib/modules/wifi/目录下。

It will automatically compile wifi ko file when compiling kernel. When generating the images, it will automatically copy wifi ko file to vendor.img and save in the directory of /vendor/lib/modules/wifi/.

执行脚本 mkimage.sh

Execute the script mkimage.sh

```
if [ `grep ".com=16_wd=1_Bullib_Modull E-y" $KERNEL_CONFIG ]; then
   echo "install will ko to $TARGET_OUT_VENDOR/Lib/modules/wifi/"
   mkdir -p $TARGET_OUT_VENDOR/lib/modules/wifi
   find kernel/drivers/net/wireless/rockchip_wlan/* -name "* .kg" | xargs -n1 -i cp {} $TARGET_OUT_VENDOR/lib/modules/wifi
fi
```

2 WIFI 兼容原理简要说明 Brief introduction of WIFI compatibility principle

2.1 WIFI 芯片识别流程 WIFI chip recognition process

- 1. 开机对 wifi 模块上电,并自动进行扫描 sdio 操作。 Power up wifi module, and automatically scan sdio.
- 2. 系统启动打开 wifi 操作时,分别对系统 sys/bus/sdio(sdio wifi), sys/bus/usb(usb wifi),

sys/bus/pic (pcie wifi)文件系统下的 uevent 进行读取。

When starting wifi, the system separately reads uevent from the file system of sys/bus/sdio(sdio wifi), sys/bus/usb(usb wifi) and sys/bus/pic (pcie wifi).

- 3. 获取到 wifi 芯片 vid pid 加载相应的 wifi ko 驱动。
 Load the corresponding wifi ko driver after acquiring vid pid of the wifi chip.
- 4. 识别到 wifi 类型后加载不同的 wpa_supplicant 参数启动 wifi。
 Load different wpa_supplicant parameter to start wifi after recognizing the wifi type.

核心代码目录:

The directory of core code:

android /hardware/libhardware_legacy/wifi kernel/net/rfkill/rfkill-wlan.c hardware/Broadcom external/wpa_supplicant_8

3 如何新增 WIFI 模块的支持 How to add new wifi module support

目前对外发布的 andriod7.1 SDK, WIFI 自动兼容框架已经搭建完毕,如果客户需要自行调试 其他模块,只需按照本章节提到的修改地方进行修改即可。

Currently released android 7.1 SDK already builds in the WIFI auto compatibility framework. If customers need to debug other module by self, only need to modify the parts mentioned in this chapter.

3.1 WIFI 驱动移植 WIFI driver porting

RK 平台上所有的 WIFI 模块驱动都是放到内核 kernel/drivers/net/wireless/rockchip_wlan 目录,一般移植新的 WIFI 驱动,需要在 kernel/drivers/net/wireless 目录添加相应的 wifi 模块的 Kconfig 和 Makefile,有的模块还需要修改 wifi 驱动的 Kconfig 和 Makefile(根据特定的 wifi 模块驱动),如果采用 Realtek 的模块,可以参考 RealTek wifi 驱动移植说明_V1.1.pdf 文档。

All WIFI module drivers on RK platforms are put in the directory of kernel/drivers/net/wireless/rockchip_wlan. Generally for porting new WIFI driver, need to add Kconfig and Makefile corresponding to the wifi module in the directory of kernel/drivers/net/wireless. Some module also requires to modify Kconfig and Makefile of wifi driver (according to the specific wifi module driver). If using Realtek module, you can refer to the document RealTek wifi 驱动移植说明 _V1.1.pdf.

内核能正确编译出 wifi ko 驱动文件, wifi ko 文件在编译 kernel 的时候会自动编译。

Kernel can correctly compile wifi ko driver file. The wifi ko file will be automatically compiled when compiling kernel.

注意:由于目前 wifi 驱动是采用 ko 方式,如果有修改内核网络相关配置,一定要重新编译 ko,否则很可能导致 wifi ko 和内核网络协议栈不匹配。

Note: Because current wifi driver is using ko method, if kernel network related configuration is modified, remember to re-compile ko, otherwise it will probably lead to the mismatch of wifi ko with kernel network protocol stack.

3.2 添加 wifi 兼容 Add wifi compatibility

1. 添加 wifi 名称和 wifi vid pid

Add wifi name and wifi vid pid

源码路径: hardware/libhardware_legacy/wifi/rk_wifi_ctrl.c 代码 **supported_wifi_devices**[]结构体中添加 wifi 模块的名称和对应 vid pid, vid pid 可以根据下面章节手动读取 uevent 进行查看;以AP6255 为例: AP6255 为模块名称,02d0:09bf 为 vid pid,如下列表中已经添加了几款 wifi 的兼容,参考如下格式添加:

Source code path: Add wifi module name and corresponding vid pid in **supported_wifi_devices[]** struct in hardware/libhardware_legacy/wifi/rk_wifi_ctrl.c. Manually read uevent according to the following chapter can check vid pid. Take AP6255 as example: AP6255 is the module name, 02d0:09bf is vid pid, the following table already adds several wifi modules referring to the following format:

2. 添加 wifi 驱动 ko 文件存放路径

Add the path to save the ko file of wifi driver

hardware/libhardware_legacy/wifi/wifi.c 中 wifi_ko_file_name module_list[]结构体存放的是 wifi 模块的 ko 驱动存放路径和加载 wifi ko 驱动所需的参数,wifi ko 存放路径统一采用 XXXX DRIVER MODULE PATH 的命名方式。

The ko driver of wifi module and the parameters required for loading wifi ko driver are saved in wifi_ko_file_name module_list[] struct in hardware/libhardware_legacy/wifi/wifi.c. The path of wifi ko

is named as XXXX_DRIVER_MODULE_PATH.

如果 ismod wifi ko 不需要带参数,那么可以使用 UNKKOWN_DRIVER_MODULE_ARG,如果需要额外参数,请根据 wifi 模块的移植文档进行相应处理。

If ismod wifi ko doesn't have parameter, you can use UNKKOWN_DRIVER_MODULE_ARG. If need additional parameter, please perform relative operation according to wifi module porting document.

注意: wifi 名称要与 supported_wifi_devies[]结构体中定义的名称一样。

Note: wifi name should be the same as the name defined in supported_wifi_devies[] struct.

```
#define RTL8188EU_DRIVER_MODULE_PATH
#define RTL8723BU_DRIVER_MODULE_PATH
#define RTL8723BS_DRIVER_MODULE_PATH
#define RTL8723BS_VQ0_DRIVER_MODULE_PATH
#define RTL8723SS_VQ0_DRIVER_MODULE_PATH
#define RTL8723DS_DRIVER_MODULE_PATH
#define RTL8723DS_DRIVER_MODULE_PATH
#define RTL818723DS_DRIVER_MODULE_PATH
#define RTL8188FD_DRIVER_MODULE_PATH
#define RTL8188FD_DRIVER_MODULE_PATH
#define RTL8322BS_DRIVER_MODULE_PATH
#define RTL8322BS_DRIVER_MODULE_PATH
#define RTL8322BS_DRIVER_MODULE_PATH
#define RTL8322BS_DRIVER_MODULE_PATH
#define RTL8189FS_DRIVER_MODULE_PATH
#define RTL8189FS_DRIVER_MODULE_PATH
#define RTL8189FS_DRIVER_MODULE_PATH
#define RTL8192DU_DRIVER_MODULE_PATH
#define RTL8322BS_DRIVER_MODULE_PATH
#define RTL8322BS_DRIVER_MODULE_PATH
#define RTL832BS_DRIVER_MODULE_PATH
#define RTL832BS_DRIVER_MODULE_PATH
#define RTL832BS_DRIVER_MODULE_PATH
#define RTL832BS_DRIVER_MODULE_PATH
#vendor/lib/modules/812au_ko"
#define RTL832BS_DRIVER_MODULE_PATH
#vendor/lib/modules/8522be_ko"
#define RTL832BS_DRIVER_MODULE_PATH
#vendor/lib/modules/s522be_ko"
#define BCM_DRIVER_MODULE_PATH
#vendor/lib/modules/s522be_ko"
#define BCM_DRIVER_MODULE_PATH
#vendor/lib/modules/sp5665.ko"
#define RTL8723BS_DRIVER_MODULE_NAME
#8723bs_#define RTL8723SS_DRIVER_MODULE_NAME
#8723bs_#define RTL8723SS_DRIVER_MODULE_NAME
#8723bs_#define RTL8723SS_DRIVER_MODULE_NAME
#8723bs_#define RTL8723SS_DRIVER_MODULE_NAME
#8723bs_#define RTL8723SS_DRIVER_MODULE_NAME
#8723bs_#define RTL8723SS_DRIVER_MODULE_NAME
#8723bs_#
```

```
wifi ko file name module list[] =
                     RTL8723BU DRIVER MODULE NAME, RTL8723BU DRIVER MODULE PATH, UNKKOWN DRIVER MODULE ARG},
                     RTL8188EU_DRIVER_MODULE_NAME, RTL8188EU_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG},
                     RTL8192DU_DRIVER_MODULE_NAME, RTL8192DU_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG},
                     RTL8822BU_DRIVER_MODULE_NAME, RTL8822BU_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG},
                     RTL8822BS DRIVER MODULE NAME, RTL8822BS DRIVER MODULE PATH, UNKKOWN DRIVER MODULE ARG),
                     RTL8188FU_DRIVER_MODULE_NAME, RTL8188FU_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG}
                     RTL8189ES_DRIVER_MODULE_NAME, RTL8189ES_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_
                     RTL8723BS_DRIVER_MODULE_NAME, RTL8723BS_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG
                     RTL8723CS_DRIVER_MODULE_NAME, RTL8723CS_DRIVER_MODULE_PATH,
                                                                                  UNKKOWN DRIVER MODULE ARG
                     RTL8723DS_DRIVER_MODULE_NAME, RTL8723DS_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG
                     RTL8812AU_DRIVER_MODULE_NAME, RTL8812AU_DRIVER_MODULE_PATH,
                                                                                  UNKKOWN DRIVER MODULE
                     RTL8189FS_DRIVER_MODULE_NAME, RTL8189FS_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG}
                     RTL8822BE DRIVER MODULE NAME, RTL8822BE DRIVER MODULE PATH, UNKKOWN DRIVER MODULE
                        SSV6051 DRIVER MODULE NAME,
                                                      SSV6051_DRIVER_MODULE_PATH, SSV6051_DRIVER_MODULE_ARG}
                                             NAME,
                       ESP8089_DRIVER_MODULE_
                                                      ESP8089_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE
                           BCM_DRIVER_MODULE_NAME,
                                                          BCM_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG]
                           BCM DRIVER MODULE NAME,
                                                          BCM_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG]
                           BCM_DRIVER_MODULE_NAME,
                                                          BCM_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG]
                           BCM DRIVER MODULE NAME,
                                                          BCM_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_
                           BCM_DRIVER_MODULE_NAME,
                                                          BCM_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG},
                                                          BCM_DRIVER_MODULE_PATH, UNKKOWN_DRIVER_MODULE_ARG}
                           BCM DRIVER MODULE NAME,
                        DRIVER_MODULE_NAME_UNKNOW,
                                                       DRIVER MODULE PATH UNKNOW, UNKKOWN DRIVER MODULE ARG}
```

3.3 启动不同的 wpa_supplicant Start different wpa_supplicant

init.connectivity.rc 中添加 wpa_supplicant 服务,以 AP6255 为例:

Add the wpa_supplicant service in init.connecance.rc. Take AP6255 as example:

```
service p2p_supplicant /system/bin/wpa_supplicant \
    -iwlan0 -Dnl80211 -c/data/misc/wifi/wpa_supplicant.conf \
    -I/system/etc/wifi/p2p_supplicant_overlay.conf \
    -puse_p2p_group_interface=1p2p_device=1 \
    -m/data/misc/wifi/p2p_supplicant.conf \
    -e/data/misc/wifi/entropy.bin -0/data/misc/wifi/sockets \
    -g@android:wpa_wlan0 \
    class main \
    socket wpa_wlan0 dgram 660 wifi wifi \
    disabled \
    oneshot
```

当检测到是 ap6255 模块后将会启动 p2p_supplicant 服务,代码如下:

p2p_supplicant service will be started when the ap6255 module is detected. The code is as follows:

```
static const char P2P_SUPPLICANT_NAME[] = "p2p_supplicant";
static const char P2P_PR0P_NAME[] = "init.svc.p2p_supplicant";
```

```
wifi_start_supplicant(int p2p_supported)
char supp_status[PROPERTY_VALUE_MAX] = {'\0'};
int count =
    st prop_info *pi;
unsigned serial = 0, i;
if (wifi_type[0] == 0)
    check wifi chip type string(wifi type);
if (p2p supported) {
        if (!strncmp(wifi type, "ESP", 3)) {
            strcpy(supplicant_name, ESP_SUPPLICANT_NAME);
            strcpy(supplicant prop name, ESP PROP NAME);
        } else if (!strncmp(wifi_type,
            strcpy(supplicant_name, RTL_SUPPLICANT_NAME);
            strcpy(supplicant_prop_name, RTL_PROP_NAME);
                } else if (!strncmp(wifi_type,
                            ALOGD (
                                                     , SSV P2P SUPPLICANT NAME);
                            strcpy(supplicant name, SSV P2P SUPPLICANT NAME);
                            strcpy(supplicant_prop_name, SSV_P2P_PROP_NAME);
            strcpy(supplicant name, P2P SUPPLICANT NAME);
            strcpy(supplicant_prop_name, P2P_PROP_NAME);
```

4 WIFI 兼 容 软 硬 件 注 意 事 项 WIFI compatibility software/hardware notices

目前发布的 SDK 一套固件可以兼容 sdio 2.0 和 sdio 3.0 wifi, sdio 2.0 clk 最高跑 50M, sdio 3.0 clk 最高跑 150M。

Currently released SDK can be compatible with sdio 2.0 and sdio 3.0 wifi using one set of images, supporting sdio 2.0 clk up to 50M, and sdio 3.0 clk up to 150M.

SDIO 配置请参考《Rockchip SDMMC SDIO eMMC 开发指南 V1.0-20160630.pdf》

For SDIO configuration, please refer to 《Rockchip SDMMC SDIO eMMC 开发指南V1.0-20160630.pdf》.

5 WIFI ko 编译注意事项 WIFI ko compiling notices

本章节主要说明内核网络相关配置修改,对应 wifi ko 驱动的编译方法。

This chapter mainly describes the modification of kernel network related configuration and compiling method corresponding to wifi ko driver.

wifi ko 要跟内核网络配置编译出的 kernel.img 一致。当调试需要**单独烧写 kernel.img 时**,如果内核有修改网络配置,需要执行 mkimage.sh 后重新生成 system.img,kernel.img 和 system.img 并烧写。

Wifi ko should be consistent with kernel.img compiled by kernel network configuration. When need

to separately flash kernel.img for debugging, if kernel modifies the network configuration, need to re-generate system.img after executing mkimage.sh, both kernel.img and system.img should be flashed.

6 WIFI 驱动加载方式说明 WIFI driver loading method introduction

如果不需要 wifi 自动兼容方案,可以将 wifi 驱动 build in 到内核,由客户自行决定。

If you don't need wifi auto compatibility solution, you can build wifi driver into kernel. Customers can make decision by themselves.

以 AP6255 为例, 配置如下:

Take AP6255 as example, the configuration is as below:

 $WIFI_BUILD_MODULE = n$

 $CONFIG_AP6XXX = y$

```
--- Rockchip Wireless LAN support
      build wifi ko modules
      Wifi load driver when kernel bootup
[*]
      ap6xxx wireless sdio cards support
      Realtek Wireless Device Driver Support
      Realtek 8188E USB WiFi
      Realtek 8188F USB WiFi
      Realtek 8189E SDIO WiFi
      Realtek 8189F SDIO WiFi
      Realtek 8723B SDIO or SPI WiFi
      Realtek 8723B USB WiFi
      Realtek 8723C SDIO or SPI WiFi
      Realtek 8723D SDIO or SPI WiFi
      Realtek 8822B PCIE WiFi
< >
```

7 WIFI 无法打开问题排查 Issue analysis of failing to open WIFI

1. 首先确认开机后系统是否有 USB WIFI 或者 SDIO wifi 设备,正常开机后,可以首先通过内核 log 进行确认,如果是 sdio, wifi 内 log 会有如下 sdio 识别成功 log:

First confirm if system has USB WIFI or SDIO wifi device after power up, after power up normally, you can confirm first through kernel log, if it is sdio, wifi will have the sdio recognition success log as below:

mmc2: new ultra high speed SDR104 SDIO card at address 0001

如果是 usb, wifi 会有类似如下 usb 信息:

If it is usb, wifi will have the usb information similar as below:

usb 2-1: new high-speed USB device number 2 using ehci-platform

usb 2-1: New USB device found, idVendor=0bda, idProduct=b82c

usb 2-1: New USB device strings: Mfr=1, Product=2, SerialNumber=3

usb 2-1: Product: 802.11ac NIC

如果 usb 信息和 sdio 扫卡成功 log 信息都没有,那说明 wifi 模块没有正常上电或者 sdio 扫卡异常,需要再次确认硬件是否有问题以及软件 dts 里面 wifi 管脚是否正确配置;因为开机对模块成功上电是检测 wifi 芯片 id 的前提,在本文 v2.1 章节中已经提到。

If there is no usb information and sdio recognition success log information, it means wifi module is not powered up normally or sdio recognition fails, need to double check if the hardware has problem and wifi pin in software dts is configured correctly. Because powering up the module successfully is the precondition to detect wifi chip id as described in chapter 2.1.

另外也可以 cat 如下路径下的 uevent 文件进行确认:

Besides, you can also cat the uevent file in the following path to confirm:

sys/bus/sdio/devices

sys/bus/usb/devices

以 AP6354 为例, cat 对应的 uevent 可以看到 ap6354 对应的 pid 和 vid(02D0: 4354)

Take AP6354 as example, cat the corresponding uevent can see the pid and vid corresponding to ap6354 (02D0: 4354):

```
rk3399_mid:/ # cat /sys/bus/sdio/devices/mmc2\:0001\:2/uevent
DRIVER=bcmsdh_sdmmc
SDIO_CLASS=00
SDIO_ID=02D0:4354
MODALIAS=sdio:c00v02D0d4354
rk3399_mid:/ #
```

2. 如果模块正常上电,也可以识别到 wifi 模块的 vid pid,再确认是否正确加载 wifi ko 驱动文件;

If the module is powered up normally and it can also recognize vid pid of wifi module, then confirm if wifi ko driver file is correctly loaded.

以 AP6354 wifi 模块为例,如下是正常加载 ko 的 log 信息:

Take AP6354 wifi module as example, the following is log information when normally loading ko:

```
1-18 08:50:18.639
                                                   Kernel version is 4.4.
01-18 08:50:18.639
                                659 E WifiHW
                                                   Wifi driver is not ready.
                         598
01-18 08:50:18.639
                         598
                                659 D WifiHW
                                                   wifi_load_driver
                                                   uevent path:/sys/bus/sdio/devices/./uevent
                               659 D WifiHW
01-18 08:50:18.639
                         598
                               659 D WifiHW
1-18 08:50:18.639
                         598
                                                   uevent path:/sys/bus/sdio/devices/../uevent
1-18 08:50:18.639
                                659 D WifiHW
                                                   uevent path:/sys/bus/sdio/devices/mmc2:0001:1/uevent
                         598
                               659 D WifiHW
659 D WifiHW
1-18 08:50:18.639
                         598
                                                    found device pid:vid : 02d0:4354
                                                   wifi detectd return ret:0
SDIO WIFI identify sucess
check_wifi_chip_type_string: AP6354
1-18 08:50:18.639
                         598
1-18 08:50:18.639
                                659 D WifiHW
                         598
1-18 08:50:18.639
                                659 D WifiHW
                         598
1-18 08:50:18.640
                         598
                                659
                                    D WifiHW
                                                    /data/wifi_chip is exit
                                                   wifi_load_driver matched ko file path /system/lib/modules/bcmdhd.ko Kernel version is 4.4.
01-18 08:50:18.640
01-18 08:50:19.008
                               659 D WifiHW
659 D WifiHW
                         598
                         598
                                659 E WifiHW
1-18 08:50:19.008
                                                   Wifi driver is not ready.
                         598
1-18 08:50:19.209
                                659 D WifiHW
                                                    Kernel version is 4.4.
                         598
                               659 E WifiHW
659 D WifiHW
1-18 08:50:19.209
                         598
                                                   Wifi driver is not ready.
11-18 08:50:19.409
                                                   Kernel version is 4.4.
                         598
                                                   Wifi driver is ready for now...
uevent path:/sys/bus/sdio/devices/./uevent
                                659 D WifiHW
1-18 08:50:19.409
                         598
1-18 08:50:19.411
                                596 D WifiHW
                               596 D WifiHW
596 D WifiHW
1-18 08:50:19.411
                         345
                                                   uevent path:/sys/bus/sdio/devices/../uevent
01-18 08:50:19.411
01-18 08:50:19.412
                         345
                                                   uevent path:/sys/bus/sdio/devices/mmc2:0001:1/uevent
                                                   wifi detectd return ret:0

SDIO WIFI identify sucess
check_wifi_chip_type_string: AP6354
                                596 D WifiHW
                         345
1-18 08:50:19.412
                         345
                                596 D WifiHW
1-18 08:50:19.412
                         345
                                596 D WifiHW
01-18 08:50:19.412
                               596 D WifiHW
659 D WifiHW
                         345
01-18 08:50:20.738
                                                   wifi_start_supplicant: p2p_supplicant
uevent path:/sys/bus/sdio/devices/./uevent
                        598
1-18 08:50:20.819
                               1206 D WifiHW
                       1206
1-18 08:50:20.819
                       1206
                               1206
                                    D WifiHW
                                                   uevent path:/sys/bus/sdio/devices/../uevent
1-18 08:50:20.819
                       1206
                               1206
                                    D WifiHW
                                                   uevent path:/sys/bus/sdio/devices/mmc2:0001:1/uevent
                                                   found device pid:vid : 02d0:4354
wifi detectd return ret:0
SDIO WIFI identify sucess
check_wifi_chip_type_string: AP6354
11-18 08:50:20.820
                       1206
                               1206 D WifiHW
1-18 08:50:20.820
                       1206
                               1206
                                    D WifiHW
  -18 08:50:20.820
                       1206
                               1206
                                    D WifiHW
1-18 08:50:20.820
                       1206
                               1206 D WifiHW
                                                   check_wifi_chip_type_string: AP6354
                       1206
                               1206 D WifiHW
   18 08:50:20.974
```

Wifi 模块与相应 ko 的对应关系:

The relationship between wifi module and corresponding ko:

模块名称	ko 名称
Module name	ko name
AP6xxx(SDIO)	bemdhd.ko
RTL8723BU(USB)	8723bu.ko
RTL8188EU(USB)	8188eu.ko
RTL8188EU(USB)	8188fu.ko
RTL8723BS(SDIO)	8723bs.ko
RTL8723CS(SDIO)	8723cs.ko
RTL8723DS(SDIO)	8723ds.ko
RTL8189ES(SDIO)	8189es.ko
RTL8189FS(SDIO)	8189fs.ko

详细的 ko 和模块对应关系详见 android/hardware/libhardware_legacy/wifi/wifi.c 文件。

The detailed relationship between ko and the module refers to android/hardware/libhardware_legacy/wifi/wifi.c file.

3. 如果 wifi ko 匹配错误或者没有相应的 ko 文件,请确认按照 v1.1 和 v1.2 章节进行确认,正常系统 ko 文件存放路径如下:

If wifi and ko don't match or there is no corresponding ko file, please confirm according to chapter 1.1 and 1.2. The normal path of system ko file is as below:


```
k3368:/vendor/lib/modules/wifi # 1s
otal 39196
                             4096 2017-12-10 21:52
             root shell
lrwxr-xr-x 2
           3
             root
                             4096
                                  2017-12-10
                                              21:53
                  she 11
                          3002696
                                  2017-12-14 01:06
                                                    8188eu.ko
           1
             root
                  root
                                  2017-12-14 01:06
             root
                  root
                          2414232
                                                    8188fu.ko
                                  2017-12-14
                          2175416
                                             01:06
                                                    8189es.ko
             root
                  root
                          2507328
                                  2017-12-14
             root
                  root
                                             01:06
                                                    8189fs.ko
                          2023896
                                  2017-12-14 01:06
             root
                  root
                                                    8723bs.ko
                                  2017-12-14 01:06
                          2691448
             root
                  root
                                                    8723bu.ko
             root
                  root
                          3037080
                                  2017-12-14
                                              01:06
                                                    8723cs.ko
                                                    8723ds.ko
                          3215960 2017-12-14 01:06
             root
                  root
                                  2017-12-14 01:06
             root
                          3578928
                                                    8822be.ko
                        15451976
                                 2017-12-14 01:06
                                                    bemdhd.ko
           1
             root
                 root
k3368:/vendor/lib/modules/wifi
```


4. 注意:由于目前 wifi 驱动是采用 ko 方式,如果有修改内核网络相关配置,一定要重新编译 ko,否则很可能加载 wifi ko 引起内核 panic,请详细阅读本文第 5 章节。


Note: Because currently wifi driver is using ko method, if kernel network related configuration is modified, remember to re-compile ko, otherwise it will probably lead to kernel panic when loading wifi ko. Please read chapter 5 carefully.

8 SDIO 问题排查 SDIO issue analysis

8.1 硬件部分 Hardware part

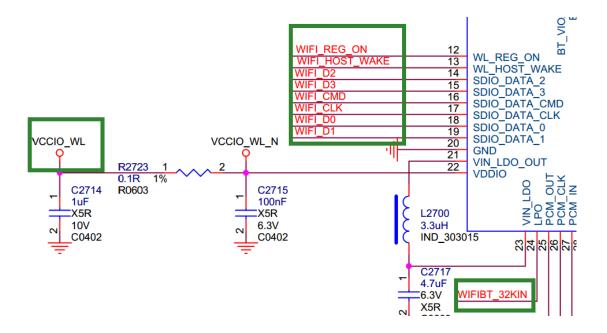

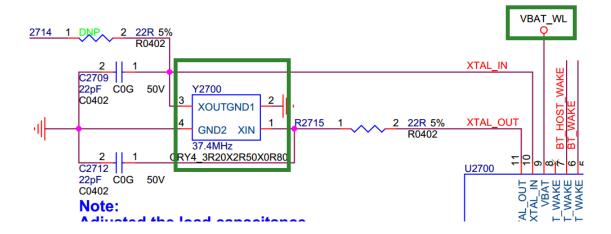



首先看下硬件: 主要的部分都在绿色方框内

Firstly check the hardware: main parts are marked as the green boxes.

WIFI D0~3: 数据线,平时为高,电压取决于 VCCIO WL 的电压;

WIFI_D0~3: data line, usually high, the voltage depends on VCCIO_WL.

WIFI_CMD: 命令线,平时为高,电压取决于 VCCIO_WL 的电压;

WIFI_CMD: command line, usually high, the voltage depends on VCCIO_WL.

WIFI_CLK: 时钟,平时为低,电压取决于 VCCIO WL 的电压;

WIFI_CLK: clock, usually low, the voltage depends on VCCIO_WL.

VBAT_WL: WIFI 模组供电电源,一直都为高,供电需打印 3.3v;

VBAT_WL: power supply of WIFI module, always high, need to print 3.3V for power supply.

VCCIO_WL: 给 DATA/CMD/CLK 的 IO 供电电源,可以为 3.3 或者 1.8v,但 SDIO3.0 必须为 1.8v:

VCCIO_WL: supply power for IO of DATA/CMD/CLK, can be 3.3V or 1.8V, but SDIO3.0 must be 1.8V.

WIFI REG ON: 正常工作时为 3.3v, WiFi 关闭时为 0v;

WIFI_REG_ON: 3.3V for normal working, 0V when Wi-Fi is disabled.

两个晶振: 32K和 26M/37.4M,正常工作时都会有波形输出;

Two crystal oscillators: 32K and 26M/37.4M, there will be waveform output for normal working. 遇到 WIFI SDIO 问题时:

When encountering WIFI SDIO issues:


1、首先以上的电压以及晶振问题;

Firstly check the above voltage and crystal oscillator issue.

2、VBAT_WL 和 VCCIO_WL 的电源是长供电,但有时候会因为这两路电源和其他模块共用一个

电源,可能会出现电压塌陷问题,导致 WIFI 模组异常;比如下图,有非常多外设都会挂在 VCC IO 上面;

The power supply of VBAT_WL and VCCIO_WL is always on, but sometimes because they share the same power with other modules, the voltage collapse issue may occur and lead to the abnormality of WIFI module. As shown in below picture, there are many peripherals connected to VCC_IO.

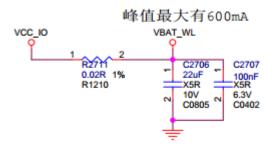

8.2 软件部分 Software part

首先介绍下 SDIO 波形基本组成:

Firstly introduce the basic component of SDIO waveform:

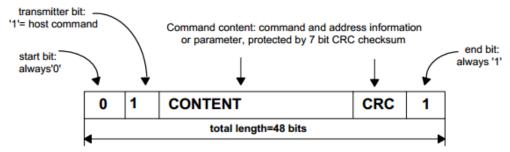


Figure 3-7: Command Token Format


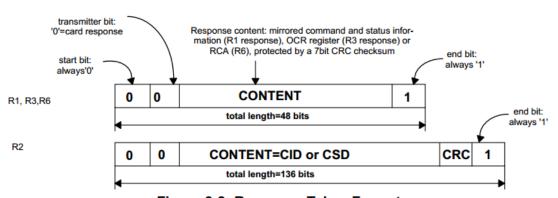


Figure 3-8: Response Token Format

1. Data Packet Format for Usual Data (8-bit width)

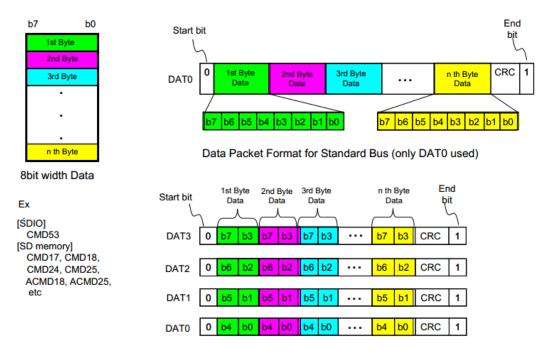


Data Packet Format for Wide Bus (all four lines used)

下图是 WIFI SDIO 识别模式时的典型的波形时序图:

The following picture shows the typical waveform timing sequence of WIFI SDIO recognition mode:

简单说一下识别 SDIO 的方式: 主控发出 48clk 并携带 48bit 的数据发给 SDIO, 而 SDIO 要回应给主控 48clk 加 48bit 的数据, 如下图:

Briefly introduce the method to recognize SDIO: SoC outputs 48clk and 48bit data to SDIO, and SDIO should respond 48clk and 48bit data to SoC, as below picture:

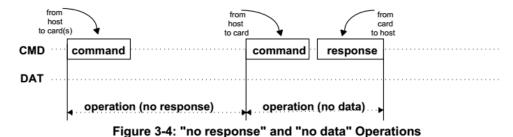

The following picture shows the timing sequence of SDIO data transmission stage:

下图是 SDIO 数据传输阶段的时序图:

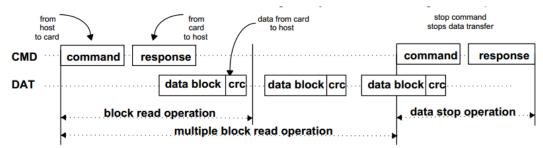


Figure 3-5: (Multiple) Block Read Operation

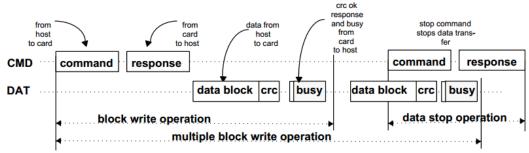


Figure 3-6: (Multiple) Block Write Operation

实例:

For example:

绿色: SDMMC_CLK

Green: SDMMC_CLE

黄色: SDMMC_CMD SDMMC_CMD 空闲时一直处于高电平;

Yellow: SDMMC_CMD keep high level when SDMMC_CMD is idle.

主控发出的波形: 当最开始的两个电平有一高一低时,是主控发出去的命令;


The waveform SoC outputs: when there is one high level and one low level at the beginning, it is the command output from SoC.

SD 卡响应的波形: 当最开始的两个电平有连续的两个低电平时,表示卡端有响应;

The waveform SD responds: when there are two continuous low levels at the beginning, it means there is response from card side.

其次主控和响应一般包含 48 个 bit 的数据,所以 48 个 clk 为一个完整的包。<mark>要确认的就是:主控</mark> 发出去命令包后,SD 卡端是否有响应。

Secondly, SoC and response generally contain 48bit data, so 48 clk is a complete package. Need to confirm that: if there is response from SD card side after SoC sending out the command package.

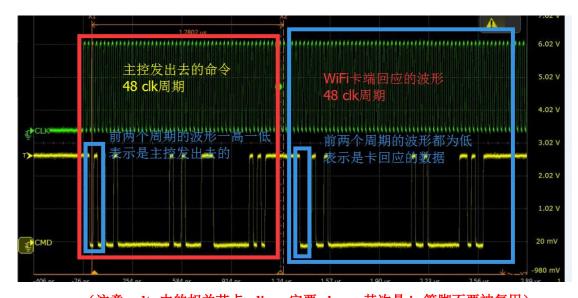

(注意: dts 中的相关节点 sdio 一定要 okay, 其次是 io 管脚不要被复用)
(Note: sdio of relative nodes in dts must be okay, and io pin should be not reused)

8.3 错误典型示例 Typical error example

(1) 电压问题,排查 WIFI_DATA 线的电压以及 VCCIO_WL 电压

Voltage problem, analyze the voltage of WIFI_DATA line and VCCIO_WL voltage

```
100.086615] slot->flags = 3
  100.086628] CPU: 0 PID: 113 Comm: kworker/u8:3 Tainted: P
                                                                        O 3.10.0 #250
  100.086644] Workqueue: kmmcd mmc rescan
         100.086663]
                        [<c0013e04>]
                                                                                 [<c0011720>]
                                         (unwind_backtrace+0x0/0xe0)
                                                                         from
(show\_stack+0x10/0x14)
          100.086677]
                          [<c0011720>]
                                            (show\_stack+0x10/0x14)
                                                                                 [< c050d3b4>]
                                                                        from
(dw_mci_set_ios+0x9c/0x21c)
         100.0866891
                        [< c050d3b4>]
                                         (dw_mci_set_ios+0x9c/0x21c)
                                                                         from
                                                                                  [<c04fabd4>]
(mmc_power_up + 0x60/0xa0)
         100.086700]
                         [<c04fabd4>]
                                          (mmc power up+0x60/0xa0)
                                                                         from
                                                                                  [<c04faeac>]
(mmc_rescan_try_freq+0x14/0xd0)
        100.086710]
                      [<c04faeac>]
                                      (mmc_rescan_try_freq+0x14/0xd0)
                                                                                 [< c04fb7b4>]
                                                                          from
(mmc rescan + 0x204/0x298)
          100.086722]
                         [< c04fb7b4>]
                                          (mmc_rescan+0x204/0x298)
                                                                         from
                                                                                 [<c00471f0>]
(process_one_work+0x29c/0x458)
        100.086734]
                      [<c00471f0>]
                                      (process_one_work+0x29c/0x458)
                                                                         from
                                                                                 [<c0047540>]
(worker\_thread+0x194/0x2d4)
[ 100.086745] [<c0047540>] (worker thread+0x194/0x2d4) from [<c004ca28>] (kthread+0xa0/0xac)
   100.086759] [<c004ca28>] (kthread+0xa0/0xac) from [<c000da98>] (ret_from_fork+0x14/0x3c)
  100.086767] 1400..dw_mci_set_ios: wait for unbusy timeout...... STATUS = 0x206 [mmc2]
```

[102.546615] 1009..mci_send_cmd: wait for unbusy timeout......[mmc2]

[102.595819] mmc_host mmc1: Timeout sending command (cmd 0x202000 arg 0x0 status 0x80202000)

(2) 有两种可能:

- a) WiFi 异常,排查 VBAT_WL 和 WIFI_REG_ON 以及晶振是否正常 Wi-Fi abnormality, analyze if VBAT_WL, WIFI_REG_ON and crystal oscillator are normal or not
- b) 走线太长导致波形质量很差,降频或者修改硬件
 The trace is too long which will cause the poor quality of waveform, reduce the frequency or modify the hardware

dwmmc_rockchip 10218000.rksdmmc: req failed (CMD52): error = 110, timeout = 8000ms [mmc2] - Timeout recovery procedure start -- rk_sdmmc: BOOT dw_mci_setup_bus: argue clk_mmc workaround out 800000Hz for init[mmc2] mmc_host mmc2: Bus speed (slot 0) = 37500000Hz (slot req 400000Hz, actual 398936HZ div = 47) rk_sdmmc: BOOT dw_mci_setup_bus: argue clk_mmc workaround out 800000Hz for init[mmc2] [mmc2] -- Timeout recovery procedure finished --

(3) 走线太长导致波形质量很差,降频或者修改硬件

The trace is too long which will cause the poor quality of waveform, reduce the frequency or modify the hardware

- [200.731403] [mmc2] Data transmission error !!!! MINTSTS: [0x00000080]
 [200.731426] [mmc2] host was already tuning, Don't need to retry tune again ignore 0.
- (4) WIFI_REG_ON 异常

WIFI_REG_ON is abnormal

rk_sdmmc: BOOT dw_mci_setup_bus: argue clk_mmc workaround out 800000Hz for init[mmc2] rk_sdmmc: BOOT dw_mci_setup_bus: argue clk_mmc workaround out 400000Hz for init[mmc2] rk_sdmmc: BOOT dw_mci_setup_bus: argue clk_mmc workaround out 600000Hz for init[mmc2]