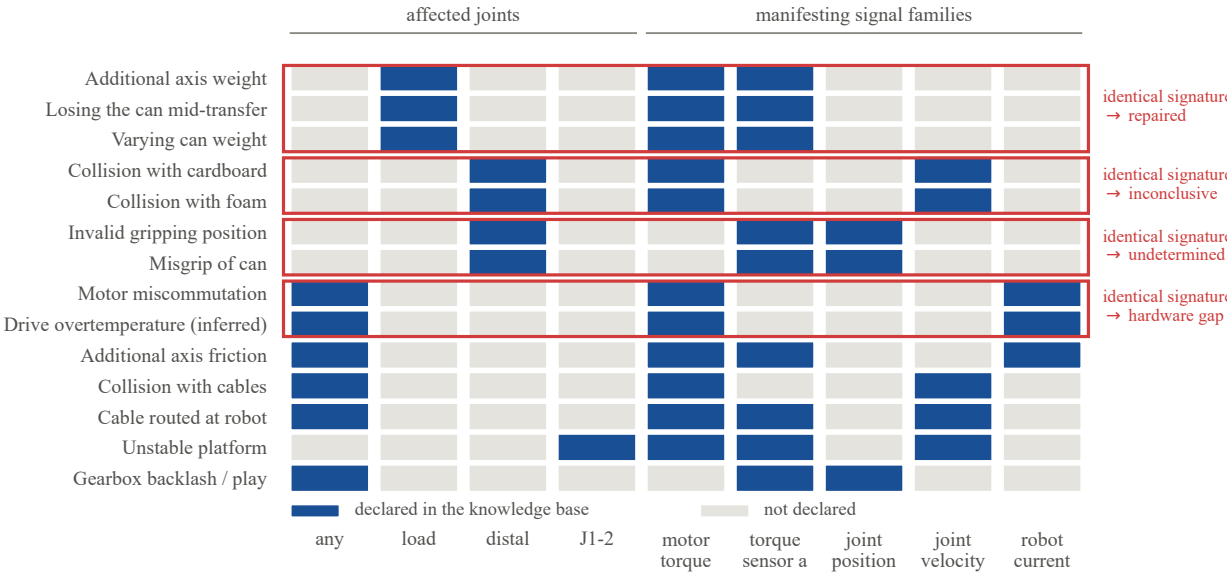

affected joints
manifesting signal families
Additional axis weight
Losing the can mid-transfer
Varying can weight
Collision with cardboard
Collision with foam
Invalid gripping position
Misgrip of can
Motor miscommutation
Drive overtemperature (inferred)
Additional axis friction
Collision with cables
Cable routed at robot
Unstable platform
Gearbox backlash / play
identical signature → repaired
identical signature → inconclusive
identical signature → undetermined
identical signature → hardware gap
declared in the knowledge base
not declared
any
load
distal
J1-2
motor torque
torque sensor a
joint position
joint velocity
robot current