Background:

T2 = Fabric Supplier: CT TNHH APPAREL FAR EASTERN

Fabric Article#: SW-D-AD002 (CSD)

Material composition: 64% Cotton + 26% Polyester + 10% Nylon

Style#: V2028/V2031

Style Name: JEFFREYS PULLOVER 2.0


Phenomenon:

Easy Pilling occurred on the Garment.


Pilling Passed at Bulk, BUT failure occurred at Bulk Mass Production.


Reports reviewing:

Report No	Issued/Report Date	Article Number	Fiber Content	Color	End Used	Sample Type	Pilling Method	Cycles/Revolutions	Pilling Rating	Requirement	Result vs Requirement
SL01251202993701TX	2025-12-18	SW-D-AD002 (CSD)	Cotton/Poly/Nylon 64/26/10	Winter Grey Heather	Shell fabric	Bulk	ASTM D4970/D4970M-22	100	4.5	≥ 4.5	Pass
SL01251202993501TX	2025-12-19	SW-D-AD002 (CSD)	Cotton/Poly/Nylon 64/26/10 (Body)	Grey	Shell fabric	Bulk	ASTM D4970/D4970M-22	100	3.5	≥ 4.5	Fail
SL01251202993601TX	2025-12-19	SW-D-AD002 (CSD)	Cotton/Poly/Nylon 64/26/10	Olive Heather	Shell fabric	Bulk	ASTM D4970/D4970M-22	100	2.0	≥ 4.5	Fail
SL01251202994101TX	2025-12-19	SW-D-AD002 (CSD)	Cotton/Poly/Nylon 64/26/10	Navy Heather	Shell fabric	Bulk	ASTM D4970/D4970M-22	100	2.0	≥ 4.5	Fail

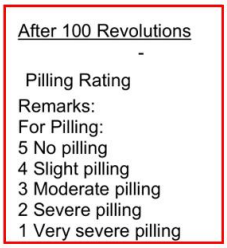



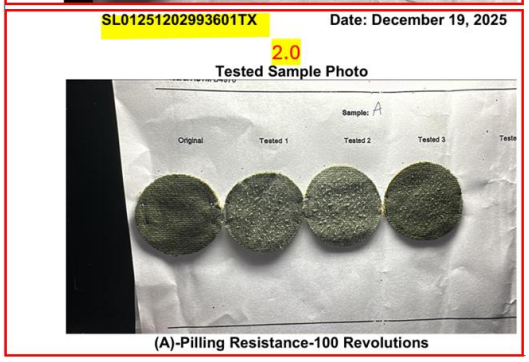

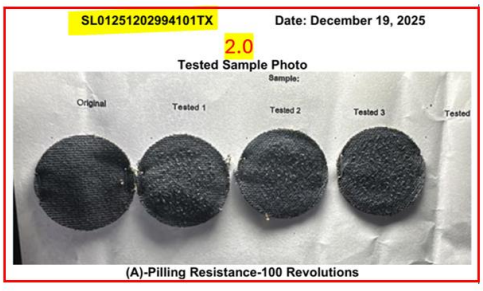

Analysis with suspected questions:

For the Passing resulted in pilling at 4.5 rating, Not seeing the photos or specimens after test.

I believe, the returned specimens need to be re-assess and review carefully.

Pilling Rating at 3.5 seems a bit too good, it looks like 2.5 or 3.0 to me.

Are all yarns from the same source? Especially cotton yarn (64% share), as quality differences can cause surface smoothness variation and pilling resistance issues.

Yarn supplier differences could explain inconsistent results.

Suggestions:

Improve Yarn Quality & Twist: Higher twist reduces loose fiber ends.

Fiber Length & Blend Control: Longer staple cotton and better polyester quality minimize fuzz.

Finishing Treatments:

Singeing (burn off protruding fibers)

Enzyme treatment (bio-polishing to remove fuzz)
These can significantly improve pilling resistance.

Remarks – GB Pilling Testing Method (different from ASTM D4970/D4970M-22) - PASS

检测报告 Test Report **SL52515313042001TX** **日期 Date:2025 年 06 月 16 日 页码 Page 9 of 13**

检测项目及测试方法 TestItem & Test method	判定 Judgment	样品 Sample	单位 Unit	技术要求 Requirement	测试结果 Test Result	
起球 Pilling Resistance GB/T 4802.1-2008 参数 E--压力 780cN, 起毛 0 次, 起球 600 次 Test Parameter E--Pressure 780cN, Fuzzing 0 Cycles, Pilling 600 Cycles	符合 Pass	大身 Body	级 Grade	≥3	原样状态 As Received 起球级数 Pilling Rating	3