Background:

T2 = Fabric Supplier: Best Pacific

T1 = Garment Vendor: Youngone

Fabric Article#: EJ161330MS1

Fabric code: Stretch Sheer Solid - F0672

Material composition: 84% Recycled Polyamide + 16% Elastane

YARN INFORMATION											
Yarn Content	Yarn Denier Dtex Count	Filament Count (N/A for spun yarn/spandex)	Luster (Please select)	Yarn Type, Spinning Method (Please select)	Sustainability (Please select)	Certification (Please select)	Yarn Direction (Please select)	Yarn % Composition on Fabric	Yarn Manufacturer Brand	Yarn/Fiber trade mark (E.g. T400, 162L, ADAPTIV...)	Yarn/Fiber COO (Pls indicate both COO if it's staple fiber)
Polyamide	40D	34F	Full Dull	FDY	Pre-Consumer Recycled	GRS	WEFT	84%	PRUTEX	N/A	CHINA
Spandex	20D	N/A	Semi Dull	Semi Dull Spandex	Virgin	N/A	WEFT	16%	Hyosung	N/A	KOREA

Structure: Weft Knit

Weight: 135 gsm

Development process & status: Original hanger selected from Jersey Lomellina switched to Best Pacific due to better price and recycled content.

6.15.25 In-house testing received - approved. 6.20.25 Material finalization, moving forward with Best pacific quality. Need to request new sample roll - waiting on Design to confirm color (special request from SC to select a color from Jan palette)

7.8.25 Sierra confirmed Peach Blossom color. Sample order requested - Best Pacific need to order yarn with a 20 day leadtime.

7.11.25 Proceeded with minibulk in color Peach Blossom (250y) to insure consistency in bulk and accurate testing standards. ETA week of Aug 15th. 8.15.25 rcvd mini bulk at HQ.


Material Quality Status

All

Approved with Exception 7/31/2025

from HQ at PLM.

Phenomenon:

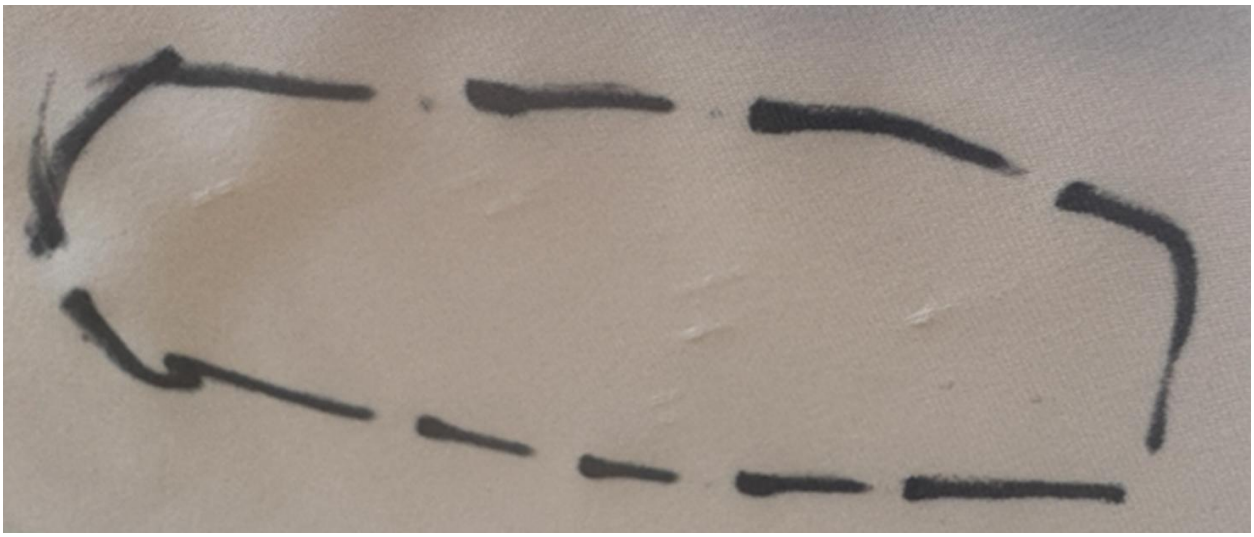

T2: To clarify the development background regarding the defects noted on the approved hanger.

This fabric is a fine-gauge, fine-yarn single jersey. It is sheer, lightweight, and soft, yet delivers strong stretch and compression. Unlike loop-locked interlock fabrics, this single jersey construction is highly sensitive.

It is prone to cosmetic yarn slippage (snagging) rather than actual yarn breakage. As we observed during the meeting, if a yarn snags, the surface can easily be massaged and reshaped by hand—very similar to delicate hosiery.

T2: Best Pacific provided a comprehensive testing report during development, including snagging performance, which was fully approved. No issues were raised during the development or wear-testing stages.

While BP guarantees that bulk fabric will meet all approved ex-mill inspection tolerances, **we cannot assume responsibility for claims arising after the fabric has been cut or converted into finished garments.**

If the brand views these inherent fabric characteristics as defects for product rejection, it makes us very worried about the risks of supplying this fabric, as we want to avoid any potential issues for both sides.

T2 Action Plan:

Stock Re-inspection: We are re-inspecting our current stock yardage to check for similar cosmetic defects.

Vendor Alignment: We are contacting Youngone to align on garment manufacturing perspectives. Given the fabric's delicate nature, we strongly recommend "white glove" handling, low stacking heights to avoid pressure marks, and careful management of its inherent rolled edges.

Slower Production: We will slow down our setting and self-inspection processes to minimize handling risks before shipment.

Finishing Adjustment: We highly recommend a slight adjustment to reduce the bulk softness, which would effectively minimize the risk of snagging.

T2 wants to ensure fully aligned with all parties on the nature of this fabric before moving forward.

POV - Technical analysis & questions – Need the Root Cause Finding!

P.A = 40D / 34F, every filament = 40/34 = 1.176D/Filament, meaning it's a fine yarn/filament!

BUT, NOT extreme softness + sensitivity, such as 20D / 48F.

3 colors? White only?

Stretch Sheer Solid - F0672	17,257
Black	7,731
Rouge	1,700
White	7,825

From the photo – could not identify whether such phenomenon is caused by Yarn twisted? Yarn overstretched/displacement/overlapping, etc----

Finding the possible root causes for causing such phenomenon could help the possible improvement for mass production.

The yarn size (40D/34F) alone does not justify the level of cosmetic snagging observed. The issue appears to be driven by a combination of fabric construction and finishing conditions, with the white colorway indicating a clear process-related amplification rather than a purely inherent material limitation.

The key issue is not whether the surface can be manually reshaped, but whether the fabric can consistently recover to its original state under normal handling conditions.