
Phenomenon & Observation:

The sample was received with noticeable localized indentations and uneven wrinkles, observed at the same positions on both the outer and inner layers.

收到的樣品在局部位置出現明顯的凹痕與不平整皺紋, 且內外層同位置均有此現象.

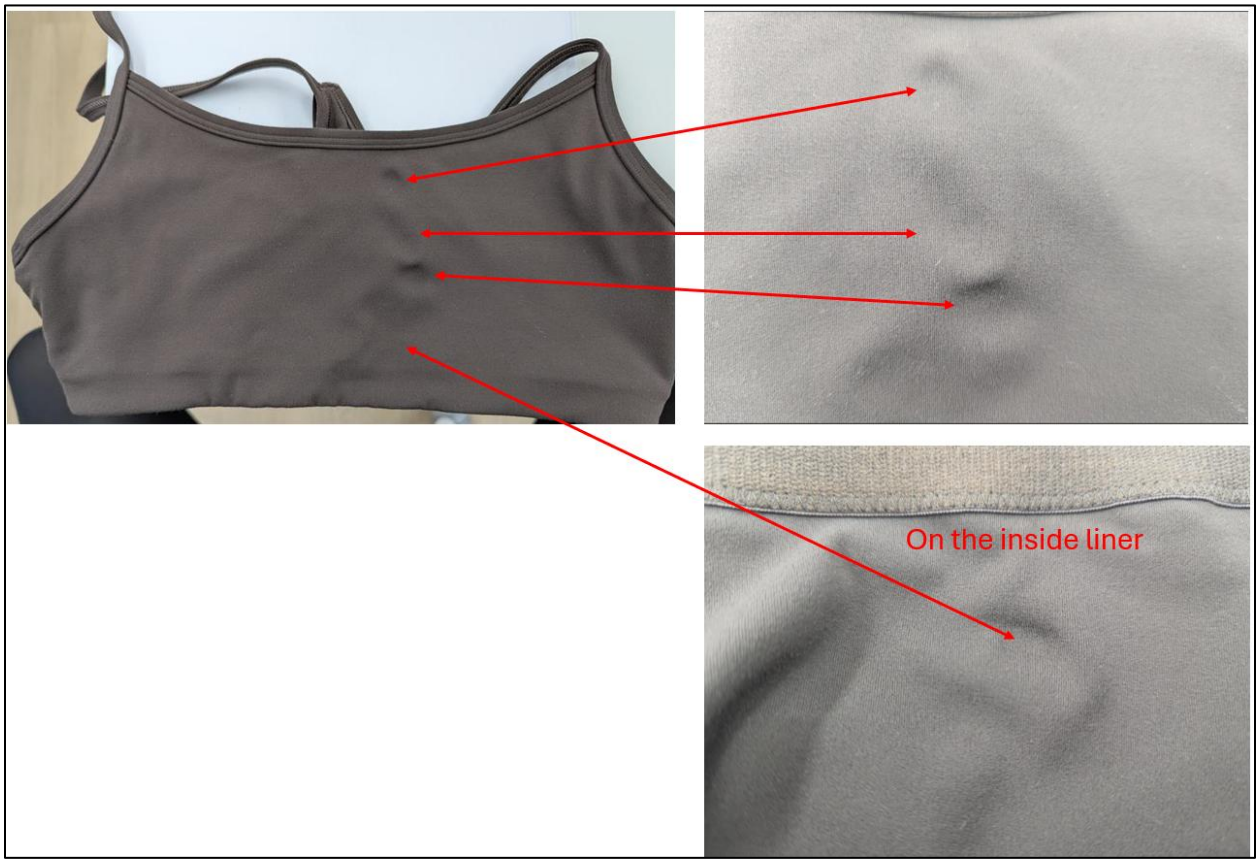

The sample showed on the photo has wrinkle pattern that highly consistent with localized point pressure, and the fact that it appears in the same position on both the outer and inner layers aligns with the behavior of hanging force through the double-layer fabric or hanging marks formed during drying, where the weight of the garment and the suspension points may create similar indentations. 照片中樣品的 "凹痕形態" 與 "局部點壓" 一致, 且內外層同位置出現, 與外力施力穿透雙層布的行為相符, 外力來源是晾乾過程中的吊痕, 衣物重量與吊掛點可能形成類似的凹痕.

If this were a material or manufacturing defect, we'd typically observe more extensive and uniform ripples or deformation, and majority of Bulk will have the same issue after wash & dry. The distribution of flaws on this sample appears much more consistent with damage caused by external force. 若此為材料/製程本身缺陷, 通常會看到更廣泛, 還有規律性的波紋或沿縫線分布, 且大部分的大貨在水洗晾乾後可能都有這樣的問題, 為什麼只有這件? 這件樣品瑕疵的分布比較像是外力所造成.