Mahindra BE / XEV EV Software Experience Survey

Survey insight report based on 35 responses

Prepared from the uploaded survey workbook | March 2026

Responses	Avg score	6 or below	Fully fixed
35	**6.5/10**	**42.9%**	**5.7%**

Executive summary

• The software experience is middling rather than broken end-to-end: the average overall rating is 6.5/10, with a median of 7. However, 42.9% of respondents rated the experience 6 or below, which is high enough to signal a broad reliability problem rather than isolated edge cases.

• The dominant product issue is suspension software performance. It is the worst-rated vehicle-system item in the survey, and open-text comments repeatedly describe the ride behavior as inconsistent, stuck in the wrong mode, or requiring restarts / drive-mode toggles to recover.

• The next most severe pain points cluster around convenience and personalization features: auto lock/unlock on approach/exit, seat-and-ORVM memory behavior, OTA update process, Alexa integration, music system audio behavior, and general UI responsiveness.

• The companion app also has clear weak spots. Live Secure360 View is the most problematic app feature by a wide margin, followed by login, car connectivity, and remote car-function controls.

• Service follow-through is a major amplifier of dissatisfaction. Only 5.7% of respondents say all issues were fixed. 34.3% are no longer with their original ASC, and ASC capability scores are materially lower for knowledge, repair quality, and customer-first problem solving than for basic courtesy.

• This dataset is small and self-selected, so it should not be treated as representative of the full owner base. It is still highly useful for prioritization because the same failure modes recur across structured ratings and open-text responses.

Method and interpretation notes

• Base file analyzed: “Mahindra BE_XEV EV Software Experience Survey (Responses).xlsx”.

• Sample size: 35 responses.

• Vehicle-system and app-feature issue ratings were converted to a 0-4 severity scale for comparison: No Issues = 0, Minor Glitches = 1, Occasional Malfunctions = 2, Frequent Bugs = 3, Critically Broken = 4.

• Version entries in the raw file were inconsistently formatted. Where useful, versions were normalized using the last visible three-digit build marker (for example 912, 402, 082).

• Because this is a voluntary survey, results are best read as a prioritization lens for pain points, not as an unbiased incidence estimate across all owners.

1) Overall experience is acceptable for some, but too inconsistent for many

Distribution of the 1-10 overall software experience score.

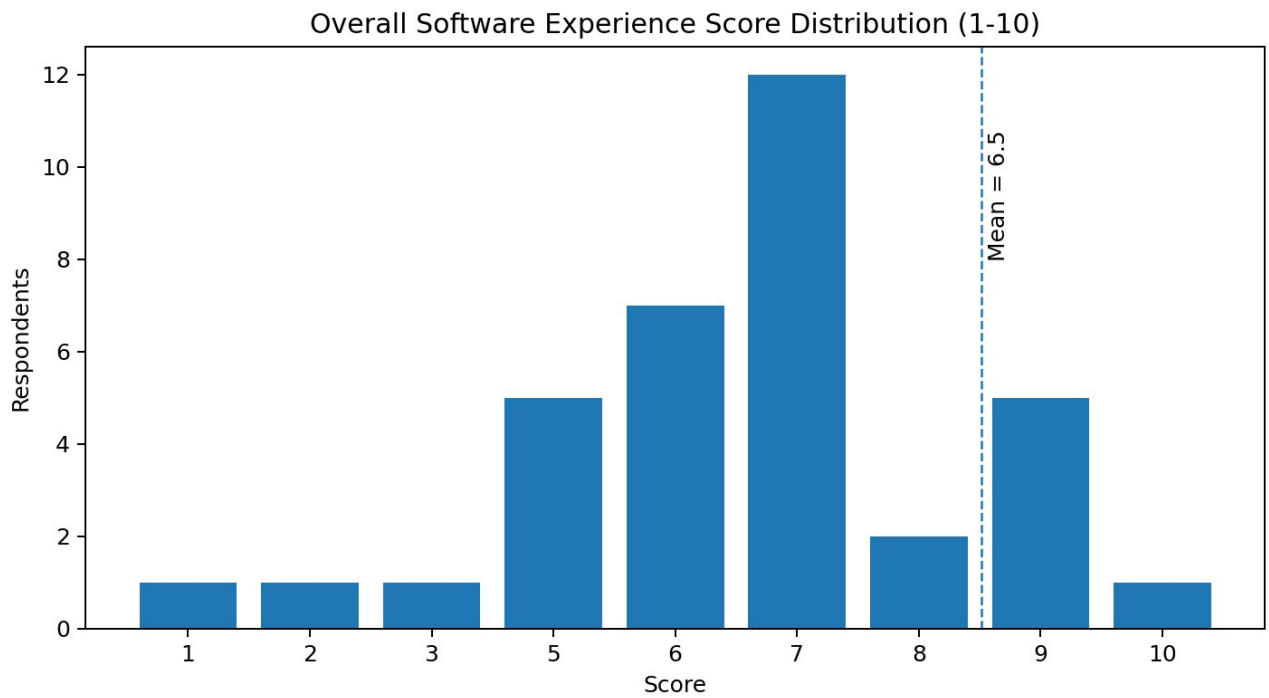

Overall Score Distribution

• Ratings cluster around 6-7, with relatively few perfect scores. The mean is 6.5, and 42.9% of respondents fall at 6 or below.

• This pattern suggests the product is not perceived as universally unstable, but it is perceived as unreliable enough that many owners cannot describe the experience as polished.

• The right framing is not ‘catastrophic failure’. It is ‘persistent friction across multiple software-controlled features’.

2) Vehicle-system problems are concentrated in suspension, convenience automation, and personalization

Average severity across the vehicle-system questions, ranked highest to lowest.

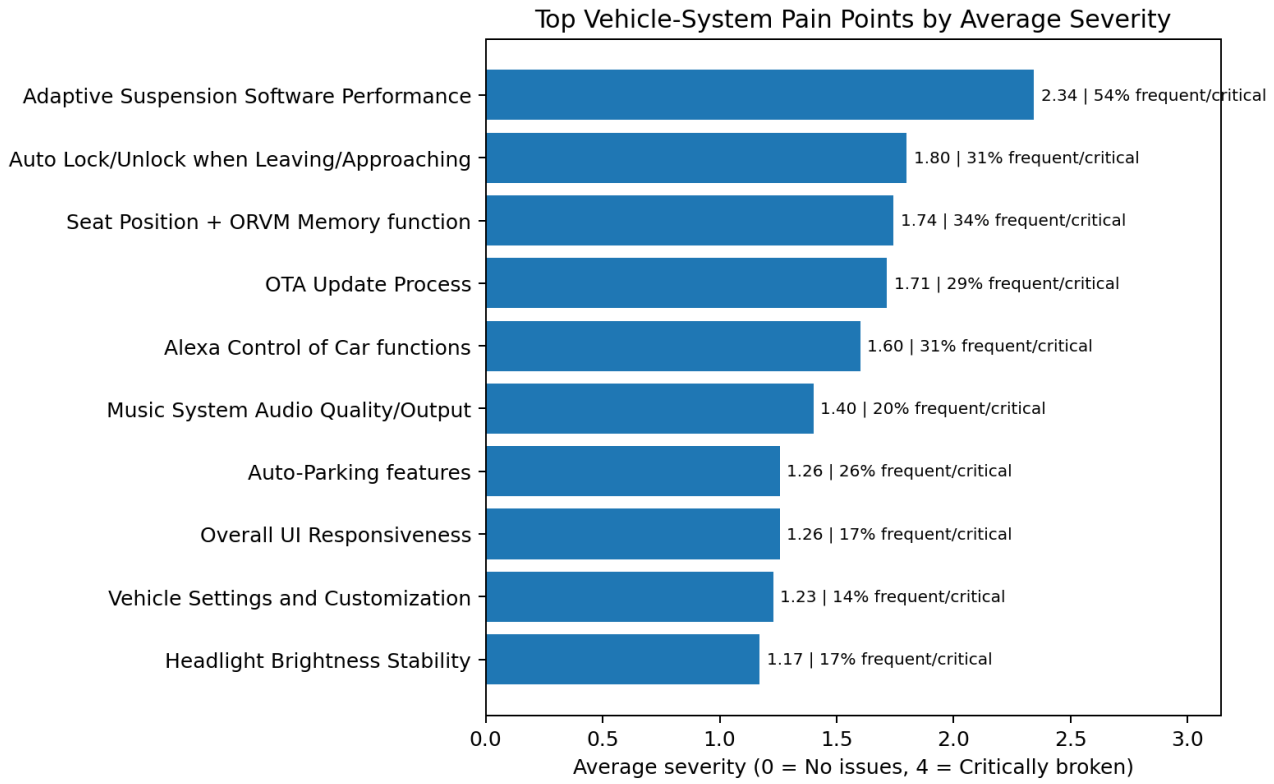

Vehicle Top Issues

• The worst-rated vehicle-system item is Adaptive Suspension Software Performance (average severity 2.34/4; 80% report some issue).

• Other top-tier pain points are Auto Lock/Unlock when Leaving/Approaching, Seat Position + ORVM Memory function, OTA Update Process, and Alexa Control of Car functions.

• These are not niche features. Several of them affect daily-use convenience and confidence, which makes their impact larger than the raw severity score alone might imply.

• The open-text comments reinforce that many issues are intermittent. Intermittent failures are especially damaging because they are hard for ASCs to reproduce and easy for customers to perceive as unresolved.

3) App reliability lags behind owner expectations for a connected EV

Average severity across Me4U app feature questions.

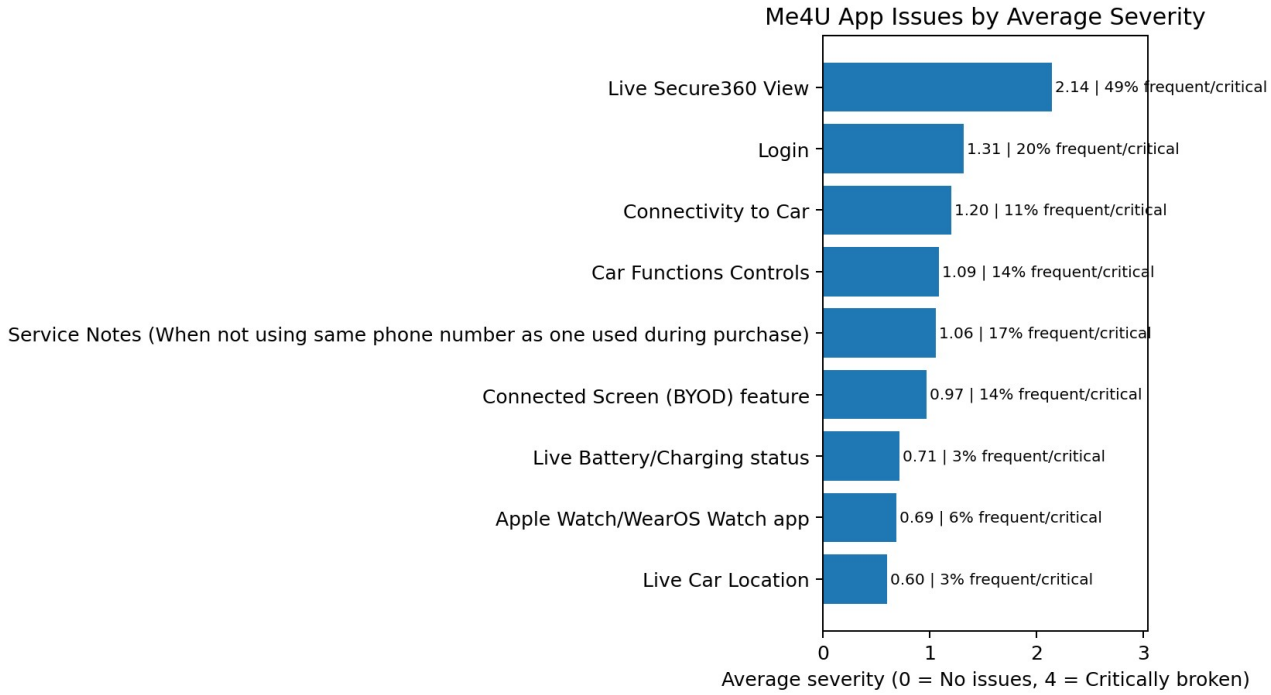

App Issues

• The most severe app issue is Live Secure360 View (average severity 2.14/4; 49% rate it frequent or critical).

• Login and car connectivity problems are especially damaging because they break the front door to the app experience; once those fail, owners cannot discover or trust downstream features.

• Remote controls, service-note handling, and BYOD-related features form a second tier of friction. Taken together, the app appears usable, but not dependable.

4) Newer versions do not appear to have cleared the main complaint cluster yet

Average overall score by model and normalized installed software version.

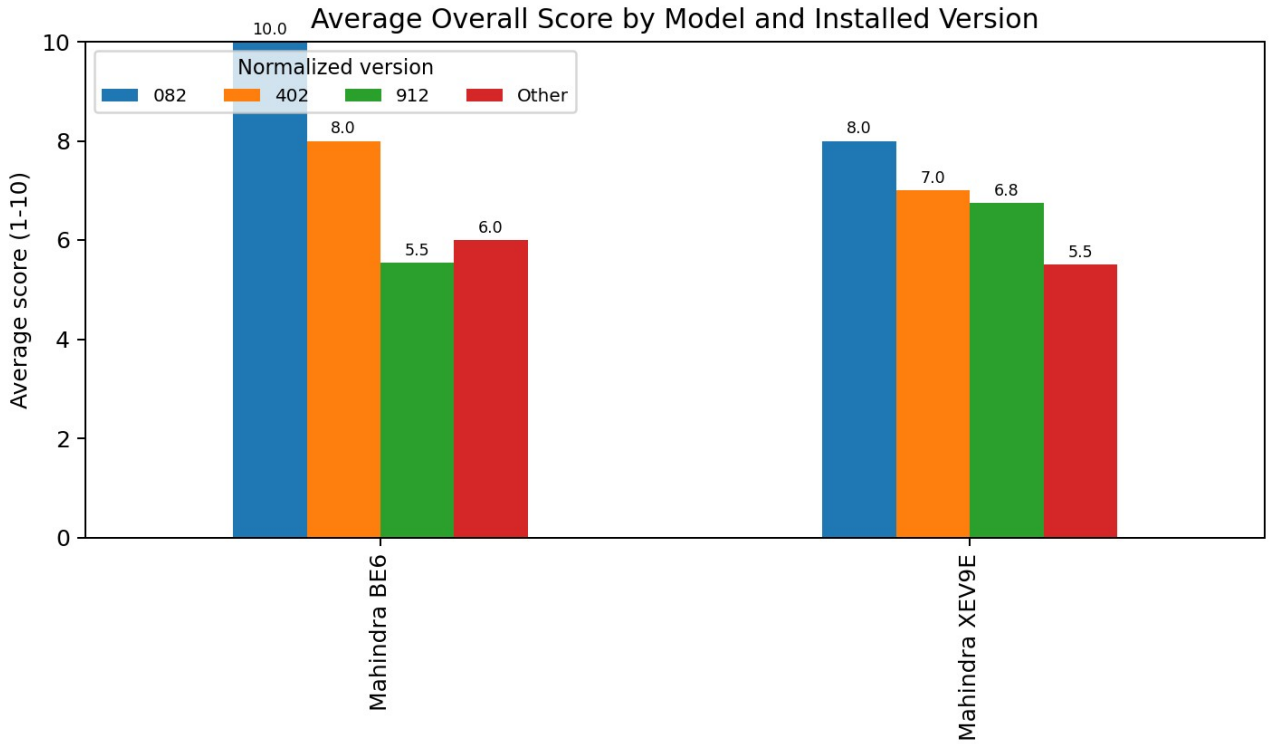

Model Version Comparison

• The normalized version comparison is directional only because the non-912 groups are small.

• The largest cohort in the file is build 912. Despite being the newest visible cluster in this sample, many of the high-friction issues still appear in comments from 912 users, especially around suspension, lock/unlock behavior, audio, ORVM memory, and Android Auto connectivity.

• By model, XEV9E owners rate the experience slightly higher on average than BE6 owners (6.8 vs 6.2), but the gap is not large enough to change the core conclusion.

5) Service capability is a second-order problem that makes the product problem feel worse

Average ratings for the current ASC across five service-quality dimensions.

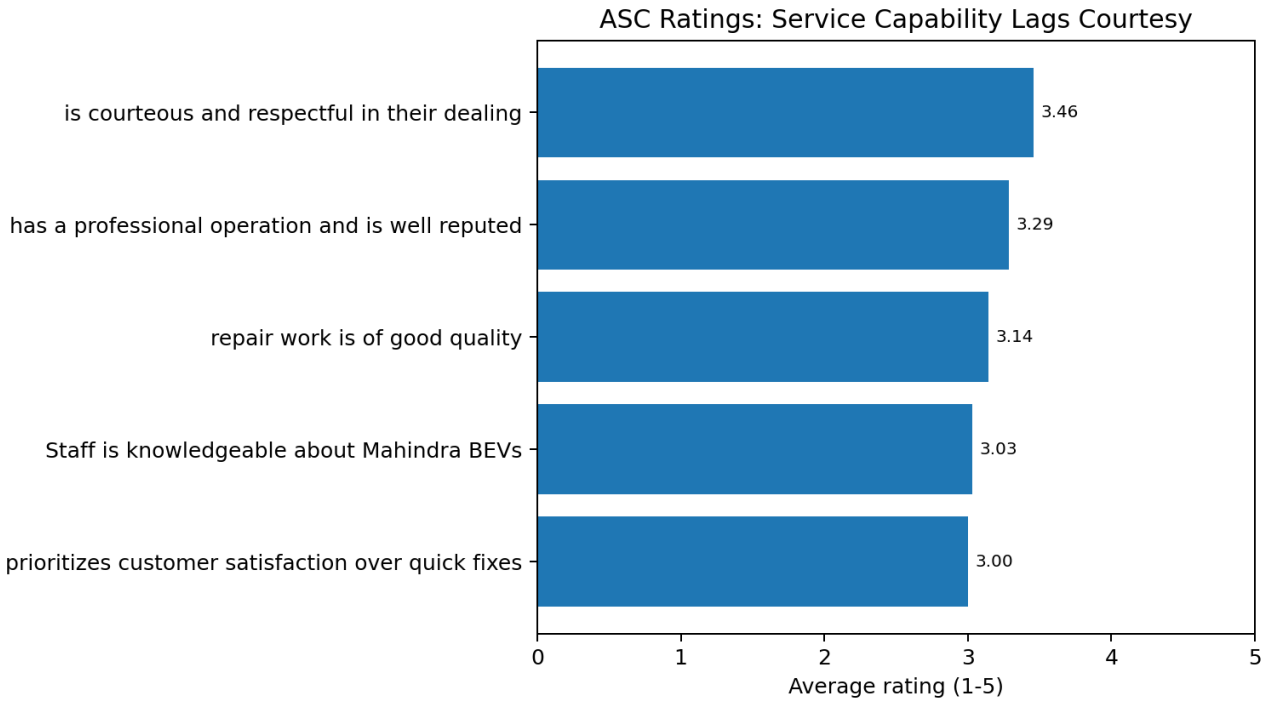

Asc Ratings

• On a 1-5 scale, the strongest ASC dimension is courtesy/respect (3.46), while the weakest are customer-first problem solving (3.00) and EV knowledge (3.03).

• 34.3% of respondents are no longer with their original ASC, which is a notable churn signal for aftersales trust.

• This matters because many of the reported failures are intermittent or software-defined. Owners need technically confident service teams to diagnose, explain, escalate, and close the loop.

6) The closure gap is large: acknowledgement exists, full resolution is rare

Outcome of issue acknowledgement / attempted fixes reported by respondents.

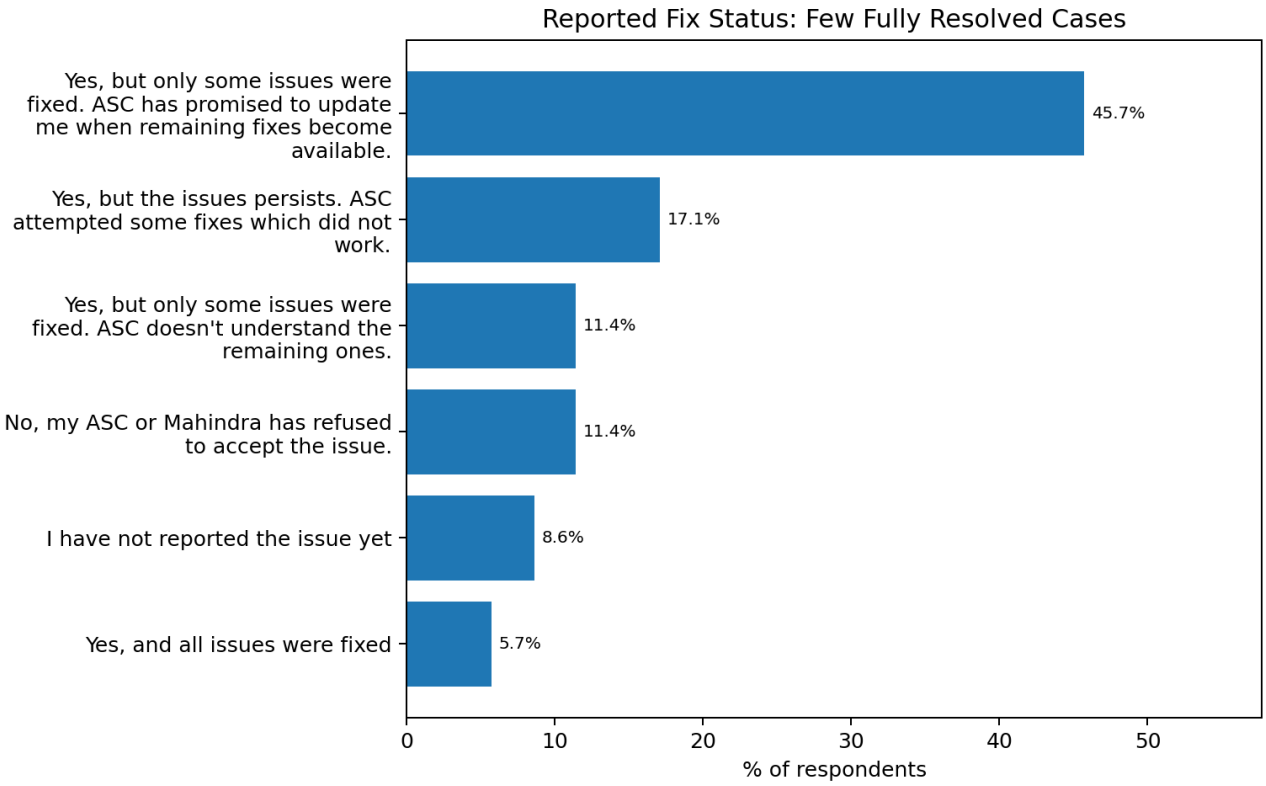

Fix Status

• Only 5.7% report full resolution.

• Most respondents fall into partial-fix or unresolved states. In practice, that means the organization is acknowledging issues, but not consistently closing them.

• This is strategically important: unresolved but acknowledged issues often erode trust faster than issues that are clearly unknown, because customers expect progress once the problem is recognized.

7) Open-text feedback confirms the same issue clusters

Keyword-themed count of the free-text comments.

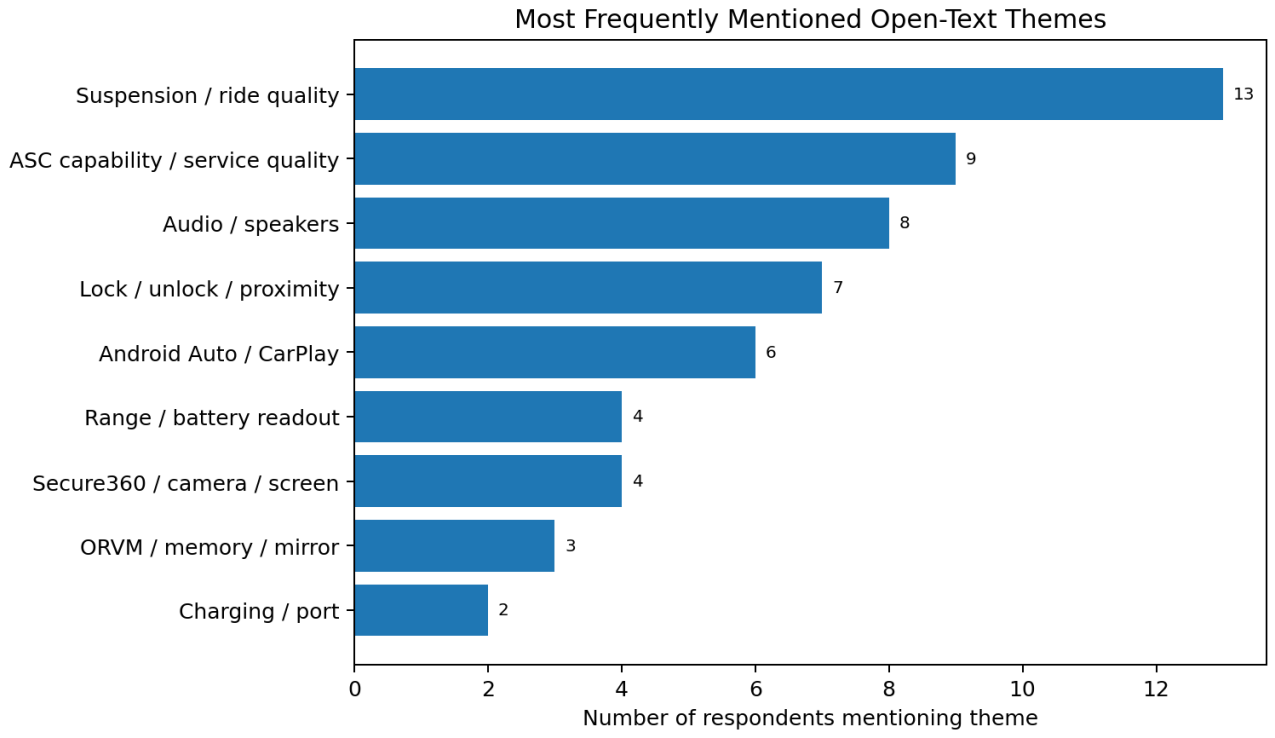

Open Text Themes

• Open-text comments closely mirror the structured ratings, which increases confidence in the findings.

• Suspension appears most often, followed by service capability, audio quality / speaker behavior, lock-unlock proximity behavior, and Android Auto / CarPlay stability.

• The theme distribution indicates a mixed reliability story: some issues are deep vehicle-control behaviors, while others are software polish, UX consistency, and ecosystem integration failures.

Illustrative owner comments (anonymized excerpts)

> *“Suspension works one day and it gets stuck in stiff suspension for many days.”*
>
> *“Auto lock/unlock doesn't work sometimes.”*
>
> *“Android Auto gets disconnected frequently.”*
>
> *“Music system audio balance has been completely ruined in the latest amplifier ECU update.”*
>
> *“Secure 360 is not recording at all and not able to use it as dash cam.”*
>
> *“Originally ASC was extremely untrained and ill-equipped to deal with the car.”*

Priority actions suggested by the survey

1. Treat suspension calibration / state-management as the flagship software defect cluster. It is the strongest signal in both scored and open-text data. A cross-functional owner should review state transitions, persistence, ECU interactions, and diagnostic observability.

2. Build a “daily convenience reliability” strike team. Auto lock/unlock, ORVM/seat memory, OTA process, Android Auto / CarPlay stability, and UI responsiveness are daily-touch features that disproportionately shape owner sentiment.

3. Stabilize the connected-app basics before adding new app polish. Secure360, login, connectivity, and remote controls should be treated as trust foundations. Failure here weakens the value story of the connected ecosystem.

4. Create a tighter software-to-ASC feedback loop. Intermittent issues need reproducible playbooks, version-aware troubleshooting trees, and a known-issues bulletin so owners are not told the problem cannot be understood or reproduced.

5. Measure closure, not acknowledgement. A useful executive metric would separate reported, acknowledged, reproduced, workaround-available, fix-shipped, and confirmed-closed states.

Appendix A: Detailed issue ranking tables

Vehicle-system issue ranking

Feature	Avg severity	Frequent/Critical %	Any issue %
Adaptive Suspension Software Performance	2.34	54.3%	80.0%
Auto Lock/Unlock when Leaving/Approaching	1.80	31.4%	71.4%
Seat Position + ORVM Memory function	1.74	34.3%	71.4%
OTA Update Process	1.71	28.6%	68.6%
Alexa Control of Car functions	1.60	31.4%	71.4%
Music System Audio Quality/Output	1.40	20.0%	68.6%
Auto-Parking features	1.26	25.7%	54.3%
Overall UI Responsiveness	1.26	17.1%	71.4%
Vehicle Settings and Customization	1.23	14.3%	65.7%
Headlight Brightness Stability	1.17	17.1%	57.1%
Android Auto/CarPlay Stability and Connectivity	1.17	17.1%	62.9%
Battery Management System and Range Readouts/Consistency	1.14	17.1%	60.0%
Air Conditioning Controls	1.14	8.6%	65.7%
ORVM Dipping	0.94	11.4%	54.3%
Cameras (Inside or Outside)	0.83	8.6%	45.7%
Door controls (Windows, ORVMs, etc)	0.80	5.7%	57.1%
ADAS Features - Emergency Braking	0.77	5.7%	51.4%

Auto-Regen Mode	0.60	2.9%	37.1%
Charging Port Logic/Status Indicators	0.43	2.9%	31.4%
ADAS Features - Lane Assist and Adaptive Cruise	0.40	0.0%	34.3%
ADAS Features - Blind View Assist	0.34	2.9%	20.0%

App-feature issue ranking

Feature	Avg severity	Frequent/Critical %	Any issue %
Live Secure360 View	2.14	48.6%	77.1%
Login	1.31	20.0%	60.0%
Connectivity to Car	1.20	11.4%	71.4%
Car Functions Controls	1.09	14.3%	60.0%
Service Notes (When not using same phone number as one used during purchase)	1.06	17.1%	54.3%
Connected Screen (BYOD) feature	0.97	14.3%	48.6%
Live Battery/Charging status	0.71	2.9%	54.3%
Apple Watch/WearOS Watch app	0.69	5.7%	37.1%
Live Car Location	0.60	2.9%	37.1%

Source: uploaded Excel workbook analyzed directly from the survey response export. Personally identifying fields such as names, email addresses, and phone numbers were excluded from the narrative.