



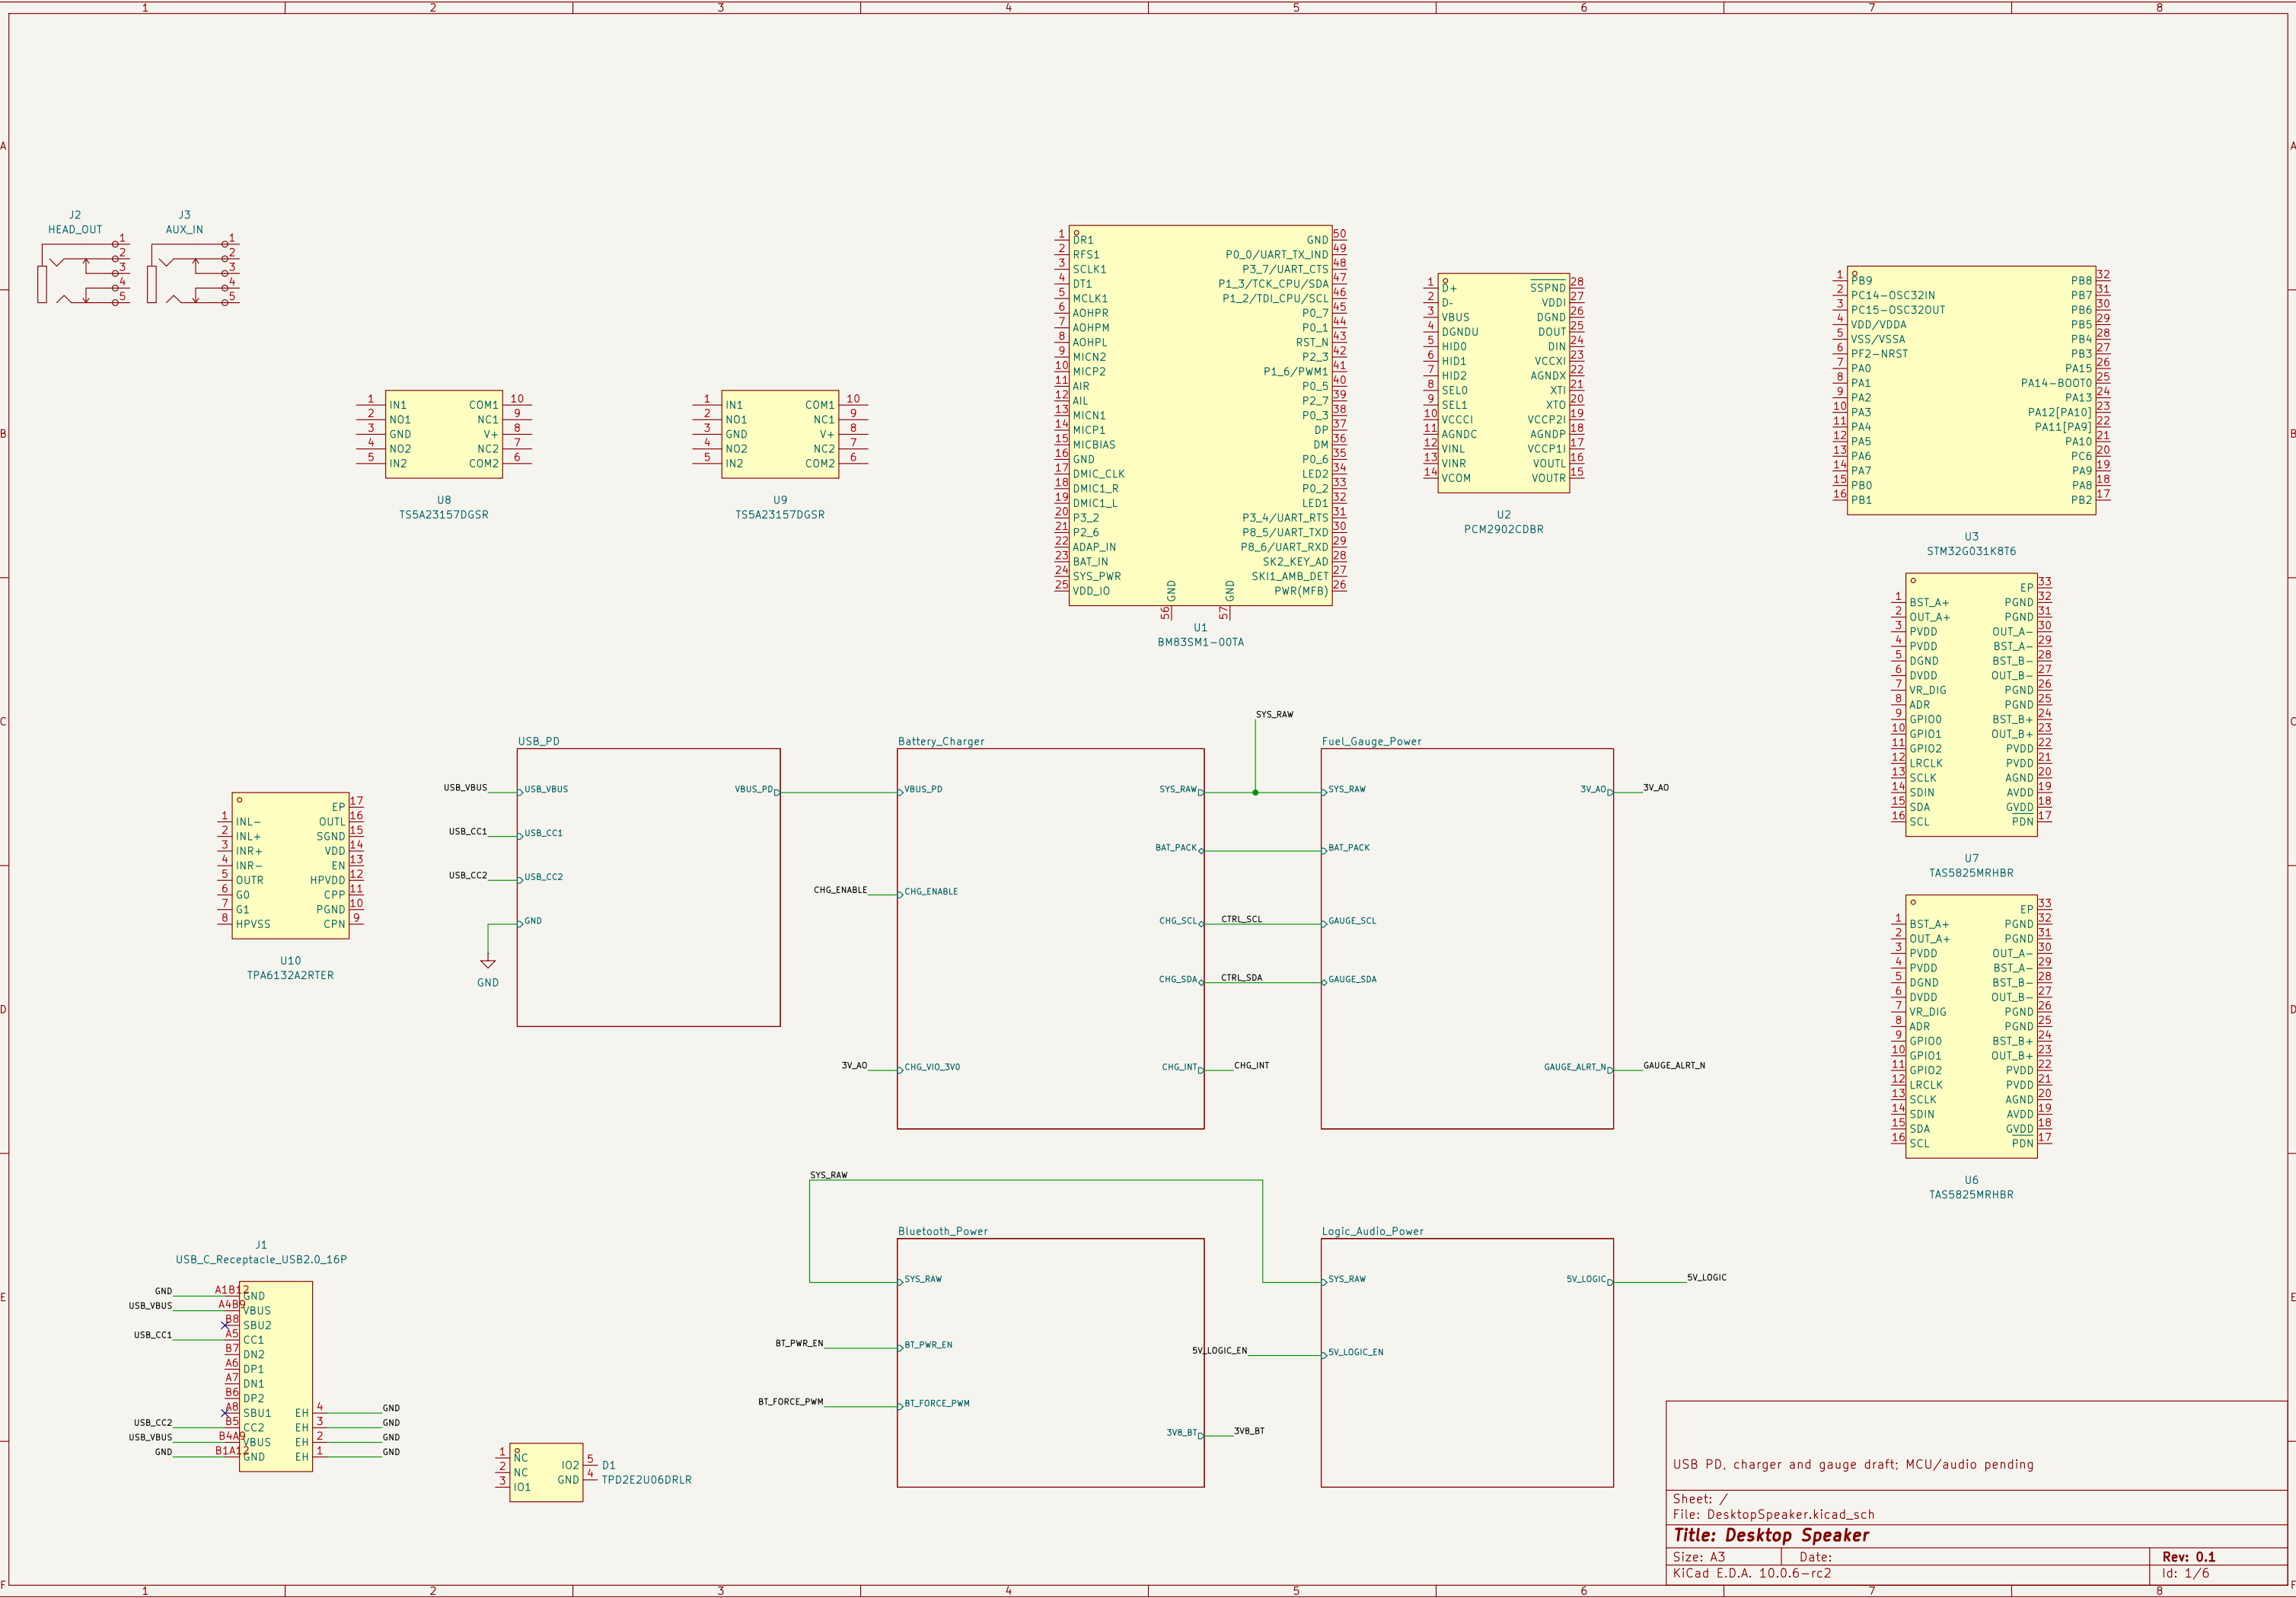

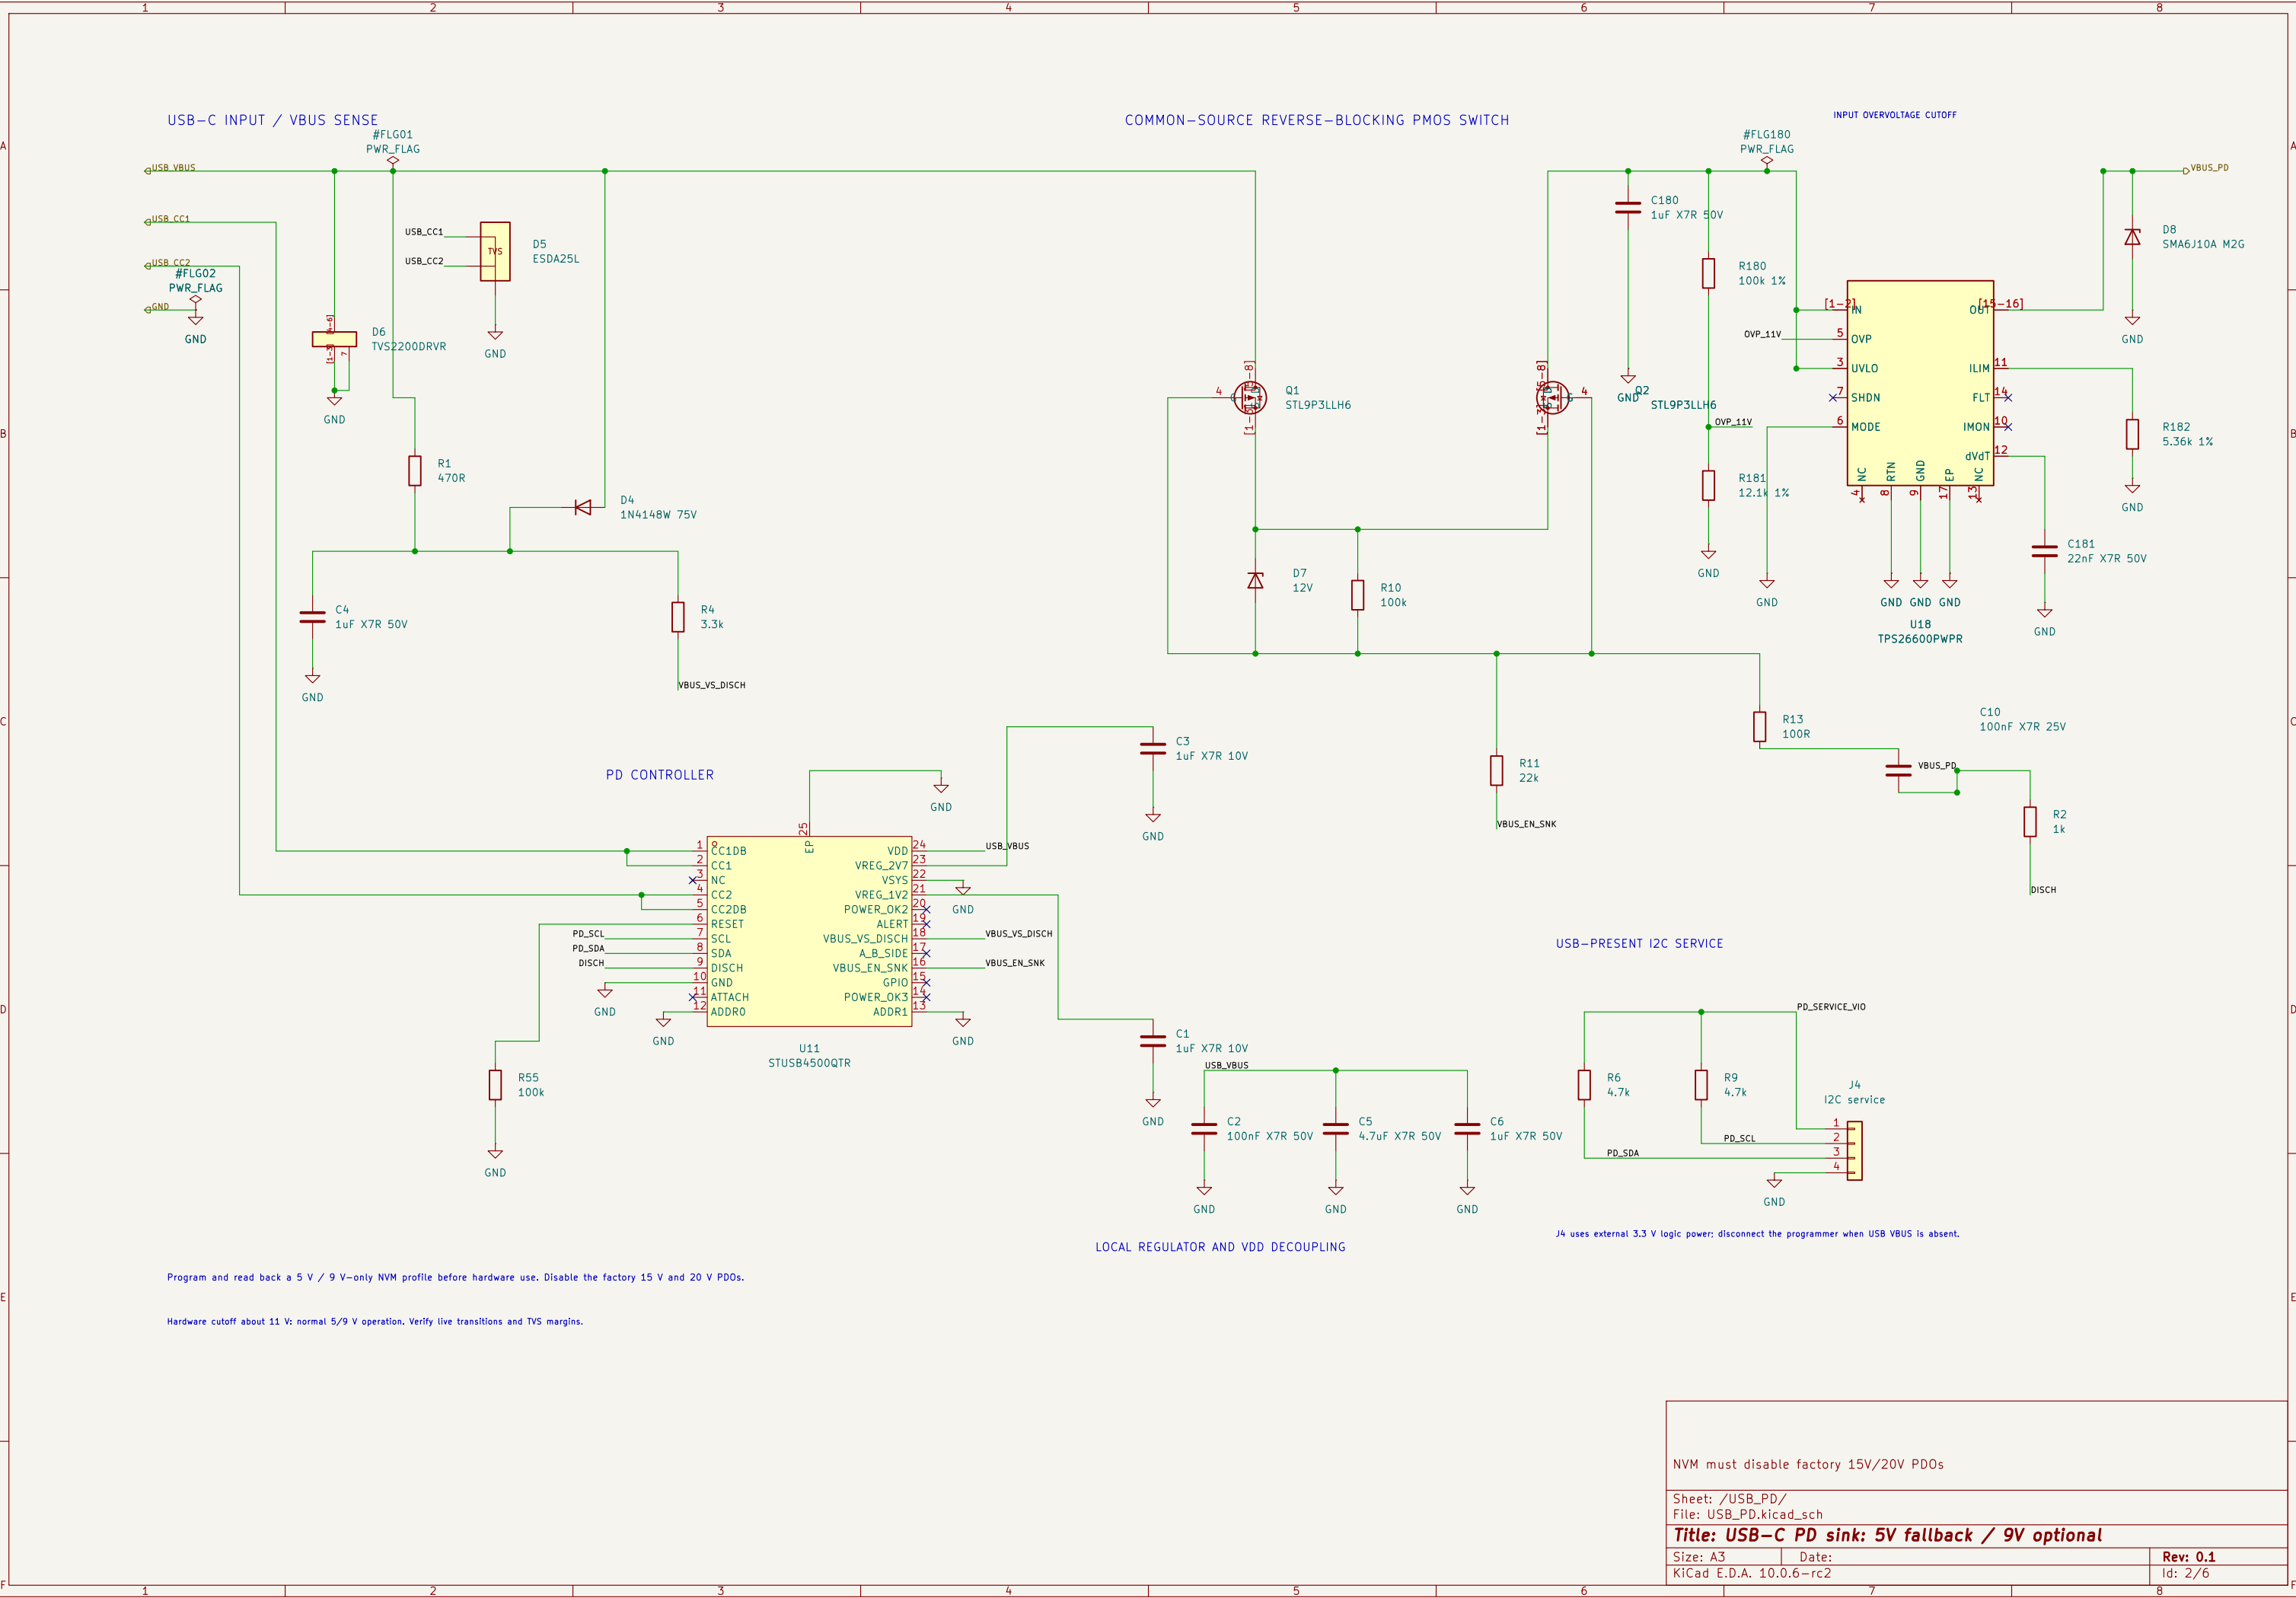


Charge disabled until MCU validates pack/source and sets IINLIM, VREG, ICHG, watchdog.

D+ / D- unused; disable AUTO_DPDM. SYS_RAW is not a regulated 5 V rail.

QON wake: hold SW100 >= 2.3 s; USB insertion also exits ship mode.

VBUS 3.9–14 V; PMID 8.2uF suggested (OTG unused)

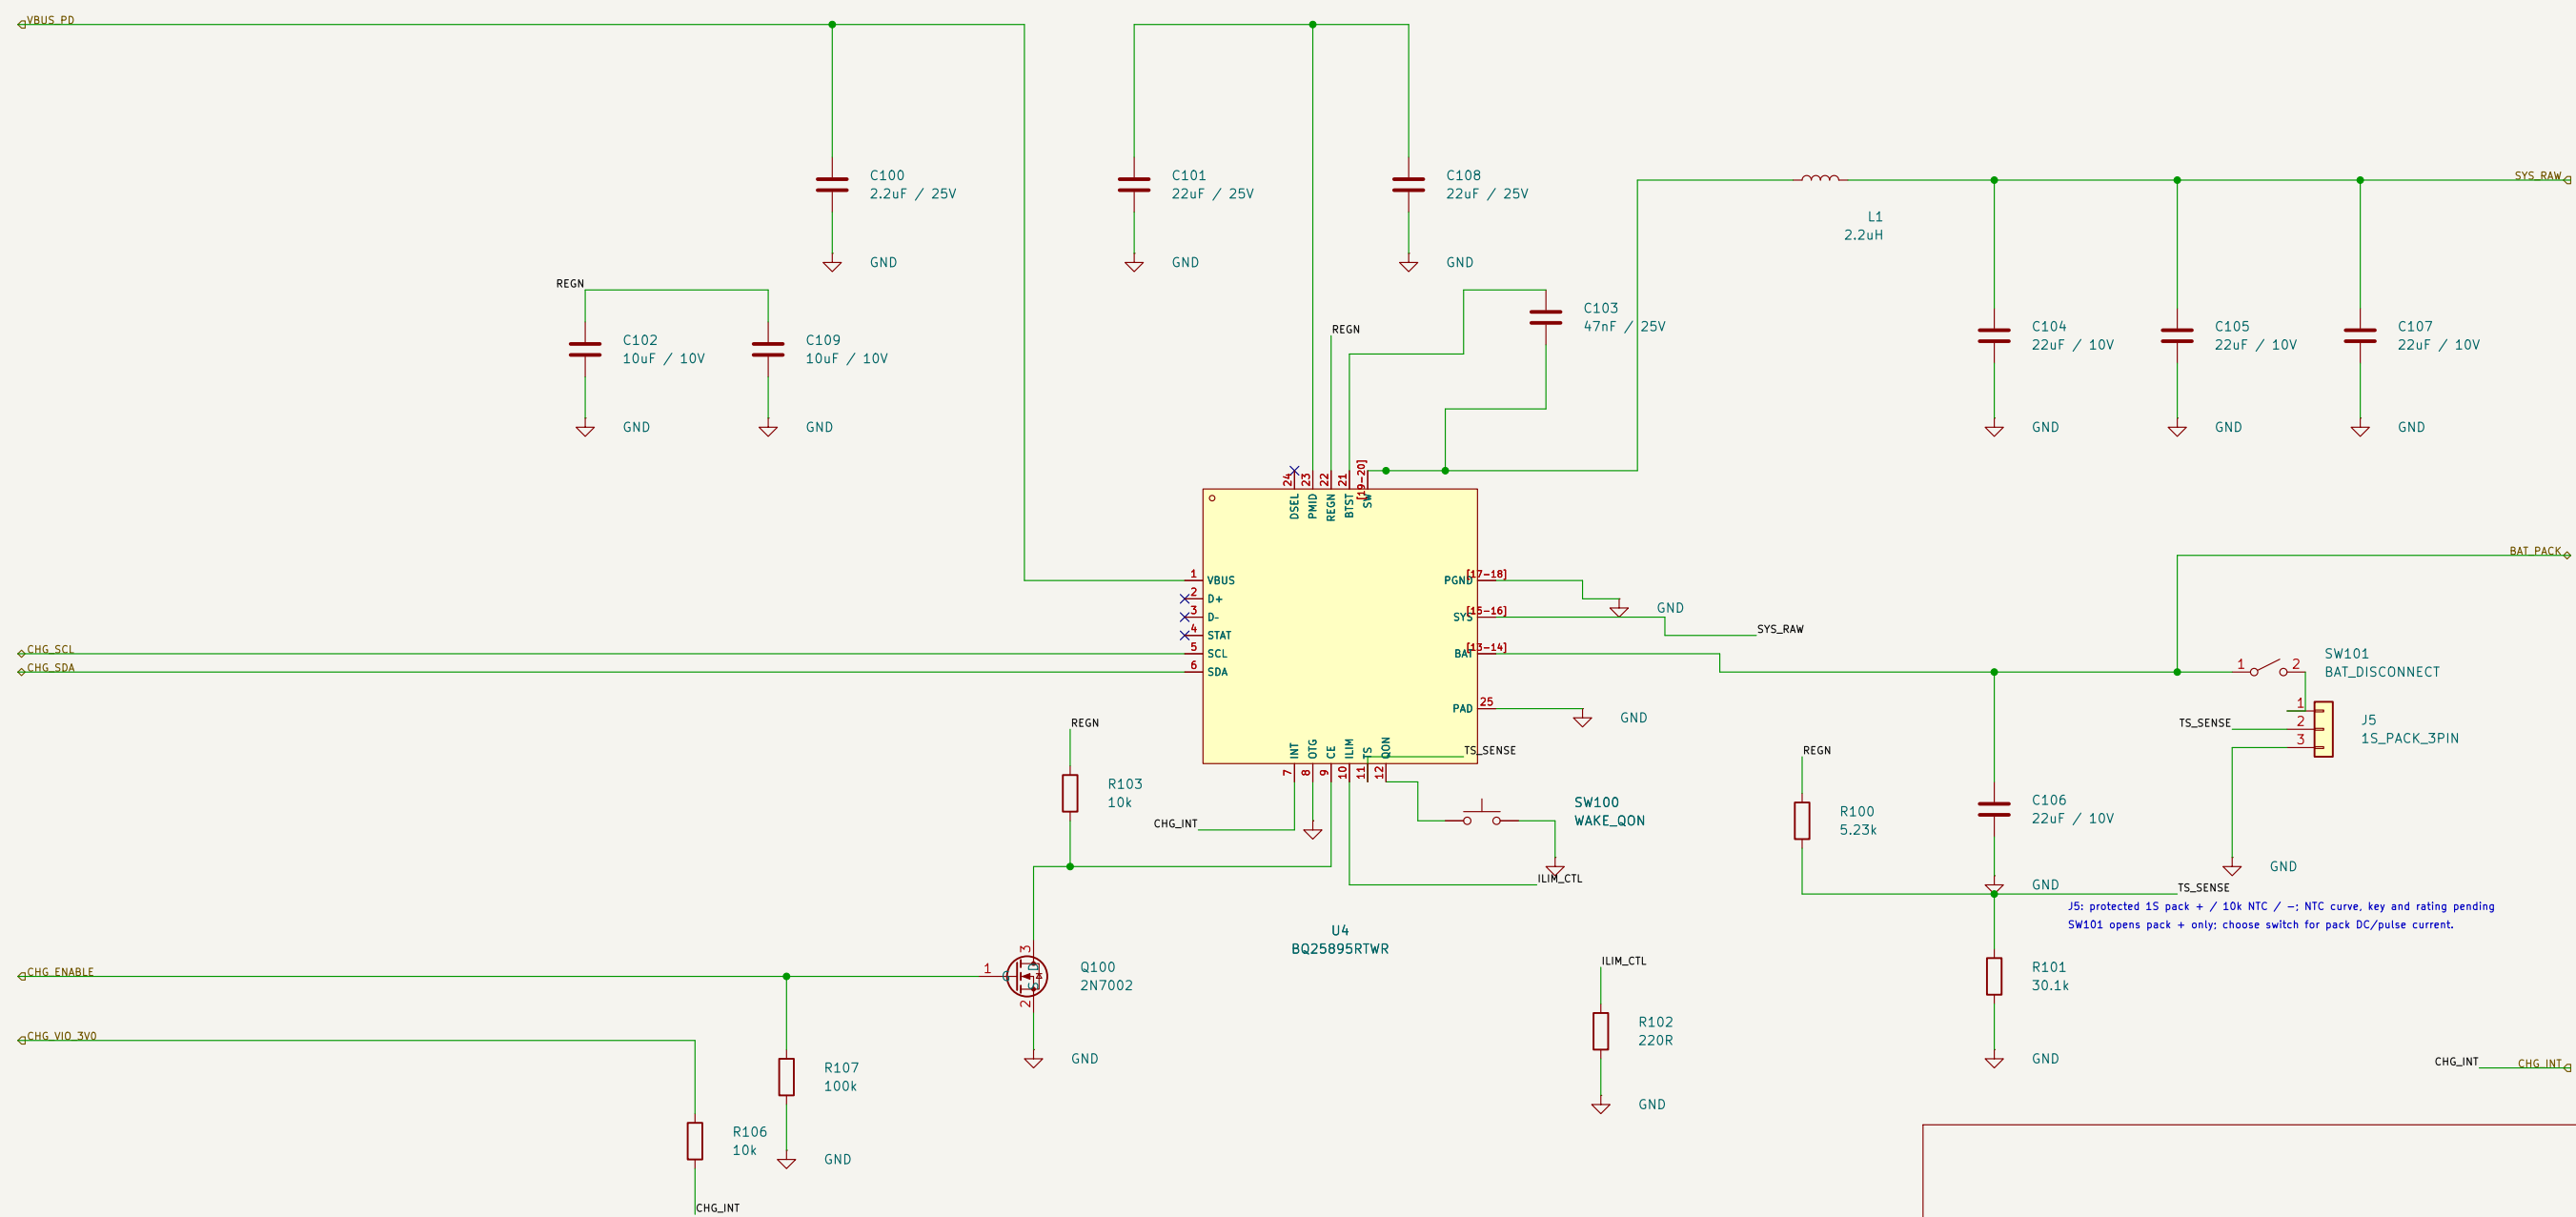

Sheet: /Battery_Charger/
File: Battery_Charger.kicad_sch

Title: BQ25895 charger and 1S battery power path


Size: A3

Date:

Rev: 0.1

Size: A5	Date:
KiCad E.D.A. 10.0.6-rc2	

Id: 3/6

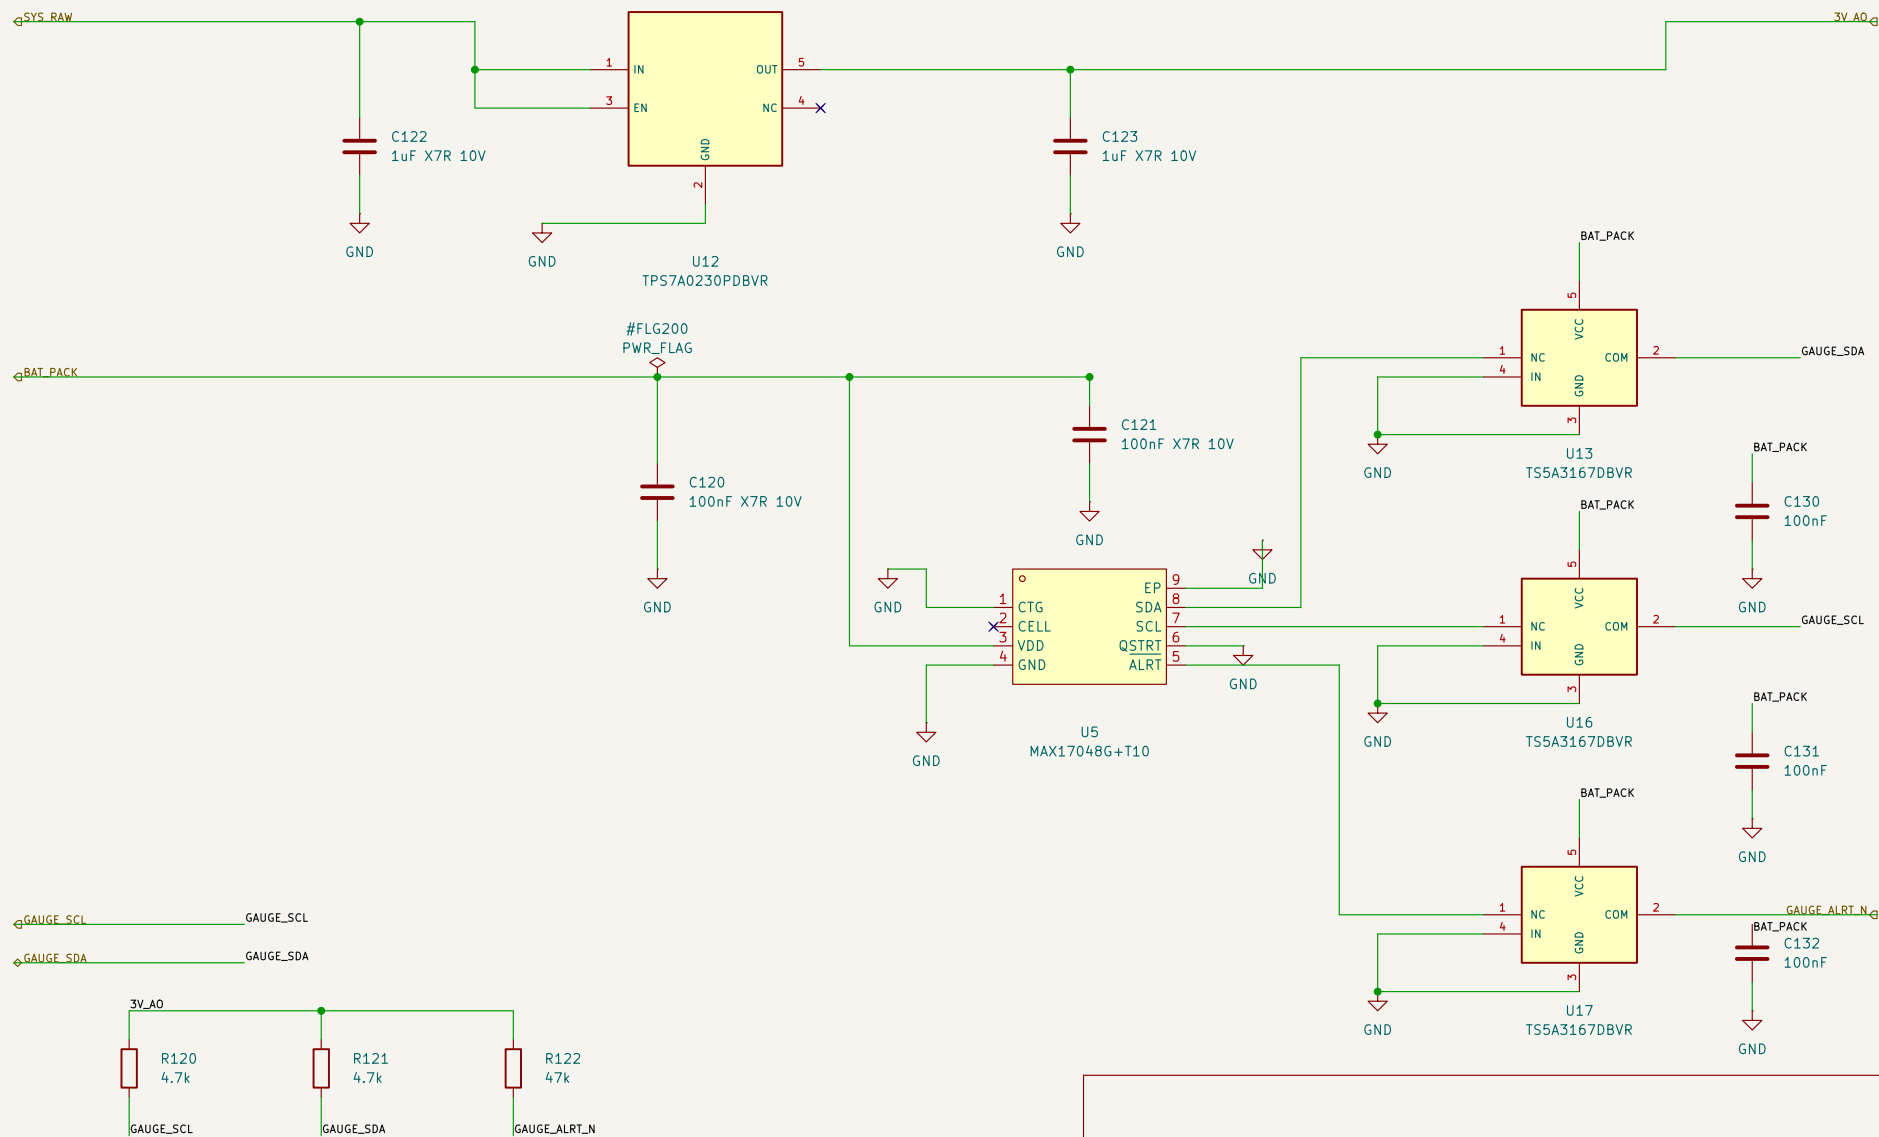

CELL pad 2 unused on MAX17048; QSTRT tied low

Gauge isolation: 3 active-low BAT-powered switches; OFF when BAT absent

Sheet: /FuelGauge_Power/
File: FuelGauge_Power.kicad_sch


Title: Fuel gauge and low-current power

Size: A4
KiCad E.D.A. 10.0.6-rc2

Date:

Rev: 0.1

Id: 4/6

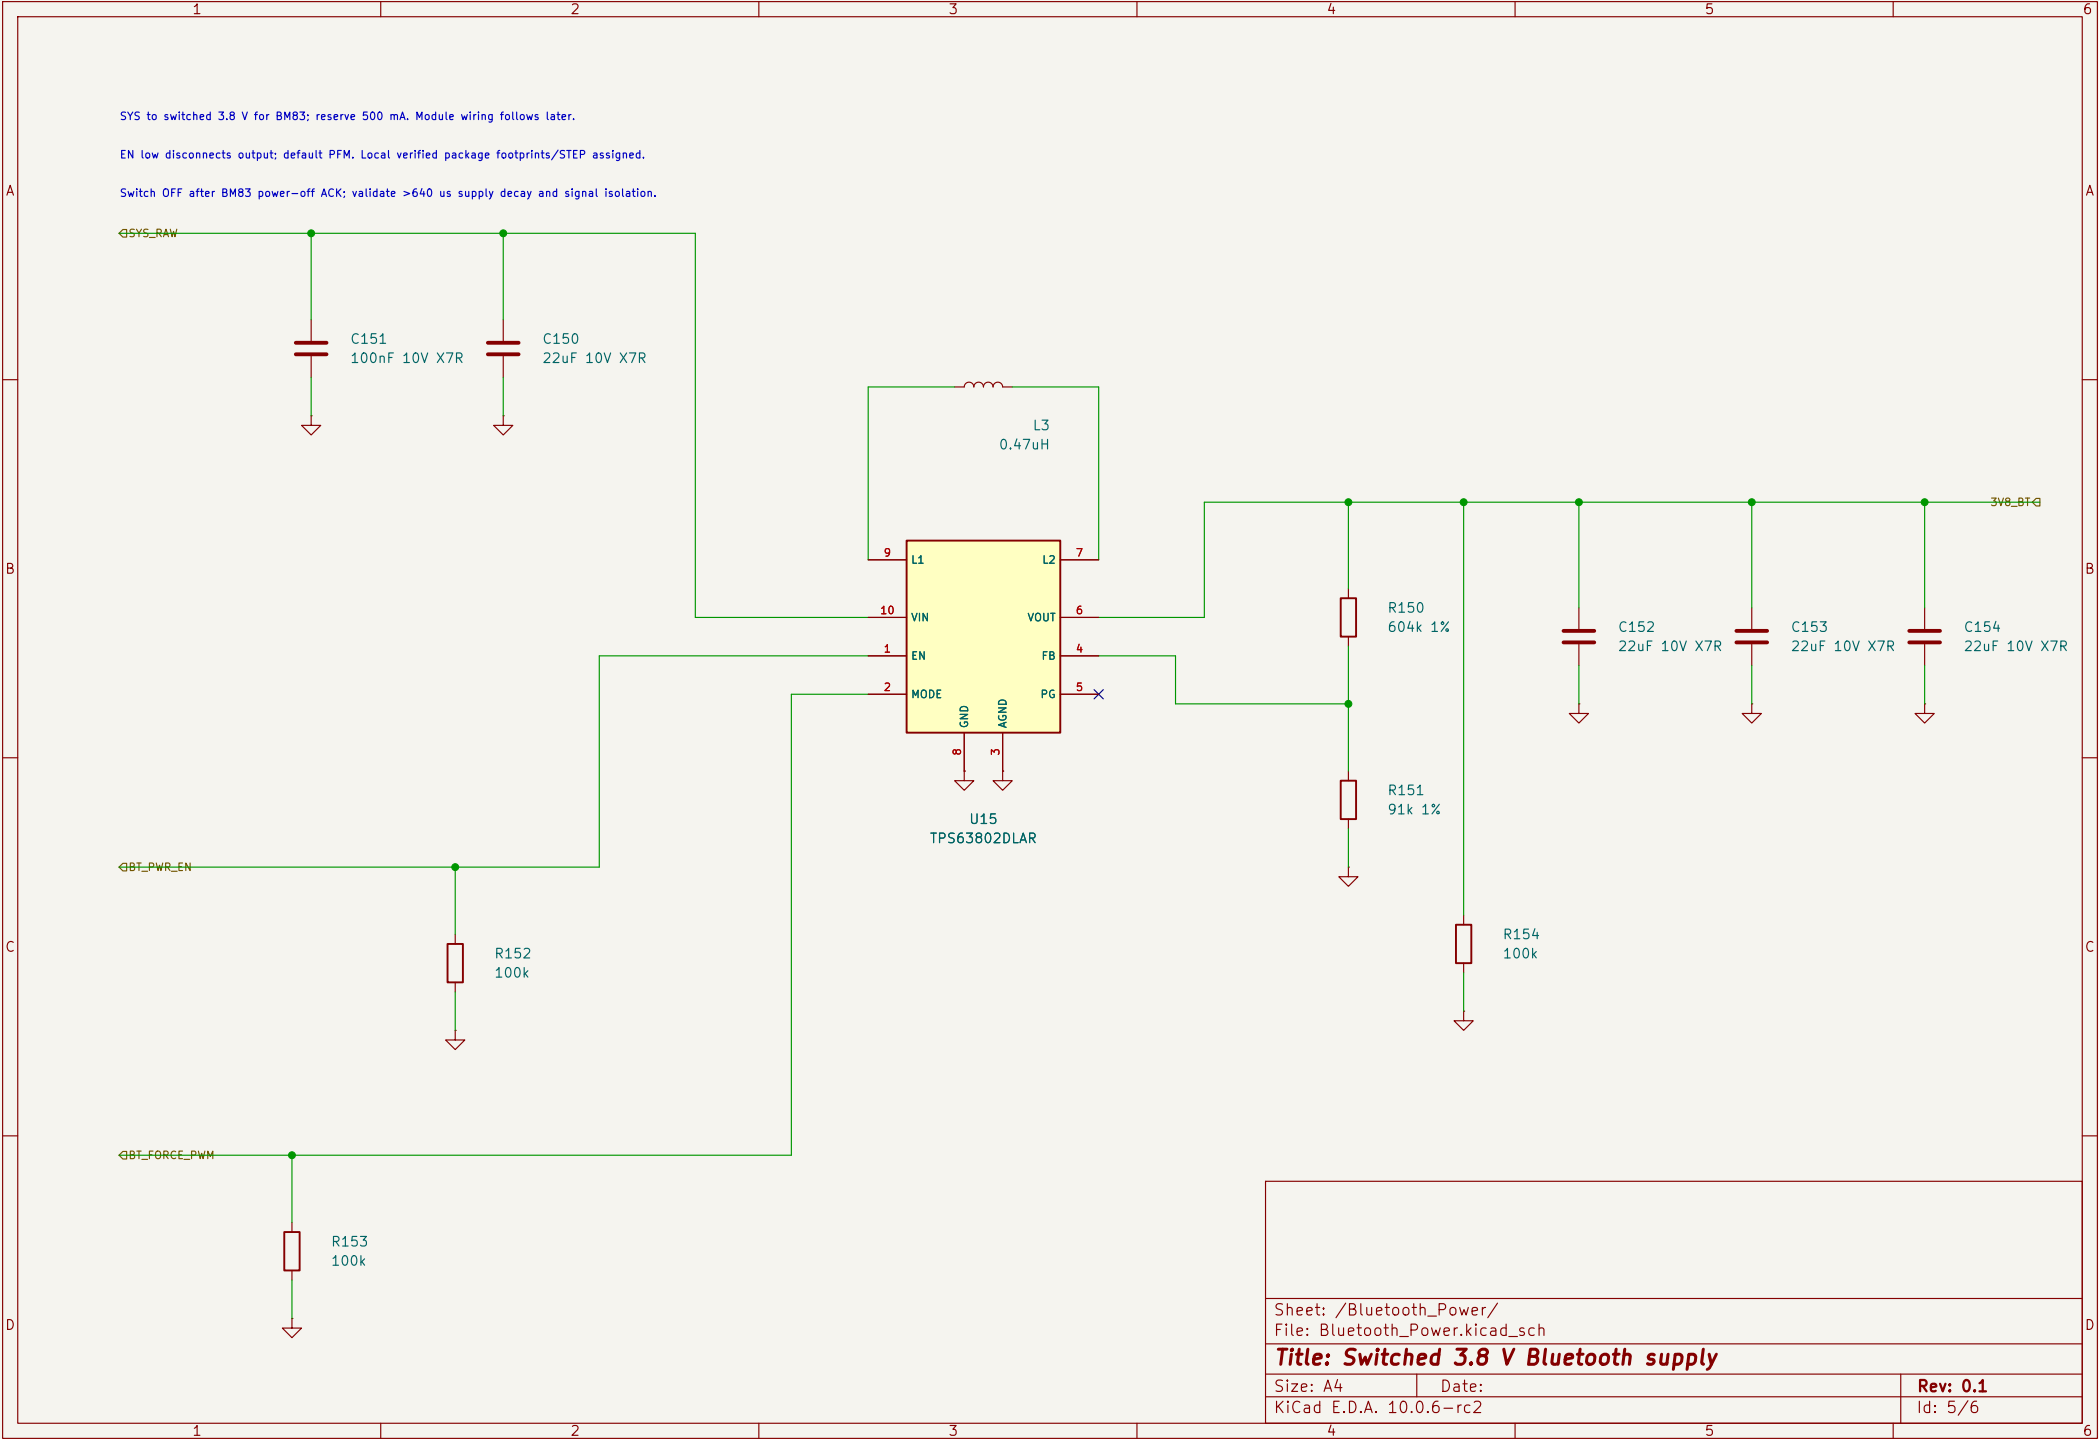

Protected 1S SYS to switched 5 V; reserve 500 mA total. Codec and other 5 V loads connect later.

EN low = true input/output disconnect; MODE tied to SYS_RAW selects forced PWM while enabled.

U14 forced PWM while enabled; feedback-divider DC bounds remain within PCM2902C supply limits. Ripple and startup transient require qualification.

