Intercom reset guide

The buttons to press, highlighted on your photo

The controls match the **classic V4 with a separate OFF button**. The model code on the back is not visible: check that it says V4 before following this guide.



Your supplied photo. A and B are the two buttons on the left.

A + B together / about 3 seconds

The documented reset **clears pairing records**. The manual does not describe a complete factory reset of all settings. [1]

1. **Switch the unit on**
   Hold the motorcycle button until the indicator flashes blue.

2. **Press A and B at the same time**
   With the unit switched on, hold both buttons for about 3 seconds.

3. **Watch the central indicator**
   Release when it flashes red: the pairing records have been cleared.

4. **Restart and reconnect**
   Press OFF, then switch on with the motorcycle button. Pair the units again.

A reset does not guarantee better audio: afterwards, carry out the checks on page 2.

AFTER THE RESET


Reconnect and test the audio

Pairing two classic V4 units [1]

1. Switch both units on. Hold **A on each unit for 3-5 seconds**, until the indicators flash alternately red and blue.
2. Briefly press A on one unit; wait about 5-7 seconds until both indicators flash blue in sync.
3. Press A again on the same unit to start the conversation.

For a group of 3 or 4 units, follow the specific sequence in the full manual [1].

Identifying the volume buttons

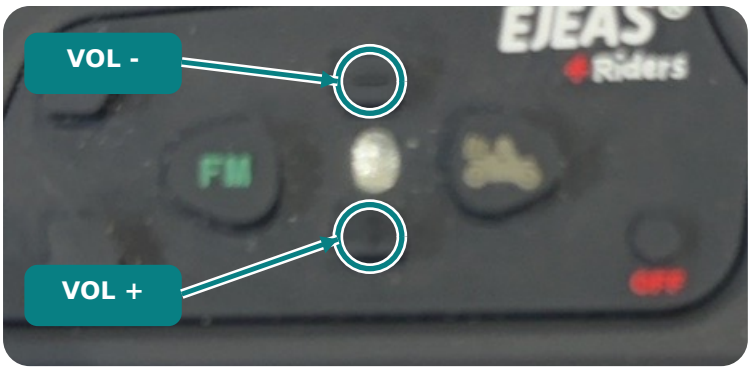

Detail from your photo, with added labels.

+ below the indicator
increases the volume.

- above the indicator
reduces the volume. [1]

If the audio is still poor

Suggested checks: change just one thing at a time and compare the result.

Plug and adapters	With the unit switched off, unplug and fully reinsert the audio plug and any adapters.
Headset	If available, try another compatible, working headset on the same intercom.
Comparison	If you have a second working V4, test your headset on that unit under the same conditions.
Volume	Start at a low level and increase it gradually during a test conversation.

If the problem persists, describe these tests to your seller or EJEAS support: support@ejeas.top. [2]

SOURCES AND SCOPE

[1] **EJEAS / VnetPhone, V4 User Manual**, pp. 1-4 (PDF 2-5); archived copy dated 14 January 2019. Full manual and reset. [2] **EJEAS, Support**, undated; official support. Accessed: 3 November 2026. Model identification is based on the photo; audio tests are suggested practical checks.