



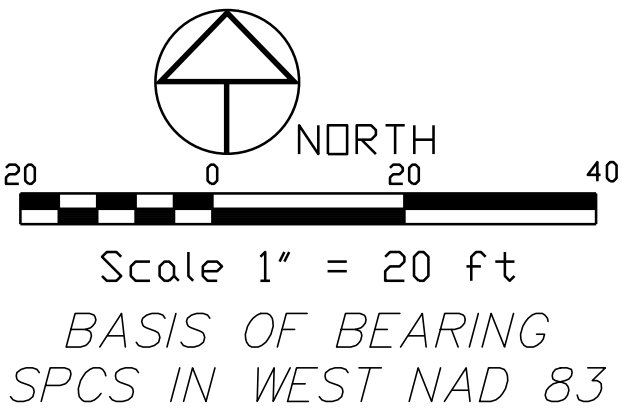

PLANT INVENTORY

	KEY	BOTANICAL NAME	COMMON NAME	SIZE & CONDITION	SPACING	TOTAL QTY
STREET TREE PLANTINGS	GD	GYMNOCLADUS DIOICUS	KENTUCKY COFFEE TREE	2" CAL., B & B	SEE PLAN	2
	NS	NYSSA SYLVATICA	BLACKGUM OR TUPELO	2" CAL., B & B	SEE PLAN	2
	TD	TAXODIUM DISTICHUM	BALD CYPRESS	2" CAL., B & B	SEE PLAN	2
	LT	LIRIODENDRON TULIPIFERA	TULIP TREE	2" CAL., B & B	SEE PLAN	2
XX PLANT QUANTITY		ST = STREET TREE PLANTINGS				
XX PLANT KEY DESIGNATION						
XX REQUIREMENT DESIGNATION						

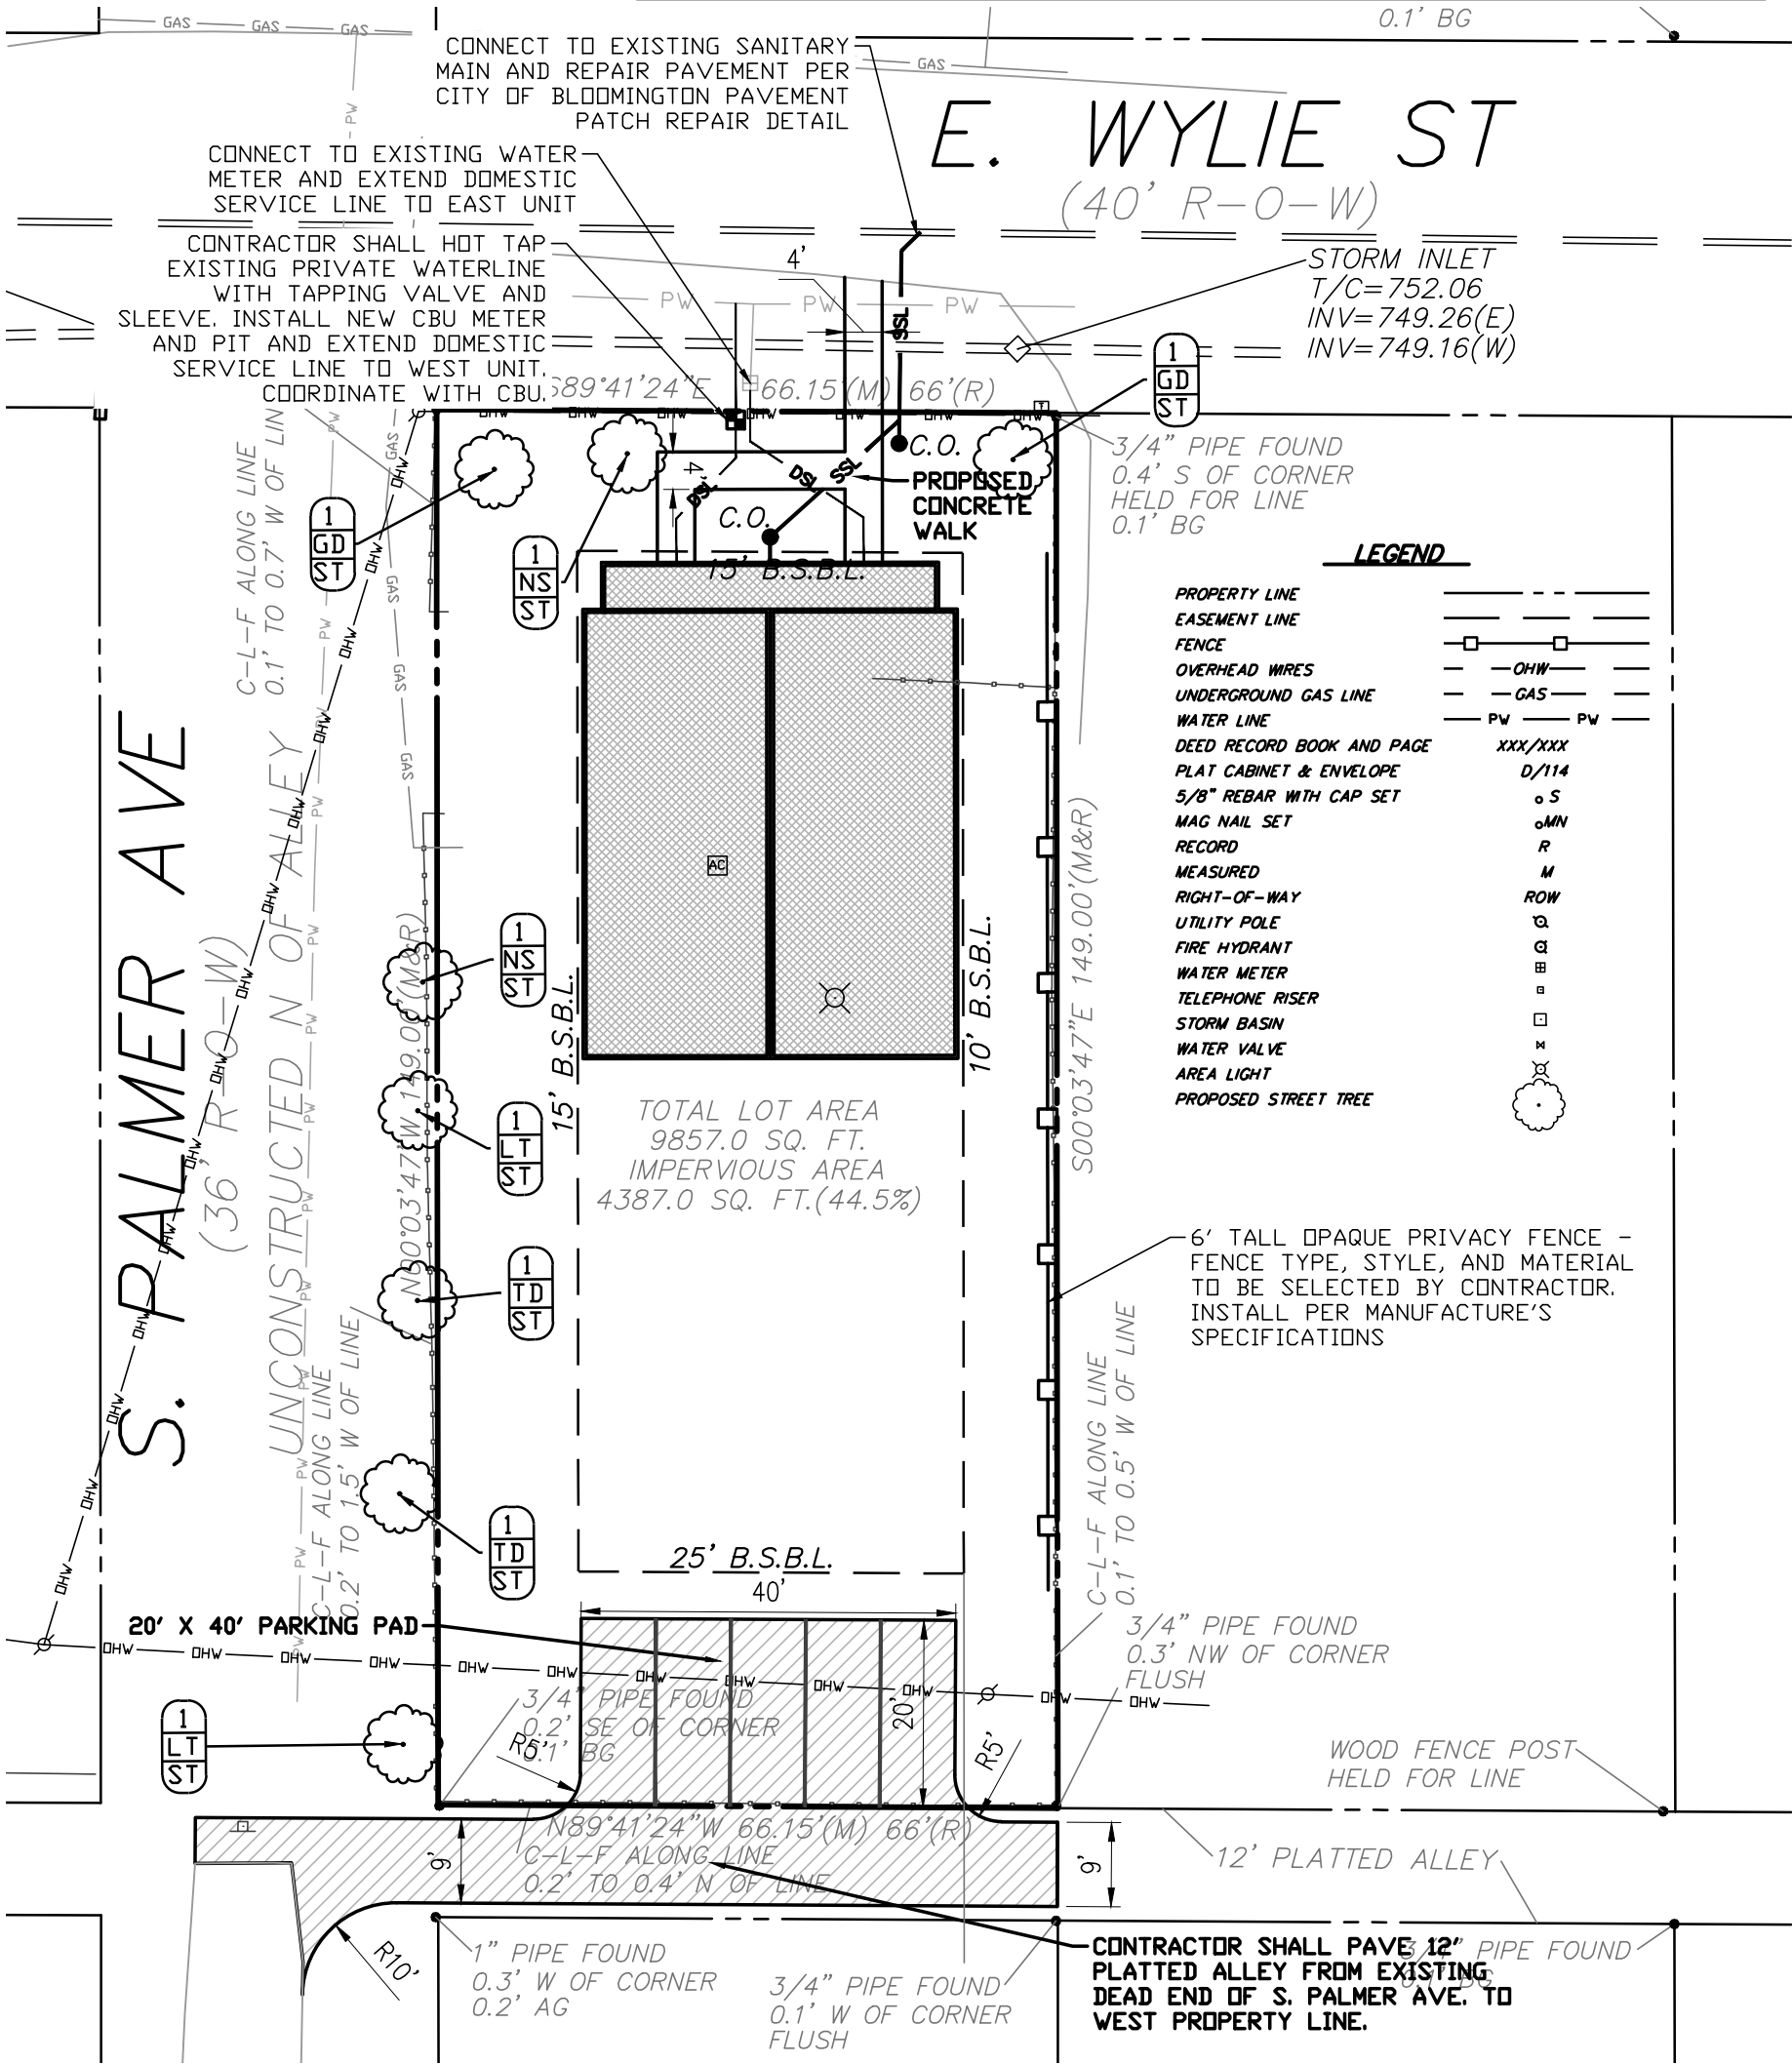

FLOOD NOTE

According to Flood Insurance Rate Map (FIRM) Community-Panel Number: 18105C 0142D, Map Revised: December 17, 2010 subject Property is in Zone X, an area determined to be outside of the flood hazard.

Source: FEMA

I affirm under penalties of perjury, that I have taken reasonable care to redact each social security number in this document, unless required by law.

Charles D. Graham

This instrument prepared by Charles D. Graham

RETRACEMENT SURVEY
LOT 132 ALLENDALE 2ND ADDITION
412 E. WYLIE STREET
BLOOMINGTON, INDIANA

Date: 5-27-2026

SHEET 1 OF 2

Project No: 5026015



BYNUM FANYO & ASSOCIATES, INC.
528 North Walnut Street
Bloomington, Indiana 47404
Phone (812)332-8030 Fax (812)339-2990

SURVEYOR'S REPORT

Complying with Indiana Administrative Code (865 IAC1-12-12),

The following is the theory of location applied in establishing the lines and corners established in this survey:

- 1. Three corners of the Subject Parcel (Spicer Rentals LLC) were found to be monumented by ¾ inch iron pipes within 0.4 feet from record positions as shown on the plat.
- 2. The remaining (NW) corner was established at the record distance from the Iron Pipe found at the Southwest corner and parallel with the East line established by the iron pipes cited above.

The following is a professional opinion of the cause and amount uncertainty in the lines and corners of the surveyed parcel because of the following:

A. Availability and condition of reference monuments.

- 1. All monuments found and shown on the plat fell within 0.40 feet of the record position relative to any adjoining monument as shown on the plat.
- 2. Three Iron pipes found in the South line of the 12 foot alley ad-joining to the South of the subject parcel confirming the location of the monuments found in the Subject parcel.

B. Occupation or possession lines

- 1. A chain link fence lines as shown on the plat 0.2 – 1.5 feet West of the West line of the subject parcel established this survey.
- 2. A chain link fence lines as shown on the plat 0.1 – 0.5 feet West of the East line of the subject parcel established this survey.
- 3. A chain link fence lines as shown on the plat 0.2 – 0.4 feet North of the South line of the subject parcel established this survey.

C. Clarity or ambiguity of record description and ad-joiners' record descriptions.


- 1.No uncertainty assigned to the location of the boundary lines with the adjoining parcels due to record descriptions as all ad-joining parcels are legally described as lots in the same Allendale 2nd Addition.

D. Relative Positional Accuracy.


- 1. The Relative positional accuracy of the measurements is 0.13 feet (40mm) +/- 100 ppm, and is consistent with a 'Suburban Survey' as defined by Indiana Code.

CERTIFICATION;

I certify that the survey as shown by the plat was performed wholly under the direction of myself, a registered land surveyor in the State of Indiana, and to the best of my belief and knowledge was executed according to 865 IAC 1-12.



Charles D. Graham
Indiana L.S. 29500014
within the State of Indiana
Bynum Fanyo & Associates, Inc.
528 N. Walnut St.
Bloomington, IN 47404
812-332-8030 tel
812-339-2990 fax

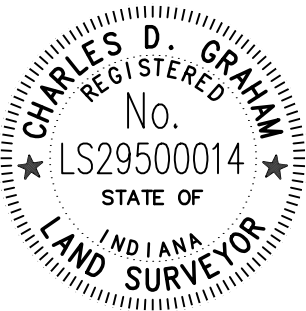

March 4, 2026
Date

RETRACEMENT SURVEY
LOT 132 ALLENDALE 2ND ADDITION
412 E. WYLIE STREET
BLOOMINGTON, INDIANA



BYNUM FANYO & ASSOCIATES, INC.
528 North Walnut Street
Bloomington, Indiana 47404
Phone (812)332-8030 Fax (812)339-2990