CIM

QUARTERLY BUILDING PERFORMANCE REVIEW

Skyline Tower

Prepared by **CIM — Data Driven Operations** · Powered by PEAK



Reporting period	Author	Issued
1 Jun – 31 Aug 2026	Jordan Avery	1 Sep 2026

AI was used to help compile this report. All figures, analysis and recommendations were human-reviewed.

ANALYTICS OVERVIEW

What we monitor at Skyline Tower

As at 1 September 2026

Building size	Equipment	Sensors	Rules	Thermal zones
16,200 m²	387	2,757	1,724	298

OPERATIONAL IMPACT

What that monitoring delivered this quarter

1 June – 31 August 2026

Good

98.8% equipment health maintained

↑ Up 0.4 pp from 98.7% in June to 99.1% in August.

Excellent

93.4% thermal comfort maintained

↓ Down 1.9 pp from 93.6% in June to 91.7% in August.

Continuous

4,155,822 automated equipment health checks ran 24/7

Averaging 1.39 million monthly checks across 1,637 scored rules.

Modelled

$18,870 labour cost avoided

125.8 hours and 16.6 working days of inspection time, valued at AUD 150/hr.

Excellent

13 faults resolved with 100% verified recovery

Median time to resolve of 21 days, measured from linked action creation to resolution.

See live equipment health dashboard › See live indoor environment dashboard ›

SUSTAINABILITY RATINGS

How the building rates under NABERS

As at 1 September 2026. Each rating is plotted at the end of its rating period.

Energy

5.5 / 6 stars

↑ Up 0.5 from 5.0

Expires Oct 2026

Indoor environment

5.0 / 6 stars

↑ Up 0.5 from 4.5 Expired

Water

4.5 / 6 stars


↓ Down 0.5 from 5.0

Expires Oct 2026


Energy



Indoor environment

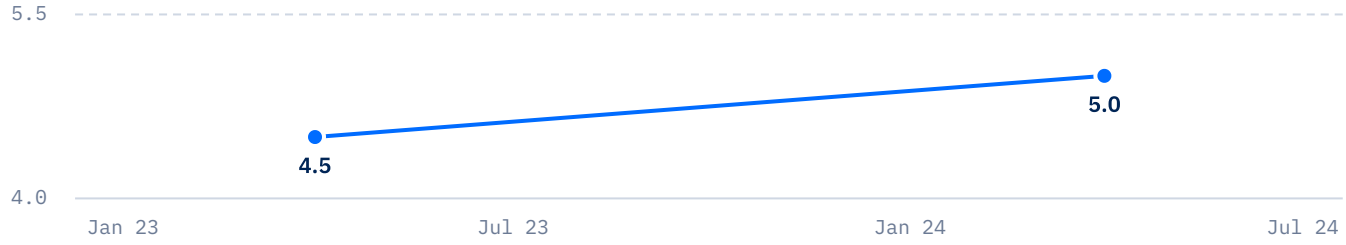

Water

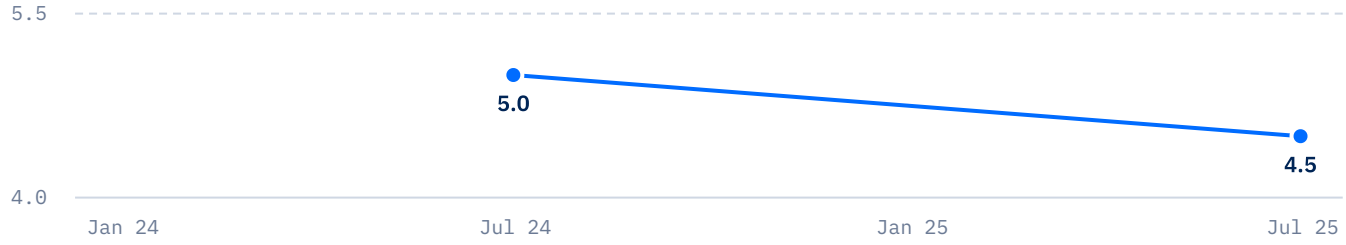

Source: NABERS ratings recorded in PEAK

See sustainability ratings ›

EQUIPMENT HEALTH SNAPSHOT

Health by equipment type

June – August 2026, the three months of the reporting quarter. Share of rule executions returning no fault, by equipment type, sorted by change across the quarter.

Excellent ≥ 99% Good ≥ 97% Average ≥ 90% Poor < 90%

EQUIPMENT TYPE	EQUIP	RULES	JUN 26	JUL 26	AUG 26	CHG
Chiller ›	5	42	94.7	95.9	**99.7**	↑ +5.0
Air Handling Units ›	7	167	97.2	98.7	**98.4**	↑ +1.2
Variable Air Volume ›	310	1,355	99.0	99.0	**99.1**	↑ +0.1
Car Park Ventilation ›	6	23	100.0	100.0	**100.0**	0.0
Condenser Water Pumps ›	2	12	100.0	100.0	**100.0**	0.0
Cooling Tower ›	4	14	100.0	100.0	**100.0**	0.0
Exhaust Air Fans ›	4	4	100.0	100.0	**100.0**	0.0
Packaged AC Units ›	2	2	100.0	100.0	**100.0**	0.0
Variable Speed Drive ›	11	11	100.0	100.0	**100.0**	0.0
Primary CHW Pumps ›	3	16	100.0	100.0	**99.8**	↓ −0.2
Site	**354**	**1,646**	98.7	99.0	**99.1**	↑ +0.4

See live equipment health dashboard ›

INDOOR ENVIRONMENT HEALTH SNAPSHOT

Thermal comfort by level

June – August 2026. Share of zone readings inside the ASHRAE comfort band during working hours, by level, in building order.

Excellent ≥ 92% Good ≥ 85% Average ≥ 75% Poor < 75%

LEVEL	ZONES	JUN 26	JUL 26	AUG 26	CHG
L22 ›	3	45.5	40.7	**44.4**	↓ −1.1
L21 ›	16	97.6	96.7	**94.6**	↓ −3.0

LEVEL	ZONES	JUN 26	JUL 26	AUG 26	CHG
L20 ›	14	95.5	92.8	**92.6**	↓ −2.9
L19 ›	16	95.8	96.3	**94.9**	↓ −0.9
L18 ›	20	97.4	98.1	**96.7**	↓ −0.7
L17 ›	18	93.4	90.5	**92.3**	↓ −1.1
L16 ›	16	92.7	91.5	**90.7**	↓ −2.0
L15 ›	16	96.9	97.5	**95.8**	↓ −1.1
L14 ›	15	99.7	99.4	**99.0**	↓ −0.7
L13 ›	15	96.1	96.9	**93.6**	↓ −2.5
L12 ›	17	96.0	96.4	**93.7**	↓ −2.3
L11 ›	13	97.7	96.5	**96.2**	↓ −1.5
L10 ›	15	97.7	97.2	**96.2**	↓ −1.5
L09 ›	18	91.8	93.4	**94.3**	↑ +2.5
L08 ›	14	95.6	94.4	**94.9**	↓ −0.7
L07 ›	14	96.3	94.6	**96.2**	↓ −0.1
L06 ›	13	86.9	84.0	**86.6**	↓ −0.3
L04 ›	19	90.5	89.4	**89.2**	↓ −1.3
L03 ›	7	87.5	79.0	**77.3**	↓ −10.2
L02 ›	6	97.3	92.0	**91.9**	↓ −5.4
L01 ›	11	71.4	61.2	**59.1**	↓ −12.3
G ›	2	98.9	96.0	**93.9**	↓ −5.0
Site	**298**	93.6	92.3	**91.7**	↓ −1.9


See live indoor environment dashboard ›

MONTHLY EQUIPMENT HEALTH

Six months of trend


March – August 2026, the last six complete months.

Site equipment health score

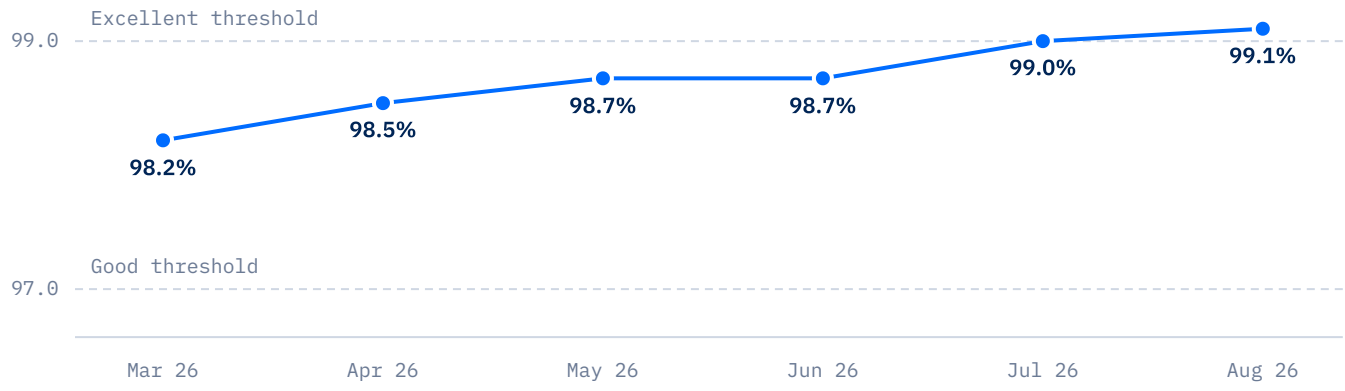

Source: PEAK equipment health dashboard

Automated health checks and labour cost avoided

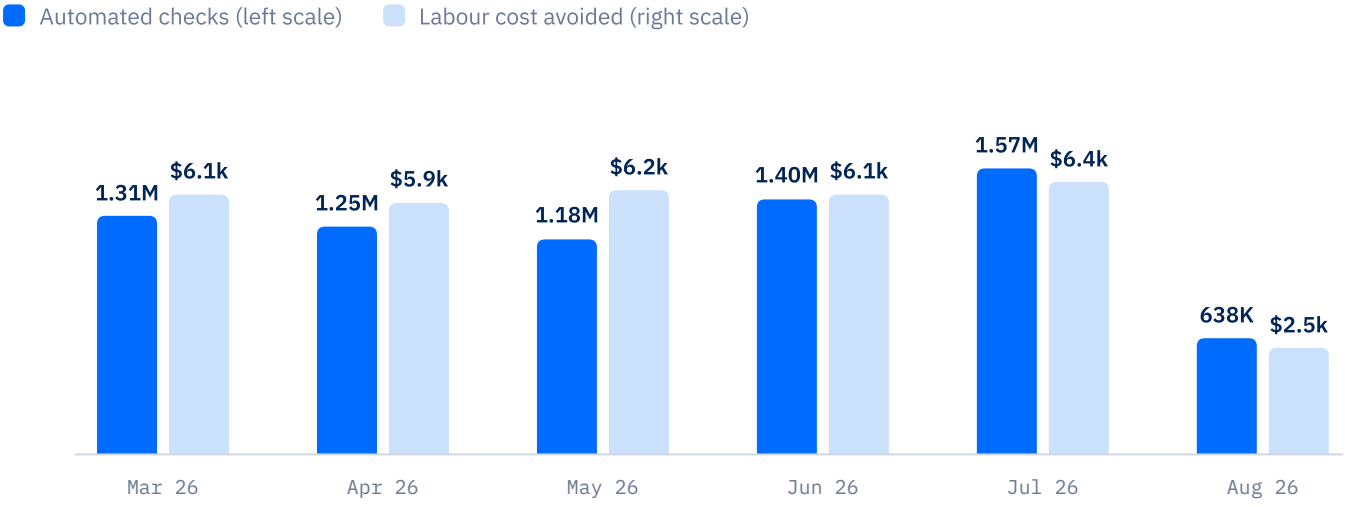


Labour cost avoided. Assumes each rule replaces one manual check: P1 daily at 30 seconds; P2 weekly, P3 monthly and P4–5 quarterly at 1 minute. Prorated over each month's days at AUD 150/hr (regional rate) and a 7.6-hour working day.

MONTHLY THERMAL COMFORT

Where comfort has been heading

March – August 2026, the last six complete months.

Site thermal comfort score

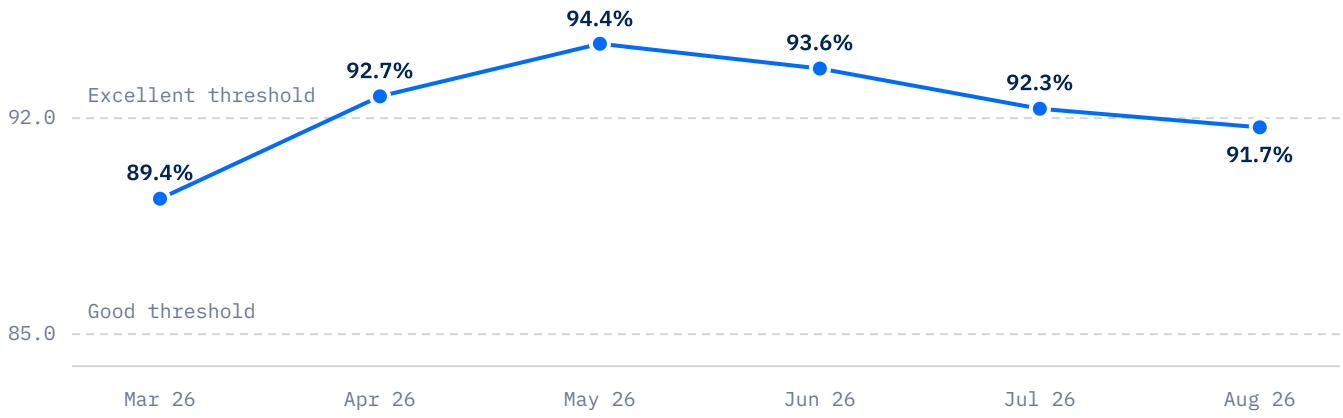

Source: PEAK indoor environment dashboard


EQUIPMENT RUN HOURS

When the plant ran

Mon 24 to Sun 30 Aug 2026, the latest full week, against the site's working hours. Bars are exact to 15 minutes.

During working hours Outside working hours No reliable data


Central plant

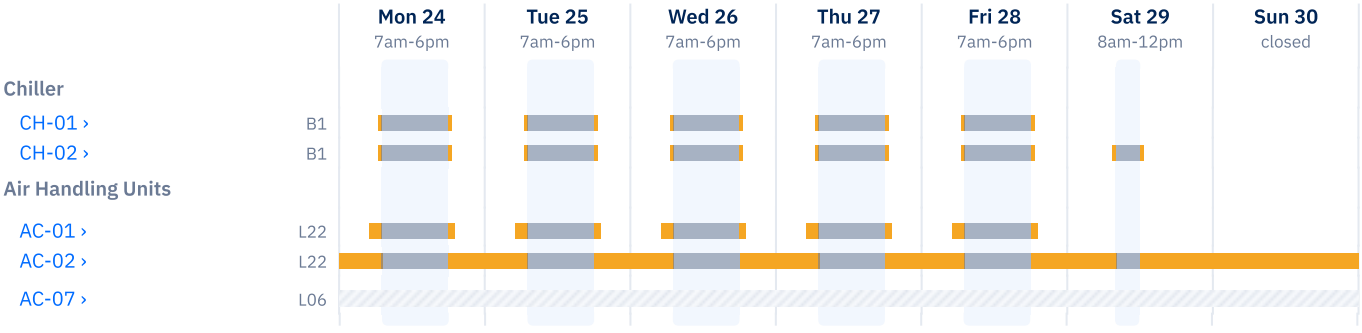

MONTHLY ACTIONS RAISED VS RESOLVED

Faults triaged and resolved

March – August 2026, the last six complete months. Raised counts actions created in the month, resolved counts actions closed in it. Actions marked Not Doing are excluded from both series.

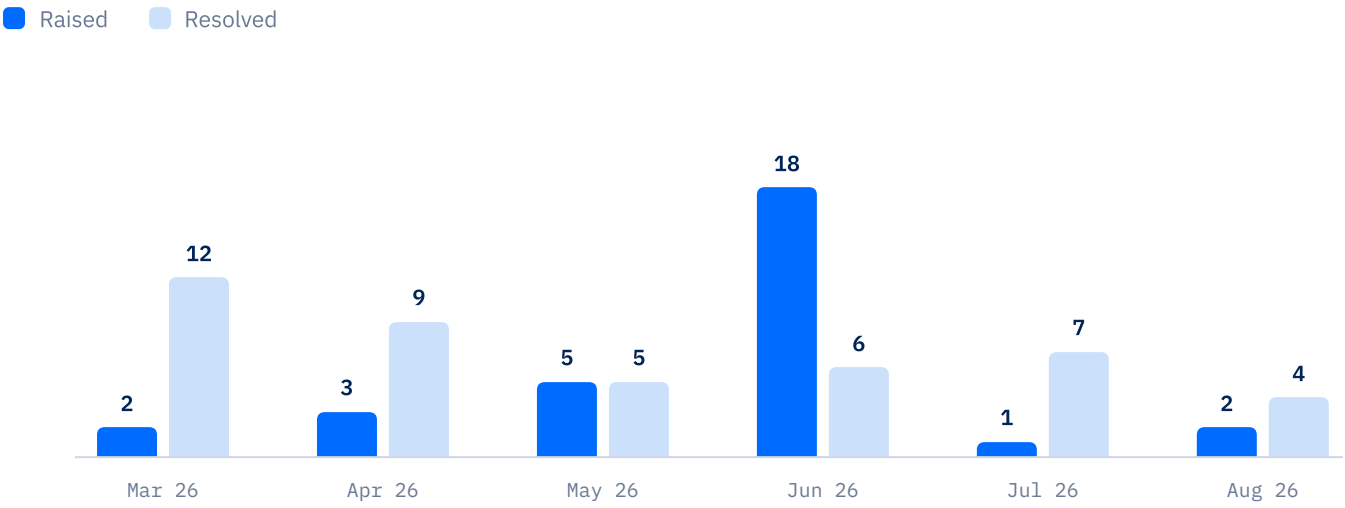

ACTIONS LEADERBOARD

Who closed the work

👏 Send Daniel a shoutout

Actions resolved March – August 2026, ranked by resolved. Completion rate is resolved ÷ (resolved + currently open); open now as at 1 September 2026.

	ASSIGNEE	COMPANY	RESOLVED	COMPLETION RATE	OPEN NOW
🏆	Daniel Reyes	CIM	12	100%	0
2	Tom Whitfield	Hawkins Air	10	100%	0
3	Oliver Grant	Automated Controls	8	100%	0
4	Marcus Bell	Hawkins Air	6	35%	11
5	Sarah Chen	CIM	4	100%	0
6	David Okafor	Hawkins Air	1	100%	0
7	Emma Lawson	Hawkins Air	1	100%	0
8	Ryan Foster	Hawkins Air	1	50%	1
9	Jack Morrison	Hawkins Air	0	0%	1
	Total		**43**	**77%**	**13**

See live actions leaderboard ›

KEY WINS

What changed in the building this quarter

Faults found by continuous monitoring and fixed on the floor, with recovery verified in PEAK.

Fixed

RELIABILITY

Evaporator pressure sensing restored on chillers CH-01 and CH-02

LEVEL B1

Both chillers had been carrying evaporator pressure faults, which leaves the plant running without reliable protection on its refrigerant circuit. On CH-02, Hawkins Air replaced the chilled water differential pressure sensor and confirmed the work on 21 July; on CH-01, Marcus Bell traced the reading back to a logic input on the chiller and corrected it on 13 July. PEAK has held both alerts recovered since.

`CH-02 — Inspect Evaporator Insufficient Pressure` · `CH-01 — Inspect Evaporator Pressure Broken Sensor`

ENERGY

Failed plant controller replaced, returning AC-01 to automatic chilled water control

LEVEL L22

The chilled water valves on AC-01, AC-02 and AC-03 had been forced open by hand while a failed level 22 plant controller was on order, which meant the units were cooling flat out with no modulation. Hawkins Air replaced the controller and returned the valves to Auto, and PEAK verified AC-01 recovered on 30 April with the valve modulating normally again: a 22% average in the first day after the fix, rising to 49% by day seven.

`AC-01 — Inspect Chilled Water Valve Leak`

ENERGY

Supply air pressure reset now running on AC-02, AC-04 and AC-05

LEVEL L22

AC-02, AC-04 and AC-05 were each holding a fixed supply air pressure setpoint, so their fans worked as hard at quarter load as at full load. Hawkins Air implemented a demand-based reset strategy on all three, and the setpoints now step between 220–260 Pa and 300–320 Pa with load instead of sitting flat. All three alerts recovered and closed by 24 June, with an estimated saving of **$6,800**.

AC-02 — Confirm Supply Pressure Override · AC-04 — Confirm Supply Pressure Override · AC-05 — Confirm Supply Pressure Override

COMFORT

AC-07 chilled water valve tuned out of a slow-response fault

LEVEL L06

AC-07 was delivering supply air 1.5–2 °C below setpoint because its chilled water valve modulated too slowly to keep up. Tom Whitfield range-tested the actuator to rule out a mechanical fault, then retuned the PID loop to match the other air handling units: integral from 0.3 to 3.0, proportional from 0.05 to 0.2, derivative to zero. The valve has modulated cleanly since, with no hunting in the change history, and the alert recovered on 12 May.

AC-07 — Inspect Chilled Water Valve Leak

NOTES ON METHOD

How these numbers are calculated

1. **Labour cost avoided.** Assumes each rule replaces one manual check: P1 daily at 30 seconds; P2 weekly, P3 monthly and P4–5 quarterly at 1 minute. Prorated over the 92-day period at AUD 150/hr (regional rate) and a 7.6-hour working day.
2. **Thermal comfort score.** Comfort band set per zone in PEAK, 21–24.9 °C across this building. The site row is PEAK's site-level score, not an average of the rows below.
3. **Zones.** Zone temperature points configured for comfort scoring. Levels with no score in the period are excluded here and from the thermal zones figure in the analytics overview.
4. **Verified recovery.** Share of alerts closed in the period with the fault recovered. Includes only alerts on active rules.
5. **Raised vs resolved.** Counts actions, not alerts. One action can cover several alerts.
6. **Run hours.** Drawn from run status or a speed, current or power reading. Enables and schedules are not used, as they show commanded state only. Where signals disagree, the lower runtime is used.